

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION (MTN)

Title

SVX Noise Suppression in high noise environments.

Technology

APX™ SERIES P25 RADIOS
Body-Worn Camera

Models Affected

APX NEXT, N70, SVX

Severity Recommendation

Low/Maintenance - Perform if system exhibits below symptoms

MTN Overview

This MTN provides instructions for maximizing noise suppression when the SVX Video Remote Speaker Microphone (RSM) is used with the APX Next and N70 radios.

Symptoms

- High levels of ambient noise are heard from the transmitting radio when the SVX Video RSM is used in a high noise environment.
- Less effective noise suppression

Customers / Regions Impacted

All customers and regions may be impacted by the issue

When To Apply

During maintenance

Test To Perform

Step 1. Locate an area with high levels of ambient noise (i.e a noisy area).

Step 2. Locate a second area with low levels of ambient noise (i.e. a quiet area).

Step 3. From the noisy area, key-up and transmit using the SVX Video RSM. The radio operator should use an appropriate test phrase for the transmission.

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION


ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

Expected Results: A listener located in the quiet area should hear a clear radio transmission with minimal ambient noise.

Test Exception: If high levels of noise are observed by the listener, the configuration of the SVX noise suppressor is not optimized. Follow the resolution procedure in this document to improve the performance of the SVX Video RSM.

Resolution Procedure

The audio features provisioned in a radio determine which Noise Reduction Group Setting options are available to the SVX Video RSM. Using CPS, Radio Central or Radio Manager, locate the "Default" radio profile. Click on the drop-down menu for Noise Reduction Group Setting under the Intelligent Accessory column as shown below.

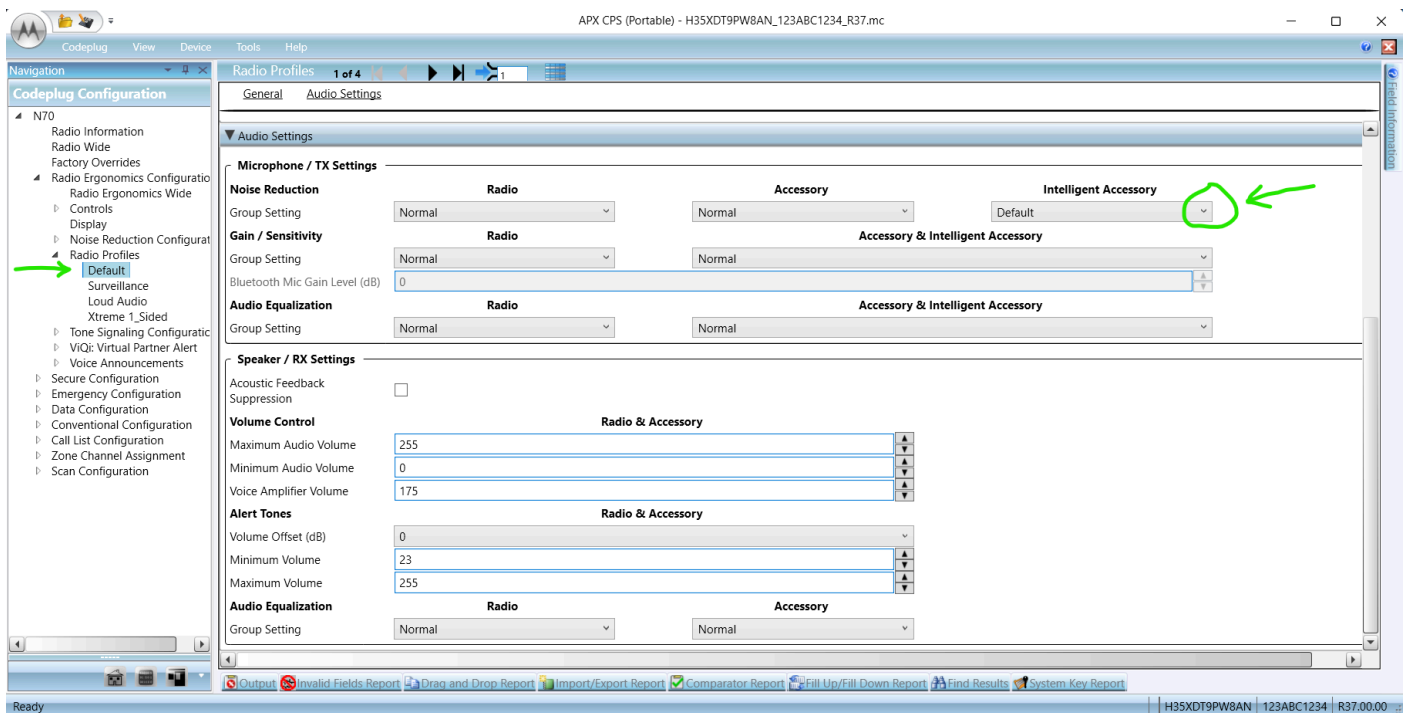


MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION


ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

Radios provisioned with APX Standard Noise Suppression will show the following options:

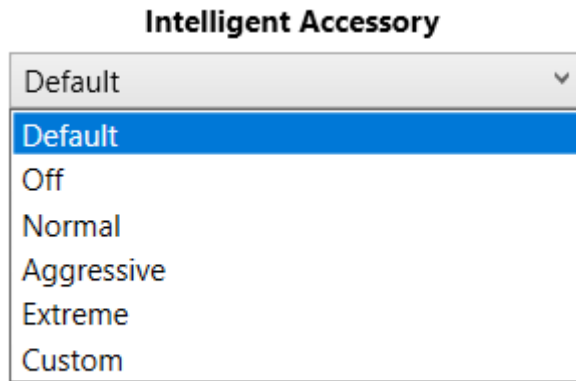

Radios provisioned with APX Adaptive Audio Engine (QA09006) will show the following options:

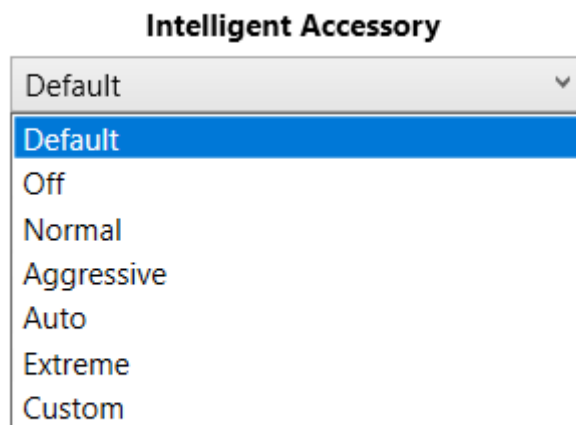


MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

Radios provisioned with Intelligent Noise Reductions (QA10089) will show the following options:

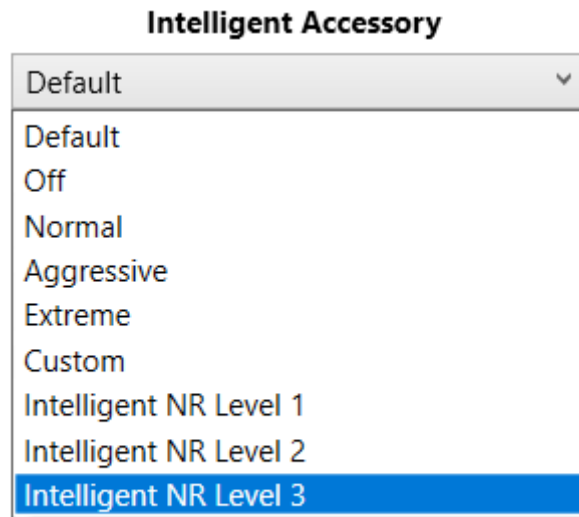

For radios with the Intelligent Noise Reduction option (QA10089) installed, **Intelligent NR Level 3** will provide the most effective noise suppression available. For all other audio options, the **Default** Noise Reduction Group Setting will provide the most effective noise suppression for the SVX accessory. The table below summarizes the recommended Noise Reduction Group Setting for SVX Video RSM for each installed audio option:

Installed Audio Option	Recommended Noise Reduction Group Setting for SVX (Intelligent Accessory)
APX Standard Noise Suppression	Default
Adaptive Audio Engine (QA09006)	Default
Intelligent Noise Reduction (QA10089)	Intelligent NR Level 3

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

Labor Allowance

This is an informational bulletin. No labor warranty is implied, intended, or authorized.

For assistance with this bulletin, please contact your MSI Technical Support Centre at <https://motorolasolutions.com/support>

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

Appendix A – Additional Information

The following table shows the amount of noise suppression applied by each Noise Reduction Group setting.

Noise Reduction Group Setting			
APX Standard	Adaptive Audio Engine / Intelligent Noise Reduction	Intelligent Accessory	Applied Noise Suppression
OFF	 Auto	Default (XV, XVP850, XVP860, XVE500, XVN500)	No Noise Suppression
Normal			
Aggressive			
Extreme	Intelligent NR Level 1 ¹		
	Intelligent NR Level 2		
	Intelligent NR Level 3 / Intelligent NR Level 3 One Sided ²	Default (SVX Video RSM)	Maximum Noise Suppression

Notes:

1. The **Intelligent NR Level 1** setting is similar to traditional DINC noise reduction however the **Intelligent NR Level 1** setting more effectively attenuates non-stationary noise sources such as sirens, alarms and other complex noise sources.
2. The **Intelligent NR Level 3 One Sided** option disables the secondary microphone on the radio. This option only applies when the radio is used without an accessory. When this option is selected, the radio user must speak into the primary microphone located on the speaker grille side of the radio.

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

Appendix B – Recommended Use Positions

The SVX User Guide requires using the Earpiece Accessory with Microphone (PMLN8709A) whenever the SVX accessory is mounted below the midway point of the torso. The Earpiece Accessory with Microphone should also be used whenever the SVX accessory is used in a high noise environment.

In a high noise environment, do the following:

1. Mount the microphone (i.e. PMLN4709A) as close to the mouth as possible.
2. Speak directly into the microphone.

MN011250A01-AD
Chapter 4: Mounting Options

4.9 Recommended Wearing Positions

Figure 31: SVX Recommended Wearing Positions



 **NOTE:** When the SVX is worn below the line, the earpiece accessory is required.

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.

DOCUMENT NUMBER:	MTN-0051-26
ISSUE DATE:	2026-02

The figures below shows the recommended location for mounting the microphone (i.e. PMLN4709A).



Notes

1. Mic is pointing toward mouth



Notes

1. Mouth is directed towards mic
2. Mic is not covered or obstructed by hand, material or other objects.

MOTOROLA SOLUTIONS TECHNICAL NOTIFICATION

ANY USE NOT APPROVED BY MOTOROLA SOLUTIONS IS PROHIBITED. This Motorola Technical Notification (MTN) is issued pursuant to Motorola's ongoing review of the quality, effectiveness, and performance of its products. The information provided in this bulletin is intended for use by trained, professional technicians only, who have the expertise to perform the service described in the MTN. Motorola disclaims any and all liability for product quality or performance if the recommendations in this MTN are not implemented, or not implemented in compliance with the instructions provided here. Implementation of these recommendations may be necessary for the product to remain compliant with applicable laws or regulations. Please be advised that failure to implement these recommendations in the manner instructed may also invalidate applicable warranties, or otherwise impact any potential contractual rights or obligations. MOTOROLA, MOTO, MOTOROLA SOLUTIONS, and the Stylized M Logo are trademarks or registered trademarks of Motorola Trademark Holdings, LLC and are used under license. All other trademarks are the property of their respective owners. © 2026 Motorola Solutions, Inc. All rights reserved.