# ACCURATE AS

| | | | |
|---|---|---|---|
| Insured: | Na Li | | |
| Property: | 739 Summerwood Dr<br>Brentwood, CA 94513 | | |
| Claim Rep.: | CHARLES ANDRUS | Business: | (800) 527-3907 |
| Company: | FOREMOST INSURANCE COMPANY | E-mail: | myclaim@foremost.com |
| Business: | PO BOX 268994<br>OKLAHOMA CITY, OK 73126-8994 | | |
| Estimator: | SARAH HAMMILL | Business: | (775) 544-8950 |
| Company: | ACCURATE AS | | |
| Business: | PO BOX 9049<br>HOT SPRINGS, AR 71910 | | |
| Reference: | | Business: | (800) 527-3907 |
| Company: | FOREMOST INSURANCE COMPANY | E-mail: | myclaim@foremost.com |
| Business: | P.O. BOX 268994<br>OKLAHOMA CITY, OK 73126-8994 | | |

**Claim Number:** 7005343475-1 **Policy Number:** 5007708912 **Type of Loss:** APPRAISAL

| | | | |
|---|---|---|---|
| Date Contacted: | 5/31/2023 12:00 AM | | |
| Date of Loss: | 11/22/2022 12:00 AM | Date Received: | 5/31/2023 12:00 AM |
| Date Inspected: | 11/13/2023 12:00 AM | Date Entered: | 5/31/2023 12:00 AM |

| | |
|---|---|
| Price List: | CAEB8X_NOV22<br>Restoration/Service/Remodel |
| Estimate: | LI-7005343475-1 |

This information is part of the attached appraisal. Please read carefully. Policy provisions may affect any payment made based on this summary. This summary does not supersede the policy. This is not an authorization to repair. Accurate AS and this appraiser do not have the authority to authorize repairs or payment. The final/agreed version of this summary has been forwarded to the insurance carrier for their consideration. The insurance company has the authority to modify or revise the summary based on coverage. Payment amount is at the sole discretion of the insurance company, based on their interpretation of the policy. Issues regarding deductibles and prior payments are at the sole discretion of the insurance company.

Accurate AS and this appraiser neither recommends nor endorses repair contractors or vendors.
Any summary figures included are for the sole purpose of reaching an agreement with opposing appraiser and/or umpire in an attempt to resolve the appraisal regarding RCV/ACV figures only.
Any portion or the entirety of this summary may be rescinded, changed, or modified with no other notice prior to final agreement as defined with an appraisal award signed by two members of the appraisal panel.

**LI-7005343475-1**

## Temporary Repairs

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 1. R&R Board-up windows and doors | | | | | | | | | |
| 615.46 | SF | 4.05 | 89.41 | 498.54 | 3,080.56 | 0/NA | Avg. | 0% | (0.00) | 3,080.56 |
| Includes: 1/2" plywood, screws, and labor to board-up windows and doors. Labor cost to remove plywood and to discard in a job-site waste receptacle. | | | | | | | | | |
| 20% waste added | | | | | | | | | |
| 2. Install Board-up windows and doors | | | | | | | | | |
| 512.88 | SF | 1.69 | 0.00 | 173.36 | 1,040.13 | 0/NA | Avg. | 0% | (0.00) | 1,040.13 |
| additional *LABOR ONLY* for detach and reset as needed during repairs | | | | | | | | | |
| 3. Temporary fencing - 9+ months (per month) | | | | | | | | | |
| 1,080.00 | LF | 0.60 | 0.00 | 129.60 | 777.60 | 0/NA | Avg. | 0% | (0.00) | 777.60 |
| **Totals: Temporary Repairs** | | **89.41** | **801.50** | **4,898.29** | | | | **0.00** | **4,898.29** |

## General Conditions

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 4. Residential Supervision / Project Management - per hour | | | | | | | | | |
| 240.00 | HR | 81.51 | 0.00 | 3,912.48 | 23,474.88 | 0/NA | Avg. | 0% | (0.00) | 23,474.88 |

**Supervision**

Every contractor is required to provide a level of supervision for all work for which they are responsible, consistent with the standard of care exercised by other contractors providing similar services. This applies to specialty sub-contractors just as it does to General Contractors who may be self-performing some of the work using in-house trades labor or overseeing the work performed by sub-contractors. The General Contractor is ultimately responsible for the entirety of the work according to their contract.

This Appraisal Valuation provides the minimal level of supervision, necessary for this project.

| | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|
| 5. Dumpster load - Approx. 20 yards, 4 tons of debris | | | | | | | | | |
| 1.00 | EA | 893.00 | 0.00 | 178.60 | 1,071.60 | 0/NA | Avg. | NA | (0.00) | 1,071.60 |
| 6. Gas/water line cap/plug - per cap | | | | | | | | | |
| 21.00 | EA | 23.52 | 2.11 | 98.78 | 594.81 | 0/NA | Avg. | 0% | (0.00) | 594.81 |
| 7. Plumbing/gas line air pressure test | | | | | | | | | |
| 2.00 | EA | 283.95 | 0.00 | 113.58 | 681.48 | 0/NA | Avg. | 0% | (0.00) | 681.48 |
| gas and water | | | | | | | | | |
| 8. Plumbing/drain line water pressure test | | | | | | | | | |
| 1.00 | EA | 674.36 | 0.00 | 134.88 | 809.24 | 0/NA | Avg. | 0% | (0.00) | 809.24 |
| 9. Scaffolding Setup & Take down - per hour | | | | | | | | | |
| 32.00 | HR | 64.92 | 0.00 | 415.48 | 2,492.92 | 0/NA | Avg. | 0% | (0.00) | 2,492.92 |
| 2 laborers, 16 hours each for set-up, take-down, movement of scaffolding | | | | | | | | | |
| 10. Scaffold - per section (per month) | | | | | | | | | |
| 30.00 | MO | 112.88 | 0.00 | 677.28 | 4,063.68 | 0/NA | Avg. | 0% | (0.00) | 4,063.68 |

## CONTINUED - General Conditions

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 11. Temporary hand washing station (per month) | | | | | | | | | |
| 8.00 MO | 242.04 | 0.00 | 387.26 | 2,323.58 | 0/NA | Avg. | 0% | (0.00) | 2,323.58 |
| 12. Temporary toilet (per month) | | | | | | | | | |
| 8.00 MO | 248.00 | 0.00 | 396.80 | 2,380.80 | 0/NA | Avg. | 0% | (0.00) | 2,380.80 |
| 13. Temporary power usage (per month) | | | | | | | | | |
| 8.00 MO | 247.98 | 193.42 | 396.76 | 2,574.02 | 0/NA | Avg. | 0% | (0.00) | 2,574.02 |
| 14. R&R Temporary power - hookup | | | | | | | | | |
| 1.00 EA | 470.85 | 0.00 | 94.18 | 565.03 | 0/NA | Avg. | 0% | (0.00) | 565.03 |
| 15. Job-site cargo/storage container - 16' long - per month | | | | | | | | | |
| 4.00 MO | 69.00 | 26.91 | 55.20 | 358.11 | 0/NA | Avg. | 0% | (0.00) | 358.11 |
| store materials and equipment during repairs | | | | | | | | | |
| 16. Final cleaning - construction - Residential | | | | | | | | | |
| 2,100.76 SF | 0.42 | 0.00 | 176.46 | 1,058.78 | 0/NA | Avg. | 0% | (0.00) | 1,058.78 |
| **Totals: General Conditions** | | **222.44** | **7,037.74** | **42,448.93** | | | | **0.00** | **42,448.93** |

## Code Compliance

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 17. Building Permit - B23-1181 (Demo)* | | | | | | | | | |
| 1.00 EA | 306.39 | 0.00 | 0.00 | 306.39 | 0/NA | Avg. | 0% | (0.00) | 306.39 |

Issue Date: 06.23.2023
Job Value $26,500.00

Demolition Permit Issuance $288.29
SMI Residential $3.27
SMI Residential Educational $0.17
State Revolving Fund $1.80
State Revolving Fund Admin Holdback $0.20
Permit Issuance CC Transaction Fee $8.92
Building Office Automation $3.74

| | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|
| 18. Building Permit - B23-2090* | | | | | | | | | |
| 1.00 EA | 5,320.47 | 0.00 | 0.00 | 5,320.47 | 0/NA | Avg. | 0% | (0.00) | 5,320.47 |

## CONTINUED - Code Compliance

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| Issue Date: 01.03.2024<br>Job Value $182,490.00<br><br>Building Permit $2729.55<br>SMI Residential $22.54<br>SMI Residential Educational $1.19<br>State Revolving Fund $7.20<br>State Revolving Fund Holdback $0.80<br>Alterations & Additions $253.96<br>Mech Alteration & Addition $154.49<br>Building Office Automation $45.04<br>Electrical Office Automation $4.19<br>Mechanical Office Automation $3.87<br>Plumbing Office Automation $3.87<br>Building Plan Check $1774.21<br>Electrical Plan Check $165.07<br>Plum Alteration & Addition $154.49 | | | | | | | | | |
| 19. Building Permit - B24-0511* | | | | | | | | | |
| 1.00 | EA | 1,991.51 | 0.00 | 0.00 | 1,991.51 | 0/NA | Avg. | 0% | (0.00) | 1,991.51 |
| Issue Date: 04.15.2024<br>Job Value $30,000.00<br><br>Building Permit $876.44<br>Other Inspections $267.18<br>SMI Residential $3.71<br>SMI Residential Educational $0.20<br>State Revolving Fund $1.80<br>State Revolving Fund Admin Holdback $0.20<br>Alterations & Additions $253.96<br>Building Office Automation $14.46<br>Electrical Office Automation $3.87<br>Building Plan Check $569.69 | | | | | | | | | |
| 20. Engineering fees* | | | | | | | | | |
| 1.00 | EA | 3,186.84 | 0.00 | 0.00 | 3,186.84 | 0/NA | Avg. | 0% | (0.00) | 3,186.84 |
| Engineering fees generated due to code compliance per local building department.<br>Determined upon submission of building department notice(s) and invoices specific to the requirements set forth within the notice(es) | | | | | | | | | |
| **Totals: Code Compliance** | | | **0.00** | **0.00** | **10,805.21** | | | | **0.00** | **10,805.21** |

## Demo & Restoration

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demo*** | | | | | | | | | |
| 21. Dumpster load - Approx. 40 yards, 7-8 tons of debris | | | | | | | | | |
| 2.00 | EA | 1,275.66 | 0.00 | 510.26 | 3,061.58 | 0/NA | Avg. | NA | (0.00) | 3,061.58 |

## CONTINUED - Demo & Restoration

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 22. Hazardous Waste/Mold Cleaning- Supervisory/Admin- per hour | | | | | | | | | |
| 12.00 HR | 120.80 | 0.00 | 289.92 | 1,739.52 | 0/NA | Avg. | 0% | (0.00) | 1,739.52 |
| Supervision of the debris removal process to ensure proper procedures and instructions are followed. Insure all labor adheres to the proper safety procedures | | | | | | | | | |
| 23. Hazardous Waste/Mold Cleaning Technician - per hour | | | | | | | | | |
| 24.00 HR | 108.88 | 0.00 | 522.62 | 3,135.74 | 0/NA | Avg. | 0% | (0.00) | 3,135.74 |
| Remove all fire debris, destroyed contents and other items as directed from the residence and dispose of in the provided waste receptacles. | | | | | | | | | |
| 24. Add for personal protective equipment - Heavy duty | | | | | | | | | |
| 60.00 EA | 39.58 | 231.54 | 474.96 | 3,081.30 | 0/NA | Avg. | 0% | (0.00) | 3,081.30 |
| ***Restoration*** | | | | | | | | | |
| *post-removal/demo cleaning - HEPA clean - wipe down seal framing* | | | | | | | | | |
| 25. Hydroxyl generator - odor counteractant - 3 optics | | | | | | | | | |
| 2.00 DA | 238.00 | 0.00 | 95.20 | 571.20 | 0/NA | Avg. | 0% | (0.00) | 571.20 |
| **Totals: Demo & Restoration** | | **231.54** | **1,892.96** | **11,589.34** | | | | **0.00** | **11,589.34** |

## Dwelling

### Roof

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 26. R&R Sheathing - plywood - 1/2" CDX | | | | | | | | | |
| 64.00 SF | 4.80 | 10.36 | 61.44 | 379.00 | 0/150 yrs | Avg. | 0% | (0.00) | 379.00 |
| 27. Roofing felt - 30 lb. | | | | | | | | | |
| 1.00 SQ | 58.86 | 1.85 | 11.78 | 72.49 | 0/20 yrs | Avg. | 0% | (0.00) | 72.49 |
| 28. Tile roofing - Detach & reset | | | | | | | | | |
| 1.50 SQ | 1,272.34 | 3.00 | 381.70 | 2,293.21 | 0/NA | Avg. | 0% | (0.00) | 2,293.21 |
| 29. Bird stop - Eave closure strip for tile roofing - clay | | | | | | | | | |
| 8.00 LF | 6.07 | 1.83 | 9.72 | 60.11 | 0/75 yrs | Avg. | 0% | (0.00) | 60.11 |
| **Totals: Roof** | | **17.04** | **464.64** | **2,804.81** | | | | **0.00** | **2,804.81** |

## Exterior

### Right Elevation

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 30. Clean air conditioning condenser unit | | | | | | | | | |
| 1.00 | EA | 107.37 | 0.15 | 21.48 | 129.00 | 0/NA | Avg. | 0% | (0.00) | 129.00 |
| 31. Digital satellite system - Detach & reset | | | | | | | | | |
| 1.00 | EA | 60.21 | 0.00 | 12.04 | 72.25 | 0/NA | Avg. | 0% | (0.00) | 72.25 |
| **Totals: Right Elevation** | | **0.15** | **33.52** | **201.25** | | | | **0.00** | **201.25** |

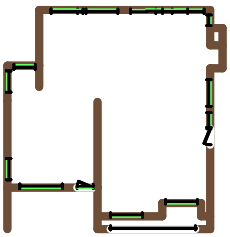

**Ext_Surfaces**

2813.80 SF Walls
2813.80 SF Walls & Ceiling
223.59 LF Floor Perimeter

| | | |
|---|---|---|
| **Window** | **6' X 4' 6"** | **Opens into Exterior** |
| **Window** | **6' X 5' 6"** | **Opens into Exterior** |
| **Window** | **5' X 4'** | **Opens into Exterior** |
| **Window** | **6' X 4'** | **Opens into Exterior** |
| **Window** | **6' X 4'** | **Opens into Exterior** |
| **Window** | **6' X 8'** | **Opens into Exterior** |
| **Window** | **2' X 5' 6"** | **Opens into Exterior** |
| **Door** | **3' X 6' 8"** | **Opens into Exterior** |
| **Window** | **5' X 2'** | **Opens into Exterior** |
| **Window** | **2' 9" X 2'** | **Opens into Exterior** |
| **Door** | **16' X 7'** | **Opens into Exterior** |
| **Door** | **3' X 6' 8"** | **Opens into Exterior** |
| **Window** | **8' X 5' 3/8"** | **Opens into Exterior** |
| **Window** | **3' X 1' 6"** | **Opens into Exterior** |
| **Window** | **8' X 2' 11 15/16"** | **Opens into Exterior** |
| **Window** | **4' X 5' 3/16"** | **Opens into Exterior** |
| **Window** | **4' X 2' 11 3/4"** | **Opens into Exterior** |
| **Window** | **4' X 4' 11 3/4"** | **Opens into Exterior** |
| **Window** | **4' X 2' 9 3/8"** | **Opens into Exterior** |
| **Window** | **4' X 3' 1/16"** | **Opens into Exterior** |
| **Window** | **6' X 4'** | **Opens into Exterior** |
| **Window** | **4' X 5' 1/8"** | **Opens into Exterior** |
| **Window** | **4' X 3' 3/16"** | **Opens into Exterior** |
| **Window** | **4' X 3' 1/16"** | **Opens into Exterior** |
| **Window** | **6' X 4'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 32. Clean fascia | | | | | | | | | |
| 310.26 LF | 1.13 | 0.00 | 70.12 | 420.71 | 0/NA | Avg. | 0% | (0.00) | 420.71 |
| 33. Clean soffit - wood | | | | | | | | | |
| 357.71 SF | 0.61 | 0.35 | 43.64 | 262.19 | 0/NA | Avg. | 0% | (0.00) | 262.19 |

## CONTINUED - Ext_Surfaces

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 34. Clean with pressure/chemical spray | | | | | | | | | |
| 2,813.80 SF | 0.51 | 2.74 | 287.00 | 1,724.78 | 0/NA | Avg. | 0% | (0.00) | 1,724.78 |
| 35. R&R Siding - hardboard - lap pattern - 8" | | | | | | | | | |
| 928.80 SF | 6.38 | 170.25 | 1,185.16 | 7,281.15 | 29/100 yrs | Avg. | 29% | (555.75) | 6,725.40 |
| 36. R&R House wrap (air/moisture barrier) | | | | | | | | | |
| 928.80 SF | 0.51 | 16.30 | 94.74 | 584.72 | 29/150 yrs | Avg. | 19.33% | (35.47) | 549.25 |
| 37. Prime & paint gutter / downspout | | | | | | | | | |
| 79.25 LF | 2.38 | 2.24 | 37.72 | 228.58 | 5/15 yrs | Avg. | 33.33% | (8.41) | 220.17 |
| 38. Prime & paint exterior fascia - wood, 6"- 8" wide | | | | | | | | | |
| 310.26 LF | 3.12 | 7.26 | 193.60 | 1,168.87 | 5/15 yrs | Avg. | 33.33% | (27.24) | 1,141.63 |
| 39. Prime & paint exterior soffit - exposed rafters | | | | | | | | | |
| 321.18 SF | 4.54 | 30.69 | 291.64 | 1,780.49 | 5/15 yrs | Avg. | 33.33% | (115.15) | 1,665.34 |
| 40. Prime & paint exterior soffit - wood | | | | | | | | | |
| 36.53 SF | 3.27 | 1.96 | 23.90 | 145.31 | 5/15 yrs | Avg. | 33.33% | (7.35) | 137.96 |
| 41. Seal & paint wood siding | | | | | | | | | |
| 928.80 SF | 2.65 | 53.43 | 492.26 | 3,007.01 | 5/15 yrs | Avg. | 33.33% | (200.47) | 2,806.54 |
| 42. Paint wood siding - 1 coat | | | | | | | | | |
| 1,885.00 SF | 1.74 | 66.16 | 655.98 | 4,002.04 | 5/15 yrs | Avg. | 33.33% | (248.25) | 3,753.79 |
| paint remaining siding for even finish appearance | | | | | | | | | |
| 43. R&R 2" x 4" lumber - redwood (.667 BF per LF) | | | | | | | | | |
| 439.17 LF | 6.88 | 125.03 | 604.30 | 3,750.82 | 0/150 yrs | Avg. | 0% | (0.00) | 3,750.82 |
| replace door and window trim - holes from board-up, damage<br>replace chimney trim - damage, to facilitate siding replacement | | | | | | | | | |
| 44. Seal & paint door or window opening (per side) | | | | | | | | | |
| 23.00 EA | 46.18 | 13.59 | 212.42 | 1,288.15 | 5/15 yrs | Avg. | 33.33% | (50.99) | 1,237.16 |
| 45. Seal & paint door or window opening - Large (per side) | | | | | | | | | |
| 1.00 EA | 57.43 | 1.00 | 11.48 | 69.91 | 5/15 yrs | Avg. | 33.33% | (3.74) | 66.17 |
| 46. Clean overhead door & hardware - Large | | | | | | | | | |
| 1.00 EA | 98.59 | 0.04 | 19.72 | 118.35 | 0/NA | Avg. | 0% | (0.00) | 118.35 |
| 47. Paint overhead door - Large - 2 coats (per side) | | | | | | | | | |
| 1.00 EA | 252.63 | 7.68 | 50.52 | 310.83 | 5/15 yrs | Avg. | 33.33% | (28.82) | 282.01 |
| 48. Paint/finish - fence post - wood | | | | | | | | | |
| 7.00 EA | 27.36 | 0.87 | 38.30 | 230.69 | 5/15 yrs | Avg. | 33.33% | (3.28) | 227.41 |
| **Totals: Ext_Surfaces** | | **499.59** | **4,312.50** | **26,374.60** | | | | **1,284.92** | **25,089.68** |
| **Total: Exterior** | | **499.74** | **4,346.02** | **26,575.85** | | | | **1,284.92** | **25,290.93** |

**Interior**

## Interior

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Repairs*** | | | | | | | | | |
| 49. Wire - average residence - copper wiring | | | | | | | | | |
| 1,822.00 SF | 8.38 | 287.78 | 3,053.68 | 18,609.82 | 0/100 yrs | Avg. | 0% | (0.00) | 18,609.82 |
| 50. Ductwork system - hot or cold air - 1600 to 2199 SF home | | | | | | | | | |
| 1.00 EA | 7,869.27 | 220.54 | 1,573.86 | 9,663.67 | 29/30 yrs | Avg. | 90% [M] | (2,234.28) | 7,429.39 |
| Includes: Trunk and branch lines, registers, return air covers, furnace plenum, return air duct, foil tape and/or mastic, duct hanger strap, and installation labor. Labor cost to remove a ductwork system and to discard in job-site waste receptacle. Quality: Ductwork for 1600 to 2199 SF living space. | | | | | | | | | |
| **Total: Interior** | | **508.32** | **4,627.54** | **28,273.49** | | | | **2,234.28** | **26,039.21** |

## 1st Floor

### 1st Floor

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Repairs*** | | | | | | | | | |
| 51. Batt insulation - 4" - R15 - paper / foil faced | | | | | | | | | |
| 1,532.27 SF | 1.38 | 132.96 | 422.90 | 2,670.39 | 0/150 yrs | Avg. | 0% | (0.00) | 2,670.39 |
| 52. Batt insulation - 10" - R30 - unfaced batt | | | | | | | | | |
| 347.67 SF | 1.85 | 42.71 | 128.64 | 814.54 | 0/150 yrs | Avg. | 0% | (0.00) | 814.54 |
| 53. Final cleaning - construction - Residential | | | | | | | | | |
| 1,310.87 SF | 0.42 | 0.00 | 110.12 | 660.69 | 0/NA | Avg. | 0% | (0.00) | 660.69 |
| **Total: 1st Floor** | | **175.67** | **661.66** | **4,145.62** | | | | **0.00** | **4,145.62** |

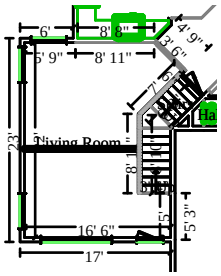


**Living Room** **Height: Peaked**

| | | | |
|---|---|---|---|
| 730.79 | SF Walls | 347.67 | SF Ceiling |
| 1078.45 | SF Walls & Ceiling | 323.27 | SF Floor |
| 35.92 | SY Flooring | 71.96 | LF Floor Perimeter |
| 81.79 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Missing Wall** | **3' 4" X 12'** | **Opens into STAIRS2** |
| **Door** | **3' X 6' 8"** | **Opens into Exterior** |
| **Window** | **3' X 1' 6"** | **Opens into Exterior** |
| **Window** | **8' X 2' 11 15/16"** | **Opens into Exterior** |
| **Window** | **8' X 5' 3/8"** | **Opens into Exterior** |
| **Window** | **4' X 5' 3/16"** | **Opens into Exterior** |
| **Window** | **4' X 2' 11 3/4"** | **Opens into Exterior** |
| **Window** | **4' X 5' 1/8"** | **Opens into Exterior** |
| **Window** | **4' X 3' 1/16"** | **Opens into Exterior** |
| **Window** | **4' X 3' 3/16"** | **Opens into Exterior** |
| **Window** | **4' X 4' 11 3/4"** | **Opens into Exterior** |
| **Window** | **4' X 2' 9 3/8"** | **Opens into Exterior** |
| **Window** | **4' X 3' 1/16"** | **Opens into Exterior** |
| **Missing Wall - Goes to Ceiling** | **8' 10 9/16" X 2'** | **Opens into KITCHEN** |
| **Missing Wall - Goes to Ceiling** | **4' 5" X 2'** | **Opens into FAMILY_ROOM** |
| **Missing Wall - Goes to Floor** | **3' 6" X 6' 8"** | **Opens into FAMILY_ROOM** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 54. Demolish/remove - bedroom/room (over 200 sf) | | | | | | | | | |
| 323.27 SF | 6.78 | 0.00 | 438.36 | 2,630.13 | 0/NA | Avg. | NA | (0.00) | 2,630.13 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 55. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 347.67 SF | 1.36 | 0.00 | 94.56 | 567.39 | 0/NA | Avg. | 0% | (0.00) | 567.39 |
| Ceiling Joists | | | | | | | | | |
| 56. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 347.67 SF | 2.02 | 14.91 | 140.46 | 857.66 | 0/15 yrs | Avg. | 0% | (0.00) | 857.66 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 57. Additional cost for high ceiling* | | | | | | | | | |
| 347.67 SF | 0.13 | 0.00 | 9.04 | 54.24 | 0/15 yrs | Avg. | 0% | (0.00) | 54.24 |
| 58. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 730.79 SF | 1.30 | 0.00 | 190.00 | 1,140.03 | 0/NA | Avg. | 0% | (0.00) | 1,140.03 |
| 59. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 730.79 SF | 1.50 | 27.08 | 219.24 | 1,342.51 | 0/15 yrs | Avg. | 0% | (0.00) | 1,342.51 |

## CONTINUED - Living Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 60. Additional cost for high wall* | | | | | | | | | |
| 336.91 SF | 0.13 | 0.00 | 8.76 | 52.56 | 0/15 yrs | Avg. | 0% | (0.00) | 52.56 |
| 61. Clean floor or roof joist system | | | | | | | | | |
| 323.27 SF | 1.55 | 0.63 | 100.22 | 601.92 | 0/NA | Avg. | 0% | (0.00) | 601.92 |
| 62. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 323.27 SF | 2.02 | 13.87 | 130.60 | 797.48 | 0/15 yrs | Avg. | 0% | (0.00) | 797.48 |
| 63. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 5,355.43 CF | 0.06 | 0.00 | 64.26 | 385.59 | 0/NA | Avg. | 0% | (0.00) | 385.59 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 64. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 347.67 SF | 4.62 | 31.52 | 321.24 | 1,959.00 | 0/150 yrs | Avg. | 0% | (0.00) | 1,959.00 |
| 65. Additional cost for high ceiling* | | | | | | | | | |
| 347.67 SF | 1.21 | 0.00 | 84.14 | 504.82 | 0/150 yrs | Avg. | 0% | (0.00) | 504.82 |
| 66. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 347.67 SF | 1.39 | 8.14 | 96.66 | 588.06 | 5/15 yrs | Avg. | 33.33% | (30.52) | 557.54 |
| 67. Additional cost for high ceiling* | | | | | | | | | |
| 347.67 SF | 0.13 | 0.00 | 9.04 | 54.24 | 0/15 yrs | Avg. | 0% | (0.00) | 54.24 |
| ***Walls*** | | | | | | | | | |
| 68. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 730.79 SF | 4.46 | 61.28 | 651.86 | 3,972.46 | 0/150 yrs | Avg. | 0% | (0.00) | 3,972.46 |
| 69. Additional cost for high wall* | | | | | | | | | |
| 336.91 SF | 1.21 | 0.00 | 81.54 | 489.20 | 0/150 yrs | Avg. | 0% | (0.00) | 489.20 |
| 70. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 196.97 LF | 5.69 | 12.68 | 224.16 | 1,357.60 | 0/150 yrs | Avg. | 0% | (0.00) | 1,357.60 |
| 71. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 730.79 SF | 1.39 | 17.10 | 203.16 | 1,236.06 | 5/15 yrs | Avg. | 33.33% | (64.16) | 1,171.90 |
| 72. Additional cost for high wall* | | | | | | | | | |
| 336.91 SF | 0.13 | 0.00 | 8.76 | 52.56 | 0/15 yrs | Avg. | 0% | (0.00) | 52.56 |
| ***Floors*** | | | | | | | | | |
| 73. Carpet pad | | | | | | | | | |
| 303.27 SF | 0.70 | 15.08 | 42.46 | 269.83 | 5/10 yrs | Avg. | 50% | (84.87) | 184.96 |
| 74. Carpet | | | | | | | | | |
| 348.76 SF | 4.63 | 111.87 | 322.96 | 2,049.59 | 5/10 yrs | Avg. | 50% | (629.64) | 1,419.95 |
| 15 % waste added for Carpet. | | | | | | | | | |
| 75. Tile floor covering | | | | | | | | | |
| 20.00 SF | 19.02 | 9.36 | 76.08 | 465.84 | 29/100 yrs | Avg. | 29% | (30.55) | 435.29 |
| 76. Tile/stone sealer | | | | | | | | | |
| 20.00 SF | 1.70 | 0.64 | 6.80 | 41.44 | 10/2 yrs | Avg. | 90% [M] | (6.52) | 34.92 |

## CONTINUED - Living Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 77. R&R Exterior door - metal - insulated - flush or panel style | | | | | | | | | |
| 1.00 | EA | 567.95 | 38.06 | 113.58 | 719.59 | 29/100 yrs | Avg. | 29% (124.23) | 595.36 |
| Includes: Exterior door, hinges, jamb, stop, brick mold, casing (one side), finish nails, screws, wood shims, caulk, and installation labor. Excludes: Lockset and painting. Quality: Insulated metal flush (smooth) or panel door with threshold, weatherstrip, and pre-drilled holes for lockset. | | | | | | | | | |
| 78. Prime & paint door slab only - exterior (per side) | | | | | | | | | |
| 2.00 | EA | 64.80 | 3.39 | 25.92 | 158.91 | 5/15 yrs | Avg. | 33.33% (12.71) | 146.20 |
| 79. Seal & paint door opening (per side)* | | | | | | | | | |
| 1.00 | EA | 46.18 | 0.59 | 9.24 | 56.01 | 5/15 yrs | Avg. | 33.33% (2.22) | 53.79 |
| 80. Door lockset & deadbolt - exterior | | | | | | | | | |
| 1.00 | EA | 97.42 | 5.61 | 19.48 | 122.51 | 29/20 yrs | Avg. | 90% [M] (56.85) | 65.66 |
| 81. Aluminum window, picture/fixed 3-11 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 204.66 | 9.06 | 40.94 | 254.66 | 29/18 yrs | Avg. | 90% [M] (91.79) | 162.87 |
| 82. Aluminum window, picture/fixed 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 433.32 | 27.71 | 86.66 | 547.69 | 29/18 yrs | Avg. | 90% [M] (280.70) | 266.99 |
| 83. Aluminum window, horiz. slider 33-40 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 655.17 | 47.88 | 131.04 | 834.09 | 29/18 yrs | Avg. | 90% [M] (485.10) | 348.99 |
| 84. Aluminum window, picture/fixed 12-23 sf (2 pane) | | | | | | | | | |
| 5.00 | EA | 343.29 | 104.66 | 343.30 | 2,164.41 | 29/18 yrs | Avg. | 90% [M] (1,060.25) | 1,104.16 |
| 85. Aluminum window, horiz. slider 12-23 sf (2 pane) | | | | | | | | | |
| 3.00 | EA | 399.30 | 79.18 | 239.58 | 1,516.66 | 29/18 yrs | Avg. | 90% [M] (802.12) | 714.54 |
| 86. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 188.50 | SF | 4.17 | 76.64 | 157.22 | 1,019.91 | 29/18 yrs | Avg. | 90% [M] (776.42) | 243.49 |
| 87. Window stool & apron | | | | | | | | | |
| 24.00 | LF | 11.15 | 10.44 | 53.52 | 331.56 | 29/150 yrs | Avg. | 19.33% (22.71) | 308.85 |
| 88. Seal & paint window stool and apron | | | | | | | | | |
| 24.00 | LF | 5.90 | 1.05 | 28.32 | 170.97 | 5/15 yrs | Avg. | 33.33% (3.95) | 167.02 |
| 89. Baseboard - 2 1/4" | | | | | | | | | |
| 71.96 | LF | 4.30 | 8.63 | 61.88 | 379.94 | 29/150 yrs | Avg. | 19.33% (18.78) | 361.16 |
| 90. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 71.96 | LF | 2.22 | 0.98 | 31.96 | 192.69 | 5/15 yrs | Avg. | 33.33% (3.69) | 189.00 |
| ***Electrical*** | | | | | | | | | |
| 91. Chandelier | | | | | | | | | |
| 2.00 | EA | 328.25 | 24.88 | 131.30 | 812.68 | 29/20 yrs | Avg. | 90% [M] (252.07) | 560.61 |
| 92. Ceiling fan without light | | | | | | | | | |
| 1.00 | EA | 330.51 | 8.53 | 66.10 | 405.14 | 29/20 yrs | Avg. | 90% [M] (86.43) | 318.71 |
| 93. Add on - Ceiling fan down rod - 37"-72" | | | | | | | | | |
| 1.00 | EA | 91.88 | 6.83 | 18.38 | 117.09 | 29/20 yrs | Avg. | 90% [M] (69.15) | 47.94 |

**********

## CONTINUED - Living Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 94. Window blind - single cell - 7.1 to 14 SF | | | | | | | | | |
| 6.00 EA | 136.85 | 43.23 | 164.22 | 1,028.55 | 29/5 yrs | Avg. | 90% [M] | (437.97) | 590.58 |
| 95. Window blind - PVC - 2" - 14.1 to 20 SF | | | | | | | | | |
| 5.00 EA | 138.35 | 35.05 | 138.36 | 865.16 | 29/5 yrs | Avg. | 90% [M] | (355.10) | 510.06 |
| **Totals: Living Room** | | **856.56** | **5,385.36** | **33,168.43** | | | | **5,788.50** | **27,379.93** |

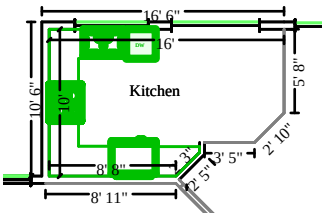


**Kitchen** **Height: 9'**

| | |
|---|---|
| 291.29 SF Walls | 143.52 SF Ceiling |
| 434.80 SF Walls & Ceiling | 143.52 SF Floor |
| 15.95 SY Flooring | 16.54 LF Floor Perimeter |
| 37.59 LF Ceil. Perimeter | |

| | | |
|---|---|---|
| **Missing Wall** | **5' 8 3/8" X 9'** | **Opens into FAMILY_ROOM** |
| **Missing Wall** | **2' 10 3/16" X 9'** | **Opens into FAMILY_ROOM** |
| **Missing Wall** | **3' 4 13/16" X 9'** | **Opens into FAMILY_ROOM** |
| **Missing Wall - Goes to Ceiling** | **8' 7 9/16" X -1'** | **Opens into LIVING_ROOM** |
| **Window** | **5' X 4'** | **Opens into Exterior** |
| **Window** | **6' X 4' 6"** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 96. Demolish/remove - kitchen/laundry | | | | | | | | | |
| 143.52 SF | 16.37 | 0.00 | 469.88 | 2,819.30 | 0/NA | Avg. | NA | (0.00) | 2,819.30 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 97. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 143.52 SF | 1.36 | 0.00 | 39.04 | 234.23 | 0/NA | Avg. | 0% | (0.00) | 234.23 |
| Ceiling Joists | | | | | | | | | |
| 98. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 143.52 SF | 2.02 | 6.16 | 57.98 | 354.05 | 0/15 yrs | Avg. | 0% | (0.00) | 354.05 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 99. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 291.29 SF | 1.30 | 0.00 | 75.74 | 454.42 | 0/NA | Avg. | 0% | (0.00) | 454.42 |

## CONTINUED - Kitchen

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 100. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 291.29 SF | 1.50 | 10.79 | 87.38 | 535.11 | 0/15 yrs | Avg. | 0% | (0.00) | 535.11 |
| 101. Clean floor or roof joist system | | | | | | | | | |
| 143.52 SF | 1.55 | 0.28 | 44.50 | 267.24 | 0/NA | Avg. | 0% | (0.00) | 267.24 |
| 102. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 143.52 SF | 2.02 | 6.16 | 57.98 | 354.05 | 0/15 yrs | Avg. | 0% | (0.00) | 354.05 |
| 103. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 1,291.64 CF | 0.06 | 0.00 | 15.50 | 93.00 | 0/NA | Avg. | 0% | (0.00) | 93.00 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 104. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 143.52 SF | 4.62 | 13.01 | 132.62 | 808.69 | 0/150 yrs | Avg. | 0% | (0.00) | 808.69 |
| 105. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 143.52 SF | 1.39 | 3.36 | 39.90 | 242.75 | 5/15 yrs | Avg. | 33.33% | (12.60) | 230.15 |
| ***Walls*** | | | | | | | | | |
| 106. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 291.29 SF | 4.46 | 24.42 | 259.84 | 1,583.41 | 0/150 yrs | Avg. | 0% | (0.00) | 1,583.41 |
| 107. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 39.00 LF | 5.69 | 2.51 | 44.38 | 268.80 | 0/150 yrs | Avg. | 0% | (0.00) | 268.80 |
| 108. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 291.29 SF | 1.39 | 6.82 | 80.98 | 492.69 | 5/15 yrs | Avg. | 33.33% | (25.57) | 467.12 |
| ***Floors*** | | | | | | | | | |
| 109. Tile floor covering | | | | | | | | | |
| 112.75 SF | 19.02 | 52.77 | 428.90 | 2,626.18 | 29/100 yrs | Avg. | 29% | (172.25) | 2,453.93 |
| 110. Tile/stone sealer | | | | | | | | | |
| 112.75 SF | 1.70 | 3.63 | 38.34 | 233.65 | 10/2 yrs | Avg. | 90% [M] | (36.76) | 196.89 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 111. Aluminum window, horiz. slider 12-23 sf (2 pane) | | | | | | | | | |
| 1.00 EA | 399.30 | 26.39 | 79.86 | 505.55 | 29/18 yrs | Avg. | 90% [M] | (267.37) | 238.18 |
| 112. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. | 90% [M] | (338.13) | 285.01 |
| 113. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 47.00 SF | 4.17 | 19.11 | 39.20 | 254.30 | 29/18 yrs | Avg. | 90% [M] | (193.59) | 60.71 |
| 114. Window stool & apron | | | | | | | | | |
| 11.00 LF | 11.15 | 4.78 | 24.54 | 151.97 | 29/150 yrs | Avg. | 19.33% | (10.40) | 141.57 |
| 115. Seal & paint window stool and apron | | | | | | | | | |
| 11.00 LF | 5.90 | 0.48 | 12.98 | 78.36 | 5/15 yrs | Avg. | 33.33% | (1.81) | 76.55 |
| 116. Baseboard - 2 1/4" | | | | | | | | | |
| 16.54 LF | 4.30 | 1.98 | 14.22 | 87.32 | 29/150 yrs | Avg. | 19.33% | (4.31) | 83.01 |

## CONTINUED - Kitchen

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 117. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 16.54 LF | 2.22 | 0.23 | 7.34 | 44.29 | 5/15 yrs | Avg. | 33.33% | (0.85) | 43.44 |
| ***Cabinetry*** | | | | | | | | | |
| 118. Cabinetry - full height unit - High grade | | | | | | | | | |
| 3.00 LF | 468.05 | 113.10 | 280.84 | 1,798.09 | 10/50 yrs | Avg. | 20% | (254.63) | 1,543.46 |
| 119. Cabinetry - upper (wall) units - High grade | | | | | | | | | |
| 5.50 LF | 238.27 | 93.30 | 262.10 | 1,665.89 | 10/50 yrs | Avg. | 20% | (210.05) | 1,455.84 |
| 120. Cabinetry - upper (wall) units - High grade | | | | | | | | | |
| 10.75 LF | 238.27 | 182.36 | 512.28 | 3,256.04 | 10/50 yrs | Avg. | 20% | (410.55) | 2,845.49 |
| 121. Add for prefinished crown molding per LF | | | | | | | | | |
| 18.25 LF | 12.80 | 13.68 | 46.72 | 294.00 | 10/150 yrs | Avg. | 6.67% | (10.27) | 283.73 |
| 122. Cabinetry - lower (base) units - High grade | | | | | | | | | |
| 13.00 LF | 434.55 | 469.32 | 1,129.84 | 7,248.31 | 10/50 yrs | Avg. | 20% | (1,056.56) | 6,191.75 |
| 123. Wood appliance panel - High grade | | | | | | | | | |
| 30.00 SF | 50.30 | 91.11 | 301.80 | 1,901.91 | 10/50 yrs | Avg. | 20% | (205.12) | 1,696.79 |
| dishwasher return | | | | | | | | | |
| ***Countertop, Backsplash*** | | | | | | | | | |
| 124. Countertop subdeck - plywood | | | | | | | | | |
| 30.00 SF | 6.86 | 6.23 | 41.16 | 253.19 | 29/150 yrs | Avg. | 19.33% | (13.55) | 239.64 |
| 125. Countertop - Tile | | | | | | | | | |
| 43.00 SF | 46.78 | 29.22 | 402.30 | 2,443.06 | 29/150 yrs | Avg. | 19.33% | (63.59) | 2,379.47 |
| 126. Mortar bed for tile | | | | | | | | | |
| 33.00 SF | 13.29 | 5.31 | 87.72 | 531.60 | 29/150 yrs | Avg. | 19.33% | (11.56) | 520.04 |
| 127. Add-on for tile backsplash installation | | | | | | | | | |
| 10.00 SF | 33.03 | 0.00 | 66.06 | 396.36 | 29/150 yrs | Avg. | 19.33% | (0.00) | 396.36 |
| 128. Seal grout on tile wall | | | | | | | | | |
| 10.00 SF | 3.06 | 0.16 | 6.12 | 36.88 | 29/2 yrs | Avg. | 90% [M] | (1.58) | 35.30 |
| 129. Tile/stone sealer | | | | | | | | | |
| 33.00 SF | 1.70 | 1.06 | 11.22 | 68.38 | 29/2 yrs | Avg. | 90% [M] | (10.75) | 57.63 |
| ***Plumbing*** | | | | | | | | | |
| 130. Sink - double basin | | | | | | | | | |
| 1.00 EA | 469.58 | 27.00 | 93.92 | 590.50 | 29/50 yrs | Avg. | 58% | (176.26) | 414.24 |
| Includes: Double bowl sink, "P" trap, end outlet continuous waste, caulking, and installation labor.<br>Excludes: Strainer/drain assemblies | | | | | | | | | |
| 131. Sink strainer and drain assembly | | | | | | | | | |
| 2.00 EA | 69.59 | 3.51 | 27.84 | 170.53 | 29/100 yrs | Avg. | 29% | (11.45) | 159.08 |
| 132. Sink faucet - Kitchen - High grade | | | | | | | | | |
| 1.00 EA | 433.34 | 29.67 | 86.66 | 549.67 | 29/15 yrs | Avg. | 90% [M] | (300.60) | 249.07 |

## CONTINUED - Kitchen

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|---|
| Includes: Kitchen sink faucet, hot and cold supply lines, and installation labor.<br>Excludes: Sink strainer.<br>Quality: Chrome or brass finish, washerless faucet with single or double handle; may include pull-down/out spout, touchless features, etc. | | | | | | | | | | |
| 133. Angle stop valve | | | | | | | | | | |
| 2.00 EA | 52.14 | 1.40 | 20.86 | 126.54 | 10/100 yrs | Avg. | 10% | | (1.58) | 124.96 |
| 134. Water filtration system - under sink | | | | | | | | | | |
| 1.00 EA | 308.95 | 17.54 | 61.80 | 388.29 | 29/25 yrs | Avg. | 90% | [M] | (177.74) | 210.55 |
| Includes: Water filtration system and installation labor.<br>Excludes: Replacement filters.<br>Quality: 3 to 5 stage filtration system with faucet and installation hardware. | | | | | | | | | | |
| 135. Refrigerator/icemaker water supply box with valve | | | | | | | | | | |
| 1.00 EA | 217.81 | 8.09 | 43.56 | 269.46 | 29/20 yrs | Avg. | 90% | [M] | (81.93) | 187.53 |
| Includes: Water supply outlet box, valve, copper tubing, and installation labor.<br>Excludes: Supply line from valve to appliance. | | | | | | | | | | |
| 136. Flexible gas supply line connector - 1/2" - up to 24" | | | | | | | | | | |
| 1.00 EA | 40.60 | 2.22 | 8.12 | 50.94 | 10/36 yrs | Avg. | 27.78% | | (6.95) | 43.99 |
| 137. Ball valve - brass - up to 1/2" | | | | | | | | | | |
| 1.00 EA | 65.96 | 1.17 | 13.20 | 80.33 | 0/70 yrs | Avg. | 0% | | (0.00) | 80.33 |
| ***Appliances*** | | | | | | | | | | |
| 138. Remove Refrigerator - side by side - 25 to 30 cf | | | | | | | | | | |
| 1.00 EA | 60.98 | 0.00 | 12.20 | 73.18 | 10/14 yrs | Avg. | NA | | (0.00) | 73.18 |
| 139. Install Refrigerator - side by side - 25 to 30 cf | | | | | | | | | | |
| 1.00 EA | 56.46 | 0.00 | 11.30 | 67.76 | 10/14 yrs | Avg. | 71.43% | | (0.00) | 67.76 |
| 140. Appliance water line - 1/4" | | | | | | | | | | |
| 1.00 EA | 111.28 | 3.66 | 22.26 | 137.20 | 10/50 yrs | Avg. | 20% | | (8.24) | 128.96 |
| 141. R&R Microwave oven - over range w/built-in hood | | | | | | | | | | |
| 1.00 EA | 537.04 | 29.84 | 107.42 | 674.30 | 10/9 yrs | Avg. | 90% | [M] | (302.26) | 372.04 |
| 142. Ductwork - hot or cold air - 4" round | | | | | | | | | | |
| 12.00 LF | 19.65 | 4.05 | 47.16 | 287.01 | 10/30 yrs | Avg. | 33.33% | | (15.19) | 271.82 |
| 143. R&R Range - freestanding - gas | | | | | | | | | | |
| 1.00 EA | 1,282.02 | 97.50 | 256.40 | 1,635.92 | 10/15 yrs | Avg. | 66.67% | | (731.67) | 904.25 |
| 144. Garbage disposer | | | | | | | | | | |
| 1.00 EA | 325.23 | 13.64 | 65.04 | 403.91 | 10/12 yrs | Avg. | 83.33% | | (127.93) | 275.98 |
| 145. R&R Dishwasher | | | | | | | | | | |
| 1.00 EA | 773.46 | 50.20 | 154.70 | 978.36 | 10/9 yrs | Avg. | 90% | [M] | (508.57) | 469.79 |
| 146. Dishwasher supply line - material only | | | | | | | | | | |
| 1.00 EA | 19.62 | 1.91 | 3.92 | 25.45 | 10/9 yrs | Avg. | 90% | [M] | (19.38) | 6.07 |
| Includes: Dishwasher supply line.<br>Quality: 6' supply line.<br>Note: This item is intended to be used when a new dishwasher supply line is also needed with the dishwasher installation. Installation of the supply line will typically be included with the dishwasher labor installation cost. | | | | | | | | | | |
| ***Electrical*** | | | | | | | | | | |

## CONTINUED - Kitchen

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 147. Flush mount wood-framed acrylic lens light fixture* | | | | | | | | | |
| 24.00 | EA | 39.41 | 46.24 | 189.16 | 1,181.24 | 29/20 yrs | Avg. | 90% [M] (468.44) | 712.80 |
| 148. Chandelier | | | | | | | | | |
| 1.00 | EA | 328.25 | 12.44 | 65.66 | 406.35 | 29/20 yrs | Avg. | 90% [M] (126.04) | 280.31 |
| 149. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] (32.60) | 81.96 |
| ********** | | | | | | | | | |
| 150. Window blind - PVC - 2" - 14.1 to 20 SF | | | | | | | | | |
| 1.00 | EA | 138.35 | 7.01 | 27.68 | 173.04 | 29/5 yrs | Avg. | 90% [M] (71.02) | 102.02 |
| 151. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 | EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. | 90% [M] (95.92) | 132.23 |
| **Totals: Kitchen** | | **1,590.89** | **6,671.42** | **41,618.90** | | | | **6,575.62** | **35,043.28** |

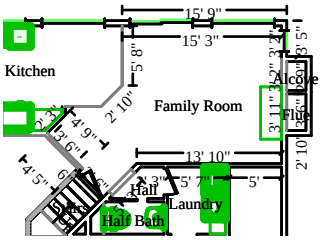


**Family Room** **Height: 9'**

| | | | |
|---|---|---|---|
| 344.91 | SF Walls | 244.42 | SF Ceiling |
| 589.32 | SF Walls & Ceiling | 244.42 | SF Floor |
| 27.16 | SY Flooring | 38.72 | LF Floor Perimeter |
| 58.72 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Window - Goes to Floor** | **6' X 8'** | **Opens into Exterior** |
| **Window** | **6' X 5' 6"** | **Opens into Exterior** |
| **Missing Wall** | **5' 8 3/8" X 9'** | **Opens into KITCHEN** |
| **Missing Wall** | **2' 10 3/16" X 9'** | **Opens into KITCHEN** |
| **Missing Wall** | **3' 4 13/16" X 9'** | **Opens into KITCHEN** |
| **Missing Wall - Goes to Ceiling** | **4' 9 1/4" X -1'** | **Opens into LIVING_ROOM** |
| **Missing Wall - Goes to Floor** | **3' 6" X 6' 8"** | **Opens into LIVING_ROOM** |
| **Door** | **2' 6" X 6' 8"** | **Opens into STAIRS** |
| **Missing Wall - Goes to Floor** | **3' X 7' 8"** | **Opens into HALL** |
| **Missing Wall - Goes to Floor** | **3' 11" X 3'** | **Opens into FLUE** |
| **Missing Wall - Goes to neither Floor/Ceiling** | **3' 2" X 6' 6"** | **Opens into ALCOVE1** |
| **Window** | **2' X 5' 6"** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|

***Demolition***

## CONTINUED - Family Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 152. Demolish/remove - bedroom/room (over 200 sf) | | | | | | | | | |
| 244.42 SF | 6.78 | 0.00 | 331.44 | 1,988.61 | 0/NA | Avg. | NA | (0.00) | 1,988.61 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 153. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 244.42 SF | 1.36 | 0.00 | 66.48 | 398.89 | 0/NA | Avg. | 0% | (0.00) | 398.89 |
| Ceiling Joists | | | | | | | | | |
| 154. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 244.42 SF | 2.02 | 10.49 | 98.74 | 602.96 | 0/15 yrs | Avg. | 0% | (0.00) | 602.96 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 155. Soda blasting exposed framing - Walls (PER SF) | | | | | | | | | |
| 180.00 SF | 3.89 | 14.22 | 140.04 | 854.46 | 0/NA | Avg. | 0% | (0.00) | 854.46 |
| fireplace framing | | | | | | | | | |
| ***Repairs*** | | | | | | | | | |
| 156. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 344.91 SF | 1.30 | 0.00 | 89.68 | 538.06 | 0/NA | Avg. | 0% | (0.00) | 538.06 |
| 157. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 344.91 SF | 1.50 | 12.78 | 103.48 | 633.63 | 0/15 yrs | Avg. | 0% | (0.00) | 633.63 |
| 158. Clean floor or roof joist system | | | | | | | | | |
| 244.42 SF | 1.55 | 0.48 | 75.78 | 455.11 | 0/NA | Avg. | 0% | (0.00) | 455.11 |
| 159. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 244.42 SF | 2.02 | 10.49 | 98.74 | 602.96 | 0/15 yrs | Avg. | 0% | (0.00) | 602.96 |
| 160. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 2,199.74 CF | 0.06 | 0.00 | 26.40 | 158.38 | 0/NA | Avg. | 0% | (0.00) | 158.38 |
| ***Framing Repairs*** | | | | | | | | | |
| 161. Floor trusses - up to 16" deep | | | | | | | | | |
| 24.00 LF | 14.03 | 11.84 | 67.34 | 415.90 | 0/150 yrs | Avg. | 0% | (0.00) | 415.90 |
| 3 open web floor trusses sistered to damaged trusses. | | | | | | | | | |
| 162. Carpenter - General Framer - per hour | | | | | | | | | |
| 4.00 HR | 114.80 | 0.00 | 91.84 | 551.04 | 0/NA | Avg. | 0% | (0.00) | 551.04 |
| Additional labor for sistering in trusses. | | | | | | | | | |
| 163. R&R Sheathing - plywood - 1/2" CDX | | | | | | | | | |
| 32.00 SF | 4.03 | 5.18 | 25.78 | 159.92 | 0/150 yrs | Avg. | 0% | (0.00) | 159.92 |
| ***Ceiling*** | | | | | | | | | |
| 164. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 244.42 SF | 4.62 | 22.16 | 225.84 | 1,377.22 | 0/150 yrs | Avg. | 0% | (0.00) | 1,377.22 |
| 165. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 244.42 SF | 1.39 | 5.72 | 67.94 | 413.40 | 5/15 yrs | Avg. | 33.33% | (21.46) | 391.94 |
| ***Walls*** | | | | | | | | | |

## CONTINUED - Family Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 166. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 344.91 SF | 4.46 | 28.92 | 307.66 | 1,874.88 | 0/150 yrs | Avg. | 0% | (0.00) | 1,874.88 |
| 167. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 99.43 LF | 5.69 | 6.40 | 113.16 | 685.32 | 0/150 yrs | Avg. | 0% | (0.00) | 685.32 |
| 168. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 344.91 SF | 1.39 | 8.07 | 95.88 | 583.37 | 5/15 yrs | Avg. | 33.33% | (30.28) | 553.09 |
| ***Floors*** | | | | | | | | | |
| 169. Carpet pad | | | | | | | | | |
| 244.42 SF | 0.70 | 12.15 | 34.22 | 217.46 | 5/10 yrs | Avg. | 50% | (68.41) | 149.05 |
| 170. Carpet | | | | | | | | | |
| 281.08 SF | 4.63 | 90.16 | 260.28 | 1,651.84 | 5/10 yrs | Avg. | 50% | (507.46) | 1,144.38 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 171. R&R 6-0 8-0 alum. sliding patio door - anodized - High grade | | | | | | | | | |
| 1.00 EA | 1,867.95 | 132.41 | 373.58 | 2,373.94 | 29/18 yrs | Avg. | 90% [M] | (1,341.41) | 1,032.53 |
| 172. Aluminum window, single hung 9-12 sf (2 pane) | | | | | | | | | |
| 1.00 EA | 300.38 | 18.39 | 60.08 | 378.85 | 29/18 yrs | Avg. | 90% [M] | (186.34) | 192.51 |
| 173. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. | 90% [M] | (338.13) | 285.01 |
| 174. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 92.00 SF | 4.17 | 37.40 | 76.72 | 497.76 | 29/18 yrs | Avg. | 90% [M] | (378.94) | 118.82 |
| 175. Window stool & apron | | | | | | | | | |
| 8.00 LF | 11.15 | 3.48 | 17.84 | 110.52 | 29/150 yrs | Avg. | 19.33% | (7.57) | 102.95 |
| 176. Seal & paint window stool and apron | | | | | | | | | |
| 8.00 LF | 5.90 | 0.35 | 9.44 | 56.99 | 5/15 yrs | Avg. | 33.33% | (1.32) | 55.67 |
| 177. Baseboard - 2 1/4" | | | | | | | | | |
| 38.72 LF | 4.30 | 4.64 | 33.30 | 204.44 | 29/150 yrs | Avg. | 19.33% | (10.11) | 194.33 |
| 178. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 38.72 LF | 2.22 | 0.53 | 17.20 | 103.69 | 5/15 yrs | Avg. | 33.33% | (1.99) | 101.70 |
| ***Fireplace*** | | | | | | | | | |
| 179. R&R Fireplace, zero clnce, gas burning, w/ venting | | | | | | | | | |
| 1.00 EA | 3,702.80 | 178.39 | 740.56 | 4,621.75 | 29/40 yrs | Avg. | 72.5% | (1,455.84) | 3,165.91 |
| 180. R&R Fireplace mantel - wood beam or shelf only (per LF) | | | | | | | | | |
| 5.00 LF | 121.81 | 25.84 | 121.82 | 756.71 | 29/150 yrs | Avg. | 19.33% | (56.24) | 700.47 |
| 181. Stain & finish wood fireplace mantel | | | | | | | | | |
| 5.00 LF | 11.84 | 0.17 | 11.84 | 71.21 | 5/15 yrs | Avg. | 33.33% | (0.64) | 70.57 |
| 182. Fireplace hearth - tile | | | | | | | | | |
| 20.00 SF | 31.92 | 20.79 | 127.68 | 786.87 | 29/150 yrs | Avg. | 19.33% | (45.24) | 741.63 |
| ***Electrical*** | | | | | | | | | |

## CONTINUED - Family Room

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 183. Ceiling fan & light | | | | | | | | | |
| 1.00 | EA | 452.98 | 12.43 | 90.60 | 556.01 | 29/20 yrs | Avg. | 90% [M] (125.94) | 430.07 |
| ********** | | | | | | | | | |
| 184. Window drapery - hardware - single rod - Large | | | | | | | | | |
| 1.00 | EA | 105.22 | 3.78 | 21.04 | 130.04 | 29/10 yrs | Avg. | 90% [M] (38.29) | 91.75 |
| 185. Window blind - PVC - 2" - 7.1 to 14 SF | | | | | | | | | |
| 1.00 | EA | 109.76 | 4.56 | 21.96 | 136.28 | 29/5 yrs | Avg. | 90% [M] (46.23) | 90.05 |
| 186. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 | EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. | 90% [M] (95.92) | 132.23 |
| **Totals: Family Room** | | **725.07** | **4,179.12** | **25,799.76** | | | | **4,757.76** | **21,042.00** |

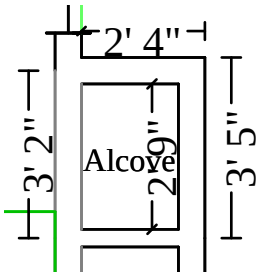


**Alcove** **Height: 7'**

| | |
|---|---|
| 46.29 SF Walls | 5.04 SF Ceiling |
| 51.33 SF Walls & Ceiling | 5.04 SF Floor |
| 0.56 SY Flooring | 9.17 LF Floor Perimeter |
| 9.17 LF Ceil. Perimeter | |

**Missing Wall - Goes to neither Floor/Ceiling 2' 9" X 6' 6" Opens into FAMILY_ROOM**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 187. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 5.04 | SF | 7.84 | 0.00 | 7.90 | 47.41 | 0/NA | Avg. | NA (0.00) | 47.41 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 188. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 5.04 | SF | 1.36 | 0.00 | 1.38 | 8.23 | 0/NA | Avg. | 0% (0.00) | 8.23 |
| Ceiling Joists | | | | | | | | | |
| 189. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 5.04 | SF | 2.02 | 0.22 | 2.04 | 12.44 | 0/15 yrs | Avg. | 0% (0.00) | 12.44 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 190. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 46.29 | SF | 1.30 | 0.00 | 12.04 | 72.22 | 0/NA | Avg. | 0% (0.00) | 72.22 |
| 191. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 46.29 | SF | 1.50 | 1.72 | 13.88 | 85.04 | 0/15 yrs | Avg. | 0% (0.00) | 85.04 |

## CONTINUED - Alcove

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 192. Clean floor or roof joist system | | | | | | | | | |
| 5.04 SF | 1.55 | 0.01 | 1.56 | 9.38 | 0/NA | Avg. | 0% | (0.00) | 9.38 |
| 193. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 5.04 SF | 2.02 | 0.22 | 2.04 | 12.44 | 0/15 yrs | Avg. | 0% | (0.00) | 12.44 |
| 194. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 35.29 CF | 0.06 | 0.00 | 0.42 | 2.54 | 0/NA | Avg. | 0% | (0.00) | 2.54 |
| ***Repairs*** | | | | | | | | | |
| ***Upper Box*** | | | | | | | | | |
| 195. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 37.00 SF | 4.46 | 3.10 | 33.00 | 201.12 | 0/150 yrs | Avg. | 0% | (0.00) | 201.12 |
| 196. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 11.50 LF | 5.69 | 0.74 | 13.08 | 79.26 | 0/150 yrs | Avg. | 0% | (0.00) | 79.26 |
| 197. Seal/prime (1 coat) then paint (1 coat) the surface area* | | | | | | | | | |
| 37.00 SF | 1.39 | 0.87 | 10.28 | 62.58 | 5/15 yrs | Avg. | 33.33% | (3.25) | 59.33 |
| ***Lower Box*** | | | | | | | | | |
| 198. Bead board - 1/4" to 3/8" hardwood | | | | | | | | | |
| 37.00 SF | 4.80 | 5.41 | 35.52 | 218.53 | 29/150 yrs | Avg. | 19.33% | (11.78) | 206.75 |
| 199. Stain & finish paneling | | | | | | | | | |
| 37.00 SF | 2.34 | 1.48 | 17.32 | 105.38 | 5/15 yrs | Avg. | 33.33% | (5.55) | 99.83 |
| 200. Shelving - 24" - in place - stain grade | | | | | | | | | |
| 5.50 LF | 28.77 | 9.55 | 31.64 | 199.43 | 29/150 yrs | Avg. | 19.33% | (20.79) | 178.64 |
| 201. Stain & finish wood shelving, 12"- 24" width | | | | | | | | | |
| 5.50 LF | 8.38 | 0.59 | 9.22 | 55.90 | 5/15 yrs | Avg. | 33.33% | (2.22) | 53.68 |
| ***Face of Boxes*** | | | | | | | | | |
| 202. Trim board - 1" x 4" - installed (hardwood - oak or =) | | | | | | | | | |
| 24.00 LF | 7.34 | 9.76 | 35.24 | 221.16 | 29/150 yrs | Avg. | 19.33% | (21.24) | 199.92 |
| 203. Trim board - 1" x 2" - installed (hardwood - oak or =) | | | | | | | | | |
| 12.00 LF | 5.29 | 2.83 | 12.70 | 79.01 | 29/150 yrs | Avg. | 19.33% | (6.16) | 72.85 |
| additional trim at lower box | | | | | | | | | |
| **Totals: Alcove** | | **36.50** | **239.26** | **1,472.07** | | | | **70.99** | **1,401.08** |

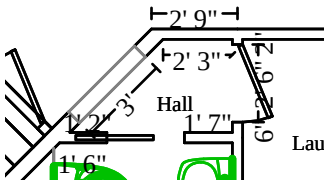


**Hall** **Height: 9'**

| | | | |
|---|---|---|---|
| 76.48 | SF Walls | 11.19 | SF Ceiling |
| 87.67 | SF Walls & Ceiling | 11.19 | SF Floor |
| 1.24 | SY Flooring | 6.71 | LF Floor Perimeter |
| 14.70 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **2' 6" X 6' 8"** | **Opens into HALF_BATH** |
| **Missing Wall - Goes to Floor** | **3' X 7' 8"** | **Opens into FAMILY_ROOM** |
| **Door** | **2' 6" X 6' 8"** | **Opens into LAUNDRY** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 204. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 11.19 SF | 7.84 | 0.00 | 17.54 | 105.27 | 0/NA | Avg. | NA | (0.00) | 105.27 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 205. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 11.19 SF | 1.36 | 0.00 | 3.04 | 18.26 | 0/NA | Avg. | 0% | (0.00) | 18.26 |
| Ceiling Joists | | | | | | | | | |
| 206. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 11.19 SF | 2.02 | 0.48 | 4.52 | 27.60 | 0/15 yrs | Avg. | 0% | (0.00) | 27.60 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 207. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 76.48 SF | 1.30 | 0.00 | 19.88 | 119.30 | 0/NA | Avg. | 0% | (0.00) | 119.30 |
| 208. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 76.48 SF | 1.50 | 2.83 | 22.94 | 140.49 | 0/15 yrs | Avg. | 0% | (0.00) | 140.49 |
| 209. Clean floor or roof joist system | | | | | | | | | |
| 11.19 SF | 1.55 | 0.02 | 3.46 | 20.82 | 0/NA | Avg. | 0% | (0.00) | 20.82 |
| 210. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 11.19 SF | 2.02 | 0.48 | 4.52 | 27.60 | 0/15 yrs | Avg. | 0% | (0.00) | 27.60 |
| 211. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 100.72 CF | 0.06 | 0.00 | 1.20 | 7.24 | 0/NA | Avg. | 0% | (0.00) | 7.24 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 212. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 11.19 SF | 4.62 | 1.01 | 10.34 | 63.05 | 0/150 yrs | Avg. | 0% | (0.00) | 63.05 |
| 213. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 11.19 SF | 1.39 | 0.26 | 3.12 | 18.93 | 5/15 yrs | Avg. | 33.33% | (0.99) | 17.94 |
| ***Walls*** | | | | | | | | | |
| 214. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 76.48 SF | 4.46 | 6.41 | 68.22 | 415.73 | 0/150 yrs | Avg. | 0% | (0.00) | 415.73 |
| 215. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 76.48 SF | 1.39 | 1.79 | 21.26 | 129.36 | 5/15 yrs | Avg. | 33.33% | (6.72) | 122.64 |

## CONTINUED - Hall

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Floors*** | | | | | | | | | |
| 216. Carpet pad | | | | | | | | | |
| 11.19 SF | 0.70 | 0.56 | 1.56 | 9.95 | 5/10 yrs | Avg. | 50% | (3.13) | 6.82 |
| 217. Carpet | | | | | | | | | |
| 12.87 SF | 4.63 | 4.13 | 11.92 | 75.64 | 5/10 yrs | Avg. | 50% | (23.23) | 52.41 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 218. Door opening (jamb & casing) - 32" to 36" wide - hardwood | | | | | | | | | |
| 1.00 EA | 262.05 | 17.48 | 52.42 | 331.95 | 29/150 yrs | Avg. | 19.33% | (38.04) | 293.91 |
| opening from family room to hallway<br>Includes: Jamb, casing for both sides of the opening, finish nails, shims, and installation labor. | | | | | | | | | |
| 219. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |
| 220. Baseboard - 2 1/4" | | | | | | | | | |
| 6.71 LF | 4.30 | 0.80 | 5.78 | 35.43 | 29/150 yrs | Avg. | 19.33% | (1.76) | 33.67 |
| 221. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 6.71 LF | 2.22 | 0.09 | 2.98 | 17.97 | 5/15 yrs | Avg. | 33.33% | (0.34) | 17.63 |
| ***Electrical*** | | | | | | | | | |
| 222. Light fixture | | | | | | | | | |
| 1.00 EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] | (32.60) | 81.96 |
| 223. Thermostat | | | | | | | | | |
| 1.00 EA | 132.81 | 5.05 | 26.56 | 164.42 | 10/35 yrs | Avg. | 28.57% | (16.23) | 148.19 |
| **Totals: Hall** | | **45.79** | **318.30** | **1,955.59** | | | | **127.47** | **1,828.12** |

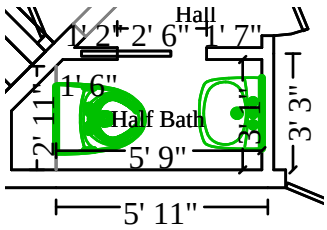


**Half Bath** **Height: 9'**

| | | | |
|---|---|---|---|
| 121.61 | SF Walls | 17.71 | SF Ceiling |
| 139.33 | SF Walls & Ceiling | 17.71 | SF Floor |
| 1.97 | SY Flooring | 11.90 | LF Floor Perimeter |
| 14.40 | LF Ceil. Perimeter | | |

**Door** **2' 6" X 6' 8"** **Opens into HALL**

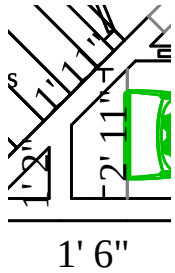


**Subroom: Alcove (1)** **Height: 6'**

| | | | |
|---|---|---|---|
| 29.56 | SF Walls | 2.84 | SF Ceiling |
| 32.39 | SF Walls & Ceiling | 2.84 | SF Floor |
| 0.32 | SY Flooring | 4.93 | LF Floor Perimeter |
| 4.93 | LF Ceil. Perimeter | | |

**Missing Wall** **2' 10 3/4" X 6'** **Opens into HALF_BATH**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 224. Demolish/remove - bathroom (up to 50 sf) | | | | | | | | | |
| 20.55 SF | 22.17 | 0.00 | 91.12 | 546.71 | 0/NA | Avg. | NA | (0.00) | 546.71 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 225. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 20.55 SF | 1.36 | 0.00 | 5.60 | 33.55 | 0/NA | Avg. | 0% | (0.00) | 33.55 |
| Ceiling Joists | | | | | | | | | |
| 226. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 20.55 SF | 2.02 | 0.88 | 8.30 | 50.69 | 0/15 yrs | Avg. | 0% | (0.00) | 50.69 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 227. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 151.17 SF | 1.30 | 0.00 | 39.30 | 235.82 | 0/NA | Avg. | 0% | (0.00) | 235.82 |
| 228. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 151.17 SF | 1.50 | 5.60 | 45.36 | 277.72 | 0/15 yrs | Avg. | 0% | (0.00) | 277.72 |
| 229. Clean floor or roof joist system | | | | | | | | | |
| 20.55 SF | 1.55 | 0.04 | 6.38 | 38.27 | 0/NA | Avg. | 0% | (0.00) | 38.27 |
| 230. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 20.55 SF | 2.02 | 0.88 | 8.30 | 50.69 | 0/15 yrs | Avg. | 0% | (0.00) | 50.69 |
| 231. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 176.58 CF | 0.06 | 0.00 | 2.12 | 12.71 | 0/NA | Avg. | 0% | (0.00) | 12.71 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 232. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 20.55 SF | 4.62 | 1.86 | 18.98 | 115.78 | 0/150 yrs | Avg. | 0% | (0.00) | 115.78 |
| 233. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 20.55 SF | 1.39 | 0.48 | 5.72 | 34.76 | 5/15 yrs | Avg. | 33.33% | (1.80) | 32.96 |
| ***Walls*** | | | | | | | | | |
| 234. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 151.17 SF | 4.46 | 12.68 | 134.84 | 821.74 | 0/150 yrs | Avg. | 0% | (0.00) | 821.74 |
| 235. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 3.00 LF | 5.69 | 0.19 | 3.42 | 20.68 | 0/150 yrs | Avg. | 0% | (0.00) | 20.68 |
| 236. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 151.17 SF | 1.39 | 3.54 | 42.02 | 255.69 | 5/15 yrs | Avg. | 33.33% | (13.27) | 242.42 |
| ***Floors*** | | | | | | | | | |

## CONTINUED - Half Bath

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 237. Tile floor covering | | | | | | | | | |
| 20.55 SF | 19.02 | 9.62 | 78.18 | 478.66 | 29/100 yrs | Avg. | 29% | (31.40) | 447.26 |
| 238. Tile base | | | | | | | | | |
| 16.83 LF | 31.99 | 6.65 | 107.68 | 652.72 | 29/100 yrs | Avg. | 29% | (21.70) | 631.02 |
| 239. Tile/stone sealer | | | | | | | | | |
| 28.96 SF | 1.70 | 0.93 | 9.84 | 60.00 | 10/2 yrs | Avg. | 90% [M] | (9.44) | 50.56 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 240. Pocket door unit - Colonist | | | | | | | | | |
| 1.00 EA | 395.16 | 17.64 | 79.04 | 491.84 | 29/100 yrs | Avg. | 29% | (57.60) | 434.24 |
| Includes: Pocket door assembly, rails, brackets, jamb, finish nails, wood shims, and installation labor.<br>Excludes: Pocket door latch, casing and painting. | | | | | | | | | |
| 241. Pocket door hardware | | | | | | | | | |
| 1.00 EA | 116.60 | 5.54 | 23.32 | 145.46 | 29/20 yrs | Avg. | 90% [M] | (56.11) | 89.35 |
| 242. Casing - 3 1/4" | | | | | | | | | |
| 34.00 LF | 4.44 | 9.22 | 30.20 | 190.38 | 29/150 yrs | Avg. | 19.33% | (20.05) | 170.33 |
| 243. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 244. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |
| ***Cabinetry*** | | | | | | | | | |
| 245. Medicine cabinet | | | | | | | | | |
| 1.00 EA | 212.29 | 15.50 | 42.46 | 270.25 | 10/20 yrs | Avg. | 50% | (87.25) | 183.00 |
| ***Plumbing*** | | | | | | | | | |
| 246. Pedestal sink | | | | | | | | | |
| 1.00 EA | 668.64 | 28.92 | 133.72 | 831.28 | 29/25 yrs | Avg. | 90% [M] | (292.94) | 538.34 |
| Includes: Pedestal sink, sink pop-up assembly, "P" trap, and installation labor. | | | | | | | | | |
| 247. Sink faucet - Bathroom | | | | | | | | | |
| 1.00 EA | 271.31 | 13.87 | 54.26 | 339.44 | 29/20 yrs | Avg. | 90% [M] | (140.55) | 198.89 |
| Includes: Kitchen sink faucet, hot and cold supply lines, and installation labor.<br>Excludes: Sink strainer.<br>Quality: Chrome or brass finish, washerless faucet with single or double handle; may include pull-down/out spout, touchless features, etc. | | | | | | | | | |
| 248. Toilet | | | | | | | | | |
| 1.00 EA | 648.32 | 29.67 | 129.66 | 807.65 | 29/150 yrs | Avg. | 19.33% | (64.57) | 743.08 |
| Includes: Toilet, wax ring, one supply line, two brass bowl bolts/screws, caulking, and installation labor.<br>Excludes: Toilet seat. | | | | | | | | | |
| 249. Toilet seat | | | | | | | | | |
| 1.00 EA | 71.17 | 3.07 | 14.24 | 88.48 | 29/9 yrs | Avg. | 90% [M] | (31.08) | 57.40 |
| 250. Angle stop valve | | | | | | | | | |
| 3.00 EA | 52.14 | 2.10 | 31.28 | 189.80 | 10/100 yrs | Avg. | 10% | (2.37) | 187.43 |
| ***Electrical*** | | | | | | | | | |

## CONTINUED - Half Bath

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 251. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] (32.60) | 81.96 |
| 252. Bathroom ventilation fan | | | | | | | | | |
| 1.00 | EA | 129.66 | 5.75 | 25.94 | 161.35 | 29/10 yrs | Avg. | 90% [M] (58.26) | 103.09 |
| ********** | | | | | | | | | |
| 253. Towel bar | | | | | | | | | |
| 1.00 | EA | 35.04 | 1.47 | 7.00 | 43.51 | 29/50 yrs | Avg. | 58% (9.61) | 33.90 |
| 254. Toilet paper holder | | | | | | | | | |
| 1.00 | EA | 32.31 | 1.21 | 6.46 | 39.98 | 29/50 yrs | Avg. | 58% (7.87) | 32.11 |
| **Totals: Half Bath** | | **183.74** | **1,244.14** | **7,648.42** | | | | **950.53** | **6,697.89** |

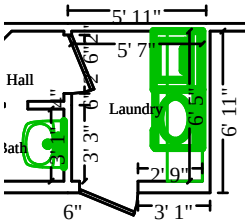


**Laundry** **Height: 9'**

| | | | |
|---|---|---|---|
| 182.66 | SF Walls | 35.83 | SF Ceiling |
| 218.49 | SF Walls & Ceiling | 35.83 | SF Floor |
| 3.98 | SY Flooring | 16.08 | LF Floor Perimeter |
| 24.00 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **2' 6" X 6' 8"** | **Opens into HALL** |
| **Door** | **2' 6" X 6' 8"** | **Opens into GARAGE** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 255. Demolish/remove - kitchen/laundry | | | | | | | | | |
| 35.83 | SF | 16.37 | 0.00 | 117.30 | 703.84 | 0/NA | Avg. | NA (0.00) | 703.84 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 256. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 35.83 | SF | 1.36 | 0.00 | 9.74 | 58.47 | 0/NA | Avg. | 0% (0.00) | 58.47 |
| Ceiling Joists | | | | | | | | | |
| 257. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 35.83 | SF | 2.02 | 1.54 | 14.48 | 88.40 | 0/15 yrs | Avg. | 0% (0.00) | 88.40 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 258. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 182.66 | SF | 1.30 | 0.00 | 47.50 | 284.96 | 0/NA | Avg. | 0% (0.00) | 284.96 |

## CONTINUED - Laundry

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 259. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 182.66 SF | 1.50 | 6.77 | 54.80 | 335.56 | 0/15 yrs | Avg. | 0% | (0.00) | 335.56 |
| 260. Clean floor or roof joist system | | | | | | | | | |
| 35.83 SF | 1.55 | 0.07 | 11.10 | 66.71 | 0/NA | Avg. | 0% | (0.00) | 66.71 |
| 261. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 35.83 SF | 2.02 | 1.54 | 14.48 | 88.40 | 0/15 yrs | Avg. | 0% | (0.00) | 88.40 |
| 262. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 322.43 CF | 0.06 | 0.00 | 3.88 | 23.23 | 0/NA | Avg. | 0% | (0.00) | 23.23 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 263. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 35.83 SF | 4.62 | 3.25 | 33.10 | 201.88 | 0/150 yrs | Avg. | 0% | (0.00) | 201.88 |
| 264. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 35.83 SF | 1.39 | 0.84 | 9.96 | 60.60 | 5/15 yrs | Avg. | 33.33% | (3.15) | 57.45 |
| ***Walls*** | | | | | | | | | |
| 265. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 182.66 SF | 4.46 | 15.32 | 162.94 | 992.92 | 0/150 yrs | Avg. | 0% | (0.00) | 992.92 |
| 266. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 182.66 SF | 1.39 | 4.27 | 50.78 | 308.95 | 5/15 yrs | Avg. | 33.33% | (16.03) | 292.92 |
| ***Floors*** | | | | | | | | | |
| 267. Tile floor covering | | | | | | | | | |
| 33.70 SF | 19.02 | 15.77 | 128.20 | 784.94 | 29/100 yrs | Avg. | 29% | (51.48) | 733.46 |
| 268. Tile base | | | | | | | | | |
| 16.08 LF | 31.99 | 6.35 | 102.88 | 623.63 | 29/100 yrs | Avg. | 29% | (20.73) | 602.90 |
| 269. Tile/stone sealer | | | | | | | | | |
| 41.74 SF | 1.70 | 1.34 | 14.20 | 86.50 | 10/2 yrs | Avg. | 90% [M] | (13.61) | 72.89 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 270. R&R Exterior door - metal - insulated - flush or panel style | | | | | | | | | |
| 1.00 EA | 567.95 | 38.06 | 113.58 | 719.59 | 29/100 yrs | Avg. | 29% | (124.23) | 595.36 |
| Includes: Exterior door, hinges, jamb, stop, brick mold, casing (one side), finish nails, screws, wood shims, caulk, and installation labor. Excludes: Lockset and painting. Quality: Insulated metal flush (smooth) or panel door with threshold, weatherstrip, and pre-drilled holes for lockset. | | | | | | | | | |
| 271. Prime & paint door slab only - exterior (per side) | | | | | | | | | |
| 2.00 EA | 64.80 | 3.39 | 25.92 | 158.91 | 5/15 yrs | Avg. | 33.33% | (12.71) | 146.20 |
| 272. Seal & paint door opening (per side)* | | | | | | | | | |
| 1.00 EA | 46.18 | 0.59 | 9.24 | 56.01 | 5/15 yrs | Avg. | 33.33% | (2.22) | 53.79 |
| 273. Door lockset & deadbolt - exterior | | | | | | | | | |
| 1.00 EA | 97.42 | 5.61 | 19.48 | 122.51 | 29/20 yrs | Avg. | 90% [M] | (56.85) | 65.66 |
| 274. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. | 29% | (82.53) | 368.17 |

## CONTINUED - Laundry

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 275. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 | EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |
| 276. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 | EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 277. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. | 90% [M] | (21.15) | 42.52 |
| ***Cabinetry*** | | | | | | | | | |
| 278. Custom cabinets - full height units | | | | | | | | | |
| 1.50 | LF | 472.54 | 56.02 | 141.76 | 906.59 | 10/50 yrs | Avg. | 20% | (126.11) | 780.48 |
| 279. Custom cabinets - wall units - 36" tall | | | | | | | | | |
| 5.00 | LF | 247.07 | 85.97 | 247.08 | 1,568.40 | 10/50 yrs | Avg. | 20% | (193.54) | 1,374.86 |
| 280. Add for prefinished crown molding per LF | | | | | | | | | |
| 6.50 | LF | 12.80 | 4.87 | 16.64 | 104.71 | 10/150 yrs | Avg. | 6.67% | (3.65) | 101.06 |
| ***Plumbing*** | | | | | | | | | |
| 281. Washing machine outlet box with valves | | | | | | | | | |
| 1.00 | EA | 369.19 | 3.12 | 73.84 | 446.15 | 29/15 yrs | Avg. | 90% [M] | (31.61) | 414.54 |
| Includes: Washing machine outlet box, valves, and installation labor. | | | | | | | | | |
| ***Appliances*** | | | | | | | | | |
| 282. Remove Washer/Washing Machine - Front-loading | | | | | | | | | |
| 1.00 | EA | 43.56 | 0.00 | 8.72 | 52.28 | 10/10 yrs | Avg. | NA [M] | (0.00) | 52.28 |
| 283. Install Washer/Washing Machine - Front-loading | | | | | | | | | |
| 1.00 | EA | 172.00 | 0.00 | 34.40 | 206.40 | 10/10 yrs | Avg. | 90% [M] | (0.00) | 206.40 |
| 284. Remove Dryer - Electric | | | | | | | | | |
| 1.00 | EA | 32.73 | 0.00 | 6.54 | 39.27 | 0/10 yrs | Avg. | NA | (0.00) | 39.27 |
| 285. Install Dryer - Electric | | | | | | | | | |
| 1.00 | EA | 124.98 | 0.00 | 25.00 | 149.98 | 0/10 yrs | Avg. | 0% | (0.00) | 149.98 |
| 286. Ductwork - hot or cold air - 4" round | | | | | | | | | |
| 7.00 | LF | 19.65 | 2.36 | 27.52 | 167.43 | 10/30 yrs | Avg. | 33.33% | (8.86) | 158.57 |
| ***Electrical*** | | | | | | | | | |
| 287. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] | (32.60) | 81.96 |
| 288. Bathroom ventilation fan | | | | | | | | | |
| 1.00 | EA | 129.66 | 5.75 | 25.94 | 161.35 | 29/10 yrs | Avg. | 90% [M] | (58.26) | 103.09 |
| **Totals: Laundry** | | **296.60** | **1,691.56** | **10,445.75** | | | | | **871.38** | **9,574.37** |

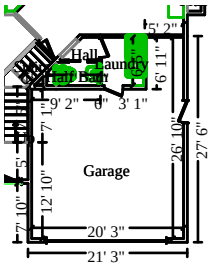


**Garage** **Height: 9'**

| | | | |
|---|---|---|---|
| 698.83 | SF Walls | 437.90 | SF Ceiling |
| 1136.73 | SF Walls & Ceiling | 437.90 | SF Floor |
| 48.66 | SY Flooring | 72.67 | LF Floor Perimeter |
| 94.17 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **3' X 6' 8"** | **Opens into Exterior** |
| **Door** | **2' 6" X 6' 8"** | **Opens into LAUNDRY** |
| **Door** | **16' X 7'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 289. Demolish/remove - bedroom/room (over 200 sf) | | | | | | | | | |
| 437.90 SF | 6.78 | 0.00 | 593.80 | 3,562.76 | 0/NA | Avg. | NA | (0.00) | 3,562.76 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 290. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 437.90 SF | 1.36 | 0.00 | 119.10 | 714.64 | 0/NA | Avg. | 0% | (0.00) | 714.64 |
| Ceiling Joists | | | | | | | | | |
| 291. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 437.90 SF | 2.02 | 18.79 | 176.92 | 1,080.27 | 0/15 yrs | Avg. | 0% | (0.00) | 1,080.27 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 292. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 698.83 SF | 1.30 | 0.00 | 181.70 | 1,090.18 | 0/NA | Avg. | 0% | (0.00) | 1,090.18 |
| 293. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 698.83 SF | 1.50 | 25.89 | 209.66 | 1,283.80 | 0/15 yrs | Avg. | 0% | (0.00) | 1,283.80 |
| 294. Clean concrete the floor | | | | | | | | | |
| 437.90 SF | 0.48 | 0.43 | 42.04 | 252.66 | 0/NA | Avg. | 0% | (0.00) | 252.66 |
| 295. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 3,941.07 CF | 0.06 | 0.00 | 47.30 | 283.76 | 0/NA | Avg. | 0% | (0.00) | 283.76 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 296. 5/8" drywall - hung, taped, floated, ready for paint | | | | | | | | | |
| 437.90 SF | 3.97 | 32.02 | 347.70 | 2,118.18 | 0/150 yrs | Avg. | 0% | (0.00) | 2,118.18 |
| 297. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 437.90 SF | 1.39 | 10.25 | 121.74 | 740.67 | 5/15 yrs | Avg. | 33.33% | (38.45) | 702.22 |
| ***Walls*** | | | | | | | | | |
| 298. 5/8" drywall - hung, taped, floated, ready for paint | | | | | | | | | |
| 698.83 SF | 3.97 | 51.10 | 554.88 | 3,380.34 | 0/150 yrs | Avg. | 0% | (0.00) | 3,380.34 |
| 299. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 698.83 SF | 1.39 | 16.35 | 194.28 | 1,182.00 | 5/15 yrs | Avg. | 33.33% | (61.36) | 1,120.64 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |

## CONTINUED - Garage

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 300. Exterior door slab - Detach & reset | | | | | | | | | |
| 1.00 | EA | 41.06 | 0.00 | 8.22 | 49.28 | 0/NA | Avg. | 0% (0.00) | 49.28 |
| pedestrian door at right elevation | | | | | | | | | |
| 301. Detach & Reset Door lockset & deadbolt - exterior | | | | | | | | | |
| 1.00 | EA | 47.85 | 0.00 | 9.58 | 57.43 | 0/20 yrs | Avg. | 0% (0.00) | 57.43 |
| 302. Prime & paint door slab only - exterior (per side) | | | | | | | | | |
| 2.00 | EA | 64.80 | 3.39 | 25.92 | 158.91 | 5/15 yrs | Avg. | 33.33% (12.71) | 146.20 |
| 303. Casing - 2 1/4" | | | | | | | | | |
| 17.00 | LF | 3.08 | 2.35 | 10.48 | 65.19 | 29/150 yrs | Avg. | 19.33% (5.12) | 60.07 |
| 304. Overhead (garage) door opener - Detach & reset | | | | | | | | | |
| 1.00 | EA | 346.68 | 0.00 | 69.34 | 416.02 | 0/NA | Avg. | 0% (0.00) | 416.02 |
| 305. Overhead door - Detach & reset - Large | | | | | | | | | |
| 1.00 | EA | 755.75 | 0.00 | 151.16 | 906.91 | 0/NA | Avg. | 0% (0.00) | 906.91 |
| 306. Seal & paint door opening (per side)* | | | | | | | | | |
| 1.00 | EA | 46.18 | 0.59 | 9.24 | 56.01 | 5/15 yrs | Avg. | 33.33% (2.22) | 53.79 |
| ***Electrical*** | | | | | | | | | |
| 307. Porcelain light fixture | | | | | | | | | |
| 2.00 | EA | 44.79 | 1.07 | 17.92 | 108.57 | 29/20 yrs | Avg. | 90% [M] (10.84) | 97.73 |
| ***HVAC, Plumbing*** | | | | | | | | | |
| 308. Furnace - forced air - Detach & reset | | | | | | | | | |
| 1.00 | EA | 1,177.53 | 0.00 | 235.50 | 1,413.03 | 0/NA | Avg. | 0% (0.00) | 1,413.03 |
| 309. Water heater - Detach & reset | | | | | | | | | |
| 1.00 | EA | 899.16 | 0.00 | 179.84 | 1,079.00 | 0/NA | Avg. | 0% (0.00) | 1,079.00 |
| 310. Water softener - Detach & reset | | | | | | | | | |
| 1.00 | EA | 899.16 | 0.00 | 179.84 | 1,079.00 | 0/NA | Avg. | 0% (0.00) | 1,079.00 |
| 311. Remove Water heater seismic strap kit - up to 55 gallon | | | | | | | | | |
| 1.00 | EA | 21.50 | 0.00 | 4.30 | 25.80 | 0/100 yrs | Avg. | NA (0.00) | 25.80 |
| 312. Remove Water heater overflow drain pan | | | | | | | | | |
| 1.00 | EA | 10.16 | 0.00 | 2.04 | 12.20 | 0/20 yrs | Avg. | NA (0.00) | 12.20 |
| 313. Install Water heater seismic strap kit - up to 55 gallon | | | | | | | | | |
| 1.00 | EA | 64.51 | 0.00 | 12.90 | 77.41 | 0/100 yrs | Avg. | 0% (0.00) | 77.41 |
| 314. Install Water heater overflow drain pan | | | | | | | | | |
| 1.00 | EA | 44.95 | 0.00 | 9.00 | 53.95 | 0/20 yrs | Avg. | 0% (0.00) | 53.95 |
| 315. Furnace or A/C - check, hvy cln, replace filters & service | | | | | | | | | |
| 2.00 | EA | 445.71 | 2.44 | 178.28 | 1,072.14 | 0/NA | Avg. | 0% (0.00) | 1,072.14 |

Clean furnace and ac unit
Includes: Cleaning chemical, filter, and labor.
Note: This item should be used when heavy contamination is present and partial disassembly of the furnace or A/C is necessary to completely clean the unit. HVAC technicians will typically clean the exterior of the furnace or A/C as part of the process of cleaning/servicing a unit.

## CONTINUED - Garage

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 316. Clean water heater | | | | | | | | | |
| 1.00 EA | 38.40 | 0.02 | 7.68 | 46.10 | 0/NA | Avg. | 0% | (0.00) | 46.10 |
| 317. Clean water softener | | | | | | | | | |
| 1.00 EA | 46.00 | 0.01 | 9.20 | 55.21 | 0/NA | Avg. | 0% | (0.00) | 55.21 |
| **Totals: Garage** | | **164.70** | **3,709.56** | **22,421.42** | | | | **130.70** | **22,290.72** |

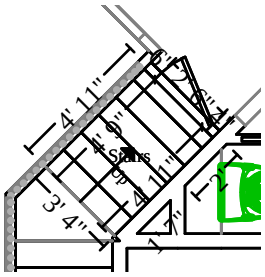


**Stairs** **Height: 13' 6"**

| | | | |
|---|---|---|---|
| 126.82 | SF Walls | 15.94 | SF Ceiling |
| 142.76 | SF Walls & Ceiling | 32.89 | SF Floor |
| 3.65 | SY Flooring | 6.12 | LF Floor Perimeter |
| 4.89 | LF Ceil. Perimeter | | |

**Door** **2' 6" X 6' 8"** **Opens into FAMILY_ROOM**

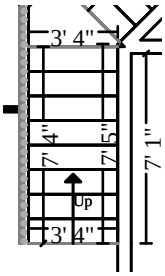


**Subroom: Stairs (1)** **Height: Sloped**

| | | | |
|---|---|---|---|
| 203.34 | SF Walls | 27.84 | SF Ceiling |
| 231.18 | SF Walls & Ceiling | 43.89 | SF Floor |
| 4.88 | SY Flooring | 8.94 | LF Floor Perimeter |
| 8.47 | LF Ceil. Perimeter | | |

**Missing Wall** **3' 4" X 15'** **Opens into LIVING_ROOM**

**Missing Wall** **3' 4" X 15'** **Opens into STAIRS1**

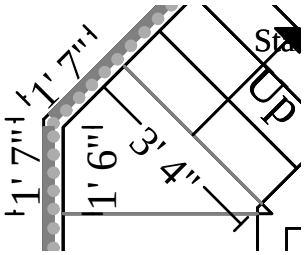


**Subroom: Stairs1 (2)** **Height: 8'**

| | | | |
|---|---|---|---|
| 21.77 | SF Walls | 5.30 | SF Ceiling |
| 27.07 | SF Walls & Ceiling | 5.32 | SF Floor |
| 0.59 | SY Flooring | | |

| | | |
|---|---|---|
| **Missing Wall** | **3' 4" X 8'** | **Opens into STAIRS2** |
| **Missing Wall** | **3' 4" X 8'** | **Opens into STAIRS** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 318. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 82.09 SF | 7.84 | 0.00 | 128.72 | 772.31 | 0/NA | Avg. | NA | (0.00) | 772.31 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 319. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 49.08 SF | 1.36 | 0.00 | 13.36 | 80.11 | 0/NA | Avg. | 0% | (0.00) | 80.11 |
| Ceiling Joists | | | | | | | | | |
| 320. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 49.08 SF | 2.02 | 2.11 | 19.82 | 121.07 | 0/15 yrs | Avg. | 0% | (0.00) | 121.07 |
| Includes underside of ceiling sheathing | | | | | | | | | |
| 321. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 351.93 SF | 1.30 | 0.00 | 91.50 | 549.01 | 0/NA | Avg. | 0% | (0.00) | 549.01 |
| 322. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 351.93 SF | 1.50 | 13.04 | 105.58 | 646.52 | 0/15 yrs | Avg. | 0% | (0.00) | 646.52 |
| 323. Clean floor or roof joist system | | | | | | | | | |
| 82.09 SF | 1.55 | 0.16 | 25.44 | 152.84 | 0/NA | Avg. | 0% | (0.00) | 152.84 |
| 324. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 82.09 SF | 2.02 | 3.52 | 33.16 | 202.50 | 0/15 yrs | Avg. | 0% | (0.00) | 202.50 |
| 325. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 584.64 CF | 0.06 | 0.00 | 7.02 | 42.10 | 0/NA | Avg. | 0% | (0.00) | 42.10 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 326. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 49.08 SF | 4.62 | 4.45 | 45.36 | 276.56 | 0/150 yrs | Avg. | 0% | (0.00) | 276.56 |
| 327. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 49.08 SF | 1.39 | 1.15 | 13.64 | 83.01 | 5/15 yrs | Avg. | 33.33% | (4.31) | 78.70 |
| ***Walls*** | | | | | | | | | |
| 328. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 351.93 SF | 4.46 | 29.51 | 313.92 | 1,913.04 | 0/150 yrs | Avg. | 0% | (0.00) | 1,913.04 |

## CONTINUED - Stairs

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 329. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 351.93 SF | 1.39 | 8.23 | 97.84 | 595.25 | 5/15 yrs | Avg. | 33.33% | (30.89) | 564.36 |
| ***Floors*** | | | | | | | | | |
| 330. Carpet pad | | | | | | | | | |
| 82.09 SF | 0.70 | 4.08 | 11.50 | 73.04 | 5/10 yrs | Avg. | 50% | (22.97) | 50.07 |
| 331. Carpet | | | | | | | | | |
| 94.41 SF | 4.63 | 30.28 | 87.42 | 554.82 | 5/10 yrs | Avg. | 50% | (170.44) | 384.38 |
| 15 % waste added for Carpet. | | | | | | | | | |
| 332. Step charge for "waterfall" carpet installation | | | | | | | | | |
| 16.00 EA | 16.74 | 0.80 | 53.56 | 322.20 | 5/10 yrs | Avg. | 50% | (4.48) | 317.72 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 333. R&R Balustrade - High grade | | | | | | | | | |
| 15.67 LF | 312.65 | 181.92 | 979.84 | 6,060.99 | 29/150 yrs | Avg. | 19.33% | (395.90) | 5,665.09 |
| Includes: Balusters, goose neck, handrail, newel post, rosette, volute, finish nails, and installation labor. Quality: Usually has an over-post design. Stained hardwood. Posts, balusters and top rail have premium grade flutes, twists and detailed turnings. May have rosette, goose neck, or volute fittings. Balusters usually drilled into rail and stair tread. | | | | | | | | | |
| 334. Stain & finish balustrade | | | | | | | | | |
| 15.67 LF | 42.80 | 7.43 | 134.14 | 812.25 | 5/15 yrs | Avg. | 33.33% | (27.87) | 784.38 |
| 335. R&R Stair Skirt/Apron - open side - hardwood | | | | | | | | | |
| 15.67 LF | 106.65 | 19.31 | 334.26 | 2,024.78 | 29/150 yrs | Avg. | 19.33% | (42.02) | 1,982.76 |
| 336. Stain & finish stair skirt/apron | | | | | | | | | |
| 15.67 LF | 11.93 | 0.67 | 37.38 | 224.99 | 5/15 yrs | Avg. | 33.33% | (2.52) | 222.47 |
| 337. Seal & paint stair stringer - one side | | | | | | | | | |
| 15.67 LF | 6.49 | 0.78 | 20.34 | 122.82 | 5/15 yrs | Avg. | 33.33% | (2.92) | 119.90 |
| ***Closet Under Stairs*** | | | | | | | | | |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 338. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 21.36 SF | 4.62 | 1.94 | 19.74 | 120.36 | 0/150 yrs | Avg. | 0% | (0.00) | 120.36 |
| 339. Seal/prime (1 coat) then paint (1 coat) the surface area* | | | | | | | | | |
| 21.36 SF | 1.39 | 0.50 | 5.94 | 36.13 | 5/15 yrs | Avg. | 33.33% | (1.88) | 34.25 |
| ***Walls*** | | | | | | | | | |
| 340. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 89.73 SF | 4.46 | 7.52 | 80.04 | 487.76 | 0/150 yrs | Avg. | 0% | (0.00) | 487.76 |
| 341. Seal/prime (1 coat) then paint (1 coat) the surface area* | | | | | | | | | |
| 89.73 SF | 1.39 | 2.10 | 24.94 | 151.76 | 5/15 yrs | Avg. | 33.33% | (7.88) | 143.88 |
| ***Floors*** | | | | | | | | | |
| 342. Carpet pad | | | | | | | | | |
| 15.94 SF | 0.70 | 0.79 | 2.24 | 14.19 | 5/10 yrs | Avg. | 50% | (4.45) | 9.74 |

**CONTINUED - Stairs**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 343. Carpet | | | | | | | | | |
| 18.33 | SF | 4.63 | 5.88 | 16.98 | 107.73 | 5/10 yrs | Avg. 50% | (33.09) | 74.64 |
| 15 % waste added for Carpet. | | | | | | | | | |
| 344. Step charge for "tucked" carpet installation - High grade | | | | | | | | | |
| 16.00 | EA | 24.31 | 0.80 | 77.80 | 467.56 | 0/10 yrs | Avg. 0% | (0.00) | 467.56 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 345. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 | EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 346. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 | EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. 33.33% | (7.63) | 128.60 |
| 347. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 | EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. 33.33% | (4.43) | 107.59 |
| 348. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 349. Baseboard - 2 1/4" | | | | | | | | | |
| 15.06 | LF | 4.30 | 1.81 | 12.96 | 79.53 | 29/150 yrs | Avg. 19.33% | (3.93) | 75.60 |
| 350. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 15.06 | LF | 2.22 | 0.21 | 6.68 | 40.32 | 5/15 yrs | Avg. 33.33% | (0.77) | 39.55 |
| 351. Closet shelf and rod package | | | | | | | | | |
| 3.33 | LF | 31.24 | 1.45 | 20.80 | 126.28 | 29/150 yrs | Avg. 19.33% | (3.15) | 123.13 |
| 352. Seal & paint closet shelving | | | | | | | | | |
| 3.33 | LF | 13.15 | 0.54 | 8.76 | 53.09 | 5/15 yrs | Avg. 33.33% | (2.02) | 51.07 |
| ***Electrical*** | | | | | | | | | |
| 353. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. 90% [M] | (32.60) | 81.96 |
| **Totals: Stairs** | | **364.78** | **2,971.24** | **18,192.10** | | | | **909.83** | **17,282.27** |

| | | | | | |
|---|---|---|---|---|---|
| **Total: 1st Floor** | **4,440.30** | **27,071.62** | **166,868.06** | **20,182.78** | **146,685.28** |

## 2nd Floor

### 2nd Floor

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|

***Repairs***

## CONTINUED - 2nd Floor

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 354. Batt insulation - 4" - R15 - paper / foil faced | | | | | | | | | |
| 1,182.77 SF | 1.38 | 102.64 | 326.44 | 2,061.30 | 0/150 yrs | Avg. | 0% | (0.00) | 2,061.30 |
| 355. Batt insulation - 10" - R30 - unfaced batt | | | | | | | | | |
| 826.54 SF | 1.85 | 101.54 | 305.82 | 1,936.46 | 0/150 yrs | Avg. | 0% | (0.00) | 1,936.46 |
| **Total: 2nd Floor** | | **204.18** | **632.26** | **3,997.76** | | | | **0.00** | **3,997.76** |

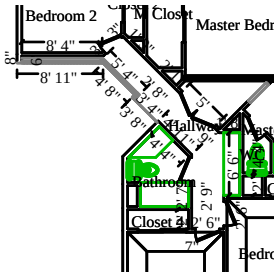


**Hallway** **Height: 9'**

| | |
|---|---|
| 403.45 SF Walls | 91.22 SF Ceiling |
| 494.68 SF Walls & Ceiling | 91.22 SF Floor |
| 10.14 SY Flooring | 31.15 LF Floor Perimeter |
| 55.82 LF Ceil. Perimeter | |

| | | |
|---|---|---|
| **Door** | **2' 6" X 6' 8"** | **Opens into BEDROOM_3** |
| **Door** | **5' X 6' 8"** | **Opens into MASTER_BEDRO** |
| **Door** | **2' 4" X 6' 8"** | **Opens into BEDROOM_2** |
| **Missing Wall** | **8' 5 1/16" X 9'** | **Opens into Exterior** |
| **Missing Wall** | **5' 4 3/8" X 9'** | **Opens into Exterior** |
| **Missing Wall** | **8 9/16" X 9'** | **Opens into Exterior** |
| **Missing Wall** | **3' 3 7/8" X 9'** | **Opens into Exterior** |
| **Door** | **2' 6" X 6' 8"** | **Opens into BATHROOM** |
| **Door** | **2' 6" X 6' 8"** | **Opens into BEDROOM_4** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 356. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 91.22 SF | 7.84 | 0.00 | 143.04 | 858.20 | 0/NA | Avg. | NA | (0.00) | 858.20 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 357. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 91.22 SF | 1.36 | 0.00 | 24.82 | 148.88 | 0/NA | Avg. | 0% | (0.00) | 148.88 |
| Attic | | | | | | | | | |
| 358. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 91.22 SF | 2.37 | 4.27 | 43.24 | 263.70 | 0/15 yrs | Avg. | 0% | (0.00) | 263.70 |
| Includes underside of roof sheathing. | | | | | | | | | |

**CONTINUED - Hallway**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 359. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 403.45 SF | 1.30 | 0.00 | 104.90 | 629.39 | 0/NA | Avg. | 0% | (0.00) | 629.39 |
| 360. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 403.45 SF | 1.50 | 14.95 | 121.04 | 741.17 | 0/15 yrs | Avg. | 0% | (0.00) | 741.17 |
| 361. Clean floor or roof joist system | | | | | | | | | |
| 91.22 SF | 1.55 | 0.18 | 28.28 | 169.85 | 0/NA | Avg. | 0% | (0.00) | 169.85 |
| 362. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 91.22 SF | 2.02 | 3.91 | 36.86 | 225.03 | 0/15 yrs | Avg. | 0% | (0.00) | 225.03 |
| 363. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 821.02 CF | 0.06 | 0.00 | 9.86 | 59.12 | 0/NA | Avg. | 0% | (0.00) | 59.12 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 364. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 91.22 SF | 4.62 | 8.27 | 84.28 | 513.99 | 0/150 yrs | Avg. | 0% | (0.00) | 513.99 |
| 365. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 91.22 SF | 1.39 | 2.13 | 25.36 | 154.29 | 5/15 yrs | Avg. | 33.33% | (8.01) | 146.28 |
| ***Walls*** | | | | | | | | | |
| 366. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 403.45 SF | 4.46 | 33.83 | 359.88 | 2,193.10 | 0/150 yrs | Avg. | 0% | (0.00) | 2,193.10 |
| 367. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 403.45 SF | 1.39 | 9.44 | 112.16 | 682.40 | 5/15 yrs | Avg. | 33.33% | (35.43) | 646.97 |
| ***Floors*** | | | | | | | | | |
| 368. Carpet pad | | | | | | | | | |
| 91.22 SF | 0.70 | 4.54 | 12.78 | 81.17 | 5/10 yrs | Avg. | 50% | (25.53) | 55.64 |
| 369. Carpet | | | | | | | | | |
| 104.91 SF | 4.63 | 33.65 | 97.14 | 616.52 | 5/10 yrs | Avg. | 50% | (189.41) | 427.11 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 370. Balustrade - High grade | | | | | | | | | |
| 15.00 LF | 304.52 | 174.14 | 913.56 | 5,655.50 | 29/150 yrs | Avg. | 19.33% | (378.97) | 5,276.53 |
| Includes: Balusters, goose neck, handrail, newel post, rosette, volute, finish nails, and installation labor. Quality: Usually has an over-post design. Stained hardwood. Posts, balusters and top rail have premium grade flutes, twists and detailed turnings. May have rosette, goose neck, or volute fittings. Balusters usually drilled into rail and stair tread. | | | | | | | | | |
| 371. Stain & finish balustrade | | | | | | | | | |
| 15.00 LF | 42.80 | 7.11 | 128.40 | 777.51 | 5/15 yrs | Avg. | 33.33% | (26.67) | 750.84 |
| 372. Baseboard - 2 1/4" | | | | | | | | | |
| 31.15 LF | 4.30 | 3.74 | 26.80 | 164.49 | 29/150 yrs | Avg. | 19.33% | (8.13) | 156.36 |
| 373. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 31.15 LF | 2.22 | 0.43 | 13.84 | 83.42 | 5/15 yrs | Avg. | 33.33% | (1.59) | 81.83 |
| ***Cabinetry*** | | | | | | | | | |

## CONTINUED - Hallway

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 374. Custom cabinets - wall units - 36" tall | | | | | | | | | |
| 6.50 LF | 247.07 | 111.76 | 321.20 | 2,038.92 | 10/50 yrs | Avg. | 20% | (251.61) | 1,787.31 |
| 375. Add for prefinished crown molding per LF | | | | | | | | | |
| 6.50 LF | 12.80 | 4.87 | 16.64 | 104.71 | 10/150 yrs | Avg. | 6.67% | (3.65) | 101.06 |
| 376. Custom cabinets - base units | | | | | | | | | |
| 6.50 LF | 350.05 | 174.37 | 455.06 | 2,904.76 | 10/50 yrs | Avg. | 20% | (392.55) | 2,512.21 |
| 377. Countertop - wood - butcher block (hardrock maple) | | | | | | | | | |
| 13.00 SF | 87.58 | 37.04 | 227.70 | 1,403.28 | 10/150 yrs | Avg. | 6.67% | (27.79) | 1,375.49 |
| ***Electrical*** | | | | | | | | | |
| 378. Light fixture | | | | | | | | | |
| 2.00 EA | 92.78 | 6.44 | 37.12 | 229.12 | 29/20 yrs | Avg. | 90% [M] | (65.20) | 163.92 |
| 379. Thermostat | | | | | | | | | |
| 1.00 EA | 132.81 | 5.05 | 26.56 | 164.42 | 10/35 yrs | Avg. | 28.57% | (16.23) | 148.19 |
| **Totals: Hallway** | | **640.12** | **3,370.52** | **20,862.94** | | | | **1,430.77** | **19,432.17** |

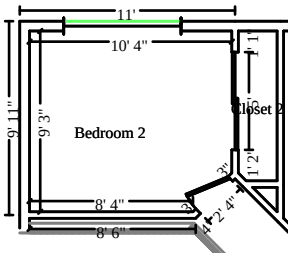


**Bedroom 2** **Height: 9'**

| | | | |
|---|---|---|---|
| 269.40 | SF Walls | 93.74 | SF Ceiling |
| 363.15 | SF Walls & Ceiling | 93.74 | SF Floor |
| 10.42 | SY Flooring | 30.70 | LF Floor Perimeter |
| 38.03 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **5' X 6' 8"** | **Opens into CLOSET_2** |
| **Door** | **2' 4" X 6' 8"** | **Opens into HALLWAY** |
| **Window** | **6' X 4'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 380. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 93.74 SF | 7.84 | 0.00 | 146.98 | 881.90 | 0/NA | Avg. | NA | (0.00) | 881.90 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 381. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 93.74 SF | 1.36 | 0.00 | 25.50 | 152.99 | 0/NA | Avg. | 0% | (0.00) | 152.99 |

Attic

## CONTINUED - Bedroom 2

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 382. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 93.74 SF | 2.37 | 4.39 | 44.44 | 270.99 | 0/15 yrs | Avg. | 0% | (0.00) | 270.99 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 383. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 269.40 SF | 1.30 | 0.00 | 70.04 | 420.26 | 0/NA | Avg. | 0% | (0.00) | 420.26 |
| 384. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 269.40 SF | 1.50 | 9.98 | 80.82 | 494.90 | 0/15 yrs | Avg. | 0% | (0.00) | 494.90 |
| 385. Clean floor or roof joist system | | | | | | | | | |
| 93.74 SF | 1.55 | 0.18 | 29.06 | 174.54 | 0/NA | Avg. | 0% | (0.00) | 174.54 |
| 386. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 93.74 SF | 2.02 | 4.02 | 37.88 | 231.25 | 0/15 yrs | Avg. | 0% | (0.00) | 231.25 |
| 387. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 843.70 CF | 0.06 | 0.00 | 10.12 | 60.74 | 0/NA | Avg. | 0% | (0.00) | 60.74 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 388. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 93.74 SF | 4.62 | 8.50 | 86.62 | 528.20 | 0/150 yrs | Avg. | 0% | (0.00) | 528.20 |
| 389. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 93.74 SF | 1.39 | 2.19 | 26.06 | 158.55 | 5/15 yrs | Avg. | 33.33% | (8.23) | 150.32 |
| ***Walls*** | | | | | | | | | |
| 390. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 269.40 SF | 4.46 | 22.59 | 240.30 | 1,464.41 | 0/150 yrs | Avg. | 0% | (0.00) | 1,464.41 |
| 391. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 269.40 SF | 1.39 | 6.30 | 74.90 | 455.67 | 5/15 yrs | Avg. | 33.33% | (23.65) | 432.02 |
| ***Floors*** | | | | | | | | | |
| 392. Carpet pad | | | | | | | | | |
| 93.74 SF | 0.70 | 4.66 | 13.12 | 83.40 | 5/10 yrs | Avg. | 50% | (26.23) | 57.17 |
| 393. Carpet | | | | | | | | | |
| 107.81 SF | 4.63 | 34.58 | 99.84 | 633.58 | 5/10 yrs | Avg. | 50% | (194.64) | 438.94 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 394. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. | 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 395. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 396. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |

## CONTINUED - Bedroom 2

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 397. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 398. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. 90% [M] | (338.13) | 285.01 |
| 399. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 24.00 | SF | 4.17 | 9.76 | 20.02 | 129.86 | 29/18 yrs | Avg. 90% [M] | (98.85) | 31.01 |
| 400. Window stool & apron | | | | | | | | | |
| 6.00 | LF | 11.15 | 2.61 | 13.38 | 82.89 | 29/150 yrs | Avg. 19.33% | (5.67) | 77.22 |
| 401. Seal & paint window stool and apron | | | | | | | | | |
| 6.00 | LF | 5.90 | 0.26 | 7.08 | 42.74 | 5/15 yrs | Avg. 33.33% | (0.99) | 41.75 |
| 402. Baseboard - 2 1/4" | | | | | | | | | |
| 30.70 | LF | 4.30 | 3.68 | 26.40 | 162.09 | 29/150 yrs | Avg. 19.33% | (8.01) | 154.08 |
| 403. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 30.70 | LF | 2.22 | 0.42 | 13.64 | 82.21 | 5/15 yrs | Avg. 33.33% | (1.57) | 80.64 |
| ***Electrical*** | | | | | | | | | |
| 404. Ceiling fan & light | | | | | | | | | |
| 1.00 | EA | 452.98 | 12.43 | 90.60 | 556.01 | 29/20 yrs | Avg. 90% [M] | (125.94) | 430.07 |
| ********** | | | | | | | | | |
| 405. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 | EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. 90% [M] | (95.92) | 132.23 |
| **Totals: Bedroom 2** | | **199.98** | **1,413.54** | **8,681.09** | | | | **1,043.57** | **7,637.52** |

**Closet 2** **Height: 9'**

| | | | |
|---|---|---|---|
| 138.29 | SF Walls | 15.14 | SF Ceiling |
| 153.43 | SF Walls & Ceiling | 15.14 | SF Floor |
| 1.68 | SY Flooring | 14.07 | LF Floor Perimeter |
| 19.07 | LF Ceil. Perimeter | | |

**Door** **5' X 6' 8"** **Opens into BEDROOM_2**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 406. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 15.14 | SF | 7.84 | 0.00 | 23.74 | 142.44 | 0/NA | Avg. NA | (0.00) | 142.44 |

## CONTINUED - Closet 2

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 407. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 15.14 SF | 1.36 | 0.00 | 4.12 | 24.71 | 0/NA | Avg. | 0% | (0.00) | 24.71 |
| Attic | | | | | | | | | |
| 408. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 15.14 SF | 2.37 | 0.71 | 7.18 | 43.77 | 0/15 yrs | Avg. | 0% | (0.00) | 43.77 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 409. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 138.29 SF | 1.30 | 0.00 | 35.96 | 215.74 | 0/NA | Avg. | 0% | (0.00) | 215.74 |
| 410. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 138.29 SF | 1.50 | 5.12 | 41.48 | 254.04 | 0/15 yrs | Avg. | 0% | (0.00) | 254.04 |
| 411. Clean floor or roof joist system | | | | | | | | | |
| 15.14 SF | 1.55 | 0.03 | 4.70 | 28.20 | 0/NA | Avg. | 0% | (0.00) | 28.20 |
| 412. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 15.14 SF | 2.02 | 0.65 | 6.12 | 37.35 | 0/15 yrs | Avg. | 0% | (0.00) | 37.35 |
| 413. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 136.28 CF | 0.06 | 0.00 | 1.64 | 9.82 | 0/NA | Avg. | 0% | (0.00) | 9.82 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 414. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 15.14 SF | 4.62 | 1.37 | 14.00 | 85.32 | 0/150 yrs | Avg. | 0% | (0.00) | 85.32 |
| 415. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 15.14 SF | 1.39 | 0.35 | 4.20 | 25.59 | 5/15 yrs | Avg. | 33.33% | (1.33) | 24.26 |
| ***Walls*** | | | | | | | | | |
| 416. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 138.29 SF | 4.46 | 11.60 | 123.36 | 751.73 | 0/150 yrs | Avg. | 0% | (0.00) | 751.73 |
| 417. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 138.29 SF | 1.39 | 3.24 | 38.44 | 233.90 | 5/15 yrs | Avg. | 33.33% | (12.14) | 221.76 |
| ***Floors*** | | | | | | | | | |
| 418. Carpet pad | | | | | | | | | |
| 15.14 SF | 0.70 | 0.75 | 2.12 | 13.47 | 5/10 yrs | Avg. | 50% | (4.23) | 9.24 |
| 419. Carpet | | | | | | | | | |
| 17.41 SF | 4.63 | 5.58 | 16.12 | 102.31 | 5/10 yrs | Avg. | 50% | (31.43) | 70.88 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 420. Bypass (sliding) door set - Colonist | | | | | | | | | |
| 1.00 EA | 316.21 | 20.39 | 63.24 | 399.84 | 29/100 yrs | Avg. | 29% | (66.55) | 333.29 |

## CONTINUED - Closet 2

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 421. Door opening (jamb & casing) - 60" or wider - paint grade | | | | | | | | | |
| 1.00 | EA | 289.01 | 17.17 | 57.80 | 363.98 | 29/150 yrs | Avg. 19.33% | (37.38) | 326.60 |
| 422. Seal 1coat & paint 1coat bypass dr set-slab only(per side)* | | | | | | | | | |
| 2.00 | EA | 65.66 | 3.11 | 26.26 | 160.69 | 5/15 yrs | Avg. 33.33% | (11.69) | 149.00 |
| 423. Seal & paint door opening - Large (per side)* | | | | | | | | | |
| 2.00 | EA | 57.43 | 1.99 | 22.98 | 139.83 | 5/15 yrs | Avg. 33.33% | (7.47) | 132.36 |
| 424. Closet Organizer - Melamine | | | | | | | | | |
| 7.00 | LF | 119.41 | 19.83 | 167.18 | 1,022.88 | 29/150 yrs | Avg. 19.33% | (43.14) | 979.74 |
| 425. Baseboard - 2 1/4" | | | | | | | | | |
| 14.07 | LF | 4.30 | 1.69 | 12.10 | 74.29 | 29/150 yrs | Avg. 19.33% | (3.68) | 70.61 |
| 426. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 14.07 | LF | 2.22 | 0.19 | 6.24 | 37.67 | 5/15 yrs | Avg. 33.33% | (0.72) | 36.95 |
| **Totals: Closet 2** | | **93.77** | **678.98** | **4,167.57** | | | | **219.76** | **3,947.81** |

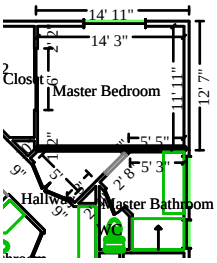


**Master Bedroom** **Height: Peaked**

| | | | |
|---|---|---|---|
| 554.72 | SF Walls | 212.83 | SF Ceiling |
| 767.55 | SF Walls & Ceiling | 196.62 | SF Floor |
| 21.85 | SY Flooring | 44.59 | LF Floor Perimeter |
| 60.80 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Missing Wall - Goes to Floor** | **2' 8" X 6' 8"** | **Opens into MASTER_BATHR** |
| **Door** | **5' X 6' 8"** | **Opens into HALLWAY** |
| **Door** | **6' X 6' 8"** | **Opens into M_CLOSET** |
| **Window** | **6' X 4'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 427. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 196.62 | SF | 7.84 | 0.00 | 308.30 | 1,849.80 | 0/NA | Avg. | NA | (0.00) | 1,849.80 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 428. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 212.83 | SF | 1.36 | 0.00 | 57.90 | 347.35 | 0/NA | Avg. | 0% | (0.00) | 347.35 |

## CONTINUED - Master Bedroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| Attic | | | | | | | | | |
| 429. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 212.83 SF | 2.37 | 9.96 | 100.88 | 615.25 | 0/15 yrs | Avg. | 0% | (0.00) | 615.25 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 430. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 554.72 SF | 1.30 | 0.00 | 144.22 | 865.36 | 0/NA | Avg. | 0% | (0.00) | 865.36 |
| 431. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 554.72 SF | 1.50 | 20.55 | 166.42 | 1,019.05 | 0/15 yrs | Avg. | 0% | (0.00) | 1,019.05 |
| 432. Clean floor or roof joist system | | | | | | | | | |
| 196.62 SF | 1.55 | 0.38 | 60.96 | 366.10 | 0/NA | Avg. | 0% | (0.00) | 366.10 |
| 433. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 196.62 SF | 2.02 | 8.43 | 79.44 | 485.04 | 0/15 yrs | Avg. | 0% | (0.00) | 485.04 |
| 434. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 2,309.77 CF | 0.06 | 0.00 | 27.72 | 166.31 | 0/NA | Avg. | 0% | (0.00) | 166.31 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 435. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 212.83 SF | 4.62 | 19.30 | 196.66 | 1,199.23 | 0/150 yrs | Avg. | 0% | (0.00) | 1,199.23 |
| 436. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 212.83 SF | 1.39 | 4.98 | 59.16 | 359.97 | 5/15 yrs | Avg. | 33.33% | (18.69) | 341.28 |
| ***Walls*** | | | | | | | | | |
| 437. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 554.72 SF | 4.46 | 46.51 | 494.82 | 3,015.38 | 0/150 yrs | Avg. | 0% | (0.00) | 3,015.38 |
| 438. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 554.72 SF | 1.39 | 12.98 | 154.22 | 938.26 | 5/15 yrs | Avg. | 33.33% | (48.71) | 889.55 |
| ***Floors*** | | | | | | | | | |
| 439. Carpet pad | | | | | | | | | |
| 196.62 SF | 0.70 | 9.78 | 27.52 | 174.93 | 5/10 yrs | Avg. | 50% | (55.03) | 119.90 |
| 440. Carpet | | | | | | | | | |
| 226.11 SF | 4.63 | 72.53 | 209.38 | 1,328.80 | 5/10 yrs | Avg. | 50% | (408.21) | 920.59 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 441. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. | 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 442. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 443. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |

## CONTINUED - Master Bedroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 444. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 445. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. 90% [M] | (338.13) | 285.01 |
| 446. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 24.00 | SF | 4.17 | 9.76 | 20.02 | 129.86 | 29/18 yrs | Avg. 90% [M] | (98.85) | 31.01 |
| 447. Window stool & apron | | | | | | | | | |
| 6.00 | LF | 11.15 | 2.61 | 13.38 | 82.89 | 29/150 yrs | Avg. 19.33% | (5.67) | 77.22 |
| 448. Seal & paint window stool and apron | | | | | | | | | |
| 6.00 | LF | 5.90 | 0.26 | 7.08 | 42.74 | 5/15 yrs | Avg. 33.33% | (0.99) | 41.75 |
| 449. Baseboard - 2 1/4" | | | | | | | | | |
| 44.59 | LF | 4.30 | 5.35 | 38.34 | 235.43 | 29/150 yrs | Avg. 19.33% | (11.63) | 223.80 |
| 450. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 44.59 | LF | 2.22 | 0.61 | 19.80 | 119.40 | 5/15 yrs | Avg. 33.33% | (2.28) | 117.12 |
| ***Electrical*** | | | | | | | | | |
| 451. Ceiling fan & light | | | | | | | | | |
| 1.00 | EA | 452.98 | 12.43 | 90.60 | 556.01 | 29/20 yrs | Avg. 90% [M] | (125.94) | 430.07 |
| 452. Add on - Ceiling fan down rod - 19"-36" | | | | | | | | | |
| 1.00 | EA | 56.43 | 3.72 | 11.28 | 71.43 | 29/20 yrs | Avg. 90% [M] | (37.73) | 33.70 |
| ********** | | | | | | | | | |
| 453. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 | EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. 90% [M] | (95.92) | 132.23 |
| **Totals: Master Bedroom** | | **313.57** | **2,544.84** | **15,582.50** | | | | **1,363.52** | **14,218.98** |

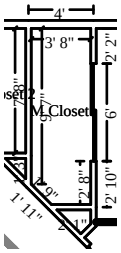


**M Closet** **Height: 9'**

| | | | |
|---|---|---|---|
| 214.41 | SF Walls | 38.94 | SF Ceiling |
| 253.35 | SF Walls & Ceiling | 38.94 | SF Floor |
| 4.33 | SY Flooring | 22.27 | LF Floor Perimeter |
| 28.27 | LF Ceil. Perimeter | | |

**Door** **6' X 6' 8"** **Opens into MASTER_BEDRO**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|

***Demolition***

## CONTINUED - M Closet

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 454. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 38.94 SF | 7.84 | 0.00 | 61.06 | 366.35 | 0/NA | Avg. | NA | (0.00) | 366.35 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 455. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 38.94 SF | 1.36 | 0.00 | 10.60 | 63.56 | 0/NA | Avg. | 0% | (0.00) | 63.56 |
| Attic | | | | | | | | | |
| 456. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 38.94 SF | 2.37 | 1.82 | 18.46 | 112.57 | 0/15 yrs | Avg. | 0% | (0.00) | 112.57 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 457. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 214.41 SF | 1.30 | 0.00 | 55.74 | 334.47 | 0/NA | Avg. | 0% | (0.00) | 334.47 |
| 458. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 214.41 SF | 1.50 | 7.94 | 64.32 | 393.88 | 0/15 yrs | Avg. | 0% | (0.00) | 393.88 |
| 459. Clean floor or roof joist system | | | | | | | | | |
| 38.94 SF | 1.55 | 0.08 | 12.08 | 72.52 | 0/NA | Avg. | 0% | (0.00) | 72.52 |
| 460. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 38.94 SF | 2.02 | 1.67 | 15.74 | 96.07 | 0/15 yrs | Avg. | 0% | (0.00) | 96.07 |
| 461. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 350.47 CF | 0.06 | 0.00 | 4.20 | 25.23 | 0/NA | Avg. | 0% | (0.00) | 25.23 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 462. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 38.94 SF | 4.62 | 3.53 | 35.98 | 219.41 | 0/150 yrs | Avg. | 0% | (0.00) | 219.41 |
| 463. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 38.94 SF | 1.39 | 0.91 | 10.82 | 65.86 | 5/15 yrs | Avg. | 33.33% | (3.42) | 62.44 |
| ***Walls*** | | | | | | | | | |
| 464. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 214.41 SF | 4.46 | 17.98 | 191.26 | 1,165.51 | 0/150 yrs | Avg. | 0% | (0.00) | 1,165.51 |
| 465. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 214.41 SF | 1.39 | 5.02 | 59.60 | 362.65 | 5/15 yrs | Avg. | 33.33% | (18.82) | 343.83 |
| ***Floors*** | | | | | | | | | |
| 466. Carpet pad | | | | | | | | | |
| 38.94 SF | 0.70 | 1.94 | 5.46 | 34.66 | 5/10 yrs | Avg. | 50% | (10.90) | 23.76 |
| 467. Carpet | | | | | | | | | |
| 44.78 SF | 4.63 | 14.36 | 41.46 | 263.15 | 5/10 yrs | Avg. | 50% | (80.84) | 182.31 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |

## CONTINUED - M Closet

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 468. Bypass mirrored door set | | | | | | | | | |
| 1.00 | EA | 350.08 | 23.14 | 70.02 | 443.24 | 29/100 yrs | Avg. 29% | (75.54) | 367.70 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 469. Door opening (jamb & casing) - 60" or wider - paint grade | | | | | | | | | |
| 1.00 | EA | 289.01 | 17.17 | 57.80 | 363.98 | 29/150 yrs | Avg. 19.33% | (37.38) | 326.60 |
| 470. Seal & paint door opening - Large (per side)* | | | | | | | | | |
| 2.00 | EA | 57.43 | 1.99 | 22.98 | 139.83 | 5/15 yrs | Avg. 33.33% | (7.47) | 132.36 |
| 471. Closet Organizer - Melamine | | | | | | | | | |
| 13.00 | LF | 119.41 | 36.82 | 310.46 | 1,899.61 | 29/150 yrs | Avg. 19.33% | (80.13) | 1,819.48 |
| 472. Baseboard - 2 1/4" | | | | | | | | | |
| 22.27 | LF | 4.30 | 2.67 | 19.16 | 117.59 | 29/150 yrs | Avg. 19.33% | (5.82) | 111.77 |
| 473. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 22.27 | LF | 2.22 | 0.30 | 9.88 | 59.62 | 5/15 yrs | Avg. 33.33% | (1.14) | 58.48 |
| ***Electrical*** | | | | | | | | | |
| 474. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. 90% [M] | (32.60) | 81.96 |
| **Totals: M Closet** | | **140.56** | **1,095.64** | **6,714.32** | | | | **354.06** | **6,360.26** |

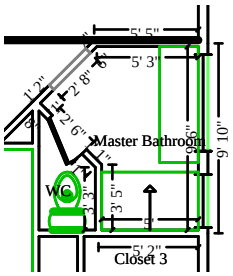


**Master Bathroom** **Height: Sloped**

| | | | |
|---|---|---|---|
| 333.76 | SF Walls | 62.49 | SF Ceiling |
| 396.25 | SF Walls & Ceiling | 57.59 | SF Floor |
| 6.40 | SY Flooring | 7.62 | LF Floor Perimeter |
| 33.25 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Missing Wall - Goes to Floor** | **2' 8" X 6' 8"** | **Opens into MASTER_BEDRO** |
| **Door** | **2' 6" X 6' 8"** | **Opens into WC** |
| **Window** | **5' X 2'** | **Opens into Exterior** |
| **Window** | **2' 9" X 2'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 475. Demolish/remove - bathroom (over 50 sf) | | | | | | | | | |
| 57.59 | SF | 19.20 | 0.00 | 221.14 | 1,326.87 | 0/NA | Avg. NA | (0.00) | 1,326.87 |

## CONTINUED - Master Bathroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 476. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 62.49 SF | 1.36 | 0.00 | 17.00 | 101.99 | 0/NA | Avg. | 0% | (0.00) | 101.99 |
| Attic | | | | | | | | | |
| 477. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 62.49 SF | 2.37 | 2.93 | 29.62 | 180.65 | 0/15 yrs | Avg. | 0% | (0.00) | 180.65 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 478. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 333.76 SF | 1.30 | 0.00 | 86.78 | 520.67 | 0/NA | Avg. | 0% | (0.00) | 520.67 |
| 479. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 333.76 SF | 1.50 | 12.37 | 100.12 | 613.13 | 0/15 yrs | Avg. | 0% | (0.00) | 613.13 |
| 480. Clean floor or roof joist system | | | | | | | | | |
| 57.59 SF | 1.55 | 0.11 | 17.86 | 107.23 | 0/NA | Avg. | 0% | (0.00) | 107.23 |
| 481. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 57.59 SF | 2.02 | 2.47 | 23.26 | 142.06 | 0/15 yrs | Avg. | 0% | (0.00) | 142.06 |
| 482. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 698.82 CF | 0.06 | 0.00 | 8.38 | 50.31 | 0/NA | Avg. | 0% | (0.00) | 50.31 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 483. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 62.49 SF | 4.62 | 5.67 | 57.74 | 352.11 | 0/150 yrs | Avg. | 0% | (0.00) | 352.11 |
| 484. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 62.49 SF | 1.39 | 1.46 | 17.38 | 105.70 | 5/15 yrs | Avg. | 33.33% | (5.49) | 100.21 |
| ***Walls*** | | | | | | | | | |
| 485. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 333.76 SF | 4.46 | 27.99 | 297.72 | 1,814.28 | 0/150 yrs | Avg. | 0% | (0.00) | 1,814.28 |
| 486. Add for bullnose (rounded) corners - per LF | | | | | | | | | |
| 23.50 LF | 5.69 | 1.51 | 26.74 | 161.97 | 0/150 yrs | Avg. | 0% | (0.00) | 161.97 |
| 487. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 333.76 SF | 1.39 | 7.81 | 92.78 | 564.52 | 5/15 yrs | Avg. | 33.33% | (29.30) | 535.22 |
| ***Floors*** | | | | | | | | | |
| 488. 1/2" Cement board | | | | | | | | | |
| 30.59 SF | 8.16 | 4.80 | 49.92 | 304.33 | 29/100 yrs | Avg. | 29% | (15.67) | 288.66 |
| 489. Stone floor covering | | | | | | | | | |
| 30.59 SF | 20.33 | 20.91 | 124.38 | 767.18 | 29/150 yrs | Avg. | 19.33% | (45.50) | 721.68 |
| 490. Tile/stone sealer | | | | | | | | | |
| 30.59 SF | 1.70 | 0.98 | 10.40 | 63.38 | 10/2 yrs | Avg. | 90% [M] | (9.97) | 53.41 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |

## CONTINUED - Master Bathroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 491. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 | EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 492. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 | EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. 33.33% | (7.63) | 128.60 |
| 493. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 | EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. 33.33% | (4.43) | 107.59 |
| 494. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 495. Aluminum window, picture/fixed 3-11 sf (2 pane) | | | | | | | | | |
| 2.00 | EA | 204.66 | 18.12 | 81.86 | 509.30 | 29/18 yrs | Avg. 90% [M] | (183.58) | 325.72 |
| 496. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 15.50 | SF | 4.17 | 6.30 | 12.92 | 83.86 | 29/18 yrs | Avg. 90% [M] | (63.84) | 20.02 |
| 497. Baseboard - 2 1/4" | | | | | | | | | |
| 7.62 | LF | 4.30 | 0.91 | 6.56 | 40.24 | 29/150 yrs | Avg. 19.33% | (1.99) | 38.25 |
| 498. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 7.62 | LF | 2.22 | 0.10 | 3.38 | 20.40 | 5/15 yrs | Avg. 33.33% | (0.39) | 20.01 |
| ***Cabinetry*** | | | | | | | | | |
| 499. Medicine cabinet | | | | | | | | | |
| 1.00 | EA | 212.29 | 15.50 | 42.46 | 270.25 | 10/20 yrs | Avg. 50% | (87.25) | 183.00 |
| 500. Vanity | | | | | | | | | |
| 6.00 | LF | 279.00 | 125.61 | 334.80 | 2,134.41 | 10/50 yrs | Avg. 20% | (282.78) | 1,851.63 |
| ***Countertop, Backsplash*** | | | | | | | | | |
| 501. Vanity top - two sinks - cultured marble - High grade | | | | | | | | | |
| 6.00 | LF | 202.53 | 67.60 | 243.04 | 1,525.82 | 29/20 yrs | Avg. 90% [M] | (684.86) | 840.96 |
| 502. Mirror - 1/4" plate glass | | | | | | | | | |
| 24.00 | SF | 19.28 | 27.61 | 92.54 | 582.87 | 29/40 yrs | Avg. 72.5% | (225.34) | 357.53 |
| 503. Add metal J channel to a mirror | | | | | | | | | |
| 6.00 | LF | 4.35 | 1.54 | 5.22 | 32.86 | 29/40 yrs | Avg. 72.5% | (12.60) | 20.26 |
| ***Tub Area*** | | | | | | | | | |
| 504. Tile tub surround - up to 60 SF | | | | | | | | | |
| 1.00 | EA | 2,040.91 | 39.83 | 408.18 | 2,488.92 | 29/150 yrs | Avg. 19.33% | (86.67) | 2,402.25 |
| 505. 1/2" Cement board | | | | | | | | | |
| 55.00 | SF | 8.14 | 8.63 | 89.54 | 545.87 | 29/150 yrs | Avg. 19.33% | (18.79) | 527.08 |
| 506. Tile/stone sealer | | | | | | | | | |
| 55.00 | SF | 1.70 | 1.77 | 18.70 | 113.97 | 29/10 yrs | Avg. 90% [M] | (17.93) | 96.04 |
| 507. Bathtub - High grade | | | | | | | | | |
| 1.00 | EA | 1,387.34 | 63.01 | 277.46 | 1,727.81 | 29/50 yrs | Avg. 58% | (411.39) | 1,316.42 |
| Includes: Bathtub, drain set, and installation labor. | | | | | | | | | |

## CONTINUED - Master Bathroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 508. Bathtub enclosure - sliding glass doors - High grade | | | | | | | | | |
| 1.00 | EA | 655.81 | 38.59 | 131.16 | 825.56 | 29/20 yrs | Avg. | 90% [M] (390.93) | 434.63 |
| ***Plumbing*** | | | | | | | | | |
| 509. Sink faucet - Bathroom | | | | | | | | | |
| 2.00 | EA | 271.31 | 27.75 | 108.52 | 678.89 | 29/20 yrs | Avg. | 90% [M] (281.12) | 397.77 |
| Includes: Bathroom sink faucet with drain assembly and drain stop, hot and cold supply lines, and installation labor. | | | | | | | | | |
| 510. Tub/shower faucet | | | | | | | | | |
| 1.00 | EA | 411.60 | 13.65 | 82.32 | 507.57 | 29/20 yrs | Avg. | 90% [M] (138.29) | 369.28 |
| Includes: Combination tub/shower faucet, shower head, shower valve, and installation labor. | | | | | | | | | |
| 511. Angle stop valve | | | | | | | | | |
| 4.00 | EA | 52.14 | 2.80 | 41.72 | 253.08 | 10/100 yrs | Avg. | 10% (3.16) | 249.92 |
| 512. P-trap assembly - ABS (plastic) | | | | | | | | | |
| 2.00 | EA | 97.96 | 1.57 | 39.18 | 236.67 | 0/25 yrs | Avg. | 0% (0.00) | 236.67 |
| ***Electrical*** | | | | | | | | | |
| 513. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] (32.60) | 81.96 |
| 514. Light bar - 6 lights | | | | | | | | | |
| 1.00 | EA | 143.91 | 4.95 | 28.78 | 177.64 | 29/20 yrs | Avg. | 90% [M] (50.18) | 127.46 |
| 515. Bathroom ventilation fan | | | | | | | | | |
| 1.00 | EA | 129.66 | 5.75 | 25.94 | 161.35 | 29/10 yrs | Avg. | 90% [M] (58.26) | 103.09 |
| ********** | | | | | | | | | |
| 516. Towel bar | | | | | | | | | |
| 2.00 | EA | 35.04 | 2.94 | 14.02 | 87.04 | 29/50 yrs | Avg. | 58% (19.23) | 67.81 |
| **Totals: Master Bathroom** | | **597.34** | **3,410.08** | **21,057.94** | | | | **3,272.85** | **17,785.09** |

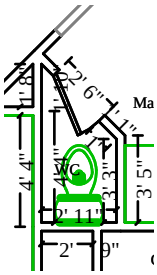


**WC** **Height: 8'**

| | | | |
|---|---|---|---|
| 114.99 | SF Walls | 13.73 | SF Ceiling |
| 128.72 | SF Walls & Ceiling | 13.73 | SF Floor |
| 1.53 | SY Flooring | 13.96 | LF Floor Perimeter |
| 16.46 | LF Ceil. Perimeter | | |

**Door** **2' 6" X 6' 8"** **Opens into MASTER_BATHR**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|

***Demolition***

## CONTINUED - WC

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 517. Demolish/remove - bathroom (up to 50 sf) | | | | | | | | | |
| 13.73 SF | 22.17 | 0.00 | 60.88 | 365.27 | 0/NA | Avg. | NA | (0.00) | 365.27 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 518. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 13.73 SF | 1.36 | 0.00 | 3.74 | 22.41 | 0/NA | Avg. | 0% | (0.00) | 22.41 |
| Attic | | | | | | | | | |
| 519. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 13.73 SF | 2.37 | 0.64 | 6.50 | 39.68 | 0/15 yrs | Avg. | 0% | (0.00) | 39.68 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 520. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 114.99 SF | 1.30 | 0.00 | 29.90 | 179.39 | 0/NA | Avg. | 0% | (0.00) | 179.39 |
| 521. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 114.99 SF | 1.50 | 4.26 | 34.50 | 211.25 | 0/15 yrs | Avg. | 0% | (0.00) | 211.25 |
| 522. Clean floor or roof joist system | | | | | | | | | |
| 13.73 SF | 1.55 | 0.03 | 4.26 | 25.57 | 0/NA | Avg. | 0% | (0.00) | 25.57 |
| 523. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 13.73 SF | 2.02 | 0.59 | 5.54 | 33.86 | 0/15 yrs | Avg. | 0% | (0.00) | 33.86 |
| 524. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 109.85 CF | 0.06 | 0.00 | 1.32 | 7.91 | 0/NA | Avg. | 0% | (0.00) | 7.91 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 525. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 13.73 SF | 4.62 | 1.25 | 12.68 | 77.36 | 0/150 yrs | Avg. | 0% | (0.00) | 77.36 |
| 526. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 13.73 SF | 1.39 | 0.32 | 3.82 | 23.22 | 5/15 yrs | Avg. | 33.33% | (1.21) | 22.01 |
| ***Walls*** | | | | | | | | | |
| 527. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 114.99 SF | 4.46 | 9.64 | 102.58 | 625.08 | 0/150 yrs | Avg. | 0% | (0.00) | 625.08 |
| 528. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 114.99 SF | 1.39 | 2.69 | 31.96 | 194.49 | 5/15 yrs | Avg. | 33.33% | (10.10) | 184.39 |
| ***Floors*** | | | | | | | | | |
| 529. 1/2" Cement board | | | | | | | | | |
| 13.73 SF | 8.16 | 2.16 | 22.40 | 136.60 | 29/100 yrs | Avg. | 29% | (7.04) | 129.56 |
| 530. Tile floor covering | | | | | | | | | |
| 13.73 SF | 19.02 | 6.43 | 52.22 | 319.79 | 29/100 yrs | Avg. | 29% | (20.97) | 298.82 |
| 531. Tile/stone sealer | | | | | | | | | |
| 13.73 SF | 1.70 | 0.44 | 4.66 | 28.44 | 10/2 yrs | Avg. | 90% [M] | (4.48) | 23.96 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |

## CONTINUED - WC

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 532. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 | EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 533. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 | EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. 33.33% | (7.63) | 128.60 |
| 534. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 | EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. 33.33% | (4.43) | 107.59 |
| 535. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 536. Baseboard - 2 1/4" | | | | | | | | | |
| 13.96 | LF | 4.30 | 1.67 | 12.00 | 73.70 | 29/150 yrs | Avg. 19.33% | (3.64) | 70.06 |
| 537. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 13.96 | LF | 2.22 | 0.19 | 6.20 | 37.38 | 5/15 yrs | Avg. 33.33% | (0.71) | 36.67 |
| ***Plumbing*** | | | | | | | | | |
| 538. Toilet | | | | | | | | | |
| 1.00 | EA | 648.32 | 29.67 | 129.66 | 807.65 | 29/150 yrs | Avg. 19.33% | (64.57) | 743.08 |
| Includes: Toilet, wax ring, one supply line, two brass bowl bolts/screws, caulking, and installation labor. Excludes: Toilet seat. | | | | | | | | | |
| 539. Toilet seat | | | | | | | | | |
| 1.00 | EA | 71.17 | 3.07 | 14.24 | 88.48 | 29/9 yrs | Avg. 90% [M] | (31.08) | 57.40 |
| 540. Angle stop valve | | | | | | | | | |
| 1.00 | EA | 52.14 | 0.70 | 10.42 | 63.26 | 10/100 yrs | Avg. 10% | (0.79) | 62.47 |
| ***Electrical*** | | | | | | | | | |
| 541. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. 90% [M] | (32.60) | 81.96 |
| 542. Bathroom ventilation fan | | | | | | | | | |
| 1.00 | EA | 129.66 | 5.75 | 25.94 | 161.35 | 29/10 yrs | Avg. 90% [M] | (58.26) | 103.09 |
| ********** | | | | | | | | | |
| 543. Toilet paper holder | | | | | | | | | |
| 1.00 | EA | 32.31 | 1.21 | 6.46 | 39.98 | 29/50 yrs | Avg. 58% | (7.87) | 32.11 |
| **Totals: WC** | | **104.51** | **722.44** | **4,439.30** | | | | **359.06** | **4,080.24** |

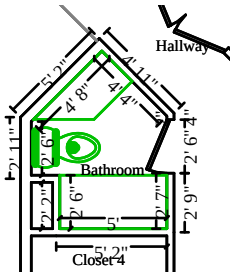


**Bathroom** **Height: 9'**

| | | | |
|---|---|---|---|
| 213.32 | SF Walls | 39.18 | SF Ceiling |
| 252.50 | SF Walls & Ceiling | 39.18 | SF Floor |
| 4.35 | SY Flooring | 6.54 | LF Floor Perimeter |
| 25.55 | LF Ceil. Perimeter | | |

**Door** **2' 6" X 6' 8"** **Opens into HALLWAY**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 544. Demolish/remove - bathroom (up to 50 sf) | | | | | | | | | |
| 39.18 SF | 22.17 | 0.00 | 173.72 | 1,042.34 | 0/NA | Avg. | NA | (0.00) | 1,042.34 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 545. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 39.18 SF | 1.36 | 0.00 | 10.66 | 63.94 | 0/NA | Avg. | 0% | (0.00) | 63.94 |
| Attic | | | | | | | | | |
| 546. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 39.18 SF | 2.37 | 1.83 | 18.58 | 113.27 | 0/15 yrs | Avg. | 0% | (0.00) | 113.27 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 547. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 213.32 SF | 1.30 | 0.00 | 55.46 | 332.78 | 0/NA | Avg. | 0% | (0.00) | 332.78 |
| 548. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 213.32 SF | 1.50 | 7.90 | 64.00 | 391.88 | 0/15 yrs | Avg. | 0% | (0.00) | 391.88 |
| 549. Clean floor or roof joist system | | | | | | | | | |
| 39.18 SF | 1.55 | 0.08 | 12.14 | 72.95 | 0/NA | Avg. | 0% | (0.00) | 72.95 |
| 550. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 39.18 SF | 2.02 | 1.68 | 15.82 | 96.64 | 0/15 yrs | Avg. | 0% | (0.00) | 96.64 |
| 551. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 352.63 CF | 0.06 | 0.00 | 4.24 | 25.40 | 0/NA | Avg. | 0% | (0.00) | 25.40 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 552. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 39.18 SF | 4.62 | 3.55 | 36.20 | 220.76 | 0/150 yrs | Avg. | 0% | (0.00) | 220.76 |
| 553. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 39.18 SF | 1.39 | 0.92 | 10.90 | 66.28 | 5/15 yrs | Avg. | 33.33% | (3.44) | 62.84 |
| ***Walls*** | | | | | | | | | |
| 554. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 213.32 SF | 4.46 | 17.89 | 190.28 | 1,159.58 | 0/150 yrs | Avg. | 0% | (0.00) | 1,159.58 |
| 555. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 213.32 SF | 1.39 | 4.99 | 59.30 | 360.80 | 5/15 yrs | Avg. | 33.33% | (18.73) | 342.07 |
| ***Floors*** | | | | | | | | | |
| 556. 1/2" Cement board | | | | | | | | | |
| 19.65 SF | 8.16 | 3.08 | 32.06 | 195.48 | 29/100 yrs | Avg. | 29% | (10.06) | 185.42 |

## CONTINUED - Bathroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 557. Stone floor covering | | | | | | | | | |
| 19.65 SF | 20.33 | 13.43 | 79.90 | 492.81 | 29/150 yrs | Avg. | 19.33% | (29.23) | 463.58 |
| 558. Tile/stone sealer | | | | | | | | | |
| 19.65 SF | 1.70 | 0.63 | 6.68 | 40.72 | 10/2 yrs | Avg. | 90% [M] | (6.41) | 34.31 |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 559. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. | 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 560. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 561. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |
| 562. Door knob - interior | | | | | | | | | |
| 1.00 EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. | 90% [M] | (21.15) | 42.52 |
| 563. Baseboard - 2 1/4" | | | | | | | | | |
| 6.54 LF | 4.30 | 0.78 | 5.62 | 34.52 | 29/150 yrs | Avg. | 19.33% | (1.71) | 32.81 |
| 564. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 6.54 LF | 2.22 | 0.09 | 2.90 | 17.51 | 5/15 yrs | Avg. | 33.33% | (0.34) | 17.17 |
| ***Cabinetry*** | | | | | | | | | |
| 565. Medicine cabinet | | | | | | | | | |
| 1.00 EA | 212.29 | 15.50 | 42.46 | 270.25 | 10/20 yrs | Avg. | 50% | (87.25) | 183.00 |
| 566. Vanity | | | | | | | | | |
| 4.25 LF | 279.00 | 88.97 | 237.16 | 1,511.88 | 10/50 yrs | Avg. | 20% | (200.30) | 1,311.58 |
| ***Countertop, Backsplash*** | | | | | | | | | |
| 567. Vanity top - one sink - cultured marble | | | | | | | | | |
| 6.67 LF | 148.54 | 40.04 | 198.16 | 1,228.96 | 29/20 yrs | Avg. | 90% [M] | (405.64) | 823.32 |
| 568. Mirror - 1/4" plate glass | | | | | | | | | |
| 24.00 SF | 19.28 | 27.61 | 92.54 | 582.87 | 29/40 yrs | Avg. | 72.5% | (225.34) | 357.53 |
| 569. Add metal J channel to a mirror | | | | | | | | | |
| 6.00 LF | 4.35 | 1.54 | 5.22 | 32.86 | 29/40 yrs | Avg. | 72.5% | (12.60) | 20.26 |
| ***Tub Area*** | | | | | | | | | |
| 570. Tile tub surround - up to 60 SF | | | | | | | | | |
| 1.00 EA | 2,040.91 | 39.83 | 408.18 | 2,488.92 | 29/150 yrs | Avg. | 19.33% | (86.67) | 2,402.25 |
| 571. 1/2" Cement board | | | | | | | | | |
| 55.00 SF | 8.14 | 8.63 | 89.54 | 545.87 | 29/150 yrs | Avg. | 19.33% | (18.79) | 527.08 |
| 572. Tile/stone sealer | | | | | | | | | |
| 55.00 SF | 1.70 | 1.77 | 18.70 | 113.97 | 29/10 yrs | Avg. | 90% [M] | (17.93) | 96.04 |
| 573. Bathtub - High grade | | | | | | | | | |
| 1.00 EA | 1,387.34 | 63.01 | 277.46 | 1,727.81 | 29/50 yrs | Avg. | 58% | (411.39) | 1,316.42 |

## CONTINUED - Bathroom

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| Includes: Bathtub, drain set, and installation labor. | | | | | | | | | |
| 574. Bathtub enclosure - sliding glass doors - High grade | | | | | | | | | |
| 1.00 | EA | 655.81 | 38.59 | 131.16 | 825.56 | 29/20 yrs | Avg. | 90% [M] | (390.93) | 434.63 |
| ***Plumbing*** | | | | | | | | | |
| 575. Sink faucet - Bathroom | | | | | | | | | |
| 1.00 | EA | 271.31 | 13.87 | 54.26 | 339.44 | 29/20 yrs | Avg. | 90% [M] | (140.55) | 198.89 |
| Includes: Bathroom sink faucet with drain assembly and drain stop, hot and cold supply lines, and installation labor. | | | | | | | | | |
| 576. Tub/shower faucet | | | | | | | | | |
| 1.00 | EA | 411.60 | 13.65 | 82.32 | 507.57 | 29/20 yrs | Avg. | 90% [M] | (138.29) | 369.28 |
| Includes: Combination tub/shower faucet, shower head, shower valve, and installation labor. | | | | | | | | | |
| 577. Toilet | | | | | | | | | |
| 1.00 | EA | 648.32 | 29.67 | 129.66 | 807.65 | 29/150 yrs | Avg. | 19.33% | (64.57) | 743.08 |
| Includes: Toilet, wax ring, one supply line, two brass bowl bolts/screws, caulking, and installation labor.<br>Excludes: Toilet seat. | | | | | | | | | |
| 578. Toilet seat | | | | | | | | | |
| 1.00 | EA | 71.17 | 3.07 | 14.24 | 88.48 | 29/9 yrs | Avg. | 90% [M] | (31.08) | 57.40 |
| 579. Angle stop valve | | | | | | | | | |
| 3.00 | EA | 52.14 | 2.10 | 31.28 | 189.80 | 10/100 yrs | Avg. | 10% | (2.37) | 187.43 |
| 580. P-trap assembly - ABS (plastic) | | | | | | | | | |
| 1.00 | EA | 97.96 | 0.78 | 19.60 | 118.34 | 0/25 yrs | Avg. | 0% | (0.00) | 118.34 |
| ***Electrical*** | | | | | | | | | |
| 581. Light fixture | | | | | | | | | |
| 1.00 | EA | 92.78 | 3.22 | 18.56 | 114.56 | 29/20 yrs | Avg. | 90% [M] | (32.60) | 81.96 |
| 582. Light bar - 5 lights | | | | | | | | | |
| 1.00 | EA | 137.86 | 4.36 | 27.58 | 169.80 | 29/20 yrs | Avg. | 90% [M] | (44.20) | 125.60 |
| 583. Bathroom ventilation fan | | | | | | | | | |
| 1.00 | EA | 129.66 | 5.75 | 25.94 | 161.35 | 29/10 yrs | Avg. | 90% [M] | (58.26) | 103.09 |
| ********** | | | | | | | | | |
| 584. Towel bar | | | | | | | | | |
| 2.00 | EA | 35.04 | 2.94 | 14.02 | 87.04 | 29/50 yrs | Avg. | 58% | (19.23) | 67.81 |
| 585. Toilet paper holder | | | | | | | | | |
| 1.00 | EA | 32.31 | 1.21 | 6.46 | 39.98 | 29/50 yrs | Avg. | 58% | (7.87) | 32.11 |
| **Totals: Bathroom** | | | **493.54** | **2,824.96** | **17,443.24** | | | | **2,581.52** | **14,861.72** |

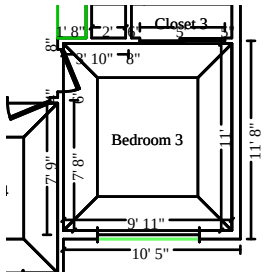


**Bedroom 3** **Height: Tray**

| | | | |
|---|---|---|---|
| 260.67 | SF Walls | 117.07 | SF Ceiling |
| 377.74 | SF Walls & Ceiling | 109.08 | SF Floor |
| 12.12 | SY Flooring | 34.33 | LF Floor Perimeter |
| 41.83 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **2' 6" X 6' 8"** | **Opens into HALLWAY** |
| **Door** | **5' X 6' 8"** | **Opens into CLOSET_3** |
| **Window** | **6' X 4'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 586. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 109.08 SF | 7.84 | 0.00 | 171.04 | 1,026.23 | 0/NA | Avg. | NA | (0.00) | 1,026.23 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 587. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 117.07 SF | 1.36 | 0.00 | 31.84 | 191.06 | 0/NA | Avg. | 0% | (0.00) | 191.06 |
| Attic | | | | | | | | | |
| 588. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 117.07 SF | 2.37 | 5.48 | 55.50 | 338.44 | 0/15 yrs | Avg. | 0% | (0.00) | 338.44 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 589. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 260.67 SF | 1.30 | 0.00 | 67.78 | 406.65 | 0/NA | Avg. | 0% | (0.00) | 406.65 |
| 590. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 260.67 SF | 1.50 | 9.66 | 78.20 | 478.87 | 0/15 yrs | Avg. | 0% | (0.00) | 478.87 |
| 591. Clean floor or roof joist system | | | | | | | | | |
| 109.08 SF | 1.55 | 0.21 | 33.82 | 203.10 | 0/NA | Avg. | 0% | (0.00) | 203.10 |
| 592. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 109.08 SF | 2.02 | 4.68 | 44.06 | 269.08 | 0/15 yrs | Avg. | 0% | (0.00) | 269.08 |
| 593. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 945.25 CF | 0.06 | 0.00 | 11.34 | 68.06 | 0/NA | Avg. | 0% | (0.00) | 68.06 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 594. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 117.07 SF | 4.62 | 10.62 | 108.18 | 659.66 | 0/150 yrs | Avg. | 0% | (0.00) | 659.66 |
| 595. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 117.07 SF | 1.39 | 2.74 | 32.54 | 198.01 | 5/15 yrs | Avg. | 33.33% | (10.28) | 187.73 |
| ***Walls*** | | | | | | | | | |
| 596. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 260.67 SF | 4.46 | 21.86 | 232.52 | 1,416.97 | 0/150 yrs | Avg. | 0% | (0.00) | 1,416.97 |
| 597. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 260.67 SF | 1.39 | 6.10 | 72.46 | 440.89 | 5/15 yrs | Avg. | 33.33% | (22.88) | 418.01 |

## CONTINUED - Bedroom 3

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Floors*** | | | | | | | | | |
| 598. Carpet pad | | | | | | | | | |
| 109.08 SF | 0.70 | 5.42 | 15.28 | 97.06 | 5/10 yrs | Avg. | 50% | (30.53) | 66.53 |
| 599. Carpet | | | | | | | | | |
| 125.45 SF | 4.63 | 40.24 | 116.16 | 737.23 | 5/10 yrs | Avg. | 50% | (226.49) | 510.74 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 600. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. | 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 601. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. | 33.33% | (7.63) | 128.60 |
| 602. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. | 33.33% | (4.43) | 107.59 |
| 603. Door knob - interior | | | | | | | | | |
| 1.00 EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. | 90% [M] | (21.15) | 42.52 |
| 604. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. | 90% [M] | (338.13) | 285.01 |
| 605. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 24.00 SF | 4.17 | 9.76 | 20.02 | 129.86 | 29/18 yrs | Avg. | 90% [M] | (98.85) | 31.01 |
| 606. Window stool & apron | | | | | | | | | |
| 6.00 LF | 11.15 | 2.61 | 13.38 | 82.89 | 29/150 yrs | Avg. | 19.33% | (5.67) | 77.22 |
| 607. Seal & paint window stool and apron | | | | | | | | | |
| 6.00 LF | 5.90 | 0.26 | 7.08 | 42.74 | 5/15 yrs | Avg. | 33.33% | (0.99) | 41.75 |
| 608. Baseboard - 2 1/4" | | | | | | | | | |
| 34.33 LF | 4.30 | 4.12 | 29.52 | 181.26 | 29/150 yrs | Avg. | 19.33% | (8.96) | 172.30 |
| 609. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 34.33 LF | 2.22 | 0.47 | 15.24 | 91.92 | 5/15 yrs | Avg. | 33.33% | (1.76) | 90.16 |
| ***Electrical*** | | | | | | | | | |
| 610. Ceiling fan & light | | | | | | | | | |
| 1.00 EA | 452.98 | 12.43 | 90.60 | 556.01 | 29/20 yrs | Avg. | 90% [M] | (125.94) | 430.07 |
| ********** | | | | | | | | | |
| 611. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. | 90% [M] | (95.92) | 132.23 |
| **Totals: Bedroom 3** | | **210.09** | **1,503.30** | **9,229.90** | | | | **1,082.14** | **8,147.76** |

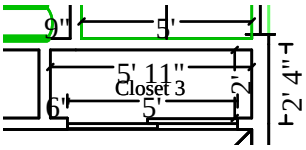


**Closet 3** **Height: 9'**

| | | | |
|---|---|---|---|
| 109.17 | SF Walls | 11.83 | SF Ceiling |
| 121.00 | SF Walls & Ceiling | 11.83 | SF Floor |
| 1.31 | SY Flooring | 10.83 | LF Floor Perimeter |
| 15.83 | LF Ceil. Perimeter | | |

**Door** **5' X 6' 8"** **Opens into BEDROOM_3**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 612. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 11.83 SF | 7.84 | 0.00 | 18.56 | 111.31 | 0/NA | Avg. | NA | (0.00) | 111.31 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 613. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 11.83 SF | 1.36 | 0.00 | 3.22 | 19.31 | 0/NA | Avg. | 0% | (0.00) | 19.31 |
| Attic | | | | | | | | | |
| 614. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 11.83 SF | 2.37 | 0.55 | 5.60 | 34.19 | 0/15 yrs | Avg. | 0% | (0.00) | 34.19 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 615. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 109.17 SF | 1.30 | 0.00 | 28.38 | 170.30 | 0/NA | Avg. | 0% | (0.00) | 170.30 |
| 616. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 109.17 SF | 1.50 | 4.04 | 32.76 | 200.56 | 0/15 yrs | Avg. | 0% | (0.00) | 200.56 |
| 617. Clean floor or roof joist system | | | | | | | | | |
| 11.83 SF | 1.55 | 0.02 | 3.66 | 22.02 | 0/NA | Avg. | 0% | (0.00) | 22.02 |
| 618. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 11.83 SF | 2.02 | 0.51 | 4.78 | 29.19 | 0/15 yrs | Avg. | 0% | (0.00) | 29.19 |
| 619. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 106.50 CF | 0.06 | 0.00 | 1.28 | 7.67 | 0/NA | Avg. | 0% | (0.00) | 7.67 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 620. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 11.83 SF | 4.62 | 1.07 | 10.94 | 66.66 | 0/150 yrs | Avg. | 0% | (0.00) | 66.66 |
| 621. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 11.83 SF | 1.39 | 0.28 | 3.28 | 20.00 | 5/15 yrs | Avg. | 33.33% | (1.04) | 18.96 |
| ***Walls*** | | | | | | | | | |
| 622. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 109.17 SF | 4.46 | 9.15 | 97.38 | 593.43 | 0/150 yrs | Avg. | 0% | (0.00) | 593.43 |
| 623. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 109.17 SF | 1.39 | 2.55 | 30.36 | 184.66 | 5/15 yrs | Avg. | 33.33% | (9.58) | 175.08 |
| ***Floors*** | | | | | | | | | |
| 624. Carpet pad | | | | | | | | | |
| 11.83 SF | 0.70 | 0.59 | 1.66 | 10.53 | 5/10 yrs | Avg. | 50% | (3.32) | 7.21 |

## CONTINUED - Closet 3

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 625. Carpet | | | | | | | | | |
| 13.61 SF | 4.63 | 4.37 | 12.60 | 79.98 | 5/10 yrs | Avg. | 50% | (24.58) | 55.40 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 626. Bypass (sliding) door set - Colonist | | | | | | | | | |
| 1.00 EA | 316.21 | 20.39 | 63.24 | 399.84 | 29/100 yrs | Avg. | 29% | (66.55) | 333.29 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 627. Door opening (jamb & casing) - 60" or wider - paint grade | | | | | | | | | |
| 1.00 EA | 289.01 | 17.17 | 57.80 | 363.98 | 29/150 yrs | Avg. | 19.33% | (37.38) | 326.60 |
| 628. Seal 1coat & paint 1coat bypass dr set-slab only(per side)* | | | | | | | | | |
| 2.00 EA | 65.66 | 3.11 | 26.26 | 160.69 | 5/15 yrs | Avg. | 33.33% | (11.69) | 149.00 |
| 629. Seal & paint door opening - Large (per side)* | | | | | | | | | |
| 2.00 EA | 57.43 | 1.99 | 22.98 | 139.83 | 5/15 yrs | Avg. | 33.33% | (7.47) | 132.36 |
| 630. Closet Organizer - Melamine | | | | | | | | | |
| 5.92 LF | 119.41 | 16.77 | 141.38 | 865.06 | 29/150 yrs | Avg. | 19.33% | (36.49) | 828.57 |
| 631. Baseboard - 2 1/4" | | | | | | | | | |
| 10.83 LF | 4.30 | 1.30 | 9.32 | 57.19 | 29/150 yrs | Avg. | 19.33% | (2.83) | 54.36 |
| 632. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 10.83 LF | 2.22 | 0.15 | 4.80 | 28.99 | 5/15 yrs | Avg. | 33.33% | (0.56) | 28.43 |
| **Totals: Closet 3** | | **84.01** | **580.24** | **3,565.39** | | | | **201.49** | **3,363.90** |

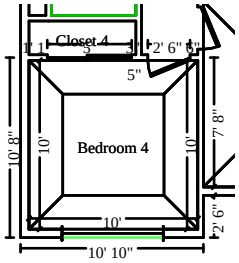


**Bedroom 4** **Height: Tray**

| | | | |
|---|---|---|---|
| 246.00 | SF Walls | 107.55 | SF Ceiling |
| 353.56 | SF Walls & Ceiling | 100.00 | SF Floor |
| 11.11 | SY Flooring | 32.50 | LF Floor Perimeter |
| 40.00 | LF Ceil. Perimeter | | |

| | | |
|---|---|---|
| **Door** | **5' X 6' 8"** | **Opens into CLOSET_4** |
| **Door** | **2' 6" X 6' 8"** | **Opens into HALLWAY** |
| **Window** | **6' X 4'** | **Opens into Exterior** |

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |

## CONTINUED - Bedroom 4

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 633. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 100.00 SF | 7.84 | 0.00 | 156.80 | 940.80 | 0/NA | Avg. | NA | (0.00) | 940.80 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 634. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 107.55 SF | 1.36 | 0.00 | 29.26 | 175.53 | 0/NA | Avg. | 0% | (0.00) | 175.53 |
| Attic | | | | | | | | | |
| 635. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 107.55 SF | 2.37 | 5.03 | 50.98 | 310.90 | 0/15 yrs | Avg. | 0% | (0.00) | 310.90 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 636. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 246.00 SF | 1.30 | 0.00 | 63.96 | 383.76 | 0/NA | Avg. | 0% | (0.00) | 383.76 |
| 637. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 246.00 SF | 1.50 | 9.11 | 73.80 | 451.91 | 0/15 yrs | Avg. | 0% | (0.00) | 451.91 |
| 638. Clean floor or roof joist system | | | | | | | | | |
| 100.00 SF | 1.55 | 0.20 | 31.00 | 186.20 | 0/NA | Avg. | 0% | (0.00) | 186.20 |
| 639. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 100.00 SF | 2.02 | 4.29 | 40.40 | 246.69 | 0/15 yrs | Avg. | 0% | (0.00) | 246.69 |
| 640. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 865.34 CF | 0.06 | 0.00 | 10.38 | 62.30 | 0/NA | Avg. | 0% | (0.00) | 62.30 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 641. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 107.55 SF | 4.62 | 9.75 | 99.38 | 606.01 | 0/150 yrs | Avg. | 0% | (0.00) | 606.01 |
| 642. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 107.55 SF | 1.39 | 2.52 | 29.90 | 181.91 | 5/15 yrs | Avg. | 33.33% | (9.44) | 172.47 |
| ***Walls*** | | | | | | | | | |
| 643. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 246.00 SF | 4.46 | 20.63 | 219.44 | 1,337.23 | 0/150 yrs | Avg. | 0% | (0.00) | 1,337.23 |
| 644. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 246.00 SF | 1.39 | 5.76 | 68.38 | 416.08 | 5/15 yrs | Avg. | 33.33% | (21.60) | 394.48 |
| ***Floors*** | | | | | | | | | |
| 645. Carpet pad | | | | | | | | | |
| 100.00 SF | 0.70 | 4.97 | 14.00 | 88.97 | 5/10 yrs | Avg. | 50% | (27.99) | 60.98 |
| 646. Carpet | | | | | | | | | |
| 115.00 SF | 4.63 | 36.89 | 106.50 | 675.84 | 5/10 yrs | Avg. | 50% | (207.63) | 468.21 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |

## CONTINUED - Bedroom 4

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 647. Interior door - Colonist - pre-hung unit | | | | | | | | | |
| 1.00 | EA | 354.52 | 25.28 | 70.90 | 450.70 | 29/100 yrs | Avg. 29% | (82.53) | 368.17 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 648. Seal & paint door slab only (per side) | | | | | | | | | |
| 2.00 | EA | 55.92 | 2.03 | 22.36 | 136.23 | 5/15 yrs | Avg. 33.33% | (7.63) | 128.60 |
| 649. Seal & paint door opening (per side)* | | | | | | | | | |
| 2.00 | EA | 46.18 | 1.18 | 18.48 | 112.02 | 5/15 yrs | Avg. 33.33% | (4.43) | 107.59 |
| 650. Door knob - interior | | | | | | | | | |
| 1.00 | EA | 51.32 | 2.09 | 10.26 | 63.67 | 29/20 yrs | Avg. 90% [M] | (21.15) | 42.52 |
| 651. Aluminum window, horiz. slider 24-32 sf (2 pane) | | | | | | | | | |
| 1.00 | EA | 491.46 | 33.38 | 98.30 | 623.14 | 29/18 yrs | Avg. 90% [M] | (338.13) | 285.01 |
| 652. Add on for grid (double or triple glazed windows) | | | | | | | | | |
| 24.00 | SF | 4.17 | 9.76 | 20.02 | 129.86 | 29/18 yrs | Avg. 90% [M] | (98.85) | 31.01 |
| 653. Window stool & apron | | | | | | | | | |
| 6.00 | LF | 11.15 | 2.61 | 13.38 | 82.89 | 29/150 yrs | Avg. 19.33% | (5.67) | 77.22 |
| 654. Seal & paint window stool and apron | | | | | | | | | |
| 6.00 | LF | 5.90 | 0.26 | 7.08 | 42.74 | 5/15 yrs | Avg. 33.33% | (0.99) | 41.75 |
| 655. Baseboard - 2 1/4" | | | | | | | | | |
| 32.50 | LF | 4.30 | 3.90 | 27.96 | 171.61 | 29/150 yrs | Avg. 19.33% | (8.48) | 163.13 |
| 656. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 32.50 | LF | 2.22 | 0.44 | 14.44 | 87.03 | 5/15 yrs | Avg. 33.33% | (1.67) | 85.36 |
| ***Electrical*** | | | | | | | | | |
| 657. Ceiling fan & light | | | | | | | | | |
| 1.00 | EA | 452.98 | 12.43 | 90.60 | 556.01 | 29/20 yrs | Avg. 90% [M] | (125.94) | 430.07 |
| ********** | | | | | | | | | |
| 658. Window blind - PVC - 2" - 20.1 to 32 SF | | | | | | | | | |
| 1.00 | EA | 182.24 | 9.47 | 36.44 | 228.15 | 29/5 yrs | Avg. 90% [M] | (95.92) | 132.23 |
| **Totals: Bedroom 4** | | **201.98** | **1,424.40** | **8,748.18** | | | | **1,058.05** | **7,690.13** |

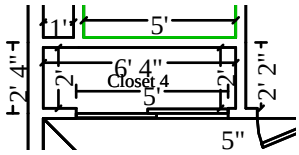


**Closet 4** **Height: 9'**

| | | | |
|---|---|---|---|
| 116.67 | SF Walls | 12.67 | SF Ceiling |
| 129.33 | SF Walls & Ceiling | 12.67 | SF Floor |
| 1.41 | SY Flooring | 11.67 | LF Floor Perimeter |
| 16.67 | LF Ceil. Perimeter | | |

**Door** **5' X 6' 8"** **Opens into BEDROOM_4**

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Demolition*** | | | | | | | | | |
| 659. Demolish/remove - bedroom/room (up to 200 sf) | | | | | | | | | |
| 12.67 SF | 7.84 | 0.00 | 19.86 | 119.19 | 0/NA | Avg. | NA | (0.00) | 119.19 |
| ***Post-demolition cleaning - HEPA*** | | | | | | | | | |
| *clean - wipe down* | | | | | | | | | |
| *seal framing* | | | | | | | | | |
| 660. HEPA Vacuuming - Detailed - (PER SF) | | | | | | | | | |
| 12.67 SF | 1.36 | 0.00 | 3.44 | 20.67 | 0/NA | Avg. | 0% | (0.00) | 20.67 |
| Attic | | | | | | | | | |
| 661. Seal attic framing (shellac) - 6 to 8/12 | | | | | | | | | |
| 12.67 SF | 2.37 | 0.59 | 6.00 | 36.62 | 0/15 yrs | Avg. | 0% | (0.00) | 36.62 |
| Includes underside of roof sheathing. | | | | | | | | | |
| 662. HEPA Vacuuming exposed framing - Walls - (PER SF) | | | | | | | | | |
| 116.67 SF | 1.30 | 0.00 | 30.34 | 182.01 | 0/NA | Avg. | 0% | (0.00) | 182.01 |
| 663. Seal stud wall for odor control (shellac) | | | | | | | | | |
| 116.67 SF | 1.50 | 4.32 | 35.00 | 214.33 | 0/15 yrs | Avg. | 0% | (0.00) | 214.33 |
| 664. Clean floor or roof joist system | | | | | | | | | |
| 12.67 SF | 1.55 | 0.02 | 3.92 | 23.58 | 0/NA | Avg. | 0% | (0.00) | 23.58 |
| 665. Seal floor or ceiling joist system (shellac) | | | | | | | | | |
| 12.67 SF | 2.02 | 0.54 | 5.12 | 31.25 | 0/15 yrs | Avg. | 0% | (0.00) | 31.25 |
| 666. Deodorize building - Ozone & hydroxyl treatment | | | | | | | | | |
| 114.00 CF | 0.06 | 0.00 | 1.36 | 8.20 | 0/NA | Avg. | 0% | (0.00) | 8.20 |
| ***Repairs*** | | | | | | | | | |
| ***Ceiling*** | | | | | | | | | |
| 667. 5/8" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 12.67 SF | 4.62 | 1.15 | 11.70 | 71.39 | 0/150 yrs | Avg. | 0% | (0.00) | 71.39 |
| 668. Seal/prime (1 coat) then paint (1 coat) the ceiling* | | | | | | | | | |
| 12.67 SF | 1.39 | 0.30 | 3.52 | 21.43 | 5/15 yrs | Avg. | 33.33% | (1.11) | 20.32 |
| ***Walls*** | | | | | | | | | |
| 669. 1/2" drywall - hung, taped, heavy texture, ready for paint | | | | | | | | | |
| 116.67 SF | 4.46 | 9.78 | 104.08 | 634.21 | 0/150 yrs | Avg. | 0% | (0.00) | 634.21 |
| 670. Seal/prime (1 coat) then paint (1 coat) the walls* | | | | | | | | | |
| 116.67 SF | 1.39 | 2.73 | 32.44 | 197.34 | 5/15 yrs | Avg. | 33.33% | (10.24) | 187.10 |
| ***Floors*** | | | | | | | | | |
| 671. Carpet pad | | | | | | | | | |
| 12.67 SF | 0.70 | 0.63 | 1.78 | 11.28 | 5/10 yrs | Avg. | 50% | (3.54) | 7.74 |

## CONTINUED - Closet 4

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 672. Carpet | | | | | | | | | |
| 14.57 SF | 4.63 | 4.67 | 13.50 | 85.63 | 5/10 yrs | Avg. | 50% | (26.31) | 59.32 |
| 15 % waste added for Carpet. | | | | | | | | | |
| ***Doors, Windows, Finish Trim*** | | | | | | | | | |
| 673. Bypass (sliding) door set - Colonist | | | | | | | | | |
| 1.00 EA | 316.21 | 20.39 | 63.24 | 399.84 | 29/100 yrs | Avg. | 29% | (66.55) | 333.29 |
| Includes: Pre-hung interior door, hinges, jamb, stop, casing (both sides), finish nails, wood shims, and installation labor. Excludes: Lockset and painting. | | | | | | | | | |
| 674. Door opening (jamb & casing) - 60" or wider - paint grade | | | | | | | | | |
| 1.00 EA | 289.01 | 17.17 | 57.80 | 363.98 | 29/150 yrs | Avg. | 19.33% | (37.38) | 326.60 |
| 675. Seal 1coat & paint 1coat bypass dr set-slab only(per side)* | | | | | | | | | |
| 2.00 EA | 65.66 | 3.11 | 26.26 | 160.69 | 5/15 yrs | Avg. | 33.33% | (11.69) | 149.00 |
| 676. Seal & paint door opening - Large (per side)* | | | | | | | | | |
| 2.00 EA | 57.43 | 1.99 | 22.98 | 139.83 | 5/15 yrs | Avg. | 33.33% | (7.47) | 132.36 |
| 677. Closet Organizer - Melamine | | | | | | | | | |
| 6.33 LF | 119.41 | 17.93 | 151.18 | 924.98 | 29/150 yrs | Avg. | 19.33% | (39.02) | 885.96 |
| 678. Baseboard - 2 1/4" | | | | | | | | | |
| 11.67 LF | 4.30 | 1.40 | 10.04 | 61.62 | 29/150 yrs | Avg. | 19.33% | (3.05) | 58.57 |
| 679. Seal (1 coat) & paint (1 coat) baseboard* | | | | | | | | | |
| 11.67 LF | 2.22 | 0.16 | 5.18 | 31.25 | 5/15 yrs | Avg. | 33.33% | (0.59) | 30.66 |
| **Totals: Closet 4** | | **86.88** | **608.74** | **3,739.32** | | | | **206.95** | **3,532.37** |

| | | | | | |
|---|---|---|---|---|---|
| **Total: 2nd Floor** | **3,370.53** | **20,809.94** | **128,229.45** | **13,173.74** | **115,055.71** |
| **Total: Interior** | **8,319.15** | **52,509.10** | **323,371.00** | **35,590.80** | **287,780.20** |
| **Total: Dwelling** | **8,835.93** | **57,319.76** | **352,751.66** | **36,875.72** | **315,875.94** |

## Other Structures

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| ***Pergola*** | | | | | | | | | |
| 680. Haul debris - per pickup truck load - including dump fees | | | | | | | | | |
| 1.00 EA | 227.27 | 0.00 | 45.46 | 272.73 | 0/NA | Avg. | NA | (0.00) | 272.73 |
| 681. R&R Pergola - Pre-manufactured Kit - Cedar | | | | | | | | | |
| 112.00 SF | 33.06 | 240.24 | 740.54 | 4,683.50 | 10/25 yrs | Avg. | 40% | (1,081.70) | 3,601.80 |

## CONTINUED - Other Structures

| QUANTITY | UNIT | TAX | O&P | RCV | AGE/LIFE | COND. | DEP % | DEPREC. | ACV |
|---|---|---|---|---|---|---|---|---|---|
| 682. Seal & paint trim - two coats | | | | | | | | | |
| 260.00 LF | 2.11 | 3.55 | 109.72 | 661.87 | 2/15 yrs | Avg. | 13.33% | (5.32) | 656.55 |
| 683. General Demolition - per hour | | | | | | | | | |
| 2.00 HR | 73.68 | 0.00 | 29.48 | 176.84 | 0/NA | Avg. | NA | (0.00) | 176.84 |
| clean general area, lawn, landscaping - pergola debris | | | | | | | | | |
| **Totals: Other Structures** | | **243.79** | **925.20** | **5,794.94** | | | | **1,087.02** | **4,707.92** |
| **Line Item Totals: LI-7005343475-1** | | **9,623.11** | **67,977.16** | **428,288.37** | | | | **37,962.74** | **390,325.63** |

[%] - Indicates that depreciate by percent was used for this item

[M] - Indicates that the depreciation percentage was limited by the maximum allowable depreciation for this item

| Additional Charges | Charge |
|---|---|
| California Lumber Assessment Fee | 58.38 |
| California Carpet Stewardship Assessment Fee | 59.25 |
| **Additional Charges Total** | **$117.63** |

## Grand Total Areas:

| | | | | | |
|---|---|---|---|---|---|
| 9,236.61 | SF Walls | 2,128.80 | SF Ceiling | 11,365.41 | SF Walls and Ceiling |
| 2,100.76 | SF Floor | 233.42 | SY Flooring | 788.78 | LF Floor Perimeter |
| 0.00 | SF Long Wall | 0.00 | SF Short Wall | 789.14 | LF Ceil. Perimeter |
| 2,100.76 | Floor Area | 2,311.48 | Total Area | 5,876.63 | Interior Wall Area |
| 5,528.85 | Exterior Wall Area | 531.65 | Exterior Perimeter of Walls | | |
| 0.00 | Surface Area | 0.00 | Number of Squares | 0.00 | Total Perimeter Length |
| 0.00 | Total Ridge Length | 0.00 | Total Hip Length | | |

| Coverage | Item Total | % | ACV Total | % |
|---|---|---|---|---|
| Dwelling | 422,493.43 | 98.65% | 385,758.88 | 98.79% |
| Other Structures | 5,794.94 | 1.35% | 4,707.92 | 1.21% |
| Contents | 0.00 | 0.00% | 0.00 | 0.00% |
| Total | 428,288.37 | 100.00% | 390,466.80 | 100.00% |

## Summary for Dwelling

| | |
|---|---|
| Line Item Total | 346,062.15 |
| California Lumber Assessment Fee | 58.38 |
| California Carpet Stewardship Assessment Fee | 59.25 |
| Subtotal | 346,179.78 |
| Overhead | 33,537.75 |
| Profit | 33,537.75 |
| Material Sales Tax | 9,352.41 |
| Storage Rental Tax | 26.91 |
| **Replacement Cost Value** | **$422,634.60** |
| Less Depreciation | (36,875.72) |
| **Actual Cash Value** | **$385,758.88** |
| **Net Claim** | **$385,758.88** |
| Total Recoverable Depreciation | 36,875.72 |
| **Net Claim if Depreciation is Recovered** | **$422,634.60** |

SARAH HAMMILL

## Summary for Other Structures

| | |
|---|---|
| Line Item Total | 4,625.95 |
| Overhead | 462.60 |
| Profit | 462.60 |
| Material Sales Tax | 243.79 |
| **Replacement Cost Value** | **$5,794.94** |
| Less Depreciation | (1,087.02) |
| **Actual Cash Value** | **$4,707.92** |
| **Net Claim** | **$4,707.92** |
| Total Recoverable Depreciation | 1,087.02 |
| **Net Claim if Depreciation is Recovered** | **$5,794.94** |

SARAH HAMMILL

## Recap of Taxes, Overhead and Profit

| | Overhead (10%) | Profit (10%) | Material Sales Tax (9.75%) | Storage Rental Tax (9.75%) |
|---|---|---|---|---|
| **Line Items** | 33,988.58 | 33,988.58 | 9,596.20 | 26.91 |
| **Additional Charges** | 11.77 | 11.77 | 0.00 | 0.00 |
| **Total** | **34,000.35** | **34,000.35** | **9,596.20** | **26.91** |

## Recap by Room

| | | | |
|---|---|---|---|
| **Estimate: LI-7005343475-1** | | | |
| **Temporary Repairs** | | **4,007.38** | **1.14%** |
| Coverage: Dwelling | 100.00% = | 4,007.38 | |
| **General Conditions** | | **35,188.75** | **10.03%** |
| Coverage: Dwelling | 100.00% = | 35,188.75 | |
| **Code Compliance** | | **10,805.21** | **3.08%** |
| Coverage: Dwelling | 100.00% = | 10,805.21 | |
| **Demo & Restoration** | | **9,464.84** | **2.70%** |
| Coverage: Dwelling | 100.00% = | 9,464.84 | |
| **Area: Dwelling** | | | |
| **Roof** | | **2,323.13** | **0.66%** |
| Coverage: Dwelling | 100.00% = | 2,323.13 | |
| **Area: Exterior** | | | |
| **Right Elevation** | | **167.58** | **0.05%** |
| Coverage: Dwelling | 100.00% = | 167.58 | |
| **Ext_Surfaces** | | **21,562.51** | **6.15%** |
| Coverage: Dwelling | 100.00% = | 21,562.51 | |
| **Area Subtotal: Exterior** | | **21,730.09** | **6.20%** |
| Coverage: Dwelling | 100.00% = | 21,730.09 | |
| **Area: Interior** | | **23,137.63** | **6.60%** |
| Coverage: Dwelling | 100.00% = | 23,137.63 | |
| **Area: 1st Floor** | | **3,308.29** | **0.94%** |
| Coverage: Dwelling | 100.00% = | 3,308.29 | |
| **Living Room** | | **26,926.51** | **7.68%** |
| Coverage: Dwelling | 100.00% = | 26,926.51 | |
| **Kitchen** | | **33,356.59** | **9.51%** |
| Coverage: Dwelling | 100.00% = | 33,356.59 | |
| **Family Room** | | **20,895.57** | **5.96%** |
| Coverage: Dwelling | 100.00% = | 20,895.57 | |
| **Alcove** | | **1,196.31** | **0.34%** |
| Coverage: Dwelling | 100.00% = | 1,196.31 | |
| **Hall** | | **1,591.50** | **0.45%** |
| Coverage: Dwelling | 100.00% = | 1,591.50 | |
| **Half Bath** | | **6,220.54** | **1.77%** |
| Coverage: Dwelling | 100.00% = | 6,220.54 | |
| **Laundry** | | **8,457.59** | **2.41%** |
| Coverage: Dwelling | 100.00% = | 8,457.59 | |
| **Garage** | | **18,547.16** | **5.29%** |

| | | | |
|---|---|---|---|
| Coverage: Dwelling | 100.00% = | 18,547.16 | |
| **Stairs** | | **14,856.08** | **4.24%** |
| Coverage: Dwelling | 100.00% = | 14,856.08 | |
| **Area Subtotal: 1st Floor** | | **135,356.14** | **38.60%** |
| Coverage: Dwelling | 100.00% = | 135,356.14 | |
| **Area: 2nd Floor** | | **3,161.32** | **0.90%** |
| Coverage: Dwelling | 100.00% = | 3,161.32 | |
| **Hallway** | | **16,852.30** | **4.81%** |
| Coverage: Dwelling | 100.00% = | 16,852.30 | |
| **Bedroom 2** | | **7,067.57** | **2.02%** |
| Coverage: Dwelling | 100.00% = | 7,067.57 | |
| **Closet 2** | | **3,394.82** | **0.97%** |
| Coverage: Dwelling | 100.00% = | 3,394.82 | |
| **Master Bedroom** | | **12,724.09** | **3.63%** |
| Coverage: Dwelling | 100.00% = | 12,724.09 | |
| **M Closet** | | **5,478.12** | **1.56%** |
| Coverage: Dwelling | 100.00% = | 5,478.12 | |
| **Master Bathroom** | | **17,050.52** | **4.86%** |
| Coverage: Dwelling | 100.00% = | 17,050.52 | |
| **WC** | | **3,612.35** | **1.03%** |
| Coverage: Dwelling | 100.00% = | 3,612.35 | |
| **Bathroom** | | **14,124.74** | **4.03%** |
| Coverage: Dwelling | 100.00% = | 14,124.74 | |
| **Bedroom 3** | | **7,516.51** | **2.14%** |
| Coverage: Dwelling | 100.00% = | 7,516.51 | |
| **Closet 3** | | **2,901.14** | **0.83%** |
| Coverage: Dwelling | 100.00% = | 2,901.14 | |
| **Bedroom 4** | | **7,121.80** | **2.03%** |
| Coverage: Dwelling | 100.00% = | 7,121.80 | |
| **Closet 4** | | **3,043.70** | **0.87%** |
| Coverage: Dwelling | 100.00% = | 3,043.70 | |
| **Area Subtotal: 2nd Floor** | | **104,048.98** | **29.67%** |
| Coverage: Dwelling | 100.00% = | 104,048.98 | |
| **Area Subtotal: Interior** | | **262,542.75** | **74.87%** |
| Coverage: Dwelling | 100.00% = | 262,542.75 | |
| **Area Subtotal: Dwelling** | | **286,595.97** | **81.72%** |
| Coverage: Dwelling | 100.00% = | 286,595.97 | |
| **Other Structures** | | **4,625.95** | **1.32%** |
| Coverage: Other Structures | 100.00% = | 4,625.95 | |

| | | | | |
|---|---|---|---|---|
| **Subtotal of Areas** | | | **350,688.10** | **100.00%** |
| Coverage: Dwelling | 98.68% | = | 346,062.15 | |
| Coverage: Other Structures | 1.32% | = | 4,625.95 | |
| **Total** | | | **350,688.10** | **100.00%** |

## Recap by Category with Depreciation

| O&P Items | | | | RCV | Deprec. | ACV |
|---|---|---|---|---|---|---|
| **APPLIANCES** | | | | **3,277.02** | **1,547.19** | **1,729.83** |
| Coverage: Dwelling | @ | 100.00% | = | 3,277.02 | | |
| **CABINETRY** | | | | **23,294.80** | **3,545.29** | **19,749.51** |
| Coverage: Dwelling | @ | 100.00% | = | 23,294.80 | | |
| **CLEANING** | | | | **8,263.71** | | **8,263.71** |
| Coverage: Dwelling | @ | 100.00% | = | 8,263.71 | | |
| **CONTENT MANIPULATION** | | | | **276.00** | | **276.00** |
| Coverage: Dwelling | @ | 100.00% | = | 276.00 | | |
| **GENERAL DEMOLITION** | | | | **25,649.16** | | **25,649.16** |
| Coverage: Dwelling | @ | 97.36% | = | 24,971.01 | | |
| Coverage: Other Structures | @ | 2.64% | = | 678.15 | | |
| **DOORS** | | | | **7,094.26** | **1,206.41** | **5,887.85** |
| Coverage: Dwelling | @ | 100.00% | = | 7,094.26 | | |
| **DRYWALL** | | | | **38,603.07** | | **38,603.07** |
| Coverage: Dwelling | @ | 100.00% | = | 38,603.07 | | |
| **ELECTRICAL** | | | | **15,916.66** | **265.45** | **15,651.21** |
| Coverage: Dwelling | @ | 100.00% | = | 15,916.66 | | |
| **FLOOR COVERING - CARPET** | | | | **8,646.31** | **2,851.04** | **5,795.27** |
| Coverage: Dwelling | @ | 100.00% | = | 8,646.31 | | |
| **FLOOR COVERING - STONE** | | | | **1,021.37** | **68.09** | **953.28** |
| Coverage: Dwelling | @ | 100.00% | = | 1,021.37 | | |
| **FLOOR COVERING - CERAMIC TILE** | | | | **5,847.28** | **427.38** | **5,419.90** |
| Coverage: Dwelling | @ | 100.00% | = | 5,847.28 | | |
| **FINISH CARPENTRY / TRIMWORK** | | | | **19,431.99** | **1,321.13** | **18,110.86** |
| Coverage: Dwelling | @ | 100.00% | = | 19,431.99 | | |
| **FINISH HARDWARE** | | | | **1,093.30** | **393.46** | **699.84** |
| Coverage: Dwelling | @ | 100.00% | = | 1,093.30 | | |
| **FIREPLACES** | | | | **4,386.20** | **1,418.97** | **2,967.23** |
| Coverage: Dwelling | @ | 100.00% | = | 4,386.20 | | |
| **FRAMING & ROUGH CARPENTRY** | | | | **3,526.39** | | **3,526.39** |
| Coverage: Dwelling | @ | 100.00% | = | 3,526.39 | | |
| **HAZARDOUS MATERIAL REMEDIATION** | | | | **17,613.47** | | **17,613.47** |
| Coverage: Dwelling | @ | 100.00% | = | 17,613.47 | | |
| **HEAT, VENT & AIR CONDITIONING** | | | | **10,577.19** | **2,087.28** | **8,489.91** |
| Coverage: Dwelling | @ | 100.00% | = | 10,577.19 | | |
| **INSULATION** | | | | **5,919.04** | | **5,919.04** |
| Coverage: Dwelling | @ | 100.00% | = | 5,919.04 | | |
| **LABOR ONLY** | | | | **19,562.40** | | **19,562.40** |
| Coverage: Dwelling | @ | 100.00% | = | 19,562.40 | | |
| **LIGHT FIXTURES** | | | | **6,066.24** | **1,943.80** | **4,122.44** |
| Coverage: Dwelling | @ | 100.00% | = | 6,066.24 | | |

| O&P Items | | | | RCV | Deprec. | ACV |
|---|---|---|---|---|---|---|
| **MARBLE - CULTURED OR NATURAL** | | | | **2,205.94** | **993.62** | **1,212.32** |
| Coverage: Dwelling | @ | 100.00% | = | 2,205.94 | | |
| **MIRRORS & SHOWER DOORS** | | | | **2,289.26** | **1,146.00** | **1,143.26** |
| Coverage: Dwelling | @ | 100.00% | = | 2,289.26 | | |
| **PLUMBING** | | | | **14,170.50** | **2,768.34** | **11,402.16** |
| Coverage: Dwelling | @ | 100.00% | = | 14,170.50 | | |
| **PANELING & WOOD WALL FINISHES** | | | | **177.60** | **10.73** | **166.87** |
| Coverage: Dwelling | @ | 100.00% | = | 177.60 | | |
| **PAINTING** | | | | **45,270.80** | **1,588.75** | **43,682.05** |
| Coverage: Dwelling | @ | 98.79% | = | 44,722.20 | | |
| Coverage: Other Structures | @ | 1.21% | = | 548.60 | | |
| **ROOFING** | | | | **2,325.10** | | **2,325.10** |
| Coverage: Dwelling | @ | 100.00% | = | 2,325.10 | | |
| **SCAFFOLDING** | | | | **5,463.84** | | **5,463.84** |
| Coverage: Dwelling | @ | 100.00% | = | 5,463.84 | | |
| **SIDING** | | | | **5,674.96** | **538.70** | **5,136.26** |
| Coverage: Dwelling | @ | 100.00% | = | 5,674.96 | | |
| **TILE** | | | | **8,237.13** | **316.92** | **7,920.21** |
| Coverage: Dwelling | @ | 100.00% | = | 8,237.13 | | |
| **TEMPORARY REPAIRS** | | | | **9,752.26** | | **9,752.26** |
| Coverage: Dwelling | @ | 100.00% | = | 9,752.26 | | |
| **WINDOWS - ALUMINUM** | | | | **10,095.90** | **6,555.11** | **3,540.79** |
| Coverage: Dwelling | @ | 100.00% | = | 10,095.90 | | |
| **WINDOWS - SLIDING PATIO DOORS** | | | | **1,794.92** | **1,222.24** | **572.68** |
| Coverage: Dwelling | @ | 100.00% | = | 1,794.92 | | |
| **WINDOW TREATMENT** | | | | **2,959.62** | **1,388.74** | **1,570.88** |
| Coverage: Dwelling | @ | 100.00% | = | 2,959.62 | | |
| **EXTERIOR STRUCTURES** | | | | **3,399.20** | **985.60** | **2,413.60** |
| Coverage: Other Structures | @ | 100.00% | = | 3,399.20 | | |
| **O&P Items Subtotal** | | | | **339,882.89** | **34,590.24** | **305,292.65** |

| Non-O&P Items | | | | RCV | Deprec. | ACV |
|---|---|---|---|---|---|---|
| **PERMITS AND FEES** | | | | **10,805.21** | | **10,805.21** |
| Coverage: Dwelling | @ | 100.00% | = | 10,805.21 | | |
| **Non-O&P Items Subtotal** | | | | **10,805.21** | **0.00** | **10,805.21** |
| **O&P Items Subtotal** | | | | **339,882.89** | **34,590.24** | **305,292.65** |
| **Permits and Fees** | | | | **117.63** | | **117.63** |
| Coverage: Dwelling | @ | 100.00% | = | 117.63 | | |
| **Overhead** | | | | **34,000.35** | | **34,000.35** |
| Coverage: Dwelling | @ | 98.64% | = | 33,537.75 | | |
| Coverage: Other Structures | @ | 1.36% | = | 462.60 | | |
| **Profit** | | | | **34,000.35** | | **34,000.35** |
| Coverage: Dwelling | @ | 98.64% | = | 33,537.75 | | |

| | | | | | | |
|---|---|---|---|---|---|---|
| Coverage: Other Structures | @ | 1.36% | = | 462.60 | | |
| **Material Sales Tax** | | | | **9,596.20** | **3,372.50** | **6,223.70** |
| Coverage: Dwelling | @ | 97.46% | = | 9,352.41 | | |
| Coverage: Other Structures | @ | 2.54% | = | 243.79 | | |
| **Storage Rental Tax** | | | | **26.91** | | **26.91** |
| Coverage: Dwelling | @ | 100.00% | = | 26.91 | | |
| **Total** | | | | **428,429.54** | **37,962.74** | **390,466.80** |

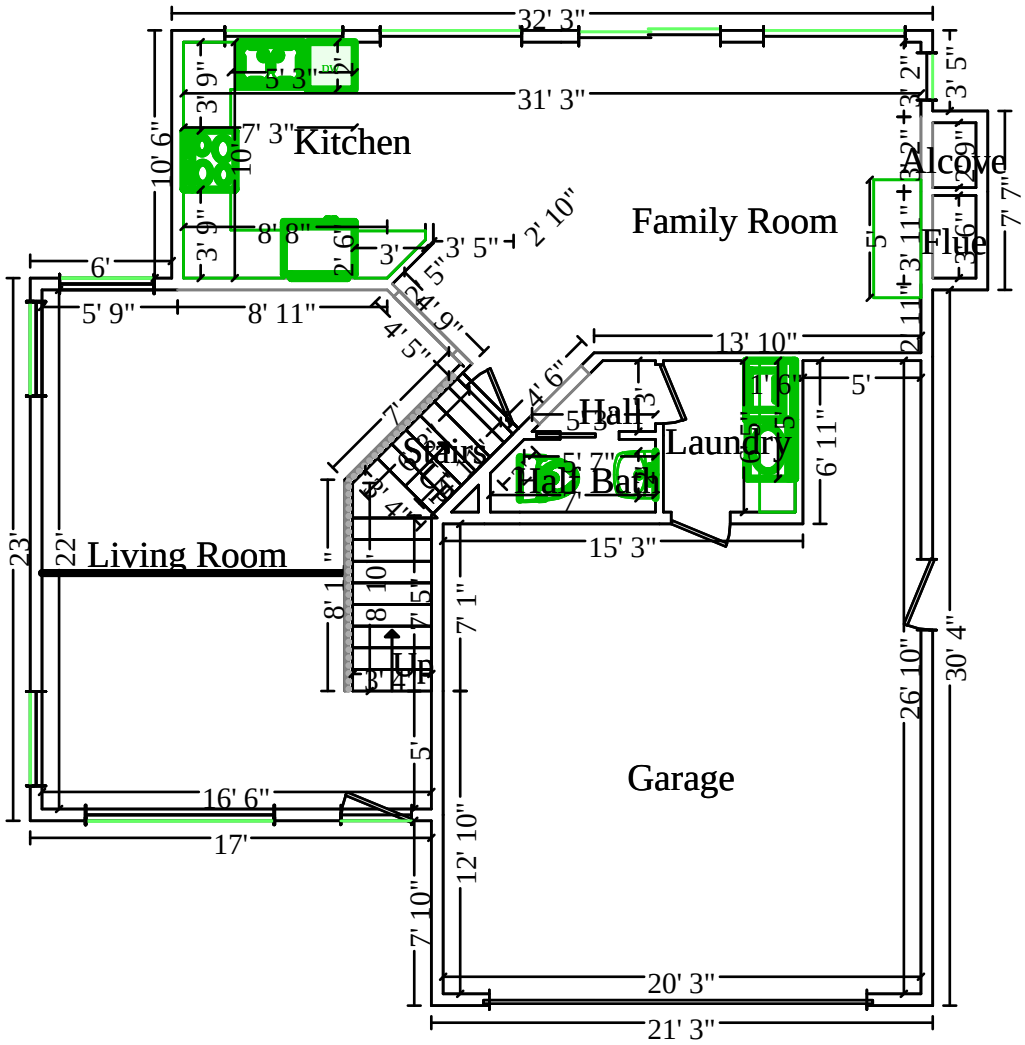
32' 3"
31' 3"
Kitchen
Family Room
Alcove
Flue
Hall
Laundry
Half Bath
Stairs
Living Room
Garage
UP
13' 10"
15' 3"
16' 6"
17'
20' 3"
21' 3"
26' 10"
30' 4"
23'
22'
10' 6"
7' 7"
6' 11"
12' 10"
7' 1"
7' 10"
8' 8"
5' 9"
8' 11"
6'
5'
3' 5"
2' 10"
4' 9"
4' 5"
4' 6"
3' 4"
3' 9"
7' 3"
5' 3"
2' 6"
3'
2' 11"
3' 11"
3' 2"
3' 5"
3' 9"
5' 7"
1' 6"
5' 5"
8' 1"
8' 10"
7' 5"
3' 4"
5'

1st Floor

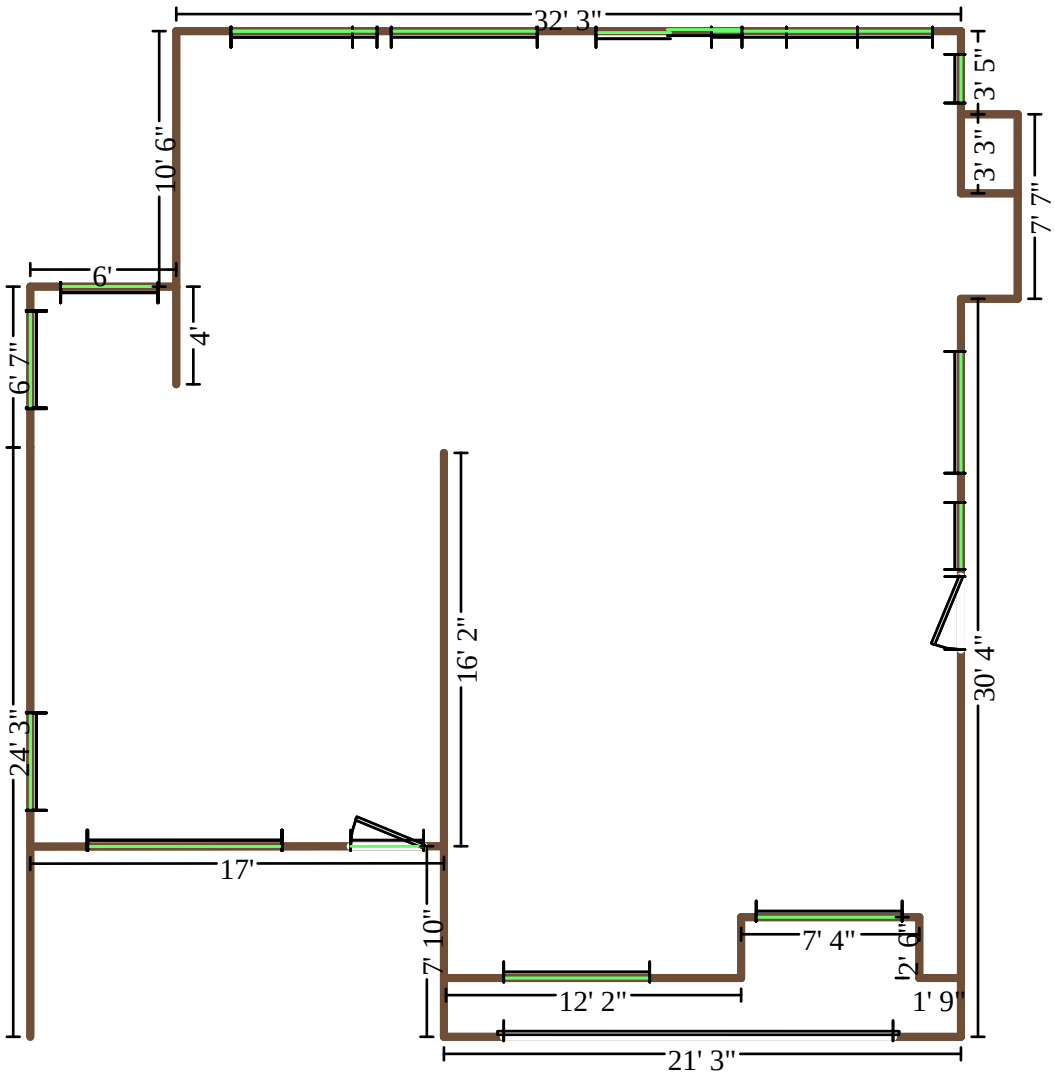


Exterior

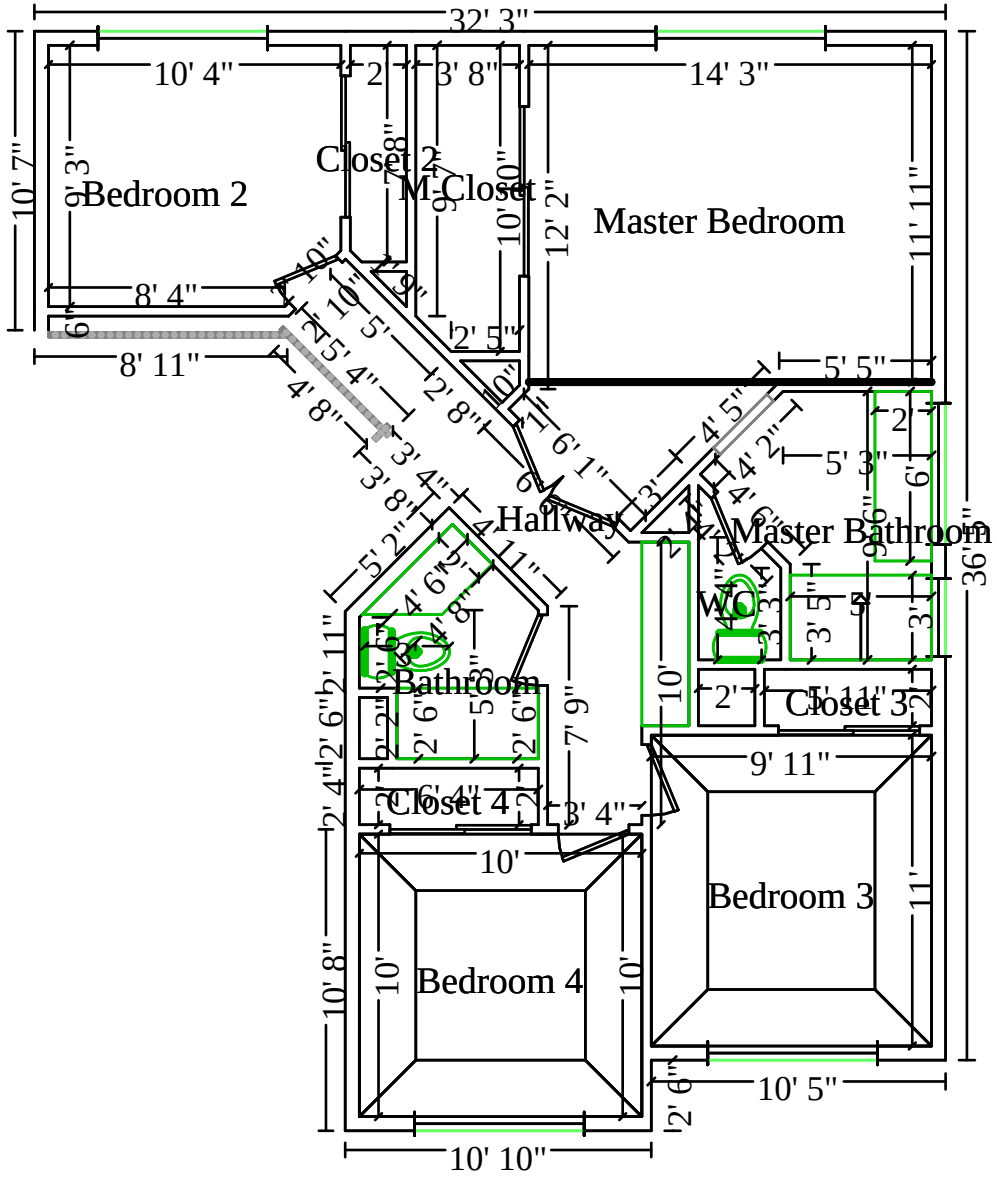
32' 3"
10' 4"
2'
3' 8"
14' 3"
10' 7"
9' 3"
Bedroom 2
Closet 2
M-Closet
Master Bedroom
8' 4"
8' 11"
2' 5"
5' 5"
Hallway
Master Bathroom
WC
Bathroom
Closet 3
Closet 4
9' 11"
Bedroom 3
Bedroom 4
10' 5"
10' 10"
36'

2nd Floor