# FRAMING TAKEOFF INDEX

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

**The roof east of grid 2 has no engineer's sheet yet; those lines are priced for budget and are confirmed with Marek before ordering.**

## SHEET INDEX

| SHEET | TITLE | COVERS |
|---|---|---|
| **T 1.01** | Basis and building summary | What the takeoff is built from, how to read a line, the derived wall heights and stud cut lengths with the arithmetic |
| **T 1.02** | Batch 1: Ground floor walls | Sill on the curb (Blueskin, primer, gasket, anchors), exterior 2x6 walls by wall, the moment-frame infill panels, interior partitions, DensGlass, furring |
| **T 1.03** | Batch 2: Second floor deck | TJI 360 by zone (west bay, stair bay, east bay), LVL beam lines, stair trimmer and header, rim, squash blocks, balcony, subfloor, stair hangers |
| **T 1.03B** | Batch 2B: Balcony deck | 2x6 joists and blocking on the steel outriggers, plywood, PT sleepers, cedar decking, kept separate from the main deck |
| **T 1.04** | Batch 3: Second floor walls | West zone 10'-7" walls, east zone walls under the lower level and the flat east roof (7'-7 7/8" and 7'-9 1/2"), the raked south wall under the slope, interior partitions, posts |
| **T 1.05** | Batch 4: Roofs, parapets and stair enclosure | West roof per Taiga; east of grid 2 the lower level, the sloped roof round the skylight and the east low roof, from the architect's 16 Oct model; the enclosure with purlins; parapets. Engineering not complete |
| **T 1.06** | Connectors, fasteners, membranes and site | Simpson hardware by SKU, nails and screws by box, Blueskin and primer, window tapes, air barrier, Tuck Tape, bracing lumber, blades |
| **T 1.07** | Order summary and budget | One line per product with the batch split, May quote prices and estimates, HST, the LSL stud option |
| **T 1.07A** | Guards and railings, separate estimate | Balcony guardrail (1-A405), stair guard and handrails (5-A404) and an optional guard on the parapet: not framing, not in the framing budget, priced as an allowance for the millwork and metal side |
| **T 1.09** | Details: openings and flashing | Typical window and door framing; the architect's window and balcony-door details (A401) reproduced |
| **T 1.09B** | Details: rim connection from inside | Property-line walls without hangers: stiffeners toe-nailed into the LSL rim and blocking panels; section and inside elevation, with the rule table |
| **T 1.09C** | Manufacturer spec: Weyerhaeuser hanger details | Weyerhaeuser H1, H2A, web stiffener attachment (W) and backer and filler blocks, as published |
| **Backup** | Full-detail set | Every cut length per wall, the architect's parapet, overhang and curb details (T 1.09A) and the reconciliation against the 1 May quote (T 1.08): in the separate full-detail PDF |

## BASIS OF TAKEOFF

| DOCUMENT | ISSUED | WHAT IT GAVE THIS TAKEOFF |
|---|---|---|
| 2601016_80LAMB_100% CD, 31 sheets, Kunaal Mohan (OAA stamp Sheena Sharp) | 30 Sep 2026 | Plans A100 to A104, sections A300 to A302, assemblies A004, details A400 to A406, schedules A405. Wall heights, openings, assemblies, parapet and sill details. |
| Gulf Engineering (Hossein Azargive): ground floor, second floor framing, foundation wall and grade beam | 20 Oct 2026 | Slab on grade, W200x36 moment frame MF-1 and outriggers, 3-ply 1 3/4 x 9 1/2 LVL beam lines, posts P1 to P3, east wall headers 2-2x8 and 3-2x8. No roof sheet. |
| Taiga Building Products EWP layout 20260370 (Scott Jutras) | 29 Apr 2026 | Joist, beam, hanger and subfloor counts per level. Page 1 (raised ground floor) is superseded by the slab on grade. Pages 2 and 3 used as the check on the deck and the west roof. |
| Downtown Lumber cash quote 3027967 to North Arrow | 1 May 2026 | Unit prices for the budget. The scan stops at line 48. |
| Architect's 3D model (DWG, IFC, DXF exports) | 16 Oct 2026 | Stud-level cross-check on counts and lengths. Since 22 Oct also the source for the framing east of grid 2 (lower level, sloped roof, east low roof heights; DXF layer S-BEAM). Its member sizes are placeholders: the 2F deck is drawn as 2x10, not TJI. |
| Weyerhaeuser TJI specifier's guide | current | Rim, squash block, blocking panel and nailing rules; the inside-attachment detail on T 1.09. |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Takeoff Index – T 1.00**

# FRAMING TAKEOFF INDEX

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

## OPEN DECISIONS AND QUESTIONS – TO CLOSE BEFORE THE ORDER

*one per row, in the words to ask them; the sheet column is where the number that depends on the answer lives*

| # | DECISION OR QUESTION | WHO | SHEET |
|---|---|---|---|
| 1 | J-bolts are cast into the curb: confirm the spacing (1.2 m on A406, 2 per wall end) and that the nuts and washers are on site. Where does the curb stop at the entry door? | Marek | T 1.02 |
| 2 | Send the full 1 May quote; the copy we have stops at line 48 (the lower roof) and the upper roof, enclosure and hardware lines are missing. | Marek | T 1.08 |
| 3 | LSL for every stud, for the 10'-7" west-zone walls and parapets only, or SPF throughout? | Marek | T 1.07 |
| 4 | Roof framing sheet, nothing east of grid 2 is engineered: the lower level (2-ply 2x10 drop beam on grid 2 and its seat at the P3 posts, headers H-A and H-B, the enclosure floor joists, 2x10 between H-A and H-B and 2x6 east of grid 3), the sloped roof (foot beam, sloped 2x10 lines, short joists, skylight headers), the east low roof, the enclosure rafters and purlins, the LVL end joists and parapet tie-down. All sizes are the architect's placeholders. | Marek (Hossein) | T 1.05 |
| 5 | Green roof engineering is not decided: who engineers the 4" Zinco green roof on R1 (A004) and its load on the roof framing, and when. It has to be settled before the roof sheet and the roof order. | Marek (Hossein, Kunaal) | T 1.05 |
| 6 | Header over the W11/W10 mulled pair in the enclosure south wall: 3.45 m (11'-4") is past the OBC Part 9 lintel table (Table 9.23.12.3.-A tops out at 2-2x12, 3.39 m with note 6). Needs an engineered header (LVL); 3-2x10 carried as a placeholder. | Marek (Hossein) | T 1.05 |
| 7 | Posts under Taiga's B9-4 at grid 3, in the second floor north and south walls: not shown on the engineer's sheet or Taiga's layout. | Marek (Hossein) | T 1.04, T 1.05 |
| 8 | Taiga's 29 Apr layout runs the sloped roof from B8-3 at grid 2 to B9-4 near grid 3; the architect's 16 Oct model stops it at a foot beam about 2'-9" short of grid 3 with a flat strip after. Which governs? | Marek (Kunaal, Taiga) | T 1.05 |
| 9 | East wall W04 header: the engineer's sheet labels 2-2x8 on the north part of the wall and 3-2x8 on the south part. Which covers W04 (2-2x8 carried)? | Marek (Hossein) | T 1.04 |
| 10 | TJI 360 9 1/2" in place of the 9 1/4" open-web joists is approved. If the 20 Oct second floor sheet is not revised and stamped with it, ask for a revised sheet or an email confirming it, for the record. | Marek (Hossein) | T 1.03 |
| 11 | Moment frame wood connection (CONNECTION REQUIRES FURTHER DETAILING, MF-1 never issued): are holes allowed through the W200x36 column and beam flanges for the 1/2" through-bolts at 16", and what size and spacing, or must the LSL and 2x10 nailers be clamped to the flanges (beam clamps, no drilling)? | Marek (Hossein) | T 1.02, T 1.03, T 1.09 |
| 12 | Rim connection from inside at the two property-line walls, no hangers: joists bear on the plate, web stiffeners at every end toe-nailed into a 1 1/4" LSL rim, LSL blocking panels in every other cavity (T 1.09B). Not on the engineer's sheet. Confirm the method and the spacing on these braced walls. | Marek (Hossein) | T 1.03, T 1.09 |
| 13 | Hurricane ties, framing angles and straps are not on the drawings: confirm the allowance on T 1.06 or specify. | Marek (Hossein) | T 1.06 |
| 14 | Post under the south end of the stair trimmer (P2 added here, not on the sheet) and the sunken tub support Taiga flagged. | Marek (Hossein) | T 1.03 |
| 15 | Roof stair layout: the stair now lands on the lower level east of grid 2, 8'-3 3/8" above the second floor, which needs 13 risers of 7 5/8". A102/A103 draw three winders at the W/C wall, a short straight and three winders at the well-end wall: 10 risers. The 16 Oct model starts the stair at grid 3 instead. Headroom under the grid-3 beam over the bottom winders is about 5'-9 1/2" against 6'-4 3/4". Lay the stair out; the roof-stair lines on T 1.05 are placeholders. | Marek (Kunaal) | T 1.05 |
| 16 | East of grid 2 is framed from the architect's 16 Oct model (DXF): lower level at 2506 above the finished floor (A302 section 2), east low roof at 2548 to the top of the joists (A302 section 1), the sloped roof round W12 at about 24 deg (A103: 23.8). The model has the headers but no joists in the enclosure floor between the roof-stair header and the south wall (added here), and the parapet along the slope is not drawn (assumed to follow the slope). | Marek (Kunaal) | T 1.04, T 1.05 |
| 17 | Enclosure east and west window pairs (W06/W05, W05/W06) drawn corner to corner: framed with a 1/2" rough opening allowance and one jack each end, the corner studs acting as the kings. Confirm the window sizes with the window supplier before the walls are framed. | Marek (Kunaal, window supplier) | T 1.05 |
| 18 | Stair openings are sized to 1950 headroom from the model stair (15 at 200 on 255). Confirm against the stair shop drawing before the headers are set. | Marek (Kunaal, stair shop) | T 1.05 |
| 19 | Furring with drainage holes behind the corrugated metal: proprietary clip or site-drilled 1x3? | Marek (Kunaal, metal supplier) | T 1.02 |
| 20 | 7/8" roof sheathing board: product intended, or 3/4" T&G plywood? | Marek (Kunaal) | T 1.05 |
| 21 | Window rough openings: schedule sizes plus 2" assumed (1/2" at the enclosure pairs); the window shop drawings govern. | Marek (window supplier) | T 1.02, T 1.04 |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Takeoff Index – T 1.00**

# BASIS AND BUILDING SUMMARY

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Framing footprint 31'-9 3/4" by 16'-2" out to out of studs. The 32'-9 3/4" and 17'-2 1/8" on the plans are to the face of the cladding; the 15'-1 3/4" interior clear plus two 2x6 walls with their sheathing and drywall gives the framing width. Two storeys plus the rooftop stair enclosure. Slab on grade on a 16" x 8" grade beam on helical piles. The ground floor exterior walls stand on a 6" concrete curb 2'-8 5/8" above the slab (A406). All heights on this sheet are measured up from the top of the slab. The west end is a W200x36 steel moment frame with curtain-wall doors; the second floor balcony sits on W200x36 outriggers. The north and south walls are on the property lines against the neighbours' garages, so nothing on those two faces can be nailed from outside once the walls are up.

## WALL HEIGHTS AND STUD CUT LENGTHS, WITH THE ARITHMETIC

*heights measured up from the top of the slab; every number is computed from the model, not typed, so a changed datum regenerates the counts*

| LEVEL OR WALL | FROM | TO | WALL HEIGHT | STUD CUT | STOCK | HOW IT WAS DERIVED |
|---|---|---|---|---|---|---|
| Ground floor exterior walls (on the curb) | Top of curb, 2'-8 5/8" above the slab | Underside of TJI, 8'-9 3/8" above the slab | 6'-0 3/4" | 5'-8 1/4" | 2x6 x 12', two studs per piece | Second floor finished floor 9'-10 1/8" above the slab, less 1" flooring, 1 1/2" gypcrete, 3/4" subfloor and the 9 1/2" joist gives the underside of the TJI; less the curb; less three plates. |
| Ground floor partitions and west infill panels | Slab | Underside of TJI, 8'-9 3/8" above the slab | 8'-9 3/8" | 8'-4 7/8" | 104 5/8" precut | Partitions run to the underside of the deck (A005 note 15). |
| Second floor, west zone (grid 1 to 4) | Subfloor, 9'-7 5/8" above the slab | Underside of roof joists, 20'-2 5/8" above the slab | 10'-7" | 10'-2 1/2" | 2x6 x 12' | Dining clear 10'-3" (A300) plus 1/2" drywall and 1" hat channel above the finished floor; the plates sit on the subfloor, 2 1/2" below the finished floor. |
| Second floor walls under the east low roof | Subfloor, 9'-7 5/8" above the slab | Underside of roof joists, 17'-5 1/8" above the slab | 7'-9 1/2" | 7'-5" | 104 5/8" precut | A302 section 1: 8'-4 3/8" from the finished floor to the top of the roof joists (the architect's model agrees exactly), less the 2x10. |
| Second floor walls under the lower level (north wall, W/C) | Subfloor, 9'-7 5/8" above the slab | Underside of lower framing, 17'-3 1/2" above the slab | 7'-7 7/8" | 7'-3 3/8" | 104 5/8" precut | A302 section 2: 8'-2 5/8" from the finished floor to the top of the lower framing, less the 2x10 (A302 section 1 dimensions the underside as 7'-5 3/4"). |
| Stair enclosure west wall on the west roof deck | Roof deck | Underside of rafters, 25'-11" above the slab | 4'-10 1/4" | 4'-5 3/4" | 2x6 x 10', two per piece | Top of the stair roof 26'-10 7/8" above the slab, less 1/2" ply, 2x4 purlin, 5/8" board and the 2x8 rafter. |
| Stair enclosure walls on the enclosure floor | Enclosure floor, 18'-1 1/2" above the slab | Underside of rafters, 25'-11" above the slab | 7'-9 3/8" | 7'-4 7/8" | 2x6 x 16', two per piece | Lower level top plus 3/4" subfloor. The south wall over the slope is raked at the bottom (T 1.05). |
| Parapets W2 (detail 2-A400) | Top of roof joists | Top of parapet, 21'-11 3/4" above the slab | 11 7/8" above the joists | 1'-5 7/8" | from 10' drops | 2x4 bottom plate on the joists, 2x6 studs rising beside the 6" roof insulation, 2x6 top plate, 3/4" plywood both faces. |

## NOTES

1. Quantity is pieces at the cut length shown. Order (stock x pcs) is what to buy: the stock length and how many, with the pieces-per-stock rule in the note.
2. Waste is stated per line, not hidden in one global factor: 5% on studs, 10% on plates, 8 to 12% on sheet goods, none on engineered beams and hangers.
3. Source names the sheet the line comes from. Where the source is 'recommended' or 'assumption' the line is mine, not the architect's or the engineer's, and the note says so in bold.
4. Price marked quote is from Downtown Lumber's 1 May 2026 quote; est. is estimated price for the budget and needs a re-quote; to quote means I have no basis for a number.
5. All dimensions are imperial. Heights are measured up from the top of the slab; the architect's site elevations in millimetres are in the full-detail backup only.
6. In scope: all wood framing from the curb up, rim and engineered beams, sheathing (DensGlass, plywood, roof board, subfloor), connectors, nails and screws, sill and window membranes, temporary bracing. Out: steel, piles, concrete, curtain wall and windows (owner supplied per A405), stairs, cladding and its clips, insulation, drywall, roofing, green roof, cedar decking.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Basis and Summary – T 1.01**

# BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Ground floor. The sill is Blueskin SA over the top of the curb on primer, foam gasket under the plate, anchors at 1.2 m (A406). Exterior walls are 2x6 at 16" on the curb, three-stud L corners, king-jack-jack at every opening, a mid-height blocking row, DensGlass outside, 1x3 furring over the mineral wool. The west wall is two 970 mm infill panels beside the curtain wall. Interior partitions run slab to deck, plywood clad both faces (A005 note 16).

### WALLS IN THIS BATCH, ONE LINE PER WALL

*stock pieces to order per wall; every cut length is in the full-detail backup set*

| WALL | WHERE | LENGTH | HEIGHT | STUDS (PCS, STOCK) | HEADERS | PLATES | BLOCKING | SHEATHING | FURRING | OPENINGS | BUDGET |
|---|---|---|---|---|---|---|---|---|---|---|---|
| **GF-N** | North wall (grid A, laneway to garden) | 31'-0 3/8" | 6'-0 3/4" | 15: 2x6 x 12' | 0 | 7 | 3 | 7 sh | 20 | none | $670 |
| **GF-S** | South wall (grid C) | 31'-0 3/8" | 6'-0 3/4" | 15: 2x6 x 12' | 0 | 7 | 3 | 7 sh | 20 | none | $670 |
| **GF-E** | East wall (garden side, grid 6), south of the entry door bay | 11'-6 5/8" | 6'-0 3/4" | 13: 2x6 x 12', 2x6 x 10', 2x6 x 8' | 6 | 3 | 1 | 3 sh | 8 | W01, W03+W02 | $431 |
| **GF-E-DOOR** | East wall, entry door bay | 3'-8 3/8" | 8'-9 3/8" | 13: 2x6 x 104 5/8" precut, 2x6 x 8' | 1 | 1 | 1 | 2 sh | 4 | DX01 | $232 |
| **GF-W-N** | West wall, north infill panel beside the curtain wall | 2'-4 7/8" | 8'-9 3/8" | 6: 2x6 x 104 5/8" precut | 0 | 1 | 1 | 1 sh | 3 | none | $115 |
| **GF-W-S** | West wall, south infill panel | 2'-4 7/8" | 8'-9 3/8" | 6: 2x6 x 104 5/8" precut | 0 | 1 | 1 | 1 sh | 3 | none | $115 |
| **GF-P-STAIR-S** | Stair and mech room south wall, grid 2 to grid 4 (P1a/P1b 2x4) | 11'-2 7/8" | 8'-9 3/8" | 13: 2x4 x 104 5/8" precut | 0 | 3 | 1 | 7 sh | 0 | none | $317 |
| **GF-P-MECH-W** | Mech room west wall with door D3, under the top of the stair (P1a 2x4) | 3'-2 1/4" | 8'-9 3/8" | 12: 2x4 x 104 5/8" precut, 2x4 x 92 5/8" precut, 2x4 x 8' | 1 | 1 | 1 | 2 sh | 0 | D3 | $138 |
| **GF-P-MECH-E** | Mech room east wall, pony wall under the stair stringers (P1a 2x4) | 3'-2 1/4" | 3'-5 5/8" | 3: 2x4 x 10' | 0 | 1 | 1 | 1 sh | 0 | none | $66 |
| **GF-P-WC-W** | W/C west wall, plumbing chase (P2a 2x6) | 7'-2 1/8" | 8'-9 3/8" | 10: 2x6 x 104 5/8" precut | 0 | 2 | 1 | 5 sh | 0 | none | $264 |
| **GF-P-WC-N** | W/C and bedroom north wall with doors D2 and D1 (P1a/P1b 2x4) | 15'-2 3/8" | 8'-9 3/8" | 26: 2x4 x 104 5/8" precut, 2x4 x 92 5/8" precut, 2x4 x 8' | 2 | 4 | 2 | 10 sh | 0 | D2, D1 | $494 |
| **GF-P-BED-W** | Bedroom west wall = W/C east wall (P1 2x4), stacked under the 2F kitchen wall | 7'-0 3/8" | 8'-9 3/8" | 10: 2x4 x 104 5/8" precut | 0 | 2 | 1 | 5 sh | 0 | none | $230 |

### GROUND FLOOR

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Posts | P3 4-2x6 built-up post, 5'-8 1/4" plies | 5'-8 1/4" | 8 | pcs | 2x6 x 12' x 4 | Under the grid 2 LVL beam, north and south walls (engineer P3). | Gulf Eng. | built-up posts nailed per OBC 9.23.10; glue optional |
| Posts | P2 3-2x6 built-up post, 5'-8 1/4" plies | 5'-8 1/4" | 12 | pcs | 2x6 x 12' x 6 | Under the grid 4 LVL beam, north and south, and east wall per engineer. | Gulf Eng. | built-up posts nailed per OBC 9.23.10; glue optional |
| Posts | P1 2-2x6 built-up post, 5'-8 1/4" plies | 5'-8 1/4" | 6 | pcs | 2x6 x 12' x 3 | East wall window jambs per engineer. | Gulf Eng. | built-up posts nailed per OBC 9.23.10; glue optional |

### WEST WALL, MOMENT FRAME

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Lumber | TimberStrand LSL 1 1/2" x 5 1/2" x 12' nailer up each W200x36 column (one 12' and one 10' per column, slab to the underside of the roof joists) | | 2 | pcs | 12' x 2 | two columns at 20'-2 5/8" each; butt joint at a bolt | Gulf Eng. MF-1 | CONNECTION REQUIRES FURTHER DETAILING: not specified on the plans; proposed by BWD, Hossein to accept. |
| Lumber | TimberStrand LSL 1 1/2" x 5 1/2" x 10' nailer up each W200x36 column (one 12' and one 10' per column, slab to the underside of the roof joists) | | 2 | pcs | 10' x 2 | two columns at 20'-2 5/8" each; butt joint at a bolt | Gulf Eng. MF-1 | CONNECTION REQUIRES FURTHER DETAILING: not specified on the plans; proposed by BWD, Hossein to accept. |
| Steel connection | 1/2" through-bolts with nut and washer, LSL nailer to the column flange | | 34 | bolts | | 16 per column at 16" o.c., two columns, 2 spare | Gulf Eng. MF-1 | Hossein to give the bolt size and spacing. |
| Membranes | Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip) | | 1 | roll | | isolates the wood from the steel: no condensation or galvanic contact at the bolts | BWD | Provide unless Hossein or Kunaal says it is not required. About 46 LF needed; one roll. |

### SILL

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Plate washers 3" x 3" x 1/4" | | 26 | pcs | | under every anchor nut | OBC 9.23.6 | |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Ground Floor Walls – T 1.02**

# BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Membranes | Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside | | 2 | rolls | | 76 LF of curb | Marek, 21 Oct | over the masonry at the sill; 15% for laps |
| Membranes | Blueskin primer (Blue Prep or Aquatac), 3.78 L | | 2 | pails | | primer under the Blueskin on concrete; about 20 m2 per pail | Henry/Bakor data sheet | |
| Membranes | Sill gasket 5 1/2" x 82' foam | | 2 | rolls | | under every bottom plate on the curb (A406 'sill sealer, bond break') | A406 | |
| Lumber | 2x12 PT sill at the slab, 16' | | 2 | pcs | 16' x 2 | detail 2-A403: 2x12 PT sill fastened to the foundation wall with concrete screws | A403 | location per the detail; verify extent |

**BATCH 1 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded)** **$4,835 before HST**

## NOTES

1. GF-E-DOOR: the entry door DX01 (850 x 2100) runs to the slab, so the curb is interrupted there. Verify against the foundation as poured; if the curb is continuous the door header drops to the schedule height and the bay reverts to the curb wall.
2. West infill panels GF-W-N and GF-W-S: 970 mm each per A101. The three DX02 curtain-wall doors between them are by the window supplier. Jambs are tied to the W200x36 columns with a 2x6 nailer and 1/2" bolts, an allowance until Hossein details it.
3. Posts P1 (2-2x6), P2 (3-2x6), P3 (4-2x6) from the engineer's second floor sheet, counted on the ground floor under the beam lines and at the east wall jambs. Squash blocks above them are on T 1.03.
4. Blocking rows: the stock quantity on each blocking line is what to order if the stud drops are not there. Ground floor curb studs leave 7" per 12', too short; order the 12' shown.
5. Partitions (A101, A301 section A, T 1.05): the main stair is a straight run along the north wall from the entry up to grid 2, so nothing full height crosses the strip. The mech room sits under the high end of the run; its east wall is a pony wall cut to the stringer line, its west wall at the well end carries the 2F wall above. The W/C east wall at 6050 is the bedroom's west wall and stacks under the 2F kitchen wall; the corridor wall at 2600 carries D2 and D1.
6. DensGlass: 12% waste, openings not deducted. Screws, PCD blade and utility blades are on T 1.06. No building paper is needed under the specified Adhero 3000; see T 1.06.
7. Furring: W1 calls for 25 mm horizontal furring with drainage holes over 75 mm of pinned mineral wool, carrying the 7/8" corrugated metal. Listed as 1x3 at 16"; confirm with the metal supplier whether a clip system replaces it.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Ground Floor Walls – T 1.02**

# BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Second floor deck on TJI 360 9 1/2" at 16", 16' long, north-south, bearing on the north and south walls. Three zones: the west bay (grid 1 to 2, balcony side), the stair bay (grid 2 to 4, with the stair opening on the north side), the east bay (grid 4 to 6). Two 3-ply LVL beam lines run with the joists under the post loads from above. The stair opening is framed with a 3-ply LVL trimmer and header on HGUS hangers with squash blocks and a post under every bearing. Rim board all round. On the two property-line walls the rim is attached from inside (T 1.09).

### DECKS AND ROOFS IN THIS BATCH

*member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers*

| DECK | ZONE | MEMBERS | LENGTH | AREA | PRODUCT | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|
| **F2-Z1** | Zone 1, west bay (grid 1 to 2), balcony side | 9 @ 16" | 15'-11 1/2" | 17.9 m2 | Weyerhaeuser TJI 360 9 1/2" x 16' | Gulf Eng. 2nd floor framing, Taiga FC2 | Bears on the north and south walls. LVL 3-ply beam line at grid 2 (column line C2) carries the post loads from above. |
| **F2-Z2** | Zone 2, stair bay (grid 2 to 4) | 8 @ 16" | 15'-11 1/2" | 17.0 m2 | Weyerhaeuser TJI 360 9 1/2" x 16' | Gulf Eng., Taiga FC2 | Stair opening runs the full bay, double to double: the two full-length 3-ply LVL beam lines are the trimmers and a 3-ply LVL header spans between them about 1050 south of the north rim (the stair is 1000 wide on A102, so the header lands over the mech room south wall) (Taiga FB5-3, FB6-3, FB7-3 with H1 hangers). Tail joists hang on the header. |
| **F2-Z3** | Zone 3, east bay (grid 4 to 6), bedroom and W/C | 6 @ 16" | 15'-11 1/2" | 12.3 m2 | Weyerhaeuser TJI 360 9 1/2" x 16' | Gulf Eng., Taiga FC2 | Sunken tub support (Taiga note) still to be confirmed by the engineer. |

### DECK TO MOMENT FRAME

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Steel connection | TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers | | 2 | boxes | | deck rim and balcony blocking to the steel beams and outriggers | Gulf Eng. 2nd floor | CONNECTION REQUIRES FURTHER DETAILING. Connectors and fasteners for the deck rim, roof end joist and parapet to the steel are not specified on the plans (no MF-1 issued). |
| Steel connection | 1/2" through-bolts with nut and washer, 2x10 nailer to the W200x36 beam and outrigger flanges | | 50 | bolts | | 4 nailers x 16' at 16" o.c., 12 each, 2 spare | Gulf Eng. 2nd floor | Hossein to give the bolt size and spacing. |
| Lumber | 2x10 SPF nailer, 16' (bolted to the steel beam and outriggers) | | 4 | pcs | 2x10 x 16' x 4 | nailer for the rim, deck and balcony framing at the steel | Gulf Eng. | |

### ZONE 1, WEST BAY (GRID 1 TO 2), BALCONY SIDE

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | TJI 360 9 1/2" x 16' | 15'-11 1/2" | 11 | pcs | 16' x 11 | 9 joists @ 16" plus 2 for blocking panels and squash | Gulf Eng. 2nd floor framing, Taiga FC2 | Bears on the north and south walls. LVL 3-ply beam line at grid 2 (column line C2) carries the post loads from above. |
| Sheathing | 3/4" T&G plywood subfloor 4x8 | | 7 | sheets | 4x8 x 7 | 17.9 m2, glued and screwed | A004 F2, Taiga note 9 | 8% waste |
| Adhesive | PL400 subfloor adhesive 828 mL | | 5 | tubes | | one tube per 1.5 sheets | Taiga note 9 | |

### ZONE 2, STAIR BAY (GRID 2 TO 4)

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | TJI 360 9 1/2" x 16': one tail joist (11'-11 1/4") south of the header and one infill (3'-2 7/8") north of it from each piece | 15'-11 1/2" | 10 | pcs | 16' x 10 | 8 joists @ 16" in the bay, all hung on the full-bay header (double to double), plus 2 for blocking panels; 3 infills north of the header outside the 6'-5 1/8" opening, 5 bays open | Gulf Eng., Taiga FC2 | Stair opening runs the full bay, double to double: the two full-length 3-ply LVL beam lines are the trimmers and a 3-ply LVL header spans between them about 1050 south of the north rim (the stair is 1000 wide on A102, so the header lands over the mech room south wall) (Taiga FB5-3, FB6-3, FB7-3 with H1 hangers). Tail joists hang on the header. |
| Sheathing | 3/4" T&G plywood subfloor 4x8 | | 7 | sheets | 4x8 x 7 | 17.0 m2, glued and screwed | A004 F2, Taiga note 9 | 8% waste |
| Adhesive | PL400 subfloor adhesive 828 mL | | 5 | tubes | | one tube per 1.5 sheets | Taiga note 9 | |

### ZONE 3, EAST BAY (GRID 4 TO 6), BEDROOM AND W/C

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | TJI 360 9 1/2" x 16' | 15'-11 1/2" | 8 | pcs | 16' x 8 | 6 joists @ 16" plus 2 for blocking panels and squash | Gulf Eng., Taiga FC2 | Sunken tub support (Taiga note) still to be confirmed by the engineer. |
| Sheathing | 3/4" T&G plywood subfloor 4x8 | | 5 | sheets | 4x8 x 5 | 12.3 m2, glued and screwed | A004 F2, Taiga note 9 | 8% waste |
| Adhesive | PL400 subfloor adhesive 828 mL | | 4 | tubes | | one tube per 1.5 sheets | Taiga note 9 | |

### ZONE 2 STAIR

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Second Floor Deck – T 1.03**

# BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Blocking | 2x6 squash blocks at the stair trimmer and header bearings, 9 1/4", two per bearing | | 8 | pcs | 2x6 x 8' x 1 | the header's two bearings on the beam lines and the beam-line posts below | Weyerhaeuser TJI guide (squash blocks), BWD | from 2x6 drops; 10d into each TJI flange; the load goes straight to the post below |
| Posts | P2 3-2x6 posts in the ground floor wall under each end of the stair header's beam lines, 5'-8 1/4" | 5'-8 1/4" | 6 | pcs | 2x6 x 12' x 3 | two posts, three plies, directly under the LVL bearings | Gulf Eng. P2, BWD | The engineer shows P3 at the north wall by the stair; this adds the matching post under the south end of the trimmer. Hossein to confirm. |
| Beams | LVL 1 3/4 x 9 1/2, 3-ply stair header, double to double | 11'-0 3/8" | 3 | pcs 12' | 12' x 3 | each ply cut 11'-0 3/8" | Gulf Eng. 2nd floor, Taiga FC2 | Spans between the two 3-ply beam lines (the trimmers), HGUS5.50/10 at each end. Taiga FB7-3, 12'. |
| Connectors | Simpson HGUS5.50/10 (3-ply LVL hanger) | | 2 | pcs | | stair header ends into the beam lines | Gulf Eng., Taiga H1 (2) | |
| Connectors | Simpson IUS2.56/9.5 (TJI face-mount hanger) | | 14 | pcs | | 8 tail joists south of the header and 3 infill joists north of it, east of the opening, 3 spare | Taiga H2 | Taiga carried 10 for the shorter opening |

## DECK

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Blocking | 2x6 squash blocks under posts P1 to P3 and the enclosure corners, 9 1/4", two per post | | 28 | pcs | 2x6 x 8' x 3 | every built-up post lands on a squash block pair, not on the subfloor | Weyerhaeuser TJI guide detail CS | from drops; match the post area |
| Connectors | Simpson H2.5A hurricane ties | | 8 | pcs | | the east and west end joists only; the property-line walls get stiffeners and blocking instead | recommended, not on drawings | **NOT ON DRAWINGS: confirm with Hossein** |

## DECK PERIMETER (PROPERTY-LINE WALLS)

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Blocking | Web stiffeners for the TJI 360 at every joist end on the property-line walls: 7/8" x 2 5/16" blocks, 6 5/8" long, one each side of the web, three 8d (0.113 x 2 1/2") nails clinched | | 82 | pcs | 7/8 4x8 x 1 | two per joist end, 41 ends (41 = south wall all joists, north wall less the stair opening); tight to the bottom flange, gap at the top 1/8" min to 2 3/4" max; each stiffener toe-nailed into the rim | Weyerhaeuser Canada / MiTek connector guide, Web Stiffener Attachment | Rip from 7/8" plywood, same stock as the roof board: one 4x8 sheet gives 19 strips x 14 blocks. |
| Blocking | TimberStrand LSL blocking panels 1 1/4" x 9 1/2" between the joists at the north and south rims, every other cavity | | 23 | pcs | 12' x 3 | 23 cavities, mostly 13 11/16", alternate cavities; toe-nailed to the plate, back-nailed into the rim, and nailed through the stiffener from the open cavity next to it; subfloor nailed into the tops | Weyerhaeuser TJ-9001 blocking panels (A1, B1); BWD method in place of hangers | Cut from 3 pcs 12' LSL, 10 blocks a piece. Every other cavity (William); Hossein to confirm on the braced walls. |
| Rim board | TimberStrand LSL rim 1 1/4" x 9 1/2" x 12' on the north and south walls (or 1 3/4" LVL), same depth as the TJI | | 6 | pcs | 12' x 6 | the two property-line walls, 31'-9 3/4" each; the stiffeners and blocking nail into it from inside | LSL holds the toe nails from the stiffeners and the blocking; replaces the 1 1/8" rim board throughout | |

## ZONE 1/2 BOUNDARY

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL 1 3/4 x 9 1/2, 3-ply flush beam at grid 2 | 15'-11 1/2" | 3 | pcs 16' | 16' x 3 | each ply cut 15'-11 1/2" | Gulf Eng. 2nd floor | Flush beam line at column C2, carries posts P3 above. Taiga FB5-3. |

## ZONE 2/3 BOUNDARY

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL 1 3/4 x 9 1/2, 3-ply flush beam at grid 4 | 15'-11 1/2" | 3 | pcs 16' | 16' x 3 | each ply cut 15'-11 1/2" | Gulf Eng. 2nd floor | Flush beam line, posts P2 above. Taiga FB6-3. |

## DECK PERIMETER

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Rim board | Rim, TimberStrand LSL 1 1/4 x 9 1/2 at the east and west ends (or 1 3/4 LVL) | | 3 | pcs 12' | 12' x 3 | 32 LF perimeter | Taiga FC2, BWD | LSL rim all round in place of the 1 1/8" rim board on Taiga's layout; the north and south rims are their own line with the hangers. 12' lengths. |

**BATCH 2 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded)** **$5,199 before HST**

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Second Floor Deck – T 1.03**

# BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

**NOTES**

1. Taiga's second floor page (FC2) carried 19 x 16' and 9 x 14' PJI-40 with FB5/FB6/FB7 3-ply LVL and 18 sheets of subfloor; the 20 Oct engineer's sheet adds the second full-length beam line and the 16' span, and the product is now Weyerhaeuser TJI 360. Have Taiga or Downtown Lumber re-run the layout on the 30 Sep set before the EWP order.
2. Stair header runs the full bay, double to double (engineer's sheet): the two full-length 3-ply beam lines are the trimmers and the 3-ply header spans between them about 1050 south of the north rim, over the stair's south wall below, with HGUS5.50/10 at each end (Taiga FB5-3, FB6-3, FB7-3). Every joist in the bay is a tail joist on the header (IUS2.56/9.5). The opening is 6'-5 1/8" from the grid-2 beam line east to the roof-stair winder square, per the engineer; the north strip east of that is framed with short infill joists on the header and the rim and carries the roof-stair winders (T 1.05).
3. Extra support under the stair doubles: 2x6 squash blocks two per bearing, and a P2 3-2x6 post in the ground floor wall under each trimmer end. The engineer shows P3 at the north wall by the stair; the south post is added here for him to confirm.
4. Balcony: 2x6 at 16" on the W200x36 outriggers with solid blocking per the engineer, 2x6 rim, LUS26 at the wall side if the joists do not land on the steel. Cedar decking and sleepers are not in this list.
5. Squash blocks under every post location (P1 to P3 and the enclosure corners), 10d into each flange per the Weyerhaeuser guide, so no post lands on subfloor alone.
6. Subfloor 3/4" T&G; glued and screwed (Taiga note 9). Gypcrete and radiant tubing go on top and are not framing.
7. TJI 360 at 9 1/2": the specifier's guide span table lists 9 1/2" for TJI 110, 210 and 230; confirm with Downtown Lumber that 9 1/2" TJI 360 is the Canadian stock item and that Hossein accepts it for the 15'-11 3/4" span at 40/20 psf.
8. Rim along the north and south walls cannot be nailed from outside once the ground floor walls are up (the neighbours' garages). The joists bear on the plate; web stiffeners at every joist end are toe-nailed into a 1 1/4" LSL rim and LSL blocking panels go in every other cavity, all nails from inside. No hangers at the rim. Detail on T 1.09B.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Second Floor Deck – T 1.03**

# BATCH 2B – BALCONY DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Balcony deck on the west, 5'-8 3/8" deep by the full width, on the W200x36 outriggers from the moment frame. Framing is 2x6 at 16" with solid blocking per the engineer, 1/2" plywood, then the roofer's 2-ply modified bitumen, 2x4 pressure-treated sleepers and 25 mm cedar decking (assembly F4). The guardrail is white oak on metal brackets fastened to the beam (A405 detail 1) and is not framing. Kept separate so it can be ordered with the steel or with the finish, whichever comes first.

### DECKS AND ROOFS IN THIS BATCH

*member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers*

| DECK | ZONE | MEMBERS | LENGTH | AREA | PRODUCT | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|
| **F2-BAL** | Balcony deck (west, on the W200x36 outriggers) | 12 @ 16" | 5'-8 3/8" | 8.6 m2 | 2x6 SPF #2 @ 16" | Gulf Eng. (2x6 @ 16"), A102, A405 det 1 | 2x6 joists east-west on the steel outriggers with solid blocking per the engineer; 2x6 rim; guardrail fastened to the beam (A405). |

### BALCONY DECK (WEST, ON THE W200X36 OUTRIGGERS)

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Rafters | 2x6 SPF #2 @ 16", 5'-8 3/8" | 5'-8 3/8" | 13 | pcs | 2x6 x 12' x 7 | 12 members plus 1 extra | Gulf Eng. (2x6 @ 16"), A102, A405 det 1 | 2x6 joists east-west on the steel outriggers with solid blocking per the engineer; 2x6 rim; guardrail fastened to the beam (A405). |
| Blocking | 2x6 solid blocking at the outriggers, 12 pcs at 14 1/2" | | 12 | pcs | 2x6 x 12' x 2 | engineer: W200x36 outrigger beam + solid blocking | Gulf Eng. | from drops |
| Joists | 2x6 SPF rim at the balcony edge and ledger side, 16' | | 2 | pcs | 2x6 x 16' x 2 | outer rim and wall-side rim | A102, A405 | |
| Sheathing | 1/2" plywood deck sheathing 4x8 (F4: 13 mm plywood under the 2-ply membrane) | | 4 | sheets | 4x8 x 4 | 8.6 m2 | A004 F4 | 2-ply modified bitumen membrane over it is by the roofer, not in this list |
| Decking | 2x4 pressure-treated sleepers @ 16" on the membrane, 5'-8 3/8" | | 14 | pcs | 2x4 PT x 12' x 7 | carry the cedar decking clear of the membrane (F4) | A004 F4 | cut from 2x4 PT x 12', two per piece |
| Decking | 5/4 x 6 cedar decking, 8' (A004 F4: 25 mm cedar decking) | | 29 | pcs | 8' x 29 | 8.6 m2 at 5 1/2" face with 1/4" gaps, 12% waste | A004 F4 | finish item; include only if North Arrow supplies the decking |
| Screws | Stainless deck screws #8 x 2 1/2", 350/box | | 2 | boxes | | cedar to sleepers, 2 per board per sleeper | | |
| Connectors | Metal railing brackets and the white oak guardrail (A405 detail 1) | | 0 | | | fastened to the beam, pre-drilled and countersunk | A405 | EXCLUDED: millwork and metal, not framing |

### BALCONY DECK

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL 1 3/4 x 9 1/2, 3-ply edge beam along the laneway side, between the outrigger ends | 16'-2" | 3 | pcs 18' | 18' x 3 | each ply cut 16'-2" | Gulf Eng. 2nd floor, A405 | Engineer's second floor sheet: 3-ply LVL at the balcony edge; the guardrail is fastened to it (A405 det 1). |
| Connectors | Simpson LUS26 (2x6 hanger) | | 26 | pcs | | balcony joists: 13 at the house-side rim, 13 at the LVL edge beam | Gulf Eng., A405 | joists hang between the house rim and the edge beam; the beam bears on the two outriggers |

**BATCH 2B BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded)** **$1,431 before HST**

### NOTES

1. F4 on A004: cedar decking on sleepers, 2-ply modified bitumen membrane, 1/2" plywood, 240 mm floor joists 'refer to structural'. The engineer's second floor sheet shows 2x6 at 16" on the outriggers, which is what is listed; if Hossein meant 2x10 to match the deck depth the count is the same and the stock changes to 2x10 x 8'.
2. Joist bearing: on the steel outriggers with solid blocking between. The LUS26 hangers at the wall side only apply if the joists do not land on the steel beam; confirm with the steel shop drawings.
3. The downspout runs below the wood decking (A102). Leave the sleeper layout open at the downspout.
4. Decking and stainless screws are finish items; delete them if the owner or the millwork side supplies the cedar.
5. The balcony membrane, drip edge and the guardrail brackets are by others.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Balcony Deck – T 1.03B**

# BATCH 3 – SECOND FLOOR WALLS

by William

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

Second floor walls on the subfloor. West zone (grid 1 to 2) walls are 10'-7" with 122 1/2" studs from 12' stock. East of grid 2 the walls stop under the lower framing level (north wall and W/C walls, 7'-7 7/8") or the flat east low roof (7'-9 1/2"), and the south wall under the sloped roof rakes between the two (architect's 16 Oct model, A302 sections 1 and 2). Headers on the east wall are 2-2x8 and 3-2x8 per the engineer. Posts P1 to P3 repeat above the ground floor posts. Interior partitions 2x4, plywood clad.

### WALLS IN THIS BATCH, ONE LINE PER WALL

*stock pieces to order per wall; every cut length is in the full-detail backup set*

| WALL | WHERE | LENGTH | HEIGHT | STUDS (PCS, STOCK) | HEADERS | PLATES | BLOCKING | SHEATHING | FURRING | OPENINGS | BUDGET |
|---|---|---|---|---|---|---|---|---|---|---|---|
| **2F-N-W** | North wall, west zone (grid 1 to grid 2) | 11'-6 3/4" | 10'-7" | 13: 2x6 x 12' | 0 | 3 | 1 | 5 sh | 13 | none | $458 |
| **2F-S-W** | South wall, west zone (grid 1 to grid 2) | 11'-6 3/4" | 10'-7" | 13: 2x6 x 12' | 0 | 3 | 1 | 5 sh | 13 | none | $458 |
| **2F-S-SL** | South wall under the sloped roof (grid 2 to the foot beam), raked top | 6'-2 5/8" | 9'-2 1/4" | 14: 2x6 x 12', 2x6 x 10', 2x6 x 104 5/8" precut, 2x6 x 92 5/8" precut | 0 | 2 | 1 | 3 sh | 6 | none | $319 |
| **2F-W-N** | West wall, north infill panel (balcony side) | 2'-4 7/8" | 10'-7" | 6: 2x6 x 12' | 0 | 1 | 1 | 1 sh | 3 | none | $147 |
| **2F-W-S** | West wall, south infill panel | 2'-4 7/8" | 10'-7" | 6: 2x6 x 12' | 0 | 1 | 1 | 1 sh | 3 | none | $147 |
| **2F-N-E** | North wall east of grid 2, under the lower level and the enclosure floor | 19'-5 5/8" | 7'-7 7/8" | 19: 2x6 x 92 5/8" precut | 0 | 5 | 2 | 6 sh | 16 | none | $525 |
| **2F-S-E** | South wall, east zone (foot beam to grid 6) | 13'-3" | 7'-9 1/2" | 14: 2x6 x 92 5/8" precut | 0 | 3 | 2 | 4 sh | 11 | none | $362 |
| **2F-E** | East wall (garden side) | 15'-3" | 7'-9 1/2" | 24: 2x6 x 92 5/8" precut, 2x6 x 14', 2x6 x 10', 2x6 x 8' | 7 | 4 | 2 | 5 sh | 13 | W08, W04, W03+W02 | $635 |
| **2F-P-WC-W** | W/C west wall beside the stair (P1b 2x4) | 3'-2 1/4" | 7'-7 7/8" | 7: 2x4 x 92 5/8" precut | 0 | 1 | 1 | 2 sh | 0 | none | $108 |
| **2F-P-WC-S** | W/C south wall with door D4 (P1a 2x4) | 9'-1" | 7'-7 7/8" | 16: 2x4 x 92 5/8" precut | 1 | 2 | 1 | 5 sh | 0 | D4 | $254 |
| **2F-P-WELL-W** | Wall at the top of the stair, west end of the well (P1a 2x4) | 3'-4" | 7'-7 7/8" | 7: 2x4 x 92 5/8" precut | 0 | 1 | 1 | 2 sh | 0 | none | $108 |
| **2F-P-COR** | Corridor wall, bedroom north with door D5 and the W/D closet (P1a 2x4) | 3'-6 1/4" | 7'-9 1/2" | 12: 2x4 x 92 5/8" precut | 1 | 1 | 1 | 2 sh | 0 | D5 | $134 |
| **2F-P-BED-W** | Kitchen / bedroom wall (P1a 2x4), stacked over the ground floor W/C east wall | 7'-2 1/8" | 7'-9 1/2" | 10: 2x4 x 92 5/8" precut | 0 | 2 | 1 | 4 sh | 0 | none | $193 |

### SECOND FLOOR

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Posts | P3 4-2x6 built-up post, 10'-2 1/2" plies | 10'-2 1/2" | 8 | pcs | 2x6 x 12' x 8 | Over the grid 2 line, carries roof beam B8-3. | Gulf Eng., Taiga | built-up posts nailed per OBC 9.23.10; glue optional |
| Posts | P2 3-2x6 built-up post, 10'-2 1/2" plies | 10'-2 1/2" | 12 | pcs | 2x6 x 12' x 12 | Grid 4 line and east wall. | Gulf Eng. | built-up posts nailed per OBC 9.23.10; glue optional |
| Posts | P1 2-2x6 built-up post, 7'-3 3/8" plies | 7'-3 3/8" | 6 | pcs | 2x6 x 92 5/8" precut x 6 | East wall jambs. | Gulf Eng. | built-up posts nailed per OBC 9.23.10; glue optional |

### STAIRS, MAIN FLIGHT (SLAB TO SECOND FLOOR)

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Stairs | LVL 1 3/4 x 11 1/4 notched stringers, 14' (A404 det 3) | 12'-10 3/8" | 3 | pcs 14' | 14' x 3 | 12 straight risers at 200 on 255 runs plus three winders at the top, 1000 wide: two outside stringers and one centre; winder carriages below | A404 det 3, A301 section A | Stringer line 12'-10" over 9'-2 1/2" of straight run; notch at the base per det 3, 6 7/8" min throat |
| Stairs | 5/8" plywood sub-treads and risers (A404 det 1: 5/8" plywood subfloor typical for all treads) | | 3 | sheets | 4x8 x 3 | 14 treads at 11" and 15 risers at 7 7/8", 1000 wide: 6.9 m2 | A404 det 1 | solid wood 1 1/2" treads and the white oak veneer risers are by the millwork side, not on this list |
| Stairs | 2x10 SPF winder carriages and riser boxes for the three top winders, 10' | | 4 | pcs | 2x10 x 10' x 4 | three carriages from the pivot post plus the riser boxes; 4x4 pivot post from a 2x6 pair | Engineer's 2F sheet, A102 | |
| Stairs | 2x4 pressure-treated kicker at the slab, 8' | | 1 | pc | 2x4 x 8' PT x 1 | stringer base notch bears on it, Tapcon to the slab (det 3: notch stringer at base) | A404 det 3 | |

### STAIRS

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Simpson LSC adjustable stringer connectors | | 6 | pcs | | top of each stringer to the header or landing rim, both flights | Simpson | or a 2x ledger with SDS screws if the LVL is notched over the rim |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Second Floor Walls – T 1.04**

# BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| BATCH 3 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded) | $4,739 before HST |
|---|---|

## NOTES

1. 2F-E: the east wall carries W08, W04, W03 and W02 at the second floor; header sizes from the engineer's sheet (2-2x8 and 3-2x8). Jack lengths follow the schedule heights plus 2"; the window shop drawings govern.
2. 2F-W-N and 2F-W-S: the infill panels beside the three DX02 curtain-wall doors at the balcony. The steel beam is the header.
3. From the architect's 16 Oct model: the high walls stop at grid 2. The old step at 19'-11 3/8" (A103 scaled) is gone; the south wall rakes from grid 2 to the foot of the slope at 18'-6 3/4".
4. 2F partitions (A102): the kitchen/bedroom wall is at 6050 stacked over the W/C east wall, not at grid 4; the corridor wall at 2600 with D5 and the W/D closet, and the wall at the top of the stair at the well end (section A) are added.
5. Mid-height blocking in the 10'-7" walls is also the fire stop; the 12' studs leave a 21 1/2" drop, one block each.
6. DensGlass on the second floor walls is sheathed with the walls lying down and the sheet run 10 1/2" past the bottom plate so it covers the rim when the wall is tilted up (T 1.09). Add that strip to the sheet count: it is inside the 12% waste.
7. LSL option for these studs is priced on T 1.07.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Second Floor Walls – T 1.04**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Roofs, parapets and the stair enclosure. ENGINEERING NOT COMPLETE: Gulf Engineering has issued no roof framing sheet (Marek, 21 Oct: 'no roof for some reason'). The west roof (grid 1 to 2) is framed per Taiga's layout; east of grid 2 is framed from the architect's 16 Oct model (DXF layer S-BEAM) and A302 sections 1 and 2: a lower framing level 2506 above the finished floor (drop beam on grid 2, beam on grid 3, headers, the enclosure floor) that the roof stair lands on and the enclosure stands on, a sloped roof at about 24 deg round skylight W12, and the flat east low roof 2548 to the top of the joists. The sizes are the architect's placeholders, carried so the yard can price them. The stair enclosure roof is R3 (2x8 rafters, 2x4 purlins, 5/8" board, standing seam). Parapets per detail 2-A400 with an LVL end joist below. Do not order this batch until the roof sheet exists.

## WALLS IN THIS BATCH, ONE LINE PER WALL

*stock pieces to order per wall; every cut length is in the full-detail backup set*

| WALL | WHERE | LENGTH | HEIGHT | STUDS (PCS, STOCK) | HEADERS | PLATES | BLOCKING | SHEATHING | FURRING | OPENINGS | BUDGET |
|---|---|---|---|---|---|---|---|---|---|---|---|
| **PAR-W** | Parapet, west edge over the balcony | 15'-3" | 1'-8 7/8" | 4: 2x6 x 8' | 0 | 3 | 2 | 2 sh | 0 | none | $204 |
| **PAR-N-W** | Parapet, north edge west zone (grid 1 to the enclosure) | 12'-0 5/8" | 1'-8 7/8" | 3: 2x6 x 8' | 0 | 2 | 2 | 2 sh | 0 | none | $181 |
| **PAR-S-W** | Parapet, south edge west zone (grid 1 to grid 2) | 12'-4 1/8" | 1'-8 7/8" | 3: 2x6 x 8' | 0 | 2 | 2 | 2 sh | 0 | none | $181 |
| **PAR-S-E** | Parapet, south edge east low roof (foot beam to grid 6) | 13'-3" | 1'-8 7/8" | 3: 2x6 x 8' | 0 | 2 | 2 | 2 sh | 0 | none | $181 |
| **PAR-E** | Parapet, east edge (low roof) | 8'-11 5/8" | 1'-8 7/8" | 3: 2x6 x 8' | 0 | 2 | 1 | 2 sh | 0 | none | $170 |
| **PAR-S-SL** | Parapet, south edge of the sloped roof (follows the slope) | 6'-2 5/8" | 1'-8 7/8" | 2: 2x6 x 8' | 0 | 1 | 1 | 1 sh | 0 | none | $94 |
| **ENC-N** | Stair enclosure, north wall (grid 2 to the east wall), on the enclosure floor | 19'-5 5/8" | 7'-9 3/8" | 19: 2x6 x 92 5/8" precut | 0 | 5 | 2 | 6 sh | 16 | none | $525 |
| **ENC-E** | Stair enclosure, east wall (W06 north, W05 south: east elevation) | 6'-3 3/8" | 7'-9 3/8" | 11: 2x6 x 92 5/8" precut, 2x6 x 10', 2x6 x 8' | 4 | 2 | 1 | 2 sh | 6 | W06+W05 | $298 |
| **ENC-S-W** | Stair enclosure, south wall over the sloped roof (grid 2 to the foot beam), raked bottom | 6'-0 5/8" | 6'-3" | 10: 2x6 x 92 5/8" precut, 2x6 x 8', 2x6 x 14', 2x6 x 12', 2x6 x 16' | 0 | 2 | 1 | 2 sh | 4 | none | $225 |
| **ENC-S-E** | Stair enclosure, south wall east of the slope (foot beam to the east wall, W11 and W10) | 13'-3" | 7'-8 1/2" | 11: 2x6 x 92 5/8" precut, 2x6 x 14', 2x6 x 8' | 5 | 3 | 2 | 4 sh | 11 | W11+W10 | $468 |
| **ENC-W** | Stair enclosure, west wall (grid 2): W05 north, W06 south (A103) | 7'-2 1/2" | 4'-10 1/4" | 6: 2x6 x 10', 2x6 x 8' | 4 | 2 | 1 | 2 sh | 4 | W05+W06 | $262 |

## DECKS AND ROOFS IN THIS BATCH

*member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers*

| DECK | ZONE | MEMBERS | LENGTH | AREA | PRODUCT | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|
| **R-W** | West roof (grid 1 to 2), R1 | 9 @ 16" | 15'-10 5/8" | 17.6 m2 | Weyerhaeuser TJI 360 9 1/2" x 16' (Taiga RJ1) | A103, A004 R1, Taiga lower roof | Taiga's engineered layout covers this roof (RJ1 x 9, B8/B9/B10 LVL). 2 degree slope by tapered insulation above. |
| **R-SLOPE** | Sloped roof south of the stair enclosure (grid 2 to the foot beam), around skylight W12, R1 | 7 @ 16" | 6'-6 1/8" | 5.9 m2 | sloped 2x10 members and short joists (listed under the sloped roof lines) | A103, A302 section 2, DXF 16 Oct | **NO ENGINEER'S ROOF SHEET. A103 draws this roof at 23.8 deg with W12 in it; the architect's 16 Oct model frames it with four sloped 2x10 lines (doubled at the skylight) and short 2x10 joists between.** |
| **L-ENC-W** | Enclosure floor, grid 2 to 3, between the roof-stair opening and the enclosure south wall | 7 @ 16" | 2'-9 1/4" | 2.3 m2 | 2x10 SPF #2 @ 16" | A302 section 2, A103 | NOT IN THE ARCHITECT'S MODEL: the DXF has the two headers but nothing between them. A302 section 2 draws the floor continuous, so 2x10 at 16" hung between H-A and H-B is added. Hossein to confirm. |
| **L-ENC-E** | Enclosure floor east of grid 3, over the W/C | 7 @ 16" | 6'-9 3/4" | 6.0 m2 | 2x6 SPF #2 @ 16" | DXF 16 Oct, A301 | 2x6 at 16" in the architect's model, north rim to header H-C, span 6'-9 3/4". Set flush with the floor west of grid 3 (the model has them 1 1/2" lower). Hossein to size. |
| **R-E** | East low roof south of the stair enclosure (foot beam to the east wall), R1, heat pump platform | 8 @ 16" | 8'-9 7/8" | 10.7 m2 | 2x10 SPF #2 @ 16" | A103, A302 section 1, DXF 16 Oct | **Framed flat at 2548 above the finished floor to the top of the joists (A302 section 1, the architect's model agrees exactly); the 1:29 falls to the drain are in the tapered insulation. Joists hang on H-B and H-C at the north end and bear on the south wall. NO ENGINEER'S ROOF SHEET.** |
| **R-ENC** | Stair enclosure roof, R3 standing seam | 15 @ 16" | 9'-2 1/8" | 16.8 m2 | 2x8 SPF #2 rafters @ 16" (R3: 183 mm members) | A004 R3, A302, A400 det 3 | Rafters north-south over the 2 m enclosure with the 600 mm overhang to the south. Two decks, as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier, 2x4 purlins on edge @ 24" across it making the vented cavity, 1/2" plywood on the purlins under the ice and water shield and standing seam. |

## WEST ROOF (GRID 1 TO 2), R1

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | TJI 360 9 1/2" x 16' | 15'-10 5/8" | 10 | pcs | 16' x 10 | 9 joists @ 16" plus 1 for blocking panels and squash | A103, A004 R1, Taiga lower roof | Taiga's engineered layout covers this roof (RJ1 x 9, B8/B9/B10 LVL). 2 degree slope by tapered insulation above. |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Roofs and Enclosure – T 1.05**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Sheathing | 7/8" roof sheathing board 4x8 (A004: 22 mm) | | 7 | sheets | 4x8 x 7 | 17.6 m2 | A004 R1 | 10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal |

**SLOPED ROOF SOUTH OF THE STAIR ENCLOSURE (GRID 2 TO THE FOOT BEAM), AROUND SKYLIGHT W12, R1**

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Sheathing | 7/8" roof sheathing board 4x8 (A004: 22 mm) | | 3 | sheets | 4x8 x 3 | 5.9 m2 | A004 R1 | 10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal |

**ENCLOSURE FLOOR, GRID 2 TO 3, BETWEEN THE ROOF-STAIR OPENING AND THE ENCLOSURE SOUTH WALL**

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | 2x10 SPF #2 @ 16", 2'-9 1/4" | 2'-9 1/4" | 8 | pcs | 2x10 x 12' x 2 | 7 members plus 1 extra | A302 section 2, A103 | NOT IN THE ARCHITECT'S MODEL: the DXF has the two headers but nothing between them. A302 section 2 draws the floor continuous, so 2x10 at 16" hung between H-A and H-B is added. Hossein to confirm. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering. |
| Connectors | Simpson LUS210 joist hangers | | 14 | pcs | | 7 joists, 2 hung ends each | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Sheathing | 3/4" T&G plywood subfloor 4x8 | | 1 | sheets | 4x8 x 1 | 2.3 m2, glued and screwed | A004 F2, Taiga note 9 | 8% waste |
| Adhesive | PL400 subfloor adhesive 828 mL | | 1 | tubes | | one tube per 1.5 sheets | Taiga note 9 | |

**ENCLOSURE FLOOR EAST OF GRID 3, OVER THE W/C**

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Joists | 2x6 SPF #2 @ 16", 6'-9 3/4" | 6'-9 3/4" | 8 | pcs | 2x6 x 14' x 4 | 7 members plus 1 extra | DXF 16 Oct, A301 | 2x6 at 16" in the architect's model, north rim to header H-C, span 6'-9 3/4". Set flush with the floor west of grid 3 (the model has them 1 1/2" lower). Hossein to size. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering. |
| Connectors | Simpson LUS26 joist hangers | | 14 | pcs | | 7 joists, 2 hung ends each | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Sheathing | 3/4" T&G plywood subfloor 4x8 | | 3 | sheets | 4x8 x 3 | 6.0 m2, glued and screwed | A004 F2, Taiga note 9 | 8% waste |
| Adhesive | PL400 subfloor adhesive 828 mL | | 2 | tubes | | one tube per 1.5 sheets | Taiga note 9 | |

**EAST LOW ROOF SOUTH OF THE STAIR ENCLOSURE (FOOT BEAM TO THE EAST WALL), R1, HEAT PUMP PLATFORM**

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Rafters | 2x10 SPF #2 @ 16", 8'-9 7/8" | 8'-9 7/8" | 9 | pcs | 2x10 x 10' x 9 | 8 members plus 1 extra | A103, A302 section 1, DXF 16 Oct | Framed flat at 2548 above the finished floor to the top of the joists (A302 section 1, the architect's model agrees exactly); the 1:29 falls to the drain are in the tapered insulation. Joists hang on H-B and H-C at the north end and bear on the south wall. NO ENGINEER'S ROOF SHEET. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering. |
| Connectors | Simpson LUS210 joist hangers | | 8 | pcs | | 8 joists, 1 hung end each | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Sheathing | 7/8" roof sheathing board 4x8 (A004: 22 mm) | | 4 | sheets | 4x8 x 4 | 10.7 m2 | A004 R1 | 10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal |

**STAIR ENCLOSURE ROOF, R3 STANDING SEAM**

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Roofs and Enclosure – T 1.05**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Rafters | 2x8 SPF #2 @ 16", 9'-2 1/8" | 9'-2 1/8" | 16 | pcs | 2x8 x 10' x 16 | 15 members plus 1 extra | A004 R3, A302, A400 det 3 | Rafters north-south over the 2 m enclosure with the 600 mm overhang to the south. Two decks, as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier, 2x4 purlins on edge @ 24" across it making the vented cavity, 1/2" plywood on the purlins under the ice and water shield and standing seam. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering. |
| Blocking | 2x8 solid blocking at bearing, 15 pcs at 14 1/2" | | 15 | pcs | 2x8 x 12' x 2 | between joists over the bearing walls (fire stop at the parapet) | OBC 9.23.9 | from joist drops or 2 pcs 12' |
| Beams | LVL 1 3/4 x 7 1/4 rim and sub-fascia around the enclosure roof: north wall line, overhang end, both ends | | 4 | pcs 20' | 20' x 4 | 58 LF; the overhang end carries the integrated gutter and fascia (3-A400) | A400 det 3, OBC 9.23.9 | **ENGINEERING NOT COMPLETE: no roof sheet; rim at the bearing wall doubles as the rafter blocking** |
| Purlins | 2x4 purlins on edge @ 24" across the rafters, 6 runs of 19'-9 1/8" | | 9 | pcs 16' | 2x4 x 16' x 9 | on the 5/8" board over the rafters; the 89 mm vented cavity under the standing seam (R3) | A004 R3, A400 det 3 | **ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.** |
| Sheathing | 1/2" plywood over the purlins, under the standing seam (R3 top layer) | | 7 | sheets | 4x8 x 7 | 16.8 m2 incl. the overhang | A004 R3 | top deck of two; the 5/8" board under the purlins is its own line (A004 R3) |
| Sheathing | 5/8" roof sheathing board 4x8 on the rafters, under the purlins (R3 lower deck, carries the air and vapour barrier) | | 7 | sheets | 4x8 x 7 | 16.8 m2 incl. the overhang | A004 R3 | 10% waste |

### STAIRS, ROOF FLIGHT (SECOND FLOOR TO ENCLOSURE)

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Stairs | LVL 1 3/4 x 11 1/4 notched stringers for the straight run between the two winder squares, 8' | 7'-2 5/8" | 2 | pcs 8' | 8' x 2 | 3 treads at 255 between the winders | A102, A103, A404 det 3 | LAYOUT NOT RESOLVED: as A102/A103 draw it (three winders at the W/C wall, straight, three winders at the well-end wall turning south) the enclosure floor is 2525 mm up in 10 risers of 252 mm; OBC 9.8.4.1 allows 200, so it needs 13 risers of 194 mm. Headroom under the grid-3 beam over the bottom winders is about 1766 mm against 1950. Kunaal to lay out the stair before anything is cut; the material here is a placeholder at that geometry |
| Stairs | 2x10 SPF winder carriages and riser boxes, two quarter-turns of three winders, 10' | | 8 | pcs | 2x10 x 10' x 8 | three carriages per fan from the pivot post plus the riser boxes; 4x4 pivot post from a 2x6 pair | A102, A103 | placeholder quantity, see the stringer line |
| Stairs | 5/8" plywood sub-treads and risers, both fans and the straight | | 2 | sheets | 4x8 x 2 | 6 winders, the straight treads and risers | A404 det 1 | |

### WEST ROOF

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL 1 3/4 x 9 1/2, 3-ply roof beam B8-3 at grid 2 (18') | 18'-0" | 3 | pcs 18' | 18' x 3 | each ply cut 18'-0" | Taiga lower roof, A403 | Taiga B8-3: the east edge of the high west roof at grid 2, north wall to south wall, on the P3 posts; the high ends of the sloped roof hang on it. A403 section 1 agrees (3-ply LVL). |

### LOWER LEVEL EAST OF GRID 2

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL 1 3/4 x 9 1/2, 4-ply beam B9-4 at grid 3 (18') | 18'-0" | 4 | pcs 18' | 18' x 4 | each ply cut 18'-0" | Taiga lower roof, DXF 16 Oct | Taiga B9-4 at the east end of the sloped section, grid 3, north wall to south wall; headers H-A and H-B hang on it. Replaces the architect's 3-ply 2x10 there. |
| Beams | LVL 1 3/4 x 9 1/2, 2-ply beam B10-2 under the enclosure south wall (12') | 12'-0" | 2 | pcs 12' | 12' x 2 | each ply cut 12'-0" | Taiga lower roof, DXF 16 Oct | Taiga B10-2 from B9-4 to the east wall along the enclosure south wall, HUS410 into B9-4; the east roof and enclosure floor joists hang on it. Replaces the architect's 2-ply 2x10 header H-C. |
| Beams | 2-ply 2x10 DROP-2, each ply 15'-3" | 15'-3" | 2 | pcs | 2x10 x 16' x 2 | Drop beam on grid 2, between the inside faces of the north and south walls (the high west walls run past it), bottom 7'-5 3/8" above the 2F finished floor. Carries the west ends of the lower level. Ends bear on the P3 posts in the north and south walls (hangers or a seat cut into the post: Hossein). | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Beams | 2-ply 2x10 H-A, each ply 9'-0" | 9'-0" | 2 | pcs | 2x10 x 10' x 2 | Header at the south edge of the roof-stair opening, drop beam to grid 3. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Roofs and Enclosure – T 1.05**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | 2-ply 2x10 H-B, each ply 9'-0" | 9'-0" | 2 | pcs | 2x10 x 10' x 2 | Header under the enclosure south wall, drop beam to grid 3; the enclosure floor joists, the sloped roof's north edge and the east roof joists west of grid 3 hang on it. Top set flush with the east roof joists and H-C so the enclosure south wall has one bearing line (the architect's model has it 1 5/8" lower). | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Connectors | Simpson HUS210-2 hangers | | 6 | pcs | | hung ends of the beams, headers and sloped members in this zone | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |

## ROOF PERIMETER

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | LVL end joist 1 3/4 x 9 1/2 (roof rim under the parapets), 16' lengths | | 7 | pcs 16' | 16' x 7 | 96 LF | A400 det 2 | Parapet detail 2-A400 calls for an LVL end joist at the roof perimeter. |

## STAIRS

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Simpson LUS210 hangers at the winder carriages | | 6 | pcs | | carriage ends to the well-end wall and the W/C wall framing | Simpson | placeholder with the stair layout |

## ROOFS

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Simpson H2.5A hurricane ties | | 70 | pcs | | every roof joist and rafter at bearing, both ends | recommended | **NOT ON DRAWINGS** |
| Connectors | Simpson HUS410 (B10-2 end) | | 2 | pcs | | Taiga B10-2 2-ply LVL into B9-4 | Taiga lower roof H1 | |

## PARAPETS

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Simpson A35 framing angles | | 48 | pcs | | parapet bottom plate to the roof joists and LVL end joist, every 24" | A400 det 2 (connection not specified) | **NOT ON DRAWINGS** |

## STAIR ENCLOSURE

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Connectors | Simpson LSTA24 straps | | 12 | pcs | | enclosure wall studs to the wall studs below at the corners and jambs | recommended | **NOT ON DRAWINGS** |

## SLOPED ROOF SOUTH OF THE ENCLOSURE

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Beams | 2-ply 2x10 FOOT, each ply 8'-9 7/8" | 8'-9 7/8" | 2 | pcs | 2x10 x 10' x 2 | Foot beam at the bottom of the slope, header H-B to the south wall; the sloped members hang on its west face. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Rafters | 2x10 SL-2158, each ply 6'-9 7/8", sloped | 6'-9 7/8" | 1 | pcs | 2x10 x 14' x 1 | Sloped 1-ply 2x10, north edge, under the enclosure south wall: from the grid-2 roof beam down to the foot beam, about 24 deg. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Rafters | 2-ply 2x10 SL-2560, each ply 6'-9 7/8", sloped | 6'-9 7/8" | 2 | pcs | 2x10 x 14' x 1 | Sloped 2-ply 2x10, north trimmer of the skylight opening: from the grid-2 roof beam down to the foot beam, about 24 deg. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Rafters | 2-ply 2x10 SL-3576, each ply 6'-9 7/8", sloped | 6'-9 7/8" | 2 | pcs | 2x10 x 14' x 1 | Sloped 2-ply 2x10, south trimmer of the skylight opening: from the grid-2 roof beam down to the foot beam, about 24 deg. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Roofs and Enclosure – T 1.05**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| CAT. | ITEM | CUT | QTY | UNIT | ORDER (STOCK x PCS) | WHERE IT GOES | SOURCE | NOTE |
|---|---|---|---|---|---|---|---|---|
| Rafters | 2x10 SL-4891, each ply 6'-9 7/8", sloped | 6'-9 7/8" | 1 | pcs | 2x10 x 14' x 1 | Sloped 1-ply 2x10, south edge, on the raked south wall: from the grid-2 roof beam down to the foot beam, about 24 deg. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Rafters | 2x10 SJ-N, 4 pcs at 16", each 1'-2 3/8" | 1'-2 3/8" | 4 | pcs | 2x10 x 8' x 1 | Short 2x10 joists north-south between the sloped members at 16", tops on the slope (the architect's model has four in each bay, north of the skylight). | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Rafters | 2x10 SJ-S, 4 pcs at 16", each 4'-0 3/4" | 4'-0 3/4" | 4 | pcs | 2x10 x 8' x 4 | Short 2x10 joists north-south between the sloped members at 16", tops on the slope (the architect's model has four in each bay, south of the skylight). | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Beams | 2-ply 2x10 SKY-H-3756, each ply 3'-1" | 3'-1" | 2 | pcs | 2x10 x 10' x 1 | Header across the top or bottom of the skylight opening between the trimmers. Not in the architect's model; added so the opening is framed. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Beams | 2-ply 2x10 SKY-H-5571, each ply 3'-1" | 3'-1" | 2 | pcs | 2x10 x 10' x 1 | Header across the top or bottom of the skylight opening between the trimmers. Not in the architect's model; added so the opening is framed. | DXF 16 Oct | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Blocking | 2x6 CURB-2636, each ply 6'-3", sloped | 6'-3" | 1 | pcs | 2x6 x 14' x 1 | 2x6 curb side round skylight W12, on the slope (A403 detail 1). A103 puts the glass at 14 deg on the 23.8 deg roof, so the curb is a wedge, ripped on site. Replaces the 2'-0 1/8" knee wall of the earlier draft, which assumed a flat roof. | A403, A103 | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Blocking | 2x6 CURB-3538, each ply 6'-3", sloped | 6'-3" | 1 | pcs | 2x6 x 14' x 1 | 2x6 curb side round skylight W12, on the slope (A403 detail 1). A103 puts the glass at 14 deg on the 23.8 deg roof, so the curb is a wedge, ripped on site. Replaces the 2'-0 1/8" knee wall of the earlier draft, which assumed a flat roof. | A403, A103 | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Blocking | 2x6 CURB-E-3832, each ply 2'-10" | 2'-10" | 1 | pcs | 2x6 x 10' x 1 | 2x6 curb end round skylight W12. | A403 | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Blocking | 2x6 CURB-E-5533, each ply 2'-10" | 2'-10" | 1 | pcs | 2x6 x 10' x 1 | 2x6 curb end round skylight W12. | A403 | **ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet** |
| Connectors | Simpson HUS210-2 hangers | | 5 | pcs | | hung ends of the beams, headers and sloped members in this zone | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Connectors | Simpson LSSU210 hangers | | 12 | pcs | | sloped 2x10 ends at the grid-2 roof beam and the foot beam (sloped / skewed seat) | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Connectors | Simpson LUS210 hangers | | 16 | pcs | | hung ends of the beams, headers and sloped members in this zone | DXF 16 Oct, Simpson | **ENGINEERING NOT COMPLETE** |
| Membranes | Blueskin SA 6" x 75' round the skylight W12 curb: up the curb faces and lapped 6" onto the roof board | | 1 | roll | | curb perimeter about 19 LF, two courses | A403, A103 | The metal step, head and counterflashings are the skylight supplier's curb kit and the roofer's: EXCLUDED, not framing |

**BATCH 4 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded)** **$9,462 before HST**

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Roofs and Enclosure – T 1.05**

# BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

**NOTES**

1. Lower level (architect's 16 Oct model): 2-ply 2x10 drop beam on grid 2, bottom 7'-5 3/8" above the second floor finished floor; 3-ply 2x10 on grid 3; 2-ply 2x10 header H-A at the south edge of the roof-stair opening and H-B / H-C under the enclosure south wall. The enclosure floor between H-A and H-B is not in that model and is added here (2x10 at 16"); east of grid 3 it is 2x6 at 16" as the model draws it. This replaces the flat high middle roof and its 3-ply LVL roof-stair header and trimmers.
2. R-SLOPE: south of the enclosure from grid 2 to the foot beam, about 24 deg (A103: 23.8). Four sloped 2x10 lines (single at the edges, doubled each side of W12), short 2x10 joists between at 16", 2-ply 2x10 headers across the skylight opening (added), the 2-ply foot beam. The south wall and its parapet follow the slope.
3. R-E: the east low roof south of the enclosure, framed flat 2548 above the finished floor to the top of the joists (A302 section 1); the 1:29 falls are in the tapered insulation. Joists hang on H-B and H-C. The heat pump sits on this roof; the outswing window W11 is the access.
4. Enclosure from A103 and the east elevation: 2500 deep to the cladding (962 + 900 + 638), W05 and W06 as a pair on the east wall (W06 north) and again on the west wall (W05 north), W11 in the south wall just east of the roof step, no windows on the north property-line wall. The roof-stair opening in the middle roof is on T 1.05.
5. R-ENC: rafters north-south over the 1903 mm enclosure with the 600 mm overhang to the south (3-A400), two decks as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier membrane, 2x4 purlins on edge at 24" over it for the vented standing-seam cavity, 1/2" plywood over the purlins.
6. Skylight W12: now in the sloped roof (A103, the architect's model), on a 2x6 wedge curb (glass at 14 deg on the 23.8 deg roof). The 2'-0 1/8" knee wall on a flat roof is gone. Read A403 again against the slope.
7. Parapets: 2x4 bottom plate on the joists, 2x6 studs at 16" beside the 150 mm insulation, 2x6 top plate, 3/4" exterior plywood both faces, cant strip and membrane by the roofer. Tie-down to the roof joists is not on the drawings; A35 angles are carried on T 1.06.
8. Roof-stair opening into the enclosure: in the lower level, from the grid-2 drop beam to the grid-3 beam, north wall to H-A. The drop beam and the grid-3 beam are the trimmers.
9. 7/8" roof sheathing board (A004) is unusual; 3/4" T&G; is the usual substitute. Kunaal to confirm before the order.
10. Hurricane ties at every joist and rafter bearing are my recommendation for the flat parapet roofs; see T 1.06.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

## Roofs and Enclosure – T 1.05

# CONNECTORS, FASTENERS, MEMBRANES, SITE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

## CONNECTORS, CONSOLIDATED BY SKU

*Simpson Strong-Tie numbers; MiTek equivalents are fine if that is what the yard stocks. Lines in bold are my recommendation, not on the drawings, for Hossein to confirm.*

| CONNECTOR | QTY | WHERE | NOTE | UNIT | EXT. |
|---|---|---|---|---|---|
| **Metal railing brackets and the white oak guardrail (A405 detail 1)** | 0 | Batch 5: fastened to the beam, pre-drilled and countersunk | EXCLUDED: millwork and metal, not framing | to quote | |
| **Simpson LUS210 joist hangers** | 22 | Batch 4: 7 joists, 2 hung ends each; Batch 4: 8 joists, 1 hung end each | ENGINEERING NOT COMPLETE | $2.10 est. | $46.20 |
| **Simpson LUS26 joist hangers** | 14 | Batch 4: 7 joists, 2 hung ends each | ENGINEERING NOT COMPLETE | $1.95 est. | $27.30 |
| **Plate washers 3" x 3" x 1/4"** | 26 | Batch 1: under every anchor nut | | $1.40 est. | $36.40 |
| **Simpson HGUS5.50/10 (3-ply LVL hanger)** | 2 | Batch 2: stair header ends into the beam lines | | $27.99 quote | $55.98 |
| **Simpson LSC adjustable stringer connectors** | 6 | Batch 3: top of each stringer to the header or landing rim, both flights | or a 2x ledger with SDS screws if the LVL is notched over the rim | $9.50 est. | $57.00 |
| **Simpson LUS210 hangers at the winder carriages** | 6 | Batch 4: carriage ends to the well-end wall and the W/C wall framing | placeholder with the stair layout | $2.10 est. | $12.60 |
| **Simpson IUS2.56/9.5 (TJI face-mount hanger)** | 14 | Batch 2: 8 tail joists south of the header and 3 infill joists north of it, east of the opening, 3 spare | Taiga carried 10 for the shorter opening | $6.25 est. | $87.50 |
| **Simpson H2.5A hurricane ties** | 78 | Batch 2: the east and west end joists only; the property-line walls get stiffeners and blocking instead; Batch 4: every roof joist and rafter at bearing, both ends | **NOT ON DRAWINGS: confirm with Hossein** | $1.25 est. | $97.50 |
| **Simpson LUS26 (2x6 hanger)** | 26 | Batch 5: balcony joists: 13 at the house-side rim, 13 at the LVL edge beam | joists hang between the house rim and the edge beam; the beam bears on the two outriggers | $1.95 est. | $50.70 |
| **Simpson A35 framing angles** | 48 | Batch 4: parapet bottom plate to the roof joists and LVL end joist, every 24" | **NOT ON DRAWINGS** | $1.35 est. | $64.80 |
| **Simpson LSTA24 straps** | 12 | Batch 4: enclosure wall studs to the wall studs below at the corners and jambs | **NOT ON DRAWINGS** | $4.50 est. | $54.00 |
| **Simpson HUS410 (B10-2 end)** | 2 | Batch 4: Taiga B10-2 2-ply LVL into B9-4 | | $24.99 est. | $49.98 |
| **Simpson HUS210-2 hangers** | 11 | Batch 4: hung ends of the beams, headers and sloped members in this zone; Batch 4: hung ends of the beams, headers and sloped members in this zone | ENGINEERING NOT COMPLETE | $14.50 est. | $159.50 |
| **Simpson LSSU210 hangers** | 12 | Batch 4: sloped 2x10 ends at the grid-2 roof beam and the foot beam (sloped / skewed seat) | ENGINEERING NOT COMPLETE | $9.95 est. | $119.40 |
| **Simpson LUS210 hangers** | 16 | Batch 4: hung ends of the beams, headers and sloped members in this zone | ENGINEERING NOT COMPLETE | $2.10 est. | $33.60 |

## FASTENERS

*20 framing nails per stud, 40 per plate piece, 16 per joist; 90 ring nails per plywood sheet; 60 screws per DensGlass sheet; 50 per subfloor sheet; 14 per hanger. Boxes rounded up with 10 to 20% over.*

| ITEM | QTY | UNIT | WHERE / BASIS | SOURCE | NOTE | UNIT PRICE | EXT. |
|---|---|---|---|---|---|---|---|
| Stainless deck screws #8 x 2 1/2", 350/box | 2 | boxes | cedar to sleepers, 2 per board per sleeper | | | $42.00 est. | $84.00 |
| 3 1/4" x 0.131 strip framing nails (30 deg paper tape), 4000/box | 5 | boxes | about 15,984 nails: 20 per stud, 40 per plate piece, 16 per joist | OBC 9.23.3 | 15% over | $72.00 est. | $360.00 |
| 2 3/8" x 0.113 ring-shank strip nails, 5000/box | 2 | boxes | plywood sheathing and roof board, about 90 per sheet, 88 sheets | OBC 9.23.3 | | $68.00 est. | $136.00 |
| 1 1/2" x 0.148 joist hanger nails (10d), 5 lb box | 7 | boxes | 269 hangers and ties, about 14 nails each, about 700 nails per 5 lb box, 20% over | Simpson | Box count to confirm with Downtown Lumber. HGUS hangers take SDS 1/4" x 3" screws: 50/box | $28.00 est. | $196.00 |
| Simpson SDS 1/4" x 3" structural screws, 50/box | 2 | boxes | HGUS5.50/10 hangers (8 per hanger) and the LVL ply nailing where screws are wanted | Simpson | | $45.00 est. | $90.00 |
| DensGlass screws #8 x 1 5/8" corrosion-resistant, 1000/box | 5 | boxes | 67 sheets at about 60 screws (8" edges, 8" field per GP) | Georgia-Pacific DensGlass install guide | DensGlass does not take ring nails well; screws only | $58.00 est. | $290.00 |
| Subfloor screws #8 x 2" (square drive), 2000/pail | 2 | pails | 43 subfloor sheets at 50 screws | Taiga note 9 | | $75.00 est. | $150.00 |
| Tapcon 1/4" x 3 1/4" concrete screws, 50/box | 2 | boxes | 2x12 PT sill at the slab per 2-A403, infill panel bottom plates to the slab | A403 | | $38.00 est. | $76.00 |

## SILL, WINDOW AND ENVELOPE MEMBRANES

*Blueskin SA on the curb with primer and the gasket on top (Marek). Windows get a sill pan and jamb tapes: Extoseal Encore and Huber tape are specified, Blueskin SA 6" is the builder's equivalent. The air barrier over the DensGlass is specified as self-adhered Adhero 3000; building paper, staples and Tuck Tape are the alternative only if Kunaal accepts it. DensGlass needs no paper under either.*

| ITEM | QTY | UNIT | WHERE / BASIS | SOURCE | NOTE | UNIT PRICE | EXT. |
|---|---|---|---|---|---|---|---|
| Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip) | 1 | roll | isolates the wood from the steel: no condensation or galvanic contact at the bolts | BWD | Provide unless Hossein or Kunaal says it is not required. About 46 LF needed; one roll. | $19.99 quote | $19.99 |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Hardware and Consumables – T 1.06**

# CONNECTORS, FASTENERS, MEMBRANES, SITE



by William

| ITEM | QTY | UNIT | WHERE / BASIS | SOURCE | NOTE | UNIT PRICE | EXT. |
|---|---|---|---|---|---|---|---|
| PL400 subfloor adhesive 828 mL | 5 | tubes | one tube per 1.5 sheets | Taiga note 9 | | $13.99 est. | $69.95 |
| PL400 subfloor adhesive 828 mL | 5 | tubes | one tube per 1.5 sheets | Taiga note 9 | | $13.99 est. | $69.95 |
| PL400 subfloor adhesive 828 mL | 4 | tubes | one tube per 1.5 sheets | Taiga note 9 | | $13.99 est. | $55.96 |
| PL400 subfloor adhesive 828 mL | 1 | tubes | one tube per 1.5 sheets | Taiga note 9 | | $13.99 est. | $13.99 |
| PL400 subfloor adhesive 828 mL | 2 | tubes | one tube per 1.5 sheets | Taiga note 9 | | $13.99 est. | $27.98 |
| Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside | 2 | rolls | 76 LF of curb | Marek, 21 Oct | over the masonry at the sill; 15% for laps | $135.00 est. | $270.00 |
| Blueskin primer (Blue Prep or Aquatac), 3.78 L | 2 | pails | primer under the Blueskin on concrete; about 20 m2 per pail | Henry/Bakor data sheet | | $78.00 est. | $156.00 |
| Sill gasket 5 1/2" x 82' foam | 2 | rolls | under every bottom plate on the curb (A406 'sill sealer, bond break') | A406 | | $19.99 quote | $39.98 |
| Blueskin SA 6" x 75' (window sills, jambs, head laps) | 1 | rolls | 9 exterior openings, about 4.5 m each | A401 det 1, A405 notes | the drawings call for Extoseal Encore at sills and Huber window tape; Blueskin SA is the builder's equivalent | $72.00 est. | $72.00 |
| Blueskin SA 6" x 75' round the skylight W12 curb: up the curb faces and lapped 6" onto the roof board | 1 | roll | curb perimeter about 19 LF, two courses | A403, A103 | The metal step, head and counterflashings are the skylight supplier's curb kit and the roofer's: EXCLUDED, not framing | $72.00 est. | $72.00 |
| Tuck Tape (red sheathing tape) 60 mm x 66 m | 8 | rolls | poly laps, membrane laps, DensGlass temporary weather protection | | | $17.99 est. | $143.92 |
| Weather-resistant air barrier: Adhero 3000 self-adhered 4' x 100' (as specified, A004 W1) | 5 | rolls | over the DensGlass, full coverage | A004 W1 | SPECIFIED; carried. No building paper under it. | $420.00 est. | $2,100.00 |
| 6 mil poly 12' x 300' (slab vapour barrier is Stego 15 mil, separate) | 1 | roll | temporary protection and interior laps | | | $34.99 quote | $34.99 |

## TEMPORARY BRACING, SITE LUMBER, BLADES

*Enough to brace every tilt-up wall both ways until sheathed, guard the stair opening, build the ramps. Re-used as blocking and furring. DensGlass is scored and snapped; the PCD blade is for the long rips.*

| ITEM | QTY | UNIT | WHERE / BASIS | SOURCE | NOTE | UNIT PRICE | EXT. |
|---|---|---|---|---|---|---|---|
| 2x4 x 16' SPF for wall bracing, kickers and the stair-opening guard | 24 | pcs | temporary diagonal bracing of every tilt-up wall and the parapets until sheathed | OBC 9.23.3 / good practice | re-used as blocking and furring later | $8.99 quote | $215.76 |
| 1x4 x 12' let-in style diagonal braces and string-line stakes | 30 | pcs | temporary | | | $4.99 est. | $149.70 |
| 1/2" plywood 4x8 for guards, ramps and the stair opening cover | 4 | sheets | temporary | | | $31.99 quote | $127.96 |
| 7 1/4" 24T framing blades | 6 | pcs | | | | $18.00 est. | $108.00 |
| 7 1/4" PCD fibre-cement/gypsum blade (DensGlass cutting) and utility knife blades 100-pack (score and snap) | 1 | each | DensGlass is scored and snapped; a PCD blade for the long rips | GP install guide | | $65.00 est. | $65.00 |
| Utility knife blades, 100-pack | 2 | packs | DensGlass, membranes | | | $24.00 est. | $48.00 |
| Reciprocating saw blades, wood with nails, 10-pack | 2 | packs | | | | $29.00 est. | $58.00 |

## STEEL CONNECTION ALLOWANCES

*The engineer has not detailed wood to steel. These are allowances so the order is not short on the day.*

| ITEM | QTY | UNIT | WHERE / BASIS | SOURCE | NOTE | UNIT PRICE | EXT. |
|---|---|---|---|---|---|---|---|
| 1/2" through-bolts with nut and washer, LSL nailer to the column flange | 34 | bolts | 16 per column at 16" o.c., two columns, 2 spare | Gulf Eng. MF-1 | Hossein to give the bolt size and spacing. | $2.75 est. | $93.50 |
| TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers | 2 | boxes | deck rim and balcony blocking to the steel beams and outriggers | Gulf Eng. 2nd floor | CONNECTION REQUIRES FURTHER DETAILING. Connectors and fasteners for the deck rim, roof end joist and parapet to the steel are not specified on the plans (no MF-1 issued). | $34.00 est. | $68.00 |
| 1/2" through-bolts with nut and washer, 2x10 nailer to the W200x36 beam and outrigger flanges | 50 | bolts | 4 nailers x 16' at 16" o.c., 12 each, 2 spare | Gulf Eng. 2nd floor | Hossein to give the bolt size and spacing. | $2.75 est. | $137.50 |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Hardware and Consumables – T 1.06**

# ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

One line per product the yard stocks, with the batch split so Marek can call off the delivery per floor. Prices: quote = Downtown Lumber 1 May 2026; est. = estimated price pending re-quote. Five months old and lumber has moved: treat the budget as an order of magnitude until Downtown Lumber re-prices this list.

**ORDER SUMMARY BY PRODUCT**

| PRODUCT | B1 GF WALLS | B2 DECK | B2B BALCONY | B3 2F WALLS | B4 ROOFS | SITE, FAST. | TOTAL | UNIT | UNIT PRICE | SRC | EXT. BEFORE HST |
|---|---|---|---|---|---|---|---|---|---|---|---|
| 2x6 x 12' | 59 | 3 | 9 | 74 | 18 | | **163** | pcs | $11.49 | est. | $1,872.87 |
| 2x6 x 16' | 24 | | 2 | 24 | 31 | | **81** | pcs | $14.99 | est. | $1,214.19 |
| DensGlass 5/8" gypsum sheathing 4x8 x 4x8 | 21 | | | 30 | 16 | | **67** | pcs | $44.00 | est. | $2,948.00 |
| 1x3 SPF horizontal furring @ 16" (drainage holes drilled) x 1x3 x 8' | 58 | | | 78 | 41 | | **177** | pcs | $2.49 | est. | $440.73 |
| 2x6 x 10' | 5 | | | 7 | 7 | | **19** | pcs | $9.49 | est. | $180.31 |
| 2x6 x 8' | 9 | 4 | | 3 | 30 | | **46** | pcs | $7.49 | est. | $344.54 |
| 2x8 x 10' | 2 | | | 1 | 16 | | **19** | pcs | $18.98 | quote | $360.62 |
| 2x8 x 8' | 3 | | | 4 | | | **7** | pcs | $15.49 | est. | $108.43 |
| 2x6 x 104 5/8" precut | 29 | | | 2 | | | **31** | pcs | $6.25 | quote | $193.75 |
| 2x4 x 104 5/8" precut | 45 | | | | | | **45** | pcs | $4.49 | quote | $202.05 |
| 2x4 x 16' | 11 | | | 7 | 9 | 24 | **51** | pcs | $8.99 | quote | $458.49 |
| 2x4 x 12' | 6 | | | 5 | | | **11** | pcs | $7.49 | est. | $82.39 |
| 1/2" plywood x 4x8 | 30 | | | 15 | | | **45** | pcs | $31.99 | quote | $1,439.55 |
| 2x4 x 92 5/8" precut | 14 | | | 52 | | | **66** | pcs | $3.99 | est. | $263.34 |
| 2x4 x 8' | 3 | | | 1 | | | **4** | pcs | $4.49 | est. | $17.96 |
| 2x4 x 10' | 5 | | | 1 | | | **6** | pcs | $5.99 | est. | $35.94 |
| 2x6 x 92 5/8" precut | | | | 53 | 34 | | **87** | pcs | $6.49 | quote | $564.63 |
| 2x6 x 14' | | | | 7 | 10 | | **17** | pcs | $9.89 | quote | $168.13 |
| 3/4" exterior-grade plywood x 4x8 | | | | | 11 | | **11** | pcs | $52.99 | est. | $582.89 |
| 2x10 x 8' | | | | | 11 | | **11** | pcs | $18.99 | est. | $208.89 |
| 2x10 x 12' | | | | | 5 | | **5** | pcs | $27.98 | quote | $139.90 |
| 1 1/2 x 5 1/2 LSL x 12' | 2 | | | | | | **2** | pcs | $59.40 | est. | $118.80 |
| 1 1/2 x 5 1/2 LSL x 10' | 2 | | | | | | **2** | pcs | $49.50 | est. | $99.00 |
| 1/2" through-bolts with nut and washer, LSL nailer to the column flange | 34 | | | | | | **34** | bolts | $2.75 | est. | $93.50 |
| Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip) | 1 | | | | | | **1** | roll | $19.99 | quote | $19.99 |
| TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers | | 2 | | | | | **2** | boxes | $34.00 | est. | $68.00 |
| 1/2" through-bolts with nut and washer, 2x10 nailer to the W200x36 beam and outrigger flanges | | 50 | | | | | **50** | bolts | $2.75 | est. | $137.50 |
| 2x10 x 16' | | 4 | | | 2 | | **6** | pcs | $37.99 | est. | $227.94 |
| TJI 360 9 1/2" x 16' | | 29 | | | 10 | | **39** | pcs | $55.20 | est. | $2,152.80 |
| 3/4" T&G plywood subfloor 4x8 x 4x8 | | 19 | | | 4 | | **23** | pcs | $49.99 | quote | $1,149.77 |
| PL400 subfloor adhesive 828 mL | | 14 | | | 3 | | **17** | tubes | $13.99 | est. | $237.83 |
| 1/2" plywood deck sheathing 4x8 (F4: 13 mm plywood under the 2-ply membrane) x 4x8 | | | 4 | | | | **4** | pcs | $31.99 | quote | $127.96 |
| 2x4 PT x 12' | | | 7 | | | | **7** | pcs | $9.99 | est. | $69.93 |
| 5/4 x 6 cedar decking x 8' | | | 29 | | | | **29** | pcs | $21.00 | est. | $609.00 |
| Stainless deck screws #8 x 2 1/2", 350/box | | | 2 | | | | **2** | boxes | $42.00 | est. | $84.00 |
| Metal railing brackets and the white oak guardrail (A405 detail 1) | | | 0 | | | | **0** | | to quote | to quote | |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Order Summary – T 1.07**

# ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| PRODUCT | B1 GF WALLS | B2 DECK | B2B BALCONY | B3 2F WALLS | B4 ROOFS | SITE, FAST. | TOTAL | UNIT | UNIT PRICE | SRC | EXT. BEFORE HST |
|---|---|---|---|---|---|---|---|---|---|---|---|
| 7/8" roof sheathing board 4x8 (A004: 22 mm) x 4x8 | | | | | 14 | | **14** | pcs | $58.00 | est. | $812.00 |
| Simpson LUS210 joist hangers | | | | | 22 | | **22** | pcs | $2.10 | est. | $46.20 |
| Simpson LUS26 joist hangers | | | | | 14 | | **14** | pcs | $1.95 | est. | $27.30 |
| 2x10 x 10' | | | | 4 | 25 | | **29** | pcs | $24.49 | quote | $710.21 |
| 2x8 x 12' | | | | | 2 | | **2** | pcs | $22.99 | quote | $45.98 |
| 1 3/4 x 7 1/4 LVL x 20' | | | | | 4 | | **4** | pcs | $100.60 | est. | $402.40 |
| 1/2" plywood over the purlins x 4x8 | | | | | 7 | | **7** | pcs | $31.99 | quote | $223.93 |
| 5/8" roof sheathing board 4x8 on the rafters x 4x8 | | | | | 7 | | **7** | pcs | $42.00 | est. | $294.00 |
| LVL 1 3/4 x 11 1/4 x 14' | | | | 3 | | | **3** | pcs | $111.30 | est. | $333.90 |
| 5/8" plywood sub-treads and risers (A404 det 1: 5/8" plywood subfloor typical for all treads) x 4x8 | | | | 3 | | | **3** | pcs | $42.00 | est. | $126.00 |
| 2x4 PT x 2x4 x 8' PT | | | | 1 | | | **1** | pcs | $6.49 | est. | $6.49 |
| LVL 1 3/4 x 11 1/4 x 8' | | | | | 2 | | **2** | pcs | $63.60 | est. | $127.20 |
| 5/8" plywood sub-treads and risers x 4x8 | | | | | 2 | | **2** | pcs | $42.00 | est. | $84.00 |
| 7/8 ply x 7/8 4x8 | | 1 | | | | | **1** | pcs | $58.00 | est. | $58.00 |
| 1 1/4 x 9 1/2 LSL x 12' | | 9 | | | | | **9** | pcs | $79.08 | est. | $711.72 |
| 1 3/4 x 9 1/2 Microllam x 16' | | 6 | | | 7 | | **13** | pcs | $105.44 | quote | $1,370.72 |
| 1 3/4 x 9 1/2 Microllam x 12' | | 3 | | | 2 | | **5** | pcs | $79.08 | quote | $395.40 |
| 1 3/4 x 9 1/2 Microllam x 18' | | | 3 | | 7 | | **10** | pcs | $118.62 | quote | $1,186.20 |
| 1 1/4 x 9 1/2 x 12' x 12' | | 3 | | | | | **3** | pcs | $79.08 | est. | $237.24 |
| Plate washers 3" x 3" x 1/4" | 26 | | | | | | **26** | pcs | $1.40 | est. | $36.40 |
| Simpson HGUS5.50/10 (3-ply LVL hanger) | | 2 | | | | | **2** | pcs | $27.99 | quote | $55.98 |
| Simpson LSC adjustable stringer connectors | | | | 6 | | | **6** | pcs | $9.50 | est. | $57.00 |
| Simpson LUS210 hangers at the winder carriages | | | | | 6 | | **6** | pcs | $2.10 | est. | $12.60 |
| Simpson IUS2.56/9.5 (TJI face-mount hanger) | | 14 | | | | | **14** | pcs | $6.25 | est. | $87.50 |
| Simpson H2.5A hurricane ties | | 8 | | | 70 | | **78** | pcs | $1.25 | est. | $97.50 |
| Simpson LUS26 (2x6 hanger) | | | 26 | | | | **26** | pcs | $1.95 | est. | $50.70 |
| Simpson A35 framing angles | | | | | 48 | | **48** | pcs | $1.35 | est. | $64.80 |
| Simpson LSTA24 straps | | | | | 12 | | **12** | pcs | $4.50 | est. | $54.00 |
| Simpson HUS410 (B10-2 end) | | | | | 2 | | **2** | pcs | $24.99 | est. | $49.98 |
| 2x10 x 14' | | | | | 4 | | **4** | pcs | $32.99 | est. | $131.96 |
| Simpson HUS210-2 hangers | | | | | 11 | | **11** | pcs | $14.50 | est. | $159.50 |
| Simpson LSSU210 hangers | | | | | 12 | | **12** | pcs | $9.95 | est. | $119.40 |
| Simpson LUS210 hangers | | | | | 16 | | **16** | pcs | $2.10 | est. | $33.60 |
| 3 1/4" x 0.131 strip framing nails (30 deg paper tape), 4000/box | | | | | | 5 | **5** | boxes | $72.00 | est. | $360.00 |
| 2 3/8" x 0.113 ring-shank strip nails, 5000/box | | | | | | 2 | **2** | boxes | $68.00 | est. | $136.00 |
| 1 1/2" x 0.148 joist hanger nails (10d), 5 lb box | | | | | | 7 | **7** | boxes | $28.00 | est. | $196.00 |
| Simpson SDS 1/4" x 3" structural screws, 50/box | | | | | | 2 | **2** | boxes | $45.00 | est. | $90.00 |
| DensGlass screws #8 x 1 5/8" corrosion-resistant, 1000/box | | | | | | 5 | **5** | boxes | $58.00 | est. | $290.00 |
| Subfloor screws #8 x 2" (square drive), 2000/pail | | | | | | 2 | **2** | pails | $75.00 | est. | $150.00 |
| Tapcon 1/4" x 3 1/4" concrete screws, 50/box | | | | | | 2 | **2** | boxes | $38.00 | est. | $76.00 |
| Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside | 2 | | | | | | **2** | rolls | $135.00 | est. | $270.00 |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Order Summary – T 1.07**

# ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

| PRODUCT | B1 GF WALLS | B2 DECK | B2B BALCONY | B3 2F WALLS | B4 ROOFS | SITE, FAST. | TOTAL | UNIT | UNIT PRICE | SRC | EXT. BEFORE HST |
|---|---|---|---|---|---|---|---|---|---|---|---|
| Blueskin primer (Blue Prep or Aquatac), 3.78 L | 2 | | | | | | **2** | pails | $78.00 | est. | $156.00 |
| Sill gasket 5 1/2" x 82' foam | 2 | | | | | | **2** | rolls | $19.99 | quote | $39.98 |
| 2x12 PT x 16' | 2 | | | | | | **2** | pcs | $54.99 | est. | $109.98 |
| Blueskin SA 6" x 75' (window sills, jambs, head laps) | | | | | | 1 | **1** | rolls | $72.00 | est. | $72.00 |
| Blueskin SA 6" x 75' round the skylight W12 curb: up the curb faces and lapped 6" onto the roof board | | | | | 1 | | **1** | roll | $72.00 | est. | $72.00 |
| Tuck Tape (red sheathing tape) 60 mm x 66 m | | | | | | 8 | **8** | rolls | $17.99 | est. | $143.92 |
| Weather-resistant air barrier: Adhero 3000 self-adhered 4' x 100' (as specified, A004 W1) | | | | | | 5 | **5** | rolls | $420.00 | est. | $2,100.00 |
| 6 mil poly 12' x 300' (slab vapour barrier is Stego 15 mil, separate) | | | | | | 1 | **1** | roll | $34.99 | quote | $34.99 |
| 1x4 x 12' let-in style diagonal braces and string-line stakes | | | | | | 30 | **30** | pcs | $4.99 | est. | $149.70 |
| 1/2" plywood 4x8 for guards, ramps and the stair opening cover | | | | | | 4 | **4** | sheets | $31.99 | quote | $127.96 |
| 7 1/4" 24T framing blades | | | | | | 6 | **6** | pcs | $18.00 | est. | $108.00 |
| 7 1/4" PCD fibre-cement/gypsum blade (DensGlass cutting) and utility knife blades 100-pack (score and snap) | | | | | | 1 | **1** | each | $65.00 | est. | $65.00 |
| Utility knife blades, 100-pack | | | | | | 2 | **2** | packs | $24.00 | est. | $48.00 |
| Reciprocating saw blades, wood with nails, 10-pack | | | | | | 2 | **2** | packs | $29.00 | est. | $58.00 |
| **FRAMING PACKAGE BEFORE HST** | | | | | | | | | | | **$30,087** |

## ESTIMATED BUDGET

*order of magnitude at five-month-old pricing; the yard re-prices the order summary above*

| | AMOUNT |
|---|---|
| Lines priced from the 1 May quote | $9,016 |
| Lines priced at estimated prices (re-quote) | $21,071 |
| Lines with no price (to quote) | 1 lines, not in the total |
| **Framing package before HST** | $30,087 |
| HST 13% | $3,911 |
| **Framing package including HST** | $33,998 |
| By batch, before HST | B1 $4,835 \| B2 $5,199 \| B2B $1,431 \| B3 $4,739 \| B4 $9,462 \| site and fasteners $4,421 |
| For comparison: Downtown Lumber quote 3027967, 1 May 2026, earlier design, scan cut off at the lower roof | $19,136.71 + HST = $21,624.48 |

## OPTION: TIMBERSTRAND LSL 1 1/2" X 5 1/2" FOR EVERY 2X6 STUD

*Straight, no crown, no twist; what the builder asked about for warp restraint on the 10'-7" walls. Same cut lengths as the SPF list. LSL comes 8', 9', 10', 12', 14', 16' and 20'; order the same stock mix as the SPF studs. Plates stay SPF (or LSL for the 16' top plates on the long walls). Price to quote; budget at about $4.95/LF est.*

| | |
|---|---|
| Total LSL stud length if every 2x6 stud is swapped | 1,935 LF |
| Budget for the LSL at the estimate rate, against the SPF stud lines it replaces | $9,579 before HST, to quote |
| Where it matters most | The 10'-7" west-zone walls and the parapets, where a twisted stud shows through the corrugated metal. A middle path is LSL on those two groups only. |
| What stays SPF | Plates, blocking, cripples, headers, interior partitions. |

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Order Summary – T 1.07**

# GUARDS AND RAILINGS – SEPARATE ESTIMATE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Guards and railings are finish items by the millwork and metal side, so they are outside the framing list and the framing budget. Kept as a separate estimate so they are not forgotten: quantities from the model, allowances from current Toronto millwork rates (est.), the parapet guard as an option because the drawings do not have one.

### GUARDS AND RAILINGS, SEPARATE ESTIMATE

*allowances only; not in the framing budget on T 1.07*

| ITEM | DETAIL | WHAT IT IS | QUANTITY | RATE | ALLOWANCE | NOTE |
|---|---|---|---|---|---|---|
| **Balcony guardrail** | 1-A405 | 2" white oak cap rail, 1" white oak railing members, metal railing brackets fastened to the LVL edge beam, stainless screws, white oak caps | 28 LF | $95 / LF est. | $2,618 | Full balcony edge plus the two returns. Millwork and metal; the brackets and their fastening to the beam need the engineer's nod. |
| **Main stair guard and handrail** | 5-A404 | 3" white oak cap rail, ends fastened to the stringer and the wall; 3/4" white oak balusters at 4" o.c. mechanically fastened to the joist; 2" cap rail at the well | 23 LF, about 70 balusters | $85 / LF est. | $1,971 | Rake of the run plus the second-floor well edge. One wall-mounted handrail on the closed side of the run is an OBC requirement and is in this line. |
| **Roof stair guard and handrail** | 5-A404, A103 | Same detail along the roof stair and the roof-level well edge | 26 LF, about 79 balusters | $85 / LF est. | $2,208 | Placeholder length until the roof stair is laid out (T 1.05). |
| **Parapet guard (OPTION, not on the drawings)** | none | 42" aluminum picket guard on the parapet cap, posts through the cap into the parapet studs with flashed saddles | 79 LF | $140 / LF to quote | to quote | The roof is equipment access through W11, not an amenity space, so the set shows no guard. If the roof is to be used, this is the line; it also means every post is a membrane penetration. |

### NOTES

1. Rates are allowances for the material and shop work of a white oak guard of this detail; site installation and finishing are extra. Re-quote with the millwork shop once the stair layout is settled.
2. The balcony guard height and baluster spacing are to OBC 9.8.8 (1070 mm above the deck, 100 mm sphere); A405 det 1 is drawn at that height.
3. Nothing on this sheet is ordered from Downtown Lumber.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Guards and Railings – T 1.07A**


# DETAILS: OPENINGS AND FLASHING

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package


by William

Typical framing at openings, drawn for this takeoff, and the architect's own window and balcony-door details reproduced from A401 at readable size. King, jack, jack on each side of every exterior opening; headers per the engineer's east wall sizes where given. Flashing and tapes exactly as Kunaal drew them; Blueskin SA is the builder's equivalent where Extoseal Encore and Huber tape are named.

## Typical window opening, 2×6 exterior wall (W1)

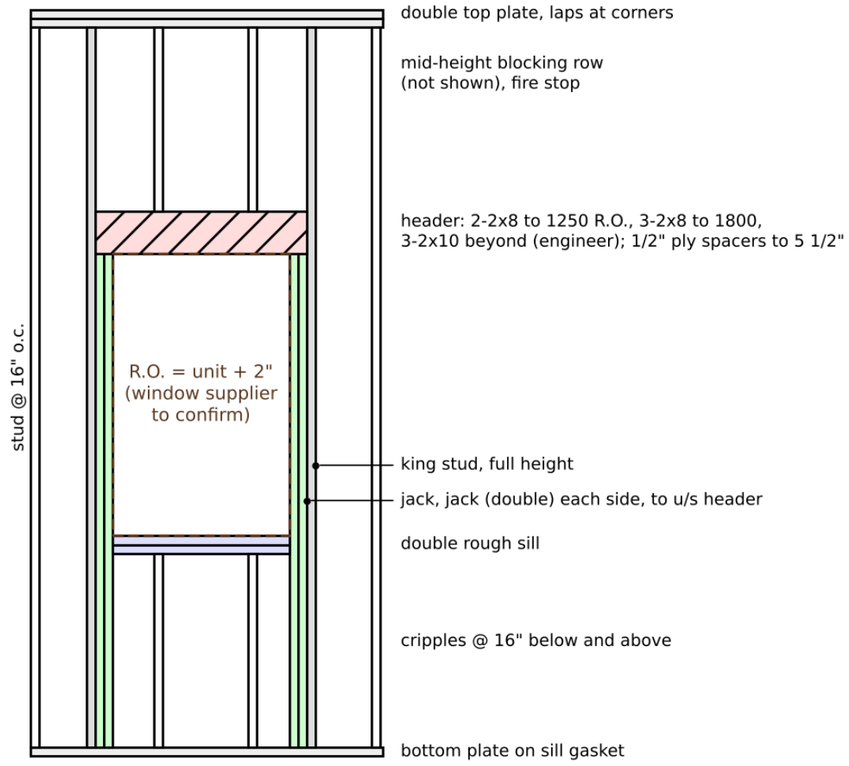


## Typical door opening (exterior 2×6 shown)

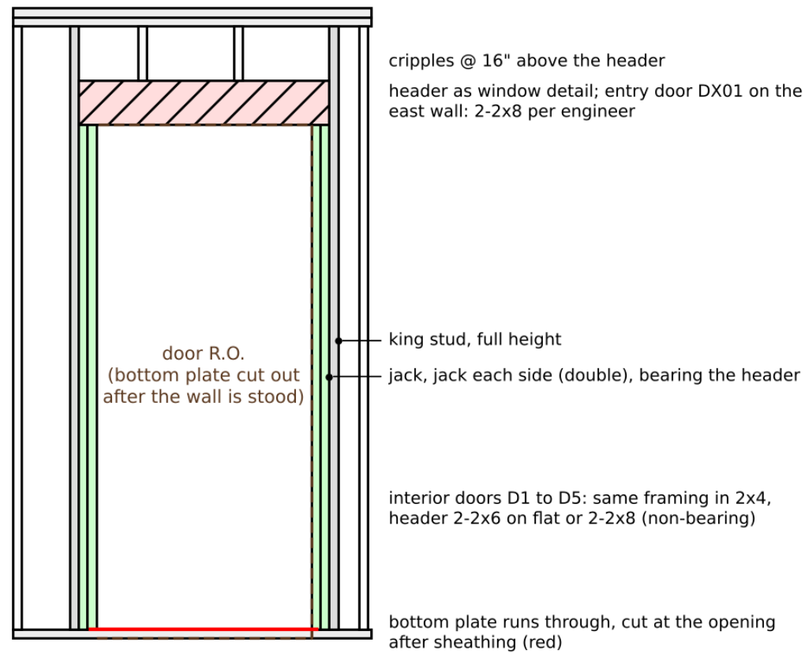


Framing per OBC 9.23. Header sizes from the engineer's 2nd floor framing sheet where shown; others to be confirmed by Gulf Engineering. Not to scale.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**


80 Lamb Ave – Laneway House
Oct 23, 2026

**Details, Openings – T 1.09**

# DETAILS: OPENINGS AND FLASHING


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

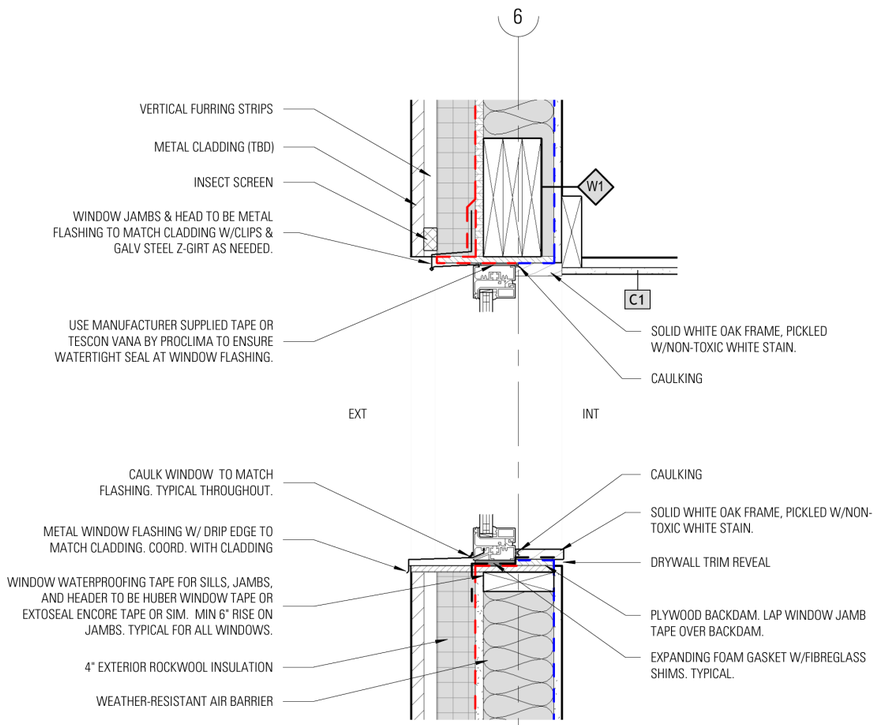


1 **TYP WINDOW**

1 : 10 REF: A301

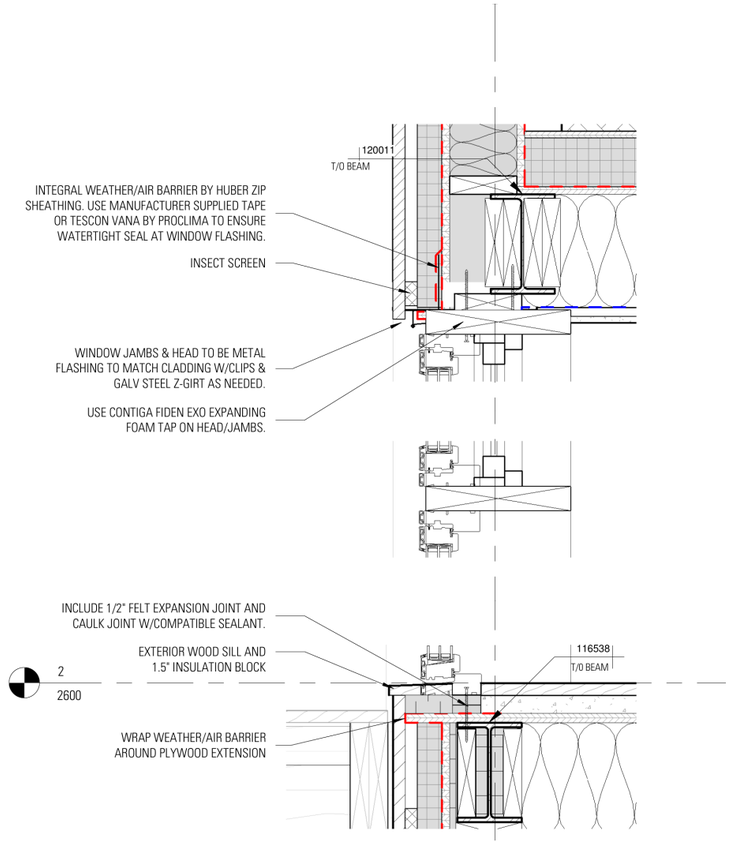


2 **DOUBLE DOOR @ BALCONY**

1 : 10 REF: A300

*1-A401 TYP WINDOW, 1:10 (Kunaal Mohan, 100% CD 30 Sep 2026). Plywood back dam, Huber or Tescon Vana tape, Extoseal Encore sill tape with 6" rise, metal head and jamb flashing to match the cladding, Contega Fiden EXO foam tape, 1 1/2" insulation block over the head.*

*2-A401 DOUBLE DOOR AT BALCONY, 1:10. The DX02 curtain-wall doors at the balcony: exterior wood sill with 1 1/2" insulation block, 1/2" felt expansion joint, weather barrier wrapped around the plywood extension, T/O beam at 12001 and 116538 marked.*

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026


**Details, Openings – T 1.09**


# DETAILS: RIM CONNECTION FROM INSIDE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Rim connection at the two property-line walls, where the neighbours' garages leave no access to the outside face of the rim once the walls are up. The joists sit on the plate as usual. Since the rim cannot be nailed into the joists from outside, a web stiffener each side of every joist end is toe-nailed into a TimberStrand LSL rim from inside, and LSL blocking panels in every other cavity are back-nailed into the rim, toe-nailed to the plate and nailed through the stiffener from the open cavity beside them. No hangers. Bearing, stiffener and blocking rules are Weyerhaeuser's; the manufacturer's figures are on T 1.09C.

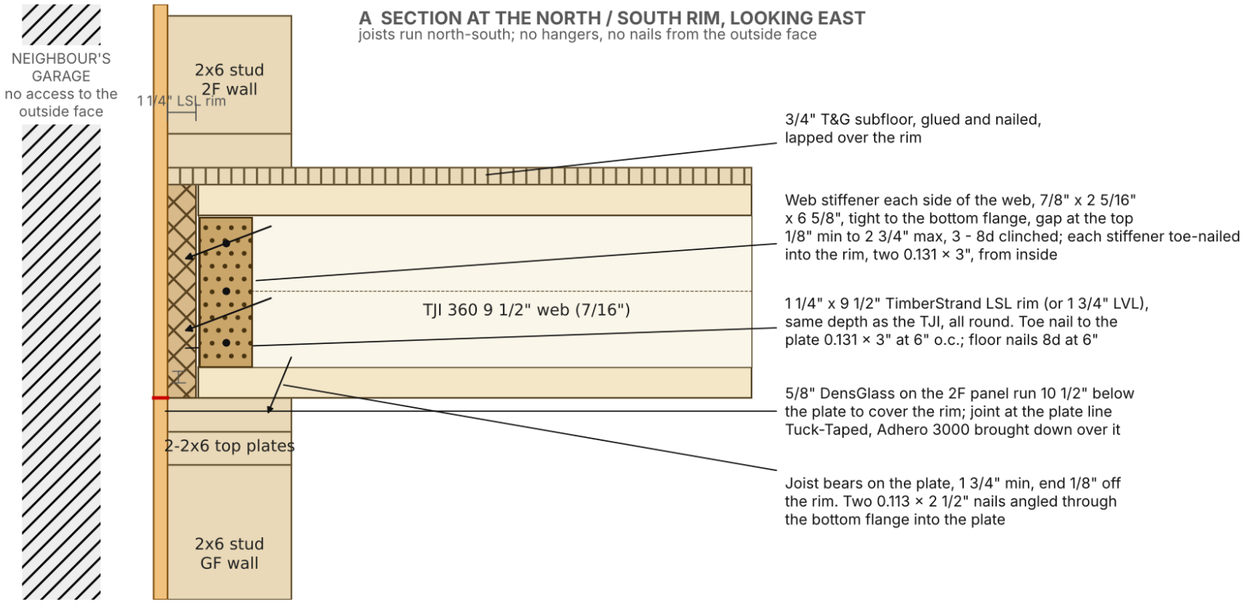

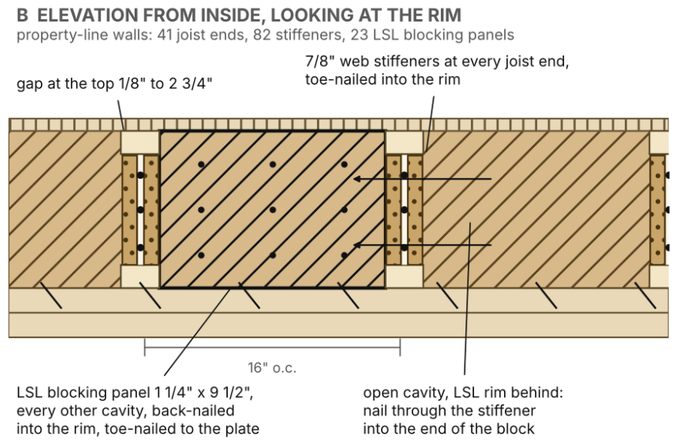
Drawn by By William Design: Weyerhaeuser bearing and web stiffener rules (connector guide W), blocking panels (TJ-9001 A1, B1). Toe nailing through the stiffener is the BWD method, engineer to confirm. Not to scale.

*RIM CONNECTION FROM INSIDE, NORTH AND SOUTH WALLS. A: section looking east, joist on the plate against the 1 1/4" LSL rim, stiffener tight to the bottom flange and toe-nailed into the rim. B: inside elevation, joists at 16" o.c. with a blocking panel in every other cavity. Both property-line walls: 41 joist ends, 82 stiffeners, 23 blocking panels, 6 pcs LSL rim (T 1.03).*

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Details, Rim Connection – T 1.09B**

# DETAILS: RIM CONNECTION FROM INSIDE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

## RIM AND JOIST CONNECTION RULES, WEYERHAEUSER TJ-9001

*Weyerhaeuser Installation Guide for Floor and Roof Framing, TJ-9001, June 2026. The drawn detail on the previous page follows these rules; the manufacturer's figures are on T 1.09C.*

| ITEM | WEYERHAEUSER TJ-9001 RULE | WHAT WE DO AT 80 LAMB |
|---|---|---|
| **Rim board to TJI, standard** | One 0.131 x 3" nail into each flange, driven through the rim from outside. (Rim board details A3 to A3.4) | Not possible on the north and south walls. Replaced by the stiffener toe nails and blocking below. The east and west rims keep the standard nailing. |
| **Rim board to plate** | Toe nail 0.131 x 3" at 6" o.c.; floor panel nails 8d at 6" o.c. into the rim; plate nail 0.131 x 3" at 12" o.c. | As published, all from inside and above. The rim on the two property-line walls is 1 1/4" TimberStrand LSL so the toe nails from the stiffeners and the blocking hold. |
| **TJI to bearing plate** | Two 0.113 x 2 1/2" nails driven at an angle into the bottom flange, one each side of the web, at least 1 1/2" from the end. Minimum end bearing 1 3/4". | As published. |
| **Hanger (details H1, H2A)** | Face-mount hanger on a TimberStrand LSL or LVL header (H2A). Without stiffeners the hanger sides must laterally support at least 3/8" of the top flange (H1); with stiffeners the hanger must support at least 60% of the joist depth. | Not used at the rim. Used only at the stair header: Simpson IUS2.56/9.5 (MiTek IHFL23925 equal), 14 pcs (T 1.03). |
| **Web stiffener (TJI 230, 360)** | 7/8" x 2 5/16" minimum each side of the web, three 8d (0.113 x 2 1/2") nails, clinched when possible. Tight to the bottom flange with face-mount hangers; gap at the top 1/8" min, 2 3/4" max. Required where the hanger does not support the top flange. | Two per joist end at both property-line walls, 82 in all, 6 5/8" long, ripped from one sheet of 7/8" plywood. Each stiffener toe-nailed into the rim with two 0.131 x 3" nails (BWD method, Hossein to confirm). |
| **Squash blocks** | 2x4 minimum, 10d into each flange, matching the bearing area of the post above (detail CS). | Under every post P1 to P3, the enclosure corners and the stair header bearings (T 1.03). |
| **Blocking panels (A1, B1)** | Rim board, LSL or a TJI offcut between joists at bearing, toe-nailed to the plate; required with braced walls above or below. | Used: 1 1/4" x 9 1/2" LSL in every other cavity at the north and south rims, 23 panels from 3 pcs 12'. The open cavity gives room to nail through the stiffener into the block. Hossein to confirm the spacing. |

## NOTES

1. The second-floor wall panels on the property-line sides are sheathed lying down with the DensGlass run 10 1/2" below the bottom plate so the rim and the joint are covered when the wall tilts up. Tuck Tape the horizontal joint; bring the air barrier down over it.
2. TJI 360 is made at 9 1/2" (TJ-9001 lists 9 1/2", 11 7/8", 14" and 16"); confirm regional stock with Downtown Lumber.
3. Connection of the end joists and parapets to the W200x36 columns at the west corners: CONNECTION REQUIRES FURTHER DETAILING, connectors and fasteners are not specified on the plans and MF-1 was never issued. Proposed: a continuous LSL nailer bolted to each column, slab to roof, gasketed from the steel (T 1.02).
4. Detail side-model of this connection in the HTML, animated through the sequence, is on the Rev 2 list.

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026


**Details, Rim Connection – T 1.09B**

# MANUFACTURER SPEC: WEYERHAEUSER HANGER DETAILS


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Manufacturer's details for the rim connection on T 1.09B, reproduced from the Weyerhaeuser Canada / MiTek connector guide. Where this sheet and T 1.09B differ, this sheet governs.

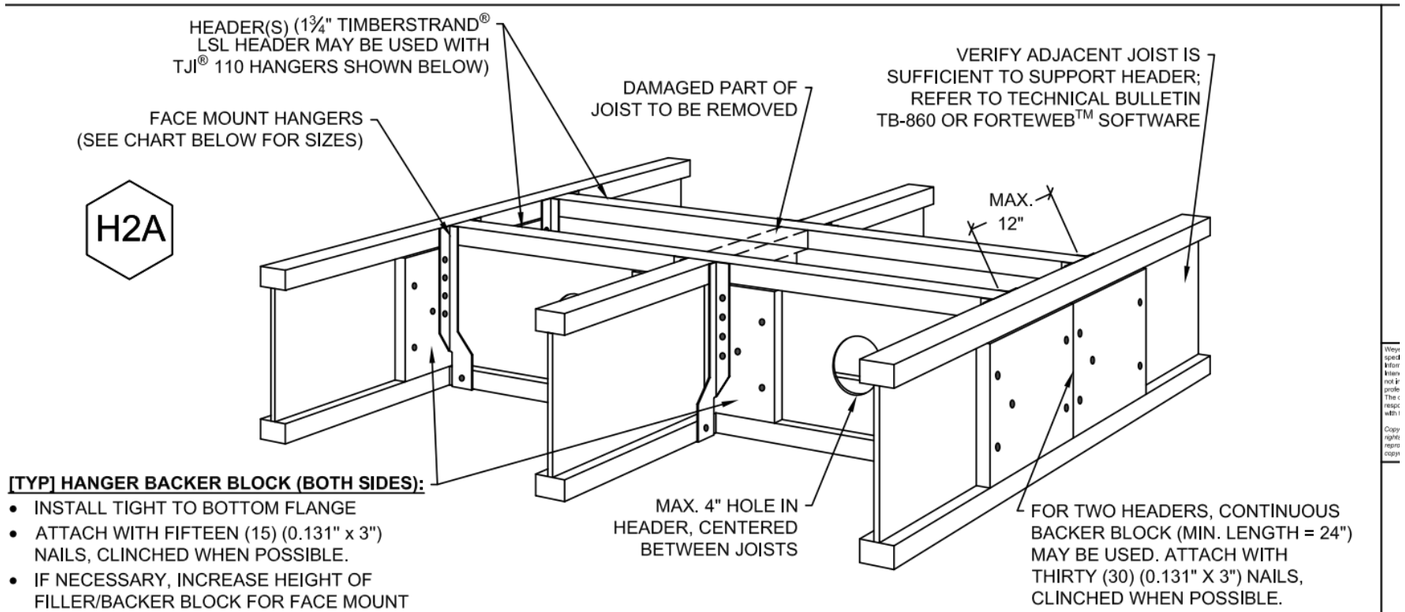


*H2A: face-mount hangers on a 1 3/4" TimberStrand LSL header. At 80 Lamb this applies to the stair header hangers; the rim has no hangers (T 1.09B).*

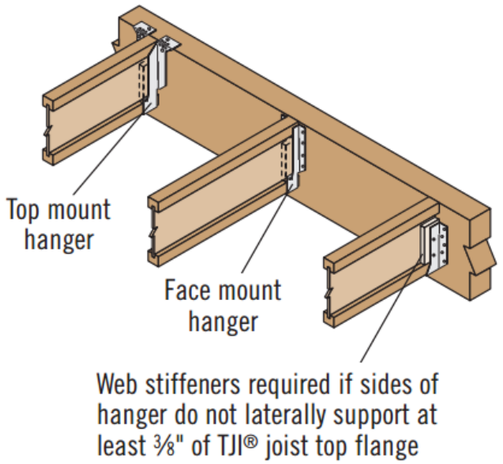


*H1: top-mount and face-mount hangers. Web stiffeners required where the hanger sides do not laterally support at least 3/8" of the top flange.*

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026


**Manufacturer Spec – T 1.09C**

# MANUFACTURER SPEC: WEYERHAEUSER HANGER DETAILS




by William

## Web Stiffener Attachment

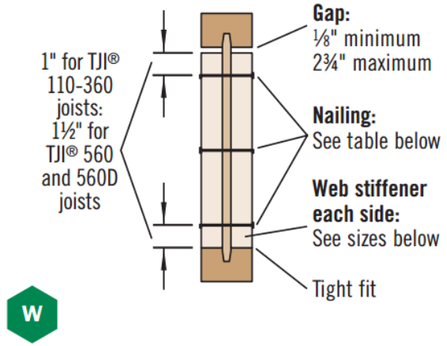


*W: web stiffener each side of the web, 7/8" x 2 5/16" minimum for TJI 360, three 8d nails clinched; gap at the top 1/8" min, 2 3/4" max; tight fit at the bottom with face-mount hangers.*

**Backer block:** Install tight to top flange (tight to bottom flange with face mount hangers). Attach per table below.

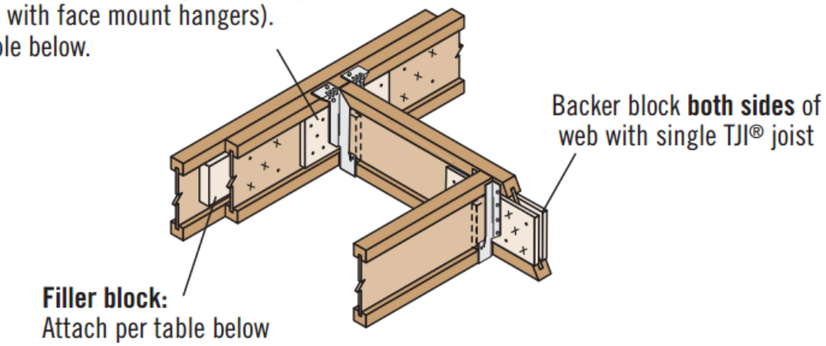


*Backer and filler blocks: for hanging off an I-joist web. Not used at 80 Lamb, shown for reference.*

**ISSUED FOR BUDGET AND COORDINATION, 23 OCT 2026**

80 Lamb Ave – Laneway House
Oct 23, 2026

**Manufacturer Spec – T 1.09C**