FRAMING TAKEOFF INDEX

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

The roof east of grid 2 has no engineer's sheet yet; those lines are priced for budget and are confirmed with Marek before ordering.

SHEET INDEX

SHEET	TITLE	COVERS
T 1.01	Basis and building summary	What the takeoff is built from, how to read a line, the derived wall heights and stud cut lengths with the arithmetic
T 1.02	Batch 1: Ground floor walls	Sill on the curb (Blueskin, primer, gasket, anchors), exterior 2x6 walls by wall, the moment-frame infill panels, interior partitions, DensGlass, furring
T 1.03	Batch 2: Second floor deck	TJI 360 by zone (west bay, stair bay, east bay), LVL beam lines, stair trimmer and header, rim, squash blocks, balcony, subfloor, stair hangers
T 1.03B	Batch 2B: Balcony deck	2x6 joists and blocking on the steel outriggers, plywood, PT sleepers, cedar decking, kept separate from the main deck
T 1.04	Batch 3: Second floor walls	West zone 10'-7" walls, east zone walls under the lower level and the flat east roof (7'-7 7/8" and 7'-9 1/2"), the raked south wall under the slope, interior partitions, posts
T 1.05	Batch 4: Roofs, parapets and stair enclosure	West roof per Taiga; east of grid 2 the lower level, the sloped roof round the skylight and the east low roof, from the architect's 16 Oct model; the enclosure with purlins; parapets. Engineering not complete
T 1.06	Connectors, fasteners, membranes and site	Simpson hardware by SKU, nails and screws by box, Blueskin and primer, window tapes, air barrier, Tuck Tape, bracing lumber, blades
T 1.06A	Exterior insulation and sheathing by elevation	Mineral wool (3" W1, 5" W1a west) by elevation and phase, R19 batts, and the floor and roof bands that take DensGlass, air barrier and furring
T 1.06B	Hanger schedule	Every hung end: the member, what it hangs on, the hanger chosen by rule from the two members, and what T2 had
T 1.07	Order summary and budget	One line per product with the batch split, May quote prices and estimates, HST, the LSL stud option
T 1.07A	Guards and railings, separate estimate	Balcony guardrail (1-A405), stair guard and handrails (5-A404) and an optional guard on the parapet: not framing, not in the framing budget, priced as an allowance for the millwork and metal side
T 1.08	Reconciliation	Line by line against Downtown Lumber quote 3027967 (1 May) and the Taiga layout (29 Apr): same, changed, missing, superseded
T 1.09	Details: openings and flashing	Typical window and door framing; the architect's window and balcony-door details (A401) reproduced
T 1.09A	Details: parapet, overhang, curb	The architect's parapet (2-A400), roof access overhang (3-A400) and grade beam and curb (A406) details reproduced
T 1.09B	Details: rim connection from inside	Property-line walls without hangers: stiffeners toe-nailed into the LSL rim and blocking panels; section and inside elevation, with the rule table
T 1.09C	Manufacturer spec: Weyerhaeuser hanger details	Weyerhaeuser H1, H2A, web stiffener attachment (W) and backer and filler blocks, as published

BASIS OF TAKEOFF

DOCUMENT	ISSUED	WHAT IT GAVE THIS TAKEOFF
2601016_80LAMB_100% CD, 31 sheets, Kunaal Mohan (OAA stamp Sheena Sharp)	30 Sep 2026	Plans A100 to A104, sections A300 to A302, assemblies A004, details A400 to A406, schedules A405. Wall heights, openings, assemblies, parapet and sill details.
Gulf Engineering (Hossein Azargive): ground floor, second floor framing, foundation wall and grade beam	20 Oct 2026	Slab on grade, W200x36 moment frame MF-1 and outriggers, 3-ply 1 3/4 x 9 1/2 LVL beam lines, posts P1 to P3, east wall headers 2-2x8 and 3-2x8. No roof sheet.
Taiga Building Products EWP layout 20260370 (Scott Jutras)	29 Apr 2026	Joist, beam, hanger and subfloor counts per level. Page 1 (raised ground floor) is superseded by the slab on grade. Pages 2 and 3 used as the check on the deck and the west roof.
Downtown Lumber cash quote 3027967 to North Arrow	1 May 2026	Unit prices for the budget. The scan stops at line 48.
Architect's 3D model (DWG, IFC, DXF exports)	16 Oct 2026	Stud-level cross-check on counts and lengths. Since 22 Oct also the source for the framing east of grid 2 (lower level, sloped roof, east low roof heights; DXF layer S-BEAM). Its member sizes are placeholders: the 2F deck is drawn as 2x10, not TJI.
Weyerhaeuser TJI specifier's guide	current	Rim, squash block, blocking panel and nailing rules; the inside-attachment detail on T 1.09.

OPEN DECISIONS AND QUESTIONS – TO CLOSE BEFORE THE ORDER

one per row, in the words to ask them; the sheet column is where the number that depends on the answer lives

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Takeoff Index – T 1.00

FRAMING TAKEOFF INDEX

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

#	DECISION OR QUESTION	WHO	SHEET
1	J-bolts are cast into the curb: confirm the spacing (1.2 m on A406, 2 per wall end) and that the nuts and washers are on site. Where does the curb stop at the entry door?	Marek	T 1.02
2	Send the full 1 May quote; the copy we have stops at line 48 (the lower roof) and the upper roof, enclosure and hardware lines are missing.	Marek	T 1.08
3	LSL for every stud, for the 10'-7" west-zone walls and parapets only, or SPF throughout?	Marek	T 1.07
4	Roof framing sheet, nothing east of grid 2 is engineered: the lower level (2-ply 2x10 drop beam on grid 2 and its seat at the P3 posts, headers H-A and H-B, the enclosure floor joists, 2x10 between H-A and H-B and 2x6 east of grid 3), the sloped roof (foot beam, sloped 2x10 lines, short joists, skylight headers), the east low roof, the enclosure rafters and purlins, the LVL end joists and parapet tie-down. All sizes are the architect's placeholders.	Marek (Hossein)	T 1.05
5	Green roof engineering is not decided: who engineers the 4" Zinco green roof on R1 (A004) and its load on the roof framing, and when. It has to be settled before the roof sheet and the roof order.	Marek (Hossein, Kunaal)	T 1.05
6	Header over the W11/W10 mulled pair in the enclosure south wall: 3.45 m (11'-4") is past the OBC Part 9 lintel table (Table 9.23.12.3.-A tops out at 2-2x12, 3.39 m with note 6). Needs an engineered header (LVL); 3-2x10 carried as a placeholder.	Marek (Hossein)	T 1.05
7	Posts under Taiga's B9-4 at grid 3, in the second floor north and south walls: not shown on the engineer's sheet or Taiga's layout.	Marek (Hossein)	T 1.04, T 1.05
8	Taiga's 29 Apr layout runs the sloped roof from B8-3 at grid 2 to B9-4 near grid 3; the architect's 16 Oct model stops it at a foot beam about 2'-9" short of grid 3 with a flat strip after. Which governs?	Marek (Kunaal, Taiga)	T 1.05
9	East wall W04 header: the engineer's sheet labels 2-2x8 on the north part of the wall and 3-2x8 on the south part. Which covers W04 (2-2x8 carried)?	Marek (Hossein)	T 1.04
10	TJI 360 9 1/2" in place of the 9 1/4" open-web joists is approved. If the 20 Oct second floor sheet is not revised and stamped with it, ask for a revised sheet or an email confirming it, for the record.	Marek (Hossein)	T 1.03
11	Moment frame wood connection (CONNECTION REQUIRES FURTHER DETAILING, MF-1 never issued): are holes allowed through the W200x36 column and beam flanges for the 1/2" through-bolts at 16", and what size and spacing, or must the LSL and 2x10 nailers be clamped to the flanges (beam clamps, no drilling)?	Marek (Hossein)	T 1.02, T 1.03, T 1.09
12	Rim connection from inside at the two property-line walls, no hangers: joists bear on the plate, web stiffeners at every end toe-nailed into a 1 1/4" LSL rim, LSL blocking panels in every other cavity (T 1.09B). Not on the engineer's sheet. Confirm the method and the spacing on these braced walls.	Marek (Hossein)	T 1.03, T 1.09
13	Hurricane ties, framing angles and straps are not on the drawings: confirm the allowance on T 1.06 or specify.	Marek (Hossein)	T 1.06
14	Post under the south end of the stair trimmer (P2 added here, not on the sheet) and the sunken tub support Taiga flagged.	Marek (Hossein)	T 1.03
15	Roof stair layout: the stair now lands on the lower level east of grid 2, 8'-3 3/8" above the second floor, which needs 13 risers of 7 5/8". A102/A103 draw three winders at the W/C wall, a short straight and three winders at the well-end wall: 10 risers. The 16 Oct model starts the stair at grid 3 instead. Headroom under the grid-3 beam over the bottom winders is about 5'-9 1/2" against 6'-4 3/4". Lay the stair out; the roof-stair lines on T 1.05 are placeholders.	Marek (Kunaal)	T 1.05
16	East of grid 2 is framed from the architect's 16 Oct model (DXF): lower level at 2506 above the finished floor (A302 section 2), east low roof at 2548 to the top of the joists (A302 section 1), the sloped roof round W12 at about 24 deg (A103: 23.8). The model has the headers but no joists in the enclosure floor between the roof-stair header and the south wall (added here), and the parapet along the slope is not drawn (assumed to follow the slope).	Marek (Kunaal)	T 1.04, T 1.05
17	Enclosure east and west window pairs (W06/W05, W05/W06) drawn corner to corner: framed with a 1/2" rough opening allowance and one jack each end, the corner studs acting as the kings. Confirm the window sizes with the window supplier before the walls are framed.	Marek (Kunaal, window supplier)	T 1.05
18	Stair openings are sized to 1950 headroom from the model stair (15 at 200 on 255). Confirm against the stair shop drawing before the headers are set.	Marek (Kunaal, stair shop)	T 1.05
19	Furring with drainage holes behind the corrugated metal: proprietary clip or site-drilled 1x3?	Marek (Kunaal, metal supplier)	T 1.02
20	7/8" roof sheathing board: product intended, or 3/4" T&G plywood?	Marek (Kunaal)	T 1.05
21	Exterior mineral wool thickness: the A004 wall schedule gives 75 mm (3") pinned semi-rigid R12ci; a detail in the set notes 4" exterior Rockwool. Carried at 75 mm (125 mm at the west wall per W1a). Confirm.	Marek (Kunaal)	T 1.06A
22	Roof joists east of grid 2: A004 (page 5 of the set) gives 235 mm roof joists @ 16" with no product, and the architect's model draws them as 2x10. Carried as TJI 360 9 1/2" on the long spans, 2x10 only round the skylight. Confirm.	Marek (Hossein)	T 1.05
23	Enclosure floor between the two headers H-A and H-B (grid 2 to 3, a 2'-9" bay): the architect's model has no joists there. Six TJI carried so the subfloor has support. Confirm or delete.	Marek (Kunaal)	T 1.05
24	Window rough openings: schedule sizes plus 2" assumed (1/2" at the enclosure pairs); the window shop drawings govern.	Marek (window supplier)	T 1.02, T 1.04

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Takeoff Index – T 1.00

BASIS AND BUILDING SUMMARY

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Framing footprint 31'-9 3/4" by 16'-2" out to out of studs. The 32'-9 3/4" and 17'-2 1/8" on the plans are to the face of the cladding; the 15'-1 3/4" interior clear plus two 2x6 walls with their sheathing and drywall gives the framing width. Two storeys plus the rooftop stair enclosure. Slab on grade on a 16" x 8" grade beam on helical piles. The ground floor exterior walls stand on a 6" concrete curb 2'-8 5/8" above the slab (A406). All heights on this sheet are measured up from the top of the slab. The west end is a W200x36 steel moment frame with curtain-wall doors; the second floor balcony sits on W200x36 outriggers. The north and south walls are on the property lines against the neighbours' garages, so nothing on those two faces can be nailed from outside once the walls are up.

WALL HEIGHTS AND STUD CUT LENGTHS, WITH THE ARITHMETIC

heights measured up from the top of the slab; every number is computed from the model, not typed, so a changed datum regenerates the counts

LEVEL OR WALL	FROM	TO	WALL HEIGHT	STUD CUT	STOCK	HOW IT WAS DERIVED
Ground floor exterior walls (on the curb)	Top of curb, 2'-8 5/8" above the slab	Underside of TJI, 8'-9 3/8" above the slab	6'-0 3/4"	5'-8 1/4"	2x6 x 12', two studs per piece	Second floor finished floor 9'-10 1/8" above the slab, less 1" flooring, 1 1/2" gypcrete, 3/4" subfloor and the 9 1/2" joist gives the underside of the TJI; less the curb; less three plates.
Ground floor partitions and west infill panels	Slab	Underside of TJI, 8'-9 3/8" above the slab	8'-9 3/8"	8'-4 7/8"	104 5/8" precut	Partitions run to the underside of the deck (A005 note 15).
Second floor, west zone (grid 1 to 4)	Subfloor, 9'-7 5/8" above the slab	Underside of roof joists, 20'-2 5/8" above the slab	10'-7"	10'-2 1/2"	2x6 x 12'	Dining clear 10'-3" (A300) plus 1/2" drywall and 1" hat channel above the finished floor; the plates sit on the subfloor, 2 1/2" below the finished floor.
Second floor walls under the east low roof	Subfloor, 9'-7 5/8" above the slab	Underside of roof joists, 17'-4 7/8" above the slab	7'-9 1/4"	7'-4 7/8"	104 5/8" precut	A302 section 1: 8'-4 3/8" from the finished floor to the top of the roof joists (the architect's model agrees exactly), less the 2x10.
Second floor walls under the lower level (north wall, W/C)	Subfloor, 9'-7 5/8" above the slab	Underside of lower framing, 17'-3 1/2" above the slab	7'-7 7/8"	7'-3 3/8"	104 5/8" precut	A302 section 2: 8'-2 5/8" from the finished floor to the top of the lower framing, less the 2x10 (A302 section 1 dimensions the underside as 7'-5 3/4").
Stair enclosure west wall on the west roof deck	Roof deck	Underside of rafters, 25'-11" above the slab	4'-10"	4'-5 1/2"	2x6 x 10', two per piece	Top of the stair roof 26'-10 7/8" above the slab, less 1/2" ply, 2x4 purlin, 5/8" board and the 2x8 rafter.
Stair enclosure walls on the enclosure floor	Enclosure floor, 18'-1 1/2" above the slab	Underside of rafters, 25'-11" above the slab	7'-9 3/8"	7'-4 7/8"	2x6 x 16', two per piece	Lower level top plus 3/4" subfloor. The south wall over the slope is raked at the bottom (T 1.05).
Parapets W2 (detail 2-A400)	Top of roof joists	Top of parapet, 21'-11 3/4" above the slab	11 3/4" above the joists	1'-5 5/8"	from 10' drops	2x4 bottom plate on the joists, 2x6 studs rising beside the 6" roof insulation, 2x6 top plate, 3/4" plywood both faces.

NOTES

1. Quantity is pieces at the cut length shown. Order (stock x pcs) is what to buy: the stock length and how many, with the pieces-per-stock rule in the note.
2. Waste is stated per line, not hidden in one global factor: 5% on studs, 10% on plates, 8 to 12% on sheet goods, none on engineered beams and hangers.
3. Source names the sheet the line comes from. Where the source is 'recommended' or 'assumption' the line is mine, not the architect's or the engineer's, and the note says so in bold.
4. Price marked quote is from Downtown Lumber's 1 May 2026 quote; est. is estimated price for the budget and needs a re-quote; to quote means I have no basis for a number.
5. All dimensions are imperial. Heights are measured up from the top of the slab; the architect's site elevations in millimetres are in the full-detail backup only.
6. In scope: all wood framing from the curb up, rim and engineered beams, sheathing (DensGlass, plywood, roof board, subfloor), connectors, nails and screws, sill and window membranes, temporary bracing. Out: steel, piles, concrete, curtain wall and windows (owner supplied per A405), stairs, cladding and its clips, insulation, drywall, roofing, green roof, cedar decking.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Basis and Summary – T 1.01

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Ground floor. The sill is Blueskin SA over the top of the curb on primer, foam gasket under the plate, anchors at 1.2 m (A406). Exterior walls are 2x6 at 16" on the curb, three-stud L corners, king-jack-jack at every opening, a mid-height blocking row, DensGlass outside, 1x3 furring over the mineral wool. The west wall is two 970 mm infill panels beside the curtain wall. Interior partitions run slab to deck, plywood clad both faces (A005 note 16).

WALLS IN THIS BATCH

lengths out to out of studs; heights from the plate below to the underside of the framing above; openings per the A405 schedules

WALL	ZONE	LENGTH	HEIGHT	STUD CUT	OPENINGS	SOURCE	NOTE
GF-N	North wall (grid A, laneway to garden)	31'-0 3/8"	6'-0 3/4"	5'-8 1/4"	none	A101, A300, A406	2x6 @ 16" on the 830 mm concrete curb. No openings.
GF-S	South wall (grid C)	31'-0 3/8"	6'-0 3/4"	5'-8 1/4"	none	A101, A302	2x6 @ 16" on the curb. No openings.
GF-E	East wall (garden side, grid 6), south of the entry door bay	11'-6 5/8"	6'-0 3/4"	5'-8 1/4"	W01, W03+W02	A101, A405	A101 tags W01, W03 and one W02 on this wall; the schedule counts three W02 in the house and the third is not located on the plans (walk-sheet item). Window sills sit just above the curb. Entry door DX01 is at the north end and runs to the slab: framed as a full-height opening, see GF-E-DOOR. Windows W01, W03, W02 x2 (frosted, fixed).
GF-E-DOOR	East wall, entry door bay	3'-8 3/8"	8'-9 3/8"	8'-4 7/8"	DX01	A101, A405	Door DX01 850 x 2100 to the slab; the curb is interrupted here for the 4'-2" door bay (king and two jacks each side of the 900 rough opening). Bottom plate cut out at the door. Verify with the foundation as poured.
GF-W-N	West wall, north infill panel beside the curtain wall	2'-4 7/8"	8'-9 3/8"	8'-4 7/8"	none	A101, A300	Solid 2x6 panel from the slab to the deck. The three DX02 curtain-wall doors between the panels are by the window supplier; the W200x36 moment frame carries the deck.
GF-W-S	West wall, south infill panel	2'-4 7/8"	8'-9 3/8"	8'-4 7/8"	none	A101, A300	As GF-W-N.
GF-P-STAIR-S	Stair and mech room south wall, grid 2 to grid 4 (P1a/P1b 2x4)	11'-2 7/8"	8'-9 3/8"	8'-4 7/8"	none	A101	One wall on A101: the mech room's south wall continuing as the closed side of the stair's first risers. Plywood clad both sides (note 16). No door in it.
GF-P-MECH-W	Mech room west wall with door D3, under the top of the stair (P1a 2x4)	3'-2 1/4"	8'-9 3/8"	8'-4 7/8"	D3	A101, A301 section A	D3 opens off the work space on the laneway side (A101). Section A cuts this wall from the slab to the stair roof; the 2F wall at the top of the well (2F-P-WELL-W) stands on it.
GF-P-MECH-E	Mech room east wall, pony wall under the stair stringers (P1a 2x4)	3'-2 1/4"	3'-5 5/8"	3'-2 5/8"	none	A101, A301 section A	Only as tall as the stair soffit here (about 2'-4"); studs cut to the slope on site. The mech room is under the stair, its ceiling is the stringer line. Nothing full height crosses the run.
GF-P-WC-W	W/C west wall, plumbing chase (P2a 2x6)	7'-2 1/8"	8'-9 3/8"	8'-4 7/8"	none	A101	2x6 chase wall for the wall-hung toilet carrier and drains.
GF-P-WC-N	W/C and bedroom north wall with doors D2 and D1 (P1a/P1b 2x4)	15'-2 3/8"	8'-9 3/8"	8'-4 7/8"	D2, D1	A101	Corridor side wall from the W/C chase to the east wall. D2 into the W/C, D1 into the bedroom.
GF-P-BED-W	Bedroom west wall = W/C east wall (P1 2x4), stacked under the 2F kitchen wall	7'-0 3/8"	8'-9 3/8"	8'-4 7/8"	none	A101	

NORTH WALL (GRID A, LANEWAY TO GARDEN)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 5'-8 1/4"	5'-8 1/4"	27	pcs	2x6 x 12' x 15	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101, A300, A406	2 per 12' stock piece, 5% extra
Plates	2x6 plates, 93 LF		7	pcs 16'	2x6 x 16' x 7	bottom plate and double top plate	A101, A300, A406	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 24 pcs at 14 1/2" (29 LF)		24	pcs	2x6 x 12' x 3	one row at mid-height, fire stop at 10' walls	A101, A300, A406	Cut from stud drops where the drop is 15" or more; otherwise order 3 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		7	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 7	exterior face, 17.5 m2	A004 W1	12% waste; openings not deducted

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		20	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 20	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

SOUTH WALL (GRID C)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 5'-8 1/4"	5'-8 1/4"	27	pcs	2x6 x 12' x 15	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101, A302	2 per 12' stock piece, 5% extra
Plates	2x6 plates, 93 LF		7	pcs 16'	2x6 x 16' x 7	bottom plate and double top plate	A101, A302	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 24 pcs at 14 1/2" (29 LF)		24	pcs	2x6 x 12' x 3	one row at mid-height, fire stop at 10' walls	A101, A302	Cut from stud drops where the drop is 15" or more; otherwise order 3 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		7	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 7	exterior face, 17.5 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		20	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 20	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

EAST WALL (GARDEN SIDE, GRID 6), SOUTH OF THE ENTRY DOOR BAY

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 5'-8 1/4"	5'-8 1/4"	9	pcs	2x6 x 12' x 5	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); W01 king studs; W03+W02 king studs	A101, A405	2 per 12' stock piece, 5% extra
Studs	2x6 studs, cut 4'-4"	4'-4"	8	pcs	2x6 x 10' x 5	W01 double jack studs (king, jack, jack each side); W03+W02 double jack studs (king, jack, jack each side)	A101, A405	2 per 10' stock piece, 5% extra
Studs	2x6 studs, cut 11 5/8"	11 5/8"	5	pcs	2x6 x 8' x 1	W03+W02 cripples below sill	A101, A405	8 per 8' stock piece, 5% extra
Studs	2x6 studs, cut 9"	9"	8	pcs	2x6 x 8' x 1	W01 cripples above header; W03+W02 cripples above header	A101, A405	10 per 8' stock piece, 5% extra
Studs	2x6 studs, cut 3 7/8"	3 7/8"	3	pcs	2x6 x 8' x 1	W01 cripples below sill	A101, A405	23 per 8' stock piece, 5% extra
Headers	2x8 header, 3'-0 1/2"	3'-0 1/2"	2	pcs	2x8 x 10' x 1	W01 2-2x8 header (engineer, east wall)	A101, A405	
Headers	2x8 header, 6'-1 7/8"	6'-1 7/8"	3	pcs	2x8 x 8' x 3	W03+W02 3-2x8 header (engineer)	A101, A405	
Headers	2x6 window sills (double), 17 LF		4	pcs	2x6 x 16' x 2	rough sills under windows, two plies per opening	A101, A405	cut from 16' stock, 10% for cuts

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Plates	2x6 plates, 35 LF		3	pcs 16'	2x6 x 16' x 3	bottom plate and double top plate	A101, A405	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 9 pcs at 14 1/2" (11 LF)		9	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A405	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		3	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 3	exterior face, 6.5 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		8	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 8	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

EAST WALL, ENTRY DOOR BAY

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 8'-4 7/8"	8'-4 7/8"	6	pcs	2x6 x 104 5/8" precut x 7	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); DX01 king studs	A101, A405	5% extra
Studs	2x6 studs, cut 7'-0 5/8"	7'-0 5/8"	4	pcs	2x6 x 8' x 5	DX01 double jack studs (king, jack, jack each side)	A101, A405	5% extra
Studs	2x6 studs, cut 9"	9"	3	pcs	2x6 x 8' x 1	DX01 cripples above header	A101, A405	10 per 8' stock piece, 5% extra
Headers	2x8 header, 3'-2 3/8"	3'-2 3/8"	2	pcs	2x8 x 10' x 1	DX01 2-2x8 header (engineer, east wall)	A101, A405	
Plates	2x6 plates, 11 LF		1	pcs 16'	2x6 x 16' x 1	bottom plate and double top plate	A101, A405	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A405	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		2	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 2	exterior face, 3.0 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		4	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 4	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

WEST WALL, NORTH INFILL PANEL BESIDE THE CURTAIN WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 8'-4 7/8"	8'-4 7/8"	5	pcs	2x6 x 104 5/8" precut x 6	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101, A300	5% extra
Plates	2x6 plates, 7 LF		1	pcs 16'	2x6 x 16' x 1	bottom plate and double top plate	A101, A300	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 2 pcs at 14 1/2" (2 LF)		2	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A300	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		1	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 1	exterior face, 2.0 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		3	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 3	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

WEST WALL, SOUTH INFILL PANEL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 8'-4 7/8"	8'-4 7/8"	5	pcs	2x6 x 104 5/8" precut x 6	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101, A300	5% extra
Plates	2x6 plates, 7 LF		1	pcs 16'	2x6 x 16' x 1	bottom plate and double top plate	A101, A300	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 2 pcs at 14 1/2" (2 LF)		2	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A300	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		1	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 1	exterior face, 2.0 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		3	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 3	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

STAIR AND MECH ROOM SOUTH WALL, GRID 2 TO GRID 4 (P1A/P1B 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 8'-4 7/8"	8'-4 7/8"	12	pcs	2x4 x 104 5/8" precut x 13	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101	5% extra
Plates	2x4 plates, 34 LF		3	pcs 16'	2x4 x 16' x 3	bottom plate and double top plate	A101	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 9 pcs at 14 1/2" (11 LF)		9	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		7	sheets	1/2" plywood 4x8 x 7	18.3 m2 both faces	A005 note 16, A004 P1a	10% waste

MECH ROOM WEST WALL WITH DOOR D3, UNDER THE TOP OF THE STAIR (P1A 2X4)

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 8'-4 7/8"	8'-4 7/8"	5	pcs	2x4 x 104 5/8" precut x 6	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); D3 king studs	A101, A301 section A	5% extra
Studs	2x4 studs, cut 7'-2"	7'-2"	4	pcs	2x4 x 92 5/8" precut x 5	D3 double jack studs (king, jack, jack each side)	A101, A301 section A	5% extra
Studs	2x4 studs, cut 1'-1 3/8"	1'-1 3/8"	3	pcs	2x4 x 8' x 1	D3 cripples above header	A101, A301 section A	7 per 8' stock piece, 5% extra
Headers	2x4 header, 3'-1"	3'-1"	1	pcs	2x4 x 10' x 1	D3 flat 2x4 header (non-bearing partition)	A101, A301 section A	
Plates	2x4 plates, 10 LF		1	pcs 16'	2x4 x 16' x 1	bottom plate and double top plate	A101, A301 section A	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A301 section A	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		2	sheets	1/2" plywood 4x8 x 2	5.2 m2 both faces	A005 note 16, A004 P1a	10% waste

MECH ROOM EAST WALL, PONY WALL UNDER THE STAIR STRINGERS (P1A 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 3'-2 5/8"	3'-2 5/8"	6	pcs	2x4 x 10' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101, A301 section A	3 per 10' stock piece, 5% extra
Plates	2x4 plates, 6 LF		1	pcs 16'	2x4 x 16' x 1	2x4 bottom plate and 2x6 top plate	A101, A301 section A	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101, A301 section A	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		1	sheets	1/2" plywood 4x8 x 1	2.1 m2 both faces	A005 note 16, A004 P1a	10% waste

W/C WEST WALL, PLUMBING CHASE (P2A 2X6)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 8'-4 7/8"	8'-4 7/8"	9	pcs	2x6 x 104 5/8" precut x 10	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101	5% extra
Plates	2x6 plates, 22 LF		2	pcs 16'	2x6 x 16' x 2	bottom plate and double top plate	A101	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 6 pcs at 14 1/2" (7 LF)		6	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		5	sheets	1/2" plywood 4x8 x 5	11.7 m2 both faces	A005 note 16, A004 P1a	10% waste

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

W/C AND BEDROOM NORTH WALL WITH DOORS D2 AND D1 (P1A/P1B 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 8'-4 7/8"	8'-4 7/8"	15	pcs	2x4 x 104 5/8" precut x 16	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); D2 king studs; D1 king studs	A101	5% extra
Studs	2x4 studs, cut 7'-1 7/8"	7'-1 7/8"	8	pcs	2x4 x 92 5/8" precut x 9	D2 double jack studs (king, jack, jack each side); D1 double jack studs (king, jack, jack each side)	A101	5% extra
Studs	2x4 studs, cut 1'-1 5/8"	1'-1 5/8"	4	pcs	2x4 x 8' x 1	D2 cripples above header; D1 cripples above header	A101	6 per 8' stock piece, 5% extra
Headers	2x4 header, 2'-5"	2'-5"	1	pcs	2x4 x 8' x 1	D2 flat 2x4 header (non-bearing partition)	A101	
Headers	2x4 header, 2'-10 7/8"	2'-10 7/8"	1	pcs	2x4 x 10' x 1	D1 flat 2x4 header (non-bearing partition)	A101	
Plates	2x4 plates, 46 LF		4	pcs 16'	2x4 x 16' x 4	bottom plate and double top plate	A101	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 12 pcs at 14 1/2" (15 LF)		12	pcs	2x4 x 12' x 2	one row at mid-height, fire stop at 10' walls	A101	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		10	sheets	1/2" plywood 4x8 x 10	24.8 m2 both faces	A005 note 16, A004 P1a	10% waste

BEDROOM WEST WALL = W/C EAST WALL (P1 2X4), STACKED UNDER THE 2F KITCHEN WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 8'-4 7/8"	8'-4 7/8"	9	pcs	2x4 x 104 5/8" precut x 10	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A101	5% extra
Plates	2x4 plates, 21 LF		2	pcs 16'	2x4 x 16' x 2	bottom plate and double top plate	A101	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 6 pcs at 14 1/2" (7 LF)		6	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A101	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		5	sheets	1/2" plywood 4x8 x 5	11.5 m2 both faces	A005 note 16, A004 P1a	10% waste

GROUND FLOOR

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Posts	P3 4-2x6 built-up post, 5'-8 1/4" plies	5'-8 1/4"	8	pcs	2x6 x 12' x 4	Under the grid 2 LVL beam, north and south walls (engineer P3).	Gulf Eng.	built-up posts nailed per OBC 9.23.10; glue optional
Posts	P2 3-2x6 built-up post, 5'-8 1/4" plies	5'-8 1/4"	12	pcs	2x6 x 12' x 6	Under the grid 4 LVL beam, north and south, and east wall per engineer.	Gulf Eng.	built-up posts nailed per OBC 9.23.10; glue optional

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Posts	P1 2-2x6 built-up post, 5'-8 1/4" plies	5'-8 1/4"	6	pcs	2x6 x 12' x 3	East wall window jambs per engineer.	Gulf Eng.	built-up posts nailed per OBC 9.23.10; glue optional

WEST WALL, MOMENT FRAME

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Lumber	TimberStrand LSL 1 1/2" x 5 1/2" x 12' nailer up each W200x36 column (one 12' and one 10' per column, slab to the underside of the roof joists)		2	pcs	LSL 1 1/2 x 5 1/2 x 12' x 2	two columns at 20'-2 5/8" each; butt joint at a bolt	Gulf Eng. MF-1	CONNECTION REQUIRES FURTHER DETAILING: not specified on the plans; proposed by BWD, Hossein to accept.
Lumber	TimberStrand LSL 1 1/2" x 5 1/2" x 10' nailer up each W200x36 column (one 12' and one 10' per column, slab to the underside of the roof joists)		2	pcs	LSL 1 1/2 x 5 1/2 x 10' x 2	two columns at 20'-2 5/8" each; butt joint at a bolt	Gulf Eng. MF-1	CONNECTION REQUIRES FURTHER DETAILING: not specified on the plans; proposed by BWD, Hossein to accept.
Steel connection	1/2" through-bolts with nut and washer, LSL nailer to the column flange		34	bolts	1/2" through-bolts with nut and washer (LSL and 2x10 nailers to the steel)	16 per column at 16" o.c., two columns, 2 spare	Gulf Eng. MF-1	Hossein to give the bolt size and spacing.
Membranes	Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip)		1	roll	Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip)	isolates the wood from the steel: no condensation or galvanic contact at the bolts	BWD	Provide unless Hossein or Kunaal says it is not required. About 46 LF needed; one roll.

SILL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Plate washers 3" x 3" x 1/4"		26	pcs	Plate washers 3" x 3" x 1/4"	under every anchor nut	OBC 9.23.6	
Membranes	Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside		2	rolls	Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside	76 LF of curb	Marek, 21 Oct	over the masonry at the sill; 15% for laps
Membranes	Blueskin primer (Blue Prep or Aquatac), 3.78 L		2	pails	Blueskin primer (Blue Prep or Aquatac), 3.78 L	primer under the Blueskin on concrete; about 20 m2 per pail	Henry/Bakor data sheet	
Membranes	Sill gasket 5 1/2" x 82' foam		2	rolls	Sill gasket 5 1/2" x 82' foam	under every bottom plate on the curb (A406 'sill sealer, bond break')	A406	
Lumber	2x12 PT sill at the slab, 16'		2	pcs	2x12 PT x 16' x 2	detail 2-A403: 2x12 PT sill fastened to the foundation wall with concrete screws	A403	location per the detail; verify extent

1ST FLOOR WALLS, CURB TO THE DECK

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 1 – GROUND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci		61	pcs	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci	437 sq ft net over the DensGlass, N, S and E elevations	A004 W1, W2	THICKNESS TO CONFIRM: 75 mm per the A004 wall schedule; a detail in the set notes 4" exterior Rockwool. 10% waste, openings deducted

1ST FLOOR WALLS, CURB TO THE DECK, WEST WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)		6	pcs	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)	42 sq ft net, the two infill panels beside the curtain wall	A004 W1a	10% waste. Stick-pinned per W1a

1ST FLOOR EXTERIOR WALLS

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.		500	sq ft	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.	474 sq ft net of stud cavity, openings deducted	A004 W1	5% waste; bag count to suit the brand

BATCH 1 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded) **$7,189 before HST**

NOTES

1. GF-E-DOOR: the entry door DX01 (850 x 2100) runs to the slab, so the curb is interrupted there. Verify against the foundation as poured; if the curb is continuous the door header drops to the schedule height and the bay reverts to the curb wall.

2. West infill panels GF-W-N and GF-W-S: 970 mm each per A101. The three DX02 curtain-wall doors between them are by the window supplier. Jambs are tied to the W200x36 columns with a 2x6 nailer and 1/2" bolts, an allowance until Hossein details it.

3. Posts P1 (2-2x6), P2 (3-2x6), P3 (4-2x6) from the engineer's second floor sheet, counted on the ground floor under the beam lines and at the east wall jambs. Squash blocks above them are on T 1.03.

4. Blocking rows: the stock quantity on each blocking line is what to order if the stud drops are not there. Ground floor curb studs leave 7" per 12', too short; order the 12' shown.

5. Partitions (A101, A301 section A, T 1.05): the main stair is a straight run along the north wall from the entry up to grid 2, so nothing full height crosses the strip. The mech room sits under the high end of the run; its east wall is a pony wall cut to the stringer line, its west wall at the well end carries the 2F wall above. The W/C east wall at 6050 is the bedroom's west wall and stacks under the 2F kitchen wall; the corridor wall at 2600 carries D2 and D1.

6. DensGlass: 12% waste, openings not deducted. Screws, PCD blade and utility blades are on T 1.06. No building paper is needed under the specified Adhero 3000; see T 1.06.

7. Furring: W1 calls for 25 mm horizontal furring with drainage holes over 75 mm of pinned mineral wool, carrying the 7/8" corrugated metal. Listed as 1x3 at 16"; confirm with the metal supplier whether a clip system replaces it.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Ground Floor Walls – T 1.02

BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Second floor deck on TJI 360 9 1/2" at 16", 16' long, north-south, bearing on the north and south walls. Three zones: the west bay (grid 1 to 2, balcony side), the stair bay (grid 2 to 4, with the stair opening on the north side), the east bay (grid 4 to 6). Two 3-ply LVL beam lines run with the joists under the post loads from above. The stair opening is framed with a 3-ply LVL trimmer and header on HGUS hangers with squash blocks and a post under every bearing. Rim board all round. On the two property-line walls the rim is attached from inside (T 1.09).

DECKS AND ROOFS IN THIS BATCH

member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers

DECK	ZONE	MEMBERS	LENGTH	AREA	PRODUCT	SOURCE	NOTE
F2-Z1	Zone 1, west bay (grid 1 to 2), balcony side	8 @ 16"	15'-11 1/2"	17.9 m2	Weyerhaeuser TJI 360 9 1/2" x 16'	Gulf Eng. 2nd floor framing, Taiga FC2	Bears on the north and south walls. LVL 3-ply beam line at grid 2 (column line C2) carries the post loads from above.
F2-Z2	Zone 2, stair bay (grid 2 to 4)	8 @ 16"	15'-11 1/2"	17.0 m2	Weyerhaeuser TJI 360 9 1/2" x 16'	Gulf Eng., Taiga FC2	Stair opening runs the full bay, double to double: the two full-length 3-ply LVL beam lines are the trimmers and a 3-ply LVL header spans between them about 1050 south of the north rim (the stair is 1000 wide on A102, so the header lands over the mech room south wall) (Taiga FB5-3, FB6-3, FB7-3 with H1 hangers). Tail joists hang on the header.
F2-Z3	Zone 3, east bay (grid 4 to 6), bedroom and W/C	5 @ 16"	15'-11 1/2"	12.3 m2	Weyerhaeuser TJI 360 9 1/2" x 16'	Gulf Eng., Taiga FC2	Sunken tub support (Taiga note) still to be confirmed by the engineer.

DECK TO MOMENT FRAME

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Steel connection	TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers		2	boxes	TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers	deck rim and balcony blocking to the steel beams and outriggers	Gulf Eng. 2nd floor	CONNECTION REQUIRES FURTHER DETAILING. Connectors and fasteners for the deck rim, roof end joist and parapet to the steel are not specified on the plans (no MF-1 issued).
Steel connection	1/2" through-bolts with nut and washer, 2x10 nailer to the W200x36 beam and outrigger flanges		50	bolts	1/2" through-bolts with nut and washer (LSL and 2x10 nailers to the steel)	4 nailers x 16' at 16" o.c., 12 each, 2 spare	Gulf Eng. 2nd floor	Hossein to give the bolt size and spacing.
Lumber	2x10 SPF nailer, 16' (bolted to the steel beam and outriggers)		4	pcs	2x10 x 16' x 4	nailer for the rim, deck and balcony framing at the steel	Gulf Eng.	

ZONE 1, WEST BAY (GRID 1 TO 2), BALCONY SIDE

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 16', cut 15'-11 1/2"	15'-11 1/2"	10	pcs	TJI 360 9 1/2" x 16' x 10	8 joists @ 16" plus 2 for blocking panels and squash	Gulf Eng. 2nd floor framing, Taiga FC2	Bears on the north and south walls. LVL 3-ply beam line at grid 2 (column line C2) carries the post loads from above.
Sheathing	3/4" T&G plywood subfloor 4x8		7	sheets	3/4" T&G plywood subfloor 4x8 x 7	17.9 m2, glued and screwed	A004 F2, Taiga note 9	8% waste
Adhesive	PL400 subfloor adhesive 828 mL		5	tubes	PL400 subfloor adhesive 828 mL	one tube per 1.5 sheets	Taiga note 9	

ZONE 2, STAIR BAY (GRID 2 TO 4)

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Deck – T 1.03

BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 16': one tail joist (11'-11 1/4") south of the header and one infill (3'-2 7/8") north of it from each piece	15'-11 1/2"	10	pcs	TJI 360 9 1/2" x 16' x 10	8 joists @ 16" in the bay, all hung on the full-bay header (double to double), plus 2 for blocking panels; 3 infills north of the header outside the 6'-5 1/8" opening, 5 bays open	Gulf Eng., Taiga FC2	Stair opening runs the full bay, double to double: the two full-length 3-ply LVL beam lines are the trimmers and a 3-ply LVL header spans between them about 1050 south of the north rim (the stair is 1000 wide on A102, so the header lands over the mech room south wall) (Taiga FB5-3, FB6-3, FB7-3 with H1 hangers). Tail joists hang on the header.
Sheathing	3/4" T&G plywood subfloor 4x8		7	sheets	3/4" T&G plywood subfloor 4x8 x 7	17.0 m2, glued and screwed	A004 F2, Taiga note 9	8% waste
Adhesive	PL400 subfloor adhesive 828 mL		5	tubes	PL400 subfloor adhesive 828 mL	one tube per 1.5 sheets	Taiga note 9	

ZONE 3, EAST BAY (GRID 4 TO 6), BEDROOM AND W/C

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 16', cut 15'-11 1/2"	15'-11 1/2"	7	pcs	TJI 360 9 1/2" x 16' x 7	5 joists @ 16" plus 2 for blocking panels and squash	Gulf Eng., Taiga FC2	Sunken tub support (Taiga note) still to be confirmed by the engineer.
Sheathing	3/4" T&G plywood subfloor 4x8		5	sheets	3/4" T&G plywood subfloor 4x8 x 5	12.3 m2, glued and screwed	A004 F2, Taiga note 9	8% waste
Adhesive	PL400 subfloor adhesive 828 mL		4	tubes	PL400 subfloor adhesive 828 mL	one tube per 1.5 sheets	Taiga note 9	

ZONE 2 STAIR

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	2x6 squash blocks at the stair trimmer and header bearings, 9 1/4", two per bearing		8	pcs	2x6 x 8' x 1	the header's two bearings on the beam lines and the beam-line posts below	Weyerhaeuser TJI guide (squash blocks), BWD	from 2x6 drops; 10d into each TJI flange; the load goes straight to the post below
Posts	P2 3-2x6 posts in the ground floor wall under each end of the stair header's beam lines, 5'-8 1/4"	5'-8 1/4"	6	pcs	2x6 x 12' x 3	two posts, three plies, directly under the LVL bearings	Gulf Eng. P2, BWD	The engineer shows P3 at the north wall by the stair; this adds the matching post under the south end of the trimmer. Hossein to confirm.
Beams	LVL 1 3/4 x 9 1/2, 3-ply stair header, double to double	11'-0 3/8"	3	pcs 12'	LVL 1 3/4 x 9 1/2 x 12' x 3	each ply cut 11'-0 3/8"	Gulf Eng. 2nd floor, Taiga FC2	Spans between the two 3-ply beam lines (the trimmers), HGUS5.50/10 at each end. Taiga FB7-3, 12'.

DECK

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	2x6 squash blocks under posts P1 to P3 and the enclosure corners, 9 1/4", two per post		28	pcs	2x6 x 8' x 3	every built-up post lands on a squash block pair, not on the subfloor	Weyerhaeuser TJI guide detail CS	from drops; match the post area

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Deck – T 1.03

BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson H2.5A hurricane ties		8	pcs	Simpson H2.5A hurricane ties	the east and west end joists only; the property-line walls get stiffeners and blocking instead	recommended, not on drawings	**NOT ON DRAWINGS: confirm with Hossein**

DECK PERIMETER (PROPERTY-LINE WALLS)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	Web stiffeners for the TJI 360 at every joist end on the property-line walls: 7/8" x 2 5/16" blocks, 6 5/8" long, one each side of the web, three 8d (0.113 x 2 1/2") nails clinched		74	pcs	7/8" roof sheathing board 4x8 (A004: 22 mm) x 1	two per joist end, 37 ends (37 = south wall all joists, north wall less the stair opening); tight to the bottom flange, gap at the top 1/8" min to 2 3/4" max; each stiffener toe-nailed into the rim	Weyerhaeuser Canada / MiTek connector guide, Web Stiffener Attachment	Rip from 7/8" plywood, same stock as the roof board: one 4x8 sheet gives 19 strips x 14 blocks.
Blocking	TimberStrand LSL blocking panels 1 1/4" x 9 1/2" between the joists at the north and south rims, every other cavity		23	pcs	LSL 1 1/4 x 9 1/2 x 12' x 3	23 cavities, mostly 13 11/16", alternate cavities; toe-nailed to the plate, back-nailed into the rim, and nailed through the stiffener from the open cavity next to it; subfloor nailed into the tops	Weyerhaeuser TJ-9001 blocking panels (A1, B1); BWD method in place of hangers	Cut from 3 pcs 12' LSL, 8 blocks a piece. Every other cavity (William); Hossein to confirm on the braced walls.
Rim board	TimberStrand LSL rim 1 1/4" x 9 1/2" x 12' on the north and south walls (or 1 3/4" LVL), same depth as the TJI		6	pcs	LSL 1 1/4 x 9 1/2 x 12' x 6	the two property-line walls, 31'-9 3/4" each; the stiffeners and blocking nail into it from inside	LSL holds the toe nails from the stiffeners and the blocking; replaces the 1 1/8" rim board throughout	

ZONE 1/2 BOUNDARY

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL 1 3/4 x 9 1/2, 3-ply flush beam at grid 2	15'-11 1/2"	3	pcs 16'	LVL 1 3/4 x 9 1/2 x 16' x 3	each ply cut 15'-11 1/2"	Gulf Eng. 2nd floor	Flush beam line at column C2, carries posts P3 above. Taiga FB5-3.

ZONE 2/3 BOUNDARY

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL 1 3/4 x 9 1/2, 3-ply flush beam at grid 4	15'-11 1/2"	3	pcs 16'	LVL 1 3/4 x 9 1/2 x 16' x 3	each ply cut 15'-11 1/2"	Gulf Eng. 2nd floor	Flush beam line, posts P2 above. Taiga FB6-3.

DECK PERIMETER

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Deck – T 1.03

BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Rim board	Rim, TimberStrand LSL 1 1/4 x 9 1/2 at the east and west ends (or 1 3/4 LVL)		3	pcs 12'	LSL 1 1/4 x 9 1/2 x 12' x 3	32 LF perimeter	Taiga FC2, BWD	LSL rim all round in place of the 1 1/8" rim board on Taiga's layout; the north and south rims are their own line with the hangers. 12' lengths.

2ND FLOOR, STAIR OPENING

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson HGUS5.50/10 hangers		2	pcs	Simpson HGUS5.50/10 hangers	hung ends of FB7-3 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	
Connectors	Simpson IUS2.37/9.5 hangers		14	pcs	Simpson IUS2.37/9.5 hangers	hung ends of TJI tails south of the header, TJI east of the opening, north of the header (rows on T 1.06B); plus 3 spare	Hanger schedule T 1.06B (hangers.py)	

FLOOR BAND AT THE 2ND FLOOR DECK (ALL FACES)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		3	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 3	exterior face of the band, 7.2 m2 measured on the elevations	A004 W1, A200 to A203	12% waste. Bands between the stud walls: missing from T1, which measured DensGlass per wall
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		8	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 8	over the mineral wool at the band	A004 W1	25 mm vented cavity per W1

FLOOR BAND AT THE 2ND FLOOR DECK

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci		9	pcs	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci	68 sq ft net over the DensGlass, N, S and E elevations	A004 W1, W2	THICKNESS TO CONFIRM: 75 mm per the A004 wall schedule; a detail in the set notes 4" exterior Rockwool. 10% waste, openings deducted

FLOOR BAND AT THE 2ND FLOOR DECK, WEST WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)		1	pcs	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)	4 sq ft net, the two infill panels beside the curtain wall	A004 W1a	10% waste. Stick-pinned per W1a

BATCH 2 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded)	$5,496 before HST

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Deck – T 1.03

BATCH 2 – SECOND FLOOR DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

NOTES

1. Taiga's second floor page (FC2) carried 19 x 16' and 9 x 14' PJI-40 with FB5/FB6/FB7 3-ply LVL and 18 sheets of subfloor; the 20 Oct engineer's sheet adds the second full-length beam line and the 16' span, and the product is now Weyerhaeuser TJI 360. Have Taiga or Downtown Lumber re-run the layout on the 30 Sep set before the EWP order.

2. Stair header runs the full bay, double to double (engineer's sheet): the two full-length 3-ply beam lines are the trimmers and the 3-ply header spans between them about 1050 south of the north rim, over the stair's south wall below, with HGUS5.50/10 at each end (Taiga FB5-3, FB6-3, FB7-3). Every joist in the bay is a tail joist on the header (IUS2.37/9.5, T 1.06B). The opening is 6'-5 1/8" from the grid-2 beam line east to the roof-stair winder square, per the engineer; the north strip east of that is framed with short infill joists on the header and the rim and carries the roof-stair winders (T 1.05).

3. Extra support under the stair doubles: 2x6 squash blocks two per bearing, and a P2 3-2x6 post in the ground floor wall under each trimmer end. The engineer shows P3 at the north wall by the stair; the south post is added here for him to confirm.

4. Balcony: 2x6 at 16" on the W200x36 outriggers with solid blocking per the engineer, 2x6 rim, LUS26 at the wall side if the joists do not land on the steel. Cedar decking and sleepers are not in this list.

5. Squash blocks under every post location (P1 to P3 and the enclosure corners), 10d into each flange per the Weyerhaeuser guide, so no post lands on subfloor alone.

6. Subfloor 3/4" T&G; glued and screwed (Taiga note 9). Gypcrete and radiant tubing go on top and are not framing.

7. TJI 360 at 9 1/2": the specifier's guide span table lists 9 1/2" for TJI 110, 210 and 230; confirm with Downtown Lumber that 9 1/2" TJI 360 is the Canadian stock item and that Hossein accepts it for the 15'-11 3/4" span at 40/20 psf.

8. Rim along the north and south walls cannot be nailed from outside once the ground floor walls are up (the neighbours' garages). The joists bear on the plate; web stiffeners at every joist end are toe-nailed into a 1 1/4" LSL rim and LSL blocking panels go in every other cavity, all nails from inside. No hangers at the rim. Detail on T 1.09B.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Deck – T 1.03

BATCH 2B – BALCONY DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Balcony deck on the west, 5'-8 3/8" deep by the full width, on the W200x36 outriggers from the moment frame. Framing is 2x6 at 16" with solid blocking per the engineer, 1/2" plywood, then the roofer's 2-ply modified bitumen, 2x4 pressure-treated sleepers and 25 mm cedar decking (assembly F4). The guardrail is white oak on metal brackets fastened to the beam (A405 detail 1) and is not framing. Kept separate so it can be ordered with the steel or with the finish, whichever comes first.

DECKS AND ROOFS IN THIS BATCH

member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers

DECK	ZONE	MEMBERS	LENGTH	AREA	PRODUCT	SOURCE	NOTE
F2-BAL	Balcony deck (west, on the W200x36 outriggers)	11 @ 16"	5'-8 3/8"	8.6 m2	2x6 SPF #2 @ 16"	Gulf Eng. (2x6 @ 16"), A102, A405 det 1	2x6 joists east-west on the steel outriggers with solid blocking per the engineer; 2x6 rim; guardrail fastened to the beam (A405).

BALCONY DECK (WEST, ON THE W200X36 OUTRIGGERS)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Rafters	2x6 SPF #2 @ 16", 5'-8 3/8"	5'-8 3/8"	12	pcs	2x6 x 12' x 6	11 members plus 1 extra	Gulf Eng. (2x6 @ 16"), A102, A405 det 1	2x6 joists east-west on the steel outriggers with solid blocking per the engineer; 2x6 rim; guardrail fastened to the beam (A405).
Blocking	2x6 solid blocking at the outriggers, 12 pcs at 14 1/2"		12	pcs	2x6 x 12' x 2	engineer: W200x36 outrigger beam + solid blocking	Gulf Eng.	from drops
Joists	2x6 SPF rim at the balcony edge and ledger side, 16'		2	pcs	2x6 x 16' x 2	outer rim and wall-side rim	A102, A405	
Sheathing	1/2" plywood deck sheathing 4x8 (F4: 13 mm plywood under the 2-ply membrane)		4	sheets	1/2" plywood 4x8 x 4	8.6 m2	A004 F4	2-ply modified bitumen membrane over it is by the roofer, not in this list
Decking	2x4 pressure-treated sleepers @ 16" on the membrane, 5'-8 3/8"		14	pcs	2x4 PT x 12' x 7	carry the cedar decking clear of the membrane (F4)	A004 F4	cut from 2x4 PT x 12', two per piece
Decking	5/4 x 6 cedar decking, 8' (A004 F4: 25 mm cedar decking)		29	pcs	5/4 x 6 cedar decking x 8' x 29	8.6 m2 at 5 1/2" face with 1/4" gaps, 12% waste	A004 F4	finish item; include only if North Arrow supplies the decking
Screws	Stainless deck screws #8 x 2 1/2", 350/box		2	boxes	Stainless deck screws #8 x 2 1/2", 350/box	cedar to sleepers, 2 per board per sleeper		
Connectors	Metal railing brackets and the white oak guardrail (A405 detail 1)		0		Metal railing brackets and the white oak guardrail (A405 detail 1)	fastened to the beam, pre-drilled and countersunk	A405	EXCLUDED: millwork and metal, not framing

BALCONY DECK

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL 1 3/4 x 9 1/2, 3-ply edge beam along the laneway side, between the outrigger ends	16'-2"	3	pcs 18'	LVL 1 3/4 x 9 1/2 x 18' x 3	each ply cut 16'-2"	Gulf Eng. 2nd floor, A405	Engineer's second floor sheet: 3-ply LVL at the balcony edge; the guardrail is fastened to it (A405 det 1).
Connectors	Simpson LUS26 hangers		22	pcs	Simpson LUS26 hangers	hung ends of Balcony joists (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	

BATCH 2B BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded) **$1,412 before HST**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Balcony Deck – T 1.03B

BATCH 2B – BALCONY DECK

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

NOTES

1. F4 on A004: cedar decking on sleepers, 2-ply modified bitumen membrane, 1/2" plywood, 240 mm floor joists 'refer to structural'. The engineer's second floor sheet shows 2x6 at 16" on the outriggers, which is what is listed; if Hossein meant 2x10 to match the deck depth the count is the same and the stock changes to 2x10 x 8'.
2. Joist bearing: on the steel outriggers with solid blocking between. The LUS26 hangers at the wall side only apply if the joists do not land on the steel beam; confirm with the steel shop drawings.
3. The downspout runs below the wood decking (A102). Leave the sleeper layout open at the downspout.
4. Decking and stainless screws are finish items; delete them if the owner or the millwork side supplies the cedar.
5. The balcony membrane, drip edge and the guardrail brackets are by others.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Balcony Deck – T 1.03B

BATCH 3 – SECOND FLOOR WALLS

by William

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

Second floor walls on the subfloor. West zone (grid 1 to 2) walls are 10'-7" with 122 1/2" studs from 12' stock. East of grid 2 the walls stop under the lower framing level (north wall and W/C walls, 7'-7 7/8") or the flat east low roof (7'-9 1/2"), and the south wall under the sloped roof rakes between the two (architect's 16 Oct model, A302 sections 1 and 2). Headers on the east wall are 2-2x8 and 3-2x8 per the engineer. Posts P1 to P3 repeat above the ground floor posts. Interior partitions 2x4, plywood clad.

WALLS IN THIS BATCH

lengths out to out of studs; heights from the plate below to the underside of the framing above; openings per the A405 schedules

WALL	ZONE	LENGTH	HEIGHT	STUD CUT	OPENINGS	SOURCE	NOTE
2F-N-W	North wall, west zone (grid 1 to grid 2)	11'-6 3/4"	10'-7"	10'-2 1/2"	none	A102, A300, DXF 16 Oct	10'-7" wall to the east face of the grid-2 roof beam. No openings on the north side in the west zone.
2F-S-W	South wall, west zone (grid 1 to grid 2)	11'-6 3/4"	10'-7"	10'-2 1/2"	none	A102, A302, DXF 16 Oct	10'-7" wall. No openings.
2F-S-SL	South wall under the sloped roof (grid 2 to the foot beam), raked top	6'-2 5/8"	9'-2 1/8"	8'-9 5/8"	none	A103, DXF 16 Oct	Top plate follows the sloped roof down from the west wall height at grid 2 to the east roof height at the foot beam (the architect's model steps the stud tops down the same way). Studs cut to the rake.
2F-W-N	West wall, north infill panel (balcony side)	2'-4 7/8"	10'-7"	10'-2 1/2"	none	A102	Three DX02 doors between the two panels, curtain wall by supplier. Moment frame beam above.
2F-W-S	West wall, south infill panel	2'-4 7/8"	10'-7"	10'-2 1/2"	none	A102	
2F-N-E	North wall east of grid 2, under the lower level and the enclosure floor	19'-5 5/8"	7'-7 7/8"	7'-3 3/8"	none	A102, A301, A302, DXF 16 Oct	Top plate at the underside of the lower framing level (2F + 7'-5 3/8"); the 2x10 rim on it carries the enclosure north wall. The drop beam and the grid-3 beam bear here.
2F-S-E	South wall, east zone (foot beam to grid 6)	13'-3"	7'-9 1/4"	7'-4 7/8"	none	A102, A302, DXF 16 Oct	Under the flat east low roof: top plate 2548 above the finished floor less the 2x10 (A302 section 1). Drainage is in the tapered insulation, not the framing.
2F-E	East wall (garden side)	15'-3"	7'-9 1/4"	7'-4 7/8"	W08, W04, W03+W02	A102, A405	Headers 2-2x8 and 3-2x8 per the engineer's second floor framing sheet. Posts P1 (2-2x6) and P2 (3-2x6) under the LVL and at the window jambs per engineer. The architect's model also draws a 3-ply 2x10 along the top of this wall; the engineer's headers govern.
2F-P-WC-W	W/C west wall beside the stair (P1b 2x4)	3'-2 1/4"	7'-7 7/8"	7'-3 3/8"	none	A102	The wall between the top of the stair and the W/C (A102: W/C 2768 long against the east wall). Stops at the W/C south wall. Under the enclosure floor.
2F-P-WC-S	W/C south wall with door D4 (P1a 2x4)	9'-1"	7'-7 7/8"	7'-3 3/8"	D4	A102	
2F-P-WELL-W	Wall at the top of the stair, west end of the well (P1a 2x4)	3'-4"	7'-7 7/8"	7'-3 3/8"	none	A102, A301 section A	Stops at the underside of the exposed grid-2 drop beam; above it the step to the high roof is open with a guard. The drop beam's east face sits 5/8" over this wall's top plate.
2F-P-COR	Corridor wall, bedroom north with door D5 and the W/D closet (P1a 2x4)	3'-6 1/4"	7'-9 1/4"	7'-4 7/8"	D5	A102	
2F-P-BED-W	Kitchen / bedroom wall (P1a 2x4), stacked over the ground floor W/C east wall	7'-2 1/8"	7'-9 1/4"	7'-4 7/8"	none	A102	Under the east low roof (east of the foot beam), so at the east-zone height, not the west.

NORTH WALL, WEST ZONE (GRID 1 TO GRID 2)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 10'-2 1/2"	10'-2 1/2"	12	pcs	2x6 x 12' x 13	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102, A300, DXF 16 Oct	5% extra
Plates	2x6 plates, 35 LF		3	pcs 16'	2x6 x 16' x 3	bottom plate and double top plate	A102, A300, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 9 pcs at 14 1/2" (11 LF)		9	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102, A300, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		5	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 5	exterior face, 11.4 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		13	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 13	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

SOUTH WALL, WEST ZONE (GRID 1 TO GRID 2)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 10'-2 1/2"	10'-2 1/2"	12	pcs	2x6 x 12' x 13	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102, A302, DXF 16 Oct	5% extra
Plates	2x6 plates, 35 LF		3	pcs 16'	2x6 x 16' x 3	bottom plate and double top plate	A102, A302, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 9 pcs at 14 1/2" (11 LF)		9	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102, A302, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		5	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 5	exterior face, 11.4 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		13	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 13	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

SOUTH WALL UNDER THE SLOPED ROOF (GRID 2 TO THE FOOT BEAM), RAKED TOP

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 10'-6"	10'-6"	2	pcs	2x6 x 12' x 3	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 10'-0"	10'-0"	1	pcs	2x6 x 12' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 9'-0"	9'-0"	1	pcs	2x6 x 10' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 8'-6"	8'-6"	1	pcs	2x6 x 104 5/8" precut x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 8'-0"	8'-0"	1	pcs	2x6 x 10' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 7'-6"	7'-6"	2	pcs	2x6 x 92 5/8" precut x 3	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, DXF 16 Oct	5% extra
Plates	2x6 plates, 20 LF		2	pcs 16'	2x6 x 16' x 2	bottom plate and double top plate	A103, DXF 16 Oct	10% for splices and laps at corners

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	2x6 mid-height blocking, 5 pcs at 14 1/2" (6 LF)		5	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A103, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		2	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 2	exterior face, 5.3 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		6	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 6	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

WEST WALL, NORTH INFILL PANEL (BALCONY SIDE)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 10'-2 1/2"	10'-2 1/2"	5	pcs	2x6 x 12' x 6	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102	5% extra
Plates	2x6 plates, 7 LF		1	pcs 16'	2x6 x 16' x 1	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 2 pcs at 14 1/2" (2 LF)		2	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		1	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 1	exterior face, 2.4 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		3	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 3	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

WEST WALL, SOUTH INFILL PANEL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 10'-2 1/2"	10'-2 1/2"	5	pcs	2x6 x 12' x 6	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102	5% extra
Plates	2x6 plates, 7 LF		1	pcs 16'	2x6 x 16' x 1	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 2 pcs at 14 1/2" (2 LF)		2	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		1	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 1	exterior face, 2.4 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		3	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 3	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

NORTH WALL EAST OF GRID 2, UNDER THE LOWER LEVEL AND THE ENCLOSURE FLOOR

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-3 3/8"	7'-3 3/8"	18	pcs	2x6 x 92 5/8" precut x 19	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102, A301, A302, DXF 16 Oct	5% extra
Plates	2x6 plates, 58 LF		5	pcs 16'	2x6 x 16' x 5	bottom plate and double top plate	A102, A301, A302, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 15 pcs at 14 1/2" (18 LF)		15	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A102, A301, A302, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		6	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 6	exterior face, 13.9 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		16	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 16	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

SOUTH WALL, EAST ZONE (FOOT BEAM TO GRID 6)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-4 7/8"	7'-4 7/8"	13	pcs	2x6 x 92 5/8" precut x 14	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102, A302, DXF 16 Oct	5% extra
Plates	2x6 plates, 40 LF		3	pcs 16'	2x6 x 16' x 3	bottom plate and double top plate	A102, A302, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 10 pcs at 14 1/2" (12 LF)		10	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A102, A302, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		4	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 4	exterior face, 9.6 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		11	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 11	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

EAST WALL (GARDEN SIDE)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-4 7/8"	7'-4 7/8"	11	pcs	2x6 x 92 5/8" precut x 12	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); W08 king studs; W04 king studs; W03+W02 king studs	A102, A405	5% extra

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 6'-9 5/8"	6'-9 5/8"	12	pcs	2x6 x 14' x 7	W08 double jack studs (king, jack, jack each side); W04 double jack studs (king, jack, jack each side); W03+W02 double jack studs (king, jack, jack each side)	A102, A405	2 per 14' stock piece, 5% extra
Studs	2x6 studs, cut 4'-5"	4'-5"	3	pcs	2x6 x 10' x 2	W08 cripples below sill	A102, A405	2 per 10' stock piece, 5% extra
Studs	2x6 studs, cut 3'-5 1/8"	3'-5 1/8"	5	pcs	2x6 x 8' x 3	W03+W02 cripples below sill	A102, A405	2 per 8' stock piece, 5% extra
Headers	2x8 header, 3'-4 3/8"	3'-4 3/8"	2	pcs	2x8 x 8' x 1	W08 2-2x8 header (engineer, east wall); head dropped 3.1" to fit under the plates	A102, A405	
Headers	2x8 header, 3'-1 1/2"	3'-1 1/2"	2	pcs	2x8 x 10' x 1	W04 2-2x8 header (engineer, east wall); head dropped 7.0" to fit under the plates	A102, A405	
Headers	2x8 header, 6'-1 7/8"	6'-1 7/8"	3	pcs	2x8 x 8' x 3	W03+W02 3-2x8 header (engineer); head dropped 3.1" to fit under the plates	A102, A405	
Headers	2x6 window sills (double), 18 LF		4	pcs	2x6 x 16' x 2	rough sills under windows, two plies per opening	A102, A405	cut from 16' stock, 10% for cuts
Plates	2x6 plates, 46 LF		4	pcs 16'	2x6 x 16' x 4	bottom plate and double top plate	A102, A405	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 12 pcs at 14 1/2" (15 LF)		12	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A102, A405	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		5	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 5	exterior face, 11.0 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		13	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 13	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

W/C WEST WALL BESIDE THE STAIR (P1B 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 7'-3 3/8"	7'-3 3/8"	6	pcs	2x4 x 92 5/8" precut x 7	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102	5% extra
Plates	2x4 plates, 10 LF		1	pcs 16'	2x4 x 16' x 1	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		2	sheets	1/2" plywood 4x8 x 2	4.5 m2 both faces	A005 note 16, A004 P1a	10% waste

W/C SOUTH WALL WITH DOOR D4 (P1A 2X4)

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 7'-3 3/8"	7'-3 3/8"	10	pcs	2x4 x 92 5/8" precut x 11	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); D4 king studs	A102	5% extra
Studs	2x4 studs, cut 7'-1 7/8"	7'-1 7/8"	4	pcs	2x4 x 92 5/8" precut x 5	D4 double jack studs (king, jack, jack each side)	A102	5% extra
Headers	2x4 header, 2'-5"	2'-5"	1	pcs	2x4 x 8' x 1	D4 flat 2x4 header (non-bearing partition)	A102	
Plates	2x4 plates, 27 LF		2	pcs 16'	2x4 x 16' x 2	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 7 pcs at 14 1/2" (8 LF)		7	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		5	sheets	1/2" plywood 4x8 x 5	12.9 m2 both faces	A005 note 16, A004 P1a	10% waste

WALL AT THE TOP OF THE STAIR, WEST END OF THE WELL (P1A 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 7'-3 3/8"	7'-3 3/8"	6	pcs	2x4 x 92 5/8" precut x 7	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102, A301 section A	5% extra
Plates	2x4 plates, 10 LF		1	pcs 16'	2x4 x 16' x 1	bottom plate and double top plate	A102, A301 section A	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102, A301 section A	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		2	sheets	1/2" plywood 4x8 x 2	4.7 m2 both faces	A005 note 16, A004 P1a	10% waste

CORRIDOR WALL, BEDROOM NORTH WITH DOOR D5 AND THE W/D CLOSET (P1A 2X4)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 7'-4 7/8"	7'-4 7/8"	6	pcs	2x4 x 92 5/8" precut x 7	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); D5 king studs	A102	5% extra
Studs	2x4 studs, cut 7'-1 7/8"	7'-1 7/8"	4	pcs	2x4 x 92 5/8" precut x 5	D5 double jack studs (king, jack, jack each side)	A102	5% extra
Headers	2x4 header, 2'-10 7/8"	2'-10 7/8"	1	pcs	2x4 x 10' x 1	D5 flat 2x4 header (non-bearing partition)	A102	
Plates	2x4 plates, 11 LF		1	pcs 16'	2x4 x 16' x 1	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 3 pcs at 14 1/2" (4 LF)		3	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		2	sheets	1/2" plywood 4x8 x 2	5.1 m2 both faces	A005 note 16, A004 P1a	10% waste

KITCHEN / BEDROOM WALL (P1A 2X4), STACKED OVER THE GROUND FLOOR W/C EAST WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x4 studs, cut 7'-4 7/8"	7'-4 7/8"	9	pcs	2x4 x 92 5/8" precut x 10	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A102	5% extra
Plates	2x4 plates, 22 LF		2	pcs 16'	2x4 x 16' x 2	bottom plate and double top plate	A102	10% for splices and laps at corners
Blocking	2x4 mid-height blocking, 6 pcs at 14 1/2" (7 LF)		6	pcs	2x4 x 12' x 1	one row at mid-height, fire stop at 10' walls	A102	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x4 x 12'
Sheathing	1/2" plywood, both faces (note 16, partitions plywood clad)		4	sheets	1/2" plywood 4x8 x 4	10.4 m2 both faces	A005 note 16, A004 P1a	10% waste

SECOND FLOOR

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Posts	P3 4-2x6 built-up post, 10'-2 1/2" plies	10'-2 1/2"	8	pcs	2x6 x 12' x 8	Over the grid 2 line, carries roof beam B8-3.	Gulf Eng., Taiga	built-up posts nailed per OBC 9.23.10; glue optional
Posts	P2 3-2x6 built-up post, 10'-2 1/2" plies	10'-2 1/2"	12	pcs	2x6 x 12' x 12	Grid 4 line and east wall.	Gulf Eng.	built-up posts nailed per OBC 9.23.10; glue optional
Posts	P1 2-2x6 built-up post, 7'-3 3/8" plies	7'-3 3/8"	6	pcs	2x6 x 92 5/8" precut x 6	East wall jambs.	Gulf Eng.	built-up posts nailed per OBC 9.23.10; glue optional

STAIRS, MAIN FLIGHT (SLAB TO SECOND FLOOR)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Stairs	LVL 1 3/4 x 11 1/4 notched stringers, 14' (A404 det 3)	12'-10 3/8"	3	pcs 14'	LVL 1 3/4 x 11 1/4 x 14' x 3	12 straight risers at 200 on 255 runs plus three winders at the top, 1000 wide: two outside stringers and one centre; winder carriages below	A404 det 3, A301 section A	Stringer line 12'-10" over 9'-2 1/2" of straight run; notch at the base per det 3, 6 7/8" min throat
Stairs	5/8" plywood sub-treads and risers (A404 det 1: 5/8" plywood subfloor typical for all treads)		3	sheets	5/8" plywood sub-treads and risers 4x8 x 3	14 treads at 11" and 15 risers at 7 7/8", 1000 wide: 6.9 m2	A404 det 1	solid wood 1 1/2" treads and the white oak veneer risers are by the millwork side, not on this list
Stairs	2x10 SPF winder carriages and riser boxes for the three top winders, 10'		4	pcs	2x10 x 10' x 4	three carriages from the pivot post plus the riser boxes; 4x4 pivot post from a 2x6 pair	Engineer's 2F sheet, A102	
Stairs	2x4 pressure-treated kicker at the slab, 8'		1	pc	2x4 PT x 8' x 1	stringer base notch bears on it, Tapcon to the slab (det 3: notch stringer at base)	A404 det 3	

2ND FLOOR WALLS

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 3 – SECOND FLOOR WALLS

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci		91	pcs	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci	654 sq ft net over the DensGlass, N, S and E elevations	A004 W1, W2	THICKNESS TO CONFIRM: 75 mm per the A004 wall schedule; a detail in the set notes 4" exterior Rockwool. 10% waste, openings deducted

2ND FLOOR WALLS, WEST WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)		7	pcs	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)	51 sq ft net, the two infill panels beside the curtain wall	A004 W1a	10% waste. Stick-pinned per W1a

2ND FLOOR EXTERIOR WALLS

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.		715	sq ft	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.	681 sq ft net of stud cavity, openings deducted	A004 W1	5% waste; bag count to suit the brand

BATCH 3 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded) **$8,029 before HST**

NOTES

1. 2F-E: the east wall carries W08, W04, W03 and W02 at the second floor; header sizes from the engineer's sheet (2-2x8 and 3-2x8). Jack lengths follow the schedule heights plus 2"; the window shop drawings govern.
2. 2F-W-N and 2F-W-S: the infill panels beside the three DX02 curtain-wall doors at the balcony. The steel beam is the header.
3. From the architect's 16 Oct model: the high walls stop at grid 2. The old step at 19'-11 3/8" (A103 scaled) is gone; the south wall rakes from grid 2 to the foot of the slope at 18'-6 3/4".
4. 2F partitions (A102): the kitchen/bedroom wall is at 6050 stacked over the W/C east wall, not at grid 4; the corridor wall at 2600 with D5 and the W/D closet, and the wall at the top of the stair at the well end (section A) are added.
5. Mid-height blocking in the 10'-7" walls is also the fire stop; the 12' studs leave a 21 1/2" drop, one block each.
6. DensGlass on the second floor walls is sheathed with the walls lying down and the sheet run 10 1/2" past the bottom plate so it covers the rim when the wall is tilted up (T 1.09). Add that strip to the sheet count: it is inside the 12% waste.
7. LSL option for these studs is priced on T 1.07.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Second Floor Walls – T 1.04

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Roofs, parapets and the stair enclosure. ENGINEERING NOT COMPLETE: Gulf Engineering has issued no roof framing sheet (Marek, 21 Oct: 'no roof for some reason'). The west roof (grid 1 to 2) is framed per Taiga's layout; east of grid 2 is framed from the architect's 16 Oct model (DXF layer S-BEAM) and A302 sections 1 and 2: a lower framing level 2506 above the finished floor (drop beam on grid 2, beam on grid 3, headers, the enclosure floor) that the roof stair lands on and the enclosure stands on, a sloped roof at about 24 deg round skylight W12, and the flat east low roof 2548 to the top of the joists. The sizes are the architect's placeholders, carried so the yard can price them. The stair enclosure roof is R3 (2x8 rafters, 2x4 purlins, 5/8" board, standing seam). Parapets per detail 2-A400 with an LVL end joist below. Do not order this batch until the roof sheet exists.

WALLS IN THIS BATCH

lengths out to out of studs; heights from the plate below to the underside of the framing above; openings per the A405 schedules

WALL	ZONE	LENGTH	HEIGHT	STUD CUT	OPENINGS	SOURCE	NOTE
PAR-W	Parapet, west edge over the balcony	15'-3"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A302	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below.
PAR-N-W	Parapet, north edge west zone (grid 1 to the enclosure)	12'-0 5/8"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A302	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below.
PAR-S-W	Parapet, south edge west zone (grid 1 to grid 2)	12'-4 1/8"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A302	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below.
PAR-S-E	Parapet, south edge east low roof (foot beam to grid 6)	13'-3"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A302	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below.
PAR-E	Parapet, east edge (low roof)	8'-11 5/8"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A302	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below.
PAR-S-SL	Parapet, south edge of the sloped roof (follows the slope)	6'-2 5/8"	1'-8 5/8"	1'-5 5/8"	none	A400 det 2, A103, A302 section 2	W2 parapet: 2x4 bottom plate on the roof joists, 2x6 studs @ 16", 2x6 top plate, 3/4" exterior plywood both faces, LVL end joist below. Assumed to run parallel to the slope at the same height above the roof as the other parapets; A302 section 2 cuts it but the shape along the slope is not drawn. Kunaal to confirm.
ENC-N	Stair enclosure, north wall (grid 2 to the east wall), on the enclosure floor	19'-5 5/8"	7'-9 3/8"	7'-4 7/8"	none	A103, A301, DXF 16 Oct	Stands on the lower level (the rim on the 2F north wall) and runs up to the stair roof: 7'-9 3/8" (the architect's model 7'-5 5/8" to its lower rafters). Property line: no windows. Replaces the two north walls of the earlier draft.
ENC-E	Stair enclosure, east wall (W06 north, W05 south: east elevation)	6'-3 3/8"	7'-9 3/8"	7'-4 7/8"	W06+W05	A103, A203, DXF 16 Oct	On the enclosure floor. W06/W05 mulled pair (A202), one header across, corner to corner as the architect draws it: 1/2" rough opening allowance, one jack each end, the enclosure corner studs act as the kings. FLAG: not standard framing (king and two jacks each end); OBC 9.23.12.3 note 4 allows 1 1/2" bearing for a header up to 3 m. The window shop drawings govern.
ENC-S-W	Stair enclosure, south wall over the sloped roof (grid 2 to the foot beam), raked bottom	6'-0 5/8"	6'-2 7/8"	5'-10 3/8"	none	A103, A302 section 2, DXF 16 Oct	Bottom plate on the sloped roof's north edge, stepping down the slope as the architect's model draws it; top level at the stair roof. No windows. 600 mm roof overhang on this side (3-A400).
ENC-S-E	Stair enclosure, south wall east of the slope (foot beam to the east wall, W11 and W10)	13'-3"	7'-8 1/2"	7'-4"	W11+W10	A103, A300, DXF 16 Oct	Bottom plate on headers H-B and H-C (top flush with the east roof joists, 7/8" above the enclosure floor), 7'-8 1/2". W11 (outswing access to the heat pump, sill 4" above the east roof deck) then W10 fixed 2400 x 1300, at the same positions as before; still drawn as a mulled pair sharing a jamb. Kunaal / window shop to confirm.
ENC-W	Stair enclosure, west wall (grid 2): W05 north, W06 south (A103)	7'-2 1/2"	4'-10"	4'-5 1/2"	W05+W06	A103, DXF 16 Oct	Framed as the east wall: corner to corner, one jack each end, corner studs as kings, 1/2" rough opening allowance. FLAG as on the east wall. This wall runs through the north corner from y = 0, so the pair is offset by the 2x6. W05/W06 mulled pair, one header across, centred as on the east wall. Stands on the west roof deck at grid 2 (the architect's model too). Second W05/W06 pair of the schedule (2 each). Inside, the enclosure floor is about 2'-11" lower: the high roof's east edge is the step.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

DECKS AND ROOFS IN THIS BATCH

member counts at 16" o.c. plus one; the lines below add the extras, blocking and hangers

DECK	ZONE	MEMBERS	LENGTH	AREA	PRODUCT	SOURCE	NOTE
R-W	West roof (grid 1 to 2), R1	8 @ 16"	15'-10 5/8"	17.6 m2	Weyerhaeuser TJI 360 9 1/2" x 16' (Taiga RJ1)	A103, A004 R1, Taiga lower roof	Taiga's engineered layout covers this roof (RJ1 x 9, B8/B9/B10 LVL). 2 degree slope by tapered insulation above.
R-SLOPE	Sloped roof south of the stair enclosure (grid 2 to the foot beam), around skylight W12, R1	7 @ 16"	6'-6 1/8"	6.0 m2	sloped 2x10 members and short joists (listed under the sloped roof lines)	A103, A302 section 2, DXF 16 Oct	**NO ENGINEER'S ROOF SHEET. A103 draws this roof at 23.8 deg with W12 in it; the architect's 16 Oct model frames it with four sloped 2x10 lines (doubled at the skylight) and short 2x10 joists between.**
L-ENC-W	Enclosure floor, grid 2 to 3, between the roof-stair opening and the enclosure south wall	6 @ 16"	2'-9 1/4"	2.3 m2	Weyerhaeuser TJI 360 9 1/2" @ 16"	A302 section 2, A103	NOT IN THE ARCHITECT'S MODEL: the DXF has the two headers but nothing between them. A302 section 2 draws the floor continuous, so 2x10 at 16" hung between H-A and H-B is added. Hossein to confirm.
L-ENC-E	Enclosure floor east of grid 3, over the W/C	6 @ 16"	6'-9 3/4"	6.0 m2	Weyerhaeuser TJI 360 9 1/2" @ 16"	DXF 16 Oct, A301	2x6 at 16" in the architect's model, north rim to header H-C, span 6'-9 3/4". Set flush with the floor west of grid 3 (the model has them 1 1/2" lower). Hossein to size.
R-E	East low roof south of the stair enclosure (foot beam to the east wall), R1, heat pump platform	7 @ 16"	8'-9 7/8"	10.7 m2	Weyerhaeuser TJI 360 9 1/2" @ 16"	A103, A302 section 1, DXF 16 Oct	**Framed flat at 2548 above the finished floor to the top of the joists (A302 section 1, the architect's model agrees exactly); the 1:29 falls to the drain are in the tapered insulation. Joists hang on H-B and H-C at the north end and bear on the south wall. NO ENGINEER'S ROOF SHEET.**
R-ENC	Stair enclosure roof, R3 standing seam	12 @ 16"	9'-2 1/8"	16.8 m2	2x8 SPF #2 rafters @ 16" (R3: 183 mm members)	A004 R3, A302, A400 det 3	Rafters north-south over the 2 m enclosure with the 600 mm overhang to the south. Two decks, as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier, 2x4 purlins on edge @ 24" across it making the vented cavity, 1/2" plywood on the purlins under the ice and water shield and standing seam.

PARAPET, WEST EDGE OVER THE BALCONY

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-5 5/8"	1'-5 5/8"	15	pcs	2x6 x 8' x 4	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A400 det 2, A302	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 31 LF		3	pcs 16'	2x6 x 16' x 3	2x4 bottom plate and 2x6 top plate	A400 det 2, A302	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 12 pcs at 14 1/2" (15 LF)		12	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A400 det 2, A302	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		2	sheets	3/4" exterior-grade plywood 4x8 x 2	4.9 m2	A400 det 2	

PARAPET, NORTH EDGE WEST ZONE (GRID 1 TO THE ENCLOSURE)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-5 5/8"	1'-5 5/8"	13	pcs	2x6 x 8' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A400 det 2, A302	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 24 LF		2	pcs 16'	2x6 x 16' x 2	2x4 bottom plate and 2x6 top plate	A400 det 2, A302	10% for splices and laps at corners

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	2x6 mid-height blocking, 10 pcs at 14 1/2" (12 LF)		10	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A400 det 2, A302	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		2	sheets	3/4" exterior-grade plywood 4x8 x 2	3.8 m2	A400 det 2	

PARAPET, SOUTH EDGE WEST ZONE (GRID 1 TO GRID 2)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-5 5/8"	1'-5 5/8"	13	pcs	2x6 x 8' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A400 det 2, A302	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 25 LF		2	pcs 16'	2x6 x 16' x 2	2x4 bottom plate and 2x6 top plate	A400 det 2, A302	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 10 pcs at 14 1/2" (12 LF)		10	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A400 det 2, A302	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		2	sheets	3/4" exterior-grade plywood 4x8 x 2	3.9 m2	A400 det 2	

PARAPET, SOUTH EDGE EAST LOW ROOF (FOOT BEAM TO GRID 6)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-5 5/8"	1'-5 5/8"	13	pcs	2x6 x 8' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A400 det 2, A302	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 26 LF		2	pcs 16'	2x6 x 16' x 2	2x4 bottom plate and 2x6 top plate	A400 det 2, A302	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 10 pcs at 14 1/2" (12 LF)		10	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A400 det 2, A302	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		2	sheets	3/4" exterior-grade plywood 4x8 x 2	4.2 m2	A400 det 2	

PARAPET, EAST EDGE (LOW ROOF)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-5 5/8"	1'-5 5/8"	10	pcs	2x6 x 8' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A400 det 2, A302	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 18 LF		2	pcs 16'	2x6 x 16' x 2	2x4 bottom plate and 2x6 top plate	A400 det 2, A302	10% for splices and laps at corners

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Blocking	2x6 mid-height blocking, 7 pcs at 14 1/2" (8 LF)		7	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A400 det 2, A302	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		2	sheets	3/4" exterior-grade plywood 4x8 x 2	2.9 m2	A400 det 2	

PARAPET, SOUTH EDGE OF THE SLOPED ROOF (FOLLOWS THE SLOPE)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 1'-6"	1'-6"	8	pcs	2x6 x 8' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A400 det 2, A103, A302 section 2	5 per 8' stock piece, 5% extra
Plates	2x6 plates, 14 LF		1	pcs 16'	2x6 x 16' x 1	2x4 bottom plate and 2x6 top plate	A400 det 2, A103, A302 section 2	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 5 pcs at 14 1/2" (6 LF)		5	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A400 det 2, A103, A302 section 2	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	3/4" exterior-grade plywood, both faces of parapet		1	sheets	3/4" exterior-grade plywood 4x8 x 1	2.0 m2	A400 det 2	

STAIR ENCLOSURE, NORTH WALL (GRID 2 TO THE EAST WALL), ON THE ENCLOSURE FLOOR

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-4 7/8"	7'-4 7/8"	18	pcs	2x6 x 92 5/8" precut x 19	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A103, A301, DXF 16 Oct	5% extra
Plates	2x6 plates, 58 LF		5	pcs 16'	2x6 x 16' x 5	bottom plate and double top plate	A103, A301, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 15 pcs at 14 1/2" (18 LF)		15	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A103, A301, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		6	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 6	exterior face, 14.1 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		16	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 16	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

STAIR ENCLOSURE, EAST WALL (W06 NORTH, W05 SOUTH: EAST ELEVATION)

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-4 7/8"	7'-4 7/8"	4	pcs	2x6 x 92 5/8" precut x 5	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A103, A203, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 4'-9 1/8"	4'-9 1/8"	2	pcs	2x6 x 10' x 2	W06+W05 one jack each end; the enclosure corner studs act as the kings	A103, A203, DXF 16 Oct	2 per 10' stock piece, 5% extra
Studs	2x6 studs, cut 1'-10 5/8"	1'-10 5/8"	5	pcs	2x6 x 8' x 2	W06+W05 cripples above header	A103, A203, DXF 16 Oct	4 per 8' stock piece, 5% extra
Studs	2x6 studs, cut 1'-8 5/8"	1'-8 5/8"	5	pcs	2x6 x 8' x 2	W06+W05 cripples below sill	A103, A203, DXF 16 Oct	4 per 8' stock piece, 5% extra
Headers	2x10 header, 6'-2 3/8"	6'-2 3/8"	3	pcs	2x10 x 8' x 3	W06+W05 3-2x10 header, confirm with engineer	A103, A203, DXF 16 Oct	
Headers	2x6 window sills (double), 12 LF		2	pcs	2x6 x 16' x 1	rough sills under windows, two plies per opening	A103, A203, DXF 16 Oct	cut from 16' stock, 10% for cuts
Plates	2x6 plates, 19 LF		2	pcs 16'	2x6 x 16' x 2	bottom plate and double top plate	A103, A203, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 5 pcs at 14 1/2" (6 LF)		5	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A103, A203, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		2	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 2	exterior face, 4.5 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		6	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 6	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

STAIR ENCLOSURE, SOUTH WALL OVER THE SLOPED ROOF (GRID 2 TO THE FOOT BEAM), RAKED BOTTOM

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-6"	7'-6"	2	pcs	2x6 x 92 5/8" precut x 3	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 7'-0"	7'-0"	1	pcs	2x6 x 8' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 6'-6"	6'-6"	1	pcs	2x6 x 14' x 1	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	2 per 14' stock piece, 5% extra
Studs	2x6 studs, cut 6'-0"	6'-0"	1	pcs	2x6 x 8' x 2	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 5'-6"	5'-6"	1	pcs	2x6 x 12' x 1	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	2 per 12' stock piece, 5% extra
Studs	2x6 studs, cut 5'-0"	5'-0"	1	pcs	2x6 x 16' x 1	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	3 per 16' stock piece, 5% extra

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 4'-6"	4'-6"	1	pcs	2x6 x 10' x 1	studs cut to the rake (6" band), incl. ends and the 3-stud corners	A103, A302 section 2, DXF 16 Oct	2 per 10' stock piece, 5% extra
Plates	2x6 plates, 19 LF		2	pcs 16'	2x6 x 16' x 2	bottom plate and double top plate	A103, A302 section 2, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 5 pcs at 14 1/2" (6 LF)		5	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A103, A302 section 2, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		2	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 2	exterior face, 3.5 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		4	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 4	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

STAIR ENCLOSURE, SOUTH WALL EAST OF THE SLOPE (FOOT BEAM TO THE EAST WALL, W11 AND W10)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 7'-4"	7'-4"	6	pcs	2x6 x 92 5/8" precut x 7	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end); W11+W10 king studs	A103, A300, DXF 16 Oct	5% extra
Studs	2x6 studs, cut 6'-5 5/8"	6'-5 5/8"	4	pcs	2x6 x 14' x 3	W11+W10 double jack studs (king, jack, jack each side)	A103, A300, DXF 16 Oct	2 per 14' stock piece, 5% extra
Studs	2x6 studs, cut 3 7/8"	3 7/8"	9	pcs	2x6 x 8' x 1	W11+W10 cripples below sill	A103, A300, DXF 16 Oct	23 per 8' stock piece, 5% extra
Headers	2x10 header, 11'-6 7/8"	11'-6 7/8"	3	pcs	2x10 x 12' x 3	W11+W10 3-2x10 header, confirm with engineer	A103, A300, DXF 16 Oct	
Headers	2x6 window sills (double), 23 LF		2	pcs	2x6 x 16' x 2	rough sills under windows, two plies per opening	A103, A300, DXF 16 Oct	cut from 16' stock, 10% for cuts
Plates	2x6 plates, 40 LF		3	pcs 16'	2x6 x 16' x 3	bottom plate and double top plate	A103, A300, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 10 pcs at 14 1/2" (12 LF)		10	pcs	2x6 x 12' x 2	one row at mid-height, fire stop at 10' walls	A103, A300, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 2 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		4	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 4	exterior face, 9.5 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		11	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 11	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

STAIR ENCLOSURE, WEST WALL (GRID 2): W05 NORTH, W06 SOUTH (A103)

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Studs	2x6 studs, cut 4'-5 1/2"	4'-5 1/2"	4	pcs	2x6 x 10' x 3	field studs @ 16" incl. both ends, none inside the openings; L corner, 2 extra studs (3-stud corner, one at each end)	A103, DXF 16 Oct	2 per 10' stock piece, 5% extra
Studs	2x6 studs, cut 3'-8 1/4"	3'-8 1/4"	2	pcs	2x6 x 8' x 2	W05+W06 one jack each end; the enclosure corner studs act as the kings	A103, DXF 16 Oct	2 per 8' stock piece, 5% extra
Studs	2x6 studs, cut 7 3/4"	7 3/4"	5	pcs	2x6 x 8' x 1	W05+W06 cripples below sill	A103, DXF 16 Oct	11 per 8' stock piece, 5% extra
Headers	2x10 header, 6'-2 3/8"	6'-2 3/8"	3	pcs	2x10 x 8' x 3	W05+W06 3-2x10 header, confirm with engineer; head dropped 12.8" to fit under the plates	A103, DXF 16 Oct	
Headers	2x6 window sills (double), 12 LF		2	pcs	2x6 x 16' x 1	rough sills under windows, two plies per opening	A103, DXF 16 Oct	cut from 16' stock, 10% for cuts
Plates	2x6 plates, 22 LF		2	pcs 16'	2x6 x 16' x 2	bottom plate and double top plate	A103, DXF 16 Oct	10% for splices and laps at corners
Blocking	2x6 mid-height blocking, 6 pcs at 14 1/2" (7 LF)		6	pcs	2x6 x 12' x 1	one row at mid-height, fire stop at 10' walls	A103, DXF 16 Oct	Cut from stud drops where the drop is 15" or more; otherwise order 1 pcs 2x6 x 12'
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		2	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 2	exterior face, 3.2 m2	A004 W1	12% waste; openings not deducted
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		4	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 4	over the mineral wool, carries the corrugated metal	A004 W1	25 mm vented cavity per W1

WEST ROOF (GRID 1 TO 2), R1

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 16', cut 15'-10 5/8"	15'-10 5/8"	9	pcs	TJI 360 9 1/2" x 16' x 9	8 joists @ 16" plus 1 for blocking panels and squash	A103, A004 R1, Taiga lower roof	Taiga's engineered layout covers this roof (RJ1 x 9, B8/B9/B10 LVL). 2 degree slope by tapered insulation above.
Sheathing	7/8" roof sheathing board 4x8 (A004: 22 mm)		7	sheets	7/8" roof sheathing board 4x8 (A004: 22 mm) x 7	17.6 m2	A004 R1	10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal

SLOPED ROOF SOUTH OF THE STAIR ENCLOSURE (GRID 2 TO THE FOOT BEAM), AROUND SKYLIGHT W12, R1

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	7/8" roof sheathing board 4x8 (A004: 22 mm)		3	sheets	7/8" roof sheathing board 4x8 (A004: 22 mm) x 3	6.0 m2	A004 R1	10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal

ENCLOSURE FLOOR, GRID 2 TO 3, BETWEEN THE ROOF-STAIR OPENING AND THE ENCLOSURE SOUTH WALL

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 20', cut 2'-9 1/4", 7 from each piece	2'-9 1/4"	7	pcs	TJI 360 9 1/2" x 20' x 1	6 joists @ 16" plus 1 for blocking panels and squash	A302 section 2, A103	NOT IN THE ARCHITECT'S MODEL: the DXF has the two headers but nothing between them. A302 section 2 draws the floor continuous, so 2x10 at 16" hung between H-A and H-B is added. Hossein to confirm. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.
Sheathing	3/4" T&G plywood subfloor 4x8		1	sheets	3/4" T&G plywood subfloor 4x8 x 1	2.3 m2, glued and screwed	A004 F2, Taiga note 9	8% waste
Adhesive	PL400 subfloor adhesive 828 mL		1	tubes	PL400 subfloor adhesive 828 mL	one tube per 1.5 sheets	Taiga note 9	

ENCLOSURE FLOOR EAST OF GRID 3, OVER THE W/C

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 16', cut 6'-9 3/4", 2 from each piece	6'-9 3/4"	7	pcs	TJI 360 9 1/2" x 16' x 4	6 joists @ 16" plus 1 for blocking panels and squash	DXF 16 Oct, A301	2x6 at 16" in the architect's model, north rim to header H-C, span 6'-9 3/4". Set flush with the floor west of grid 3 (the model has them 1 1/2" lower). Hossein to size. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.
Sheathing	3/4" T&G plywood subfloor 4x8		3	sheets	3/4" T&G plywood subfloor 4x8 x 3	6.0 m2, glued and screwed	A004 F2, Taiga note 9	8% waste
Adhesive	PL400 subfloor adhesive 828 mL		2	tubes	PL400 subfloor adhesive 828 mL	one tube per 1.5 sheets	Taiga note 9	

EAST LOW ROOF SOUTH OF THE STAIR ENCLOSURE (FOOT BEAM TO THE EAST WALL), R1, HEAT PUMP PLATFORM

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Joists	TJI 360 9 1/2" x 18', cut 8'-9 7/8", 2 from each piece	8'-9 7/8"	8	pcs	TJI 360 9 1/2" x 18' x 4	7 joists @ 16" plus 1 for blocking panels and squash	A103, A302 section 1, DXF 16 Oct	Framed flat at 2548 above the finished floor to the top of the joists (A302 section 1, the architect's model agrees exactly); the 1:29 falls to the drain are in the tapered insulation. Joists hang on H-B and H-C at the north end and bear on the south wall. NO ENGINEER'S ROOF SHEET. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.
Sheathing	7/8" roof sheathing board 4x8 (A004: 22 mm)		4	sheets	7/8" roof sheathing board 4x8 (A004: 22 mm) x 4	10.7 m2	A004 R1	10% waste; 7/8" is a special order at most yards, 3/4" T&G is the usual substitute, confirm with Kunaal

STAIR ENCLOSURE ROOF, R3 STANDING SEAM

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Rafters	2x8 SPF #2 @ 16", 9'-2 1/8"	9'-2 1/8"	13	pcs	2x8 x 10' x 13	12 members plus 1 extra	A004 R3, A302, A400 det 3	Rafters north-south over the 2 m enclosure with the 600 mm overhang to the south. Two decks, as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier, 2x4 purlins on edge @ 24" across it making the vented cavity, 1/2" plywood on the purlins under the ice and water shield and standing seam. ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.
Blocking	2x8 solid blocking at bearing, 12 pcs at 14 1/2"		12	pcs	2x8 x 12' x 2	between joists over the bearing walls (fire stop at the parapet)	OBC 9.23.9	from joist drops or 2 pcs 12'
Beams	LVL 1 3/4 x 7 1/4 rim and sub-fascia around the enclosure roof: north wall line, overhang end, both ends		4	pcs 20'	LVL 1 3/4 x 7 1/4 x 20' x 4	58 LF; the overhang end carries the integrated gutter and fascia (3-A400)	A400 det 3, OBC 9.23.9	**ENGINEERING NOT COMPLETE: no roof sheet; rim at the bearing wall doubles as the rafter blocking**
Purlins	2x4 purlins on edge @ 24" across the rafters, 6 runs of 19'-9 1/8"		9	pcs 16'	2x4 x 16' x 9	on the 5/8" board over the rafters; the 89 mm vented cavity under the standing seam (R3)	A004 R3, A400 det 3	**ENGINEERING NOT COMPLETE: no roof framing sheet from Gulf Engineering as of 21 Oct. Framed from the architect's assemblies (A004) and sections. Confirm with Hossein before ordering.**
Sheathing	1/2" plywood over the purlins, under the standing seam (R3 top layer)		7	sheets	1/2" plywood 4x8 x 7	16.8 m2 incl. the overhang	A004 R3	top deck of two; the 5/8" board under the purlins is its own line (A004 R3)
Sheathing	5/8" roof sheathing board 4x8 on the rafters, under the purlins (R3 lower deck, carries the air and vapour barrier)		7	sheets	5/8" roof sheathing board 4x8 on the rafters x 7	16.8 m2 incl. the overhang	A004 R3	10% waste

STAIRS, ROOF FLIGHT (SECOND FLOOR TO ENCLOSURE)

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Stairs	LVL 1 3/4 x 11 1/4 notched stringers for the straight run between the two winder squares, 8'	7'-2 5/8"	2	pcs 8'	LVL 1 3/4 x 11 1/4 x 8' x 2	3 treads at 255 between the winders	A102, A103, A404 det 3	LAYOUT NOT RESOLVED: as A102/A103 draw it (three winders at the W/C wall, straight, three winders at the well-end wall turning south) the enclosure floor is 2525 mm up in 10 risers of 252 mm; OBC 9.8.4.1 allows 200, so it needs 13 risers of 194 mm. Headroom under the grid-3 beam over the bottom winders is about 1766 mm against 1950. Kunaal to lay out the stair before anything is cut; the material here is a placeholder at that geometry
Stairs	2x10 SPF winder carriages and riser boxes, two quarter-turns of three winders, 10'		8	pcs	2x10 x 10' x 8	three carriages per fan from the pivot post plus the riser boxes; 4x4 pivot post from a 2x6 pair	A102, A103	placeholder quantity, see the stringer line
Stairs	5/8" plywood sub-treads and risers, both fans and the straight		2	sheets	5/8" plywood sub-treads and risers 4x8 x 2	6 winders, the straight treads and risers	A404 det 1	

WEST ROOF

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL 1 3/4 x 9 1/2, 3-ply roof beam B8-3 at grid 2 (18')	18'-0"	3	pcs 18'	LVL 1 3/4 x 9 1/2 x 18' x 3	each ply cut 18'-0"	Taiga lower roof, A403	Taiga B8-3: the east edge of the high west roof at grid 2, north wall to south wall, on the P3 posts; the high ends of the sloped roof hang on it. A403 section 1 agrees (3-ply LVL).

LOWER LEVEL EAST OF GRID 2

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL 1 3/4 x 9 1/2, 4-ply beam B9-4 at grid 3 (18')	18'-0"	4	pcs 18'	LVL 1 3/4 x 9 1/2 x 18' x 4	each ply cut 18'-0"	Taiga lower roof, DXF 16 Oct	Taiga B9-4 at the east end of the sloped section, grid 3, north wall to south wall; headers H-A and H-B hang on it. Replaces the architect's 3-ply 2x10 there.
Beams	LVL 1 3/4 x 9 1/2, 2-ply beam B10-2 under the enclosure south wall (12')	12'-0"	2	pcs 12'	LVL 1 3/4 x 9 1/2 x 12' x 2	each ply cut 12'-0"	Taiga lower roof, DXF 16 Oct	Taiga B10-2 from B9-4 to the east wall along the enclosure south wall, HUS410 into B9-4; the east roof and enclosure floor joists hang on it. Replaces the architect's 2-ply 2x10 header H-C.
Beams	2-ply 2x10 DROP-2, each ply 15'-3"	15'-3"	2	pcs	2x10 x 16' x 2	Drop beam on grid 2, between the inside faces of the north and south walls (the high west walls run past it), bottom 7'-5 3/8" above the 2F finished floor. Carries the west ends of the lower level. Ends bear on the P3 posts in the north and south walls (hangers or a seat cut into the post: Hossein).	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Beams	2-ply 2x10 H-A, each ply 9'-0"	9'-0"	2	pcs	2x10 x 10' x 2	Header at the south edge of the roof-stair opening, drop beam to grid 3.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Beams	2-ply 2x10 H-B, each ply 9'-0"	9'-0"	2	pcs	2x10 x 10' x 2	Header under the enclosure south wall, drop beam to grid 3; the enclosure floor joists, the sloped roof's north edge and the east roof joists west of grid 3 hang on it. Top set flush with the east roof joists and H-C so the enclosure south wall has one bearing line (the architect's model has it 1 5/8" lower).	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Connectors	Simpson HUS210-2 hangers		4	pcs	Simpson HUS210-2 hangers	hung ends of H-A, H-B (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**
Connectors	Simpson HUS410 hangers		1	pcs	Simpson HUS410 hangers	hung ends of B10-2 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	

ROOF PERIMETER

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	LVL end joist 1 3/4 x 9 1/2 (roof rim under the parapets), 16' lengths		7	pcs 16'	LVL 1 3/4 x 9 1/2 x 16' x 7	96 LF	A400 det 2	Parapet detail 2-A400 calls for an LVL end joist at the roof perimeter.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

ROOFS

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson H2.5A hurricane ties		70	pcs	Simpson H2.5A hurricane ties	every roof joist and rafter at bearing, both ends	recommended	**NOT ON DRAWINGS**

PARAPETS

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson A35 framing angles		48	pcs	Simpson A35 framing angles	parapet bottom plate to the roof joists and LVL end joist, every 24"	A400 det 2 (connection not specified)	**NOT ON DRAWINGS**

STAIR ENCLOSURE

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson LSTA24 straps		12	pcs	Simpson LSTA24 straps	enclosure wall studs to the wall studs below at the corners and jambs	recommended	**NOT ON DRAWINGS**

SLOPED ROOF SOUTH OF THE ENCLOSURE

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Beams	2-ply 2x10 FOOT, each ply 8'-9 7/8"	8'-9 7/8"	2	pcs	2x10 x 10' x 2	Foot beam at the bottom of the slope, header H-B to the south wall; the sloped members hang on its west face.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Rafters	2x10 SL-2158, each ply 6'-9 7/8", sloped	6'-9 7/8"	1	pcs	2x10 x 14' x 1	Sloped 1-ply 2x10, north edge, under the enclosure south wall: from the grid-2 roof beam down to the foot beam, about 24 deg.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Rafters	2-ply 2x10 SL-2560, each ply 6'-9 7/8", sloped	6'-9 7/8"	2	pcs	2x10 x 14' x 1	Sloped 2-ply 2x10, north trimmer of the skylight opening: from the grid-2 roof beam down to the foot beam, about 24 deg.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Rafters	2-ply 2x10 SL-3576, each ply 6'-9 7/8", sloped	6'-9 7/8"	2	pcs	2x10 x 14' x 1	Sloped 2-ply 2x10, south trimmer of the skylight opening: from the grid-2 roof beam down to the foot beam, about 24 deg.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Rafters	2x10 SL-4891, each ply 6'-9 7/8", sloped	6'-9 7/8"	1	pcs	2x10 x 14' x 1	Sloped 1-ply 2x10, south edge, on the raked south wall: from the grid-2 roof beam down to the foot beam, about 24 deg.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Rafters	2x10 SJ-N, 4 pcs at 16", each 1'-2 3/8"	1'-2 3/8"	4	pcs	2x10 x 8' x 1	Short 2x10 joists north-south between the sloped members at 16", tops on the slope (the architect's model has four in each bay, north of the skylight).	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Rafters	2x10 SJ-S, 4 pcs at 16", each 4'-0 3/4"	4'-0 3/4"	4	pcs	2x10 x 8' x 4	Short 2x10 joists north-south between the sloped members at 16", tops on the slope (the architect's model has four in each bay, south of the skylight).	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Beams	2-ply 2x10 SKY-H-3756, each ply 3'-1"	3'-1"	2	pcs	2x10 x 10' x 1	Header across the top or bottom of the skylight opening between the trimmers. Not in the architect's model; added so the opening is framed.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Beams	2-ply 2x10 SKY-H-5569, each ply 3'-1"	3'-1"	2	pcs	2x10 x 10' x 1	Header across the top or bottom of the skylight opening between the trimmers. Not in the architect's model; added so the opening is framed.	DXF 16 Oct	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Blocking	2x6 CURB-2636, each ply 6'-3", sloped	6'-3"	1	pcs	2x6 x 14' x 1	2x6 curb side round skylight W12, on the slope (A403 detail 1). A103 puts the glass at 14 deg on the 23.8 deg roof, so the curb is a wedge, ripped on site. Replaces the 2'-0 1/8" knee wall of the earlier draft, which assumed a flat roof.	A403, A103	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Blocking	2x6 CURB-3538, each ply 6'-3", sloped	6'-3"	1	pcs	2x6 x 14' x 1	2x6 curb side round skylight W12, on the slope (A403 detail 1). A103 puts the glass at 14 deg on the 23.8 deg roof, so the curb is a wedge, ripped on site. Replaces the 2'-0 1/8" knee wall of the earlier draft, which assumed a flat roof.	A403, A103	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Blocking	2x6 CURB-E-3832, each ply 2'-10"	2'-10"	1	pcs	2x6 x 10' x 1	2x6 curb end round skylight W12.	A403	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Blocking	2x6 CURB-E-5531, each ply 2'-10"	2'-10"	1	pcs	2x6 x 10' x 1	2x6 curb end round skylight W12.	A403	**ENGINEERING NOT COMPLETE: architect's placeholder size; Hossein to size with the roof sheet**
Membranes	Blueskin SA 6" x 75' round the skylight W12 curb: up the curb faces and lapped 6" onto the roof board		1	roll	Blueskin SA 6" x 75' (window sills, jambs, heads, skylight curb)	curb perimeter about 19 LF, two courses	A403, A103	The metal step, head and counterflashings are the skylight supplier's curb kit and the roofer's: EXCLUDED, not framing

EAST LOW ROOF

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson ITS2.37/9.5 hangers		1	pcs	Simpson ITS2.37/9.5 hangers	hung ends of East roof joists west of grid 3 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson IUS2.37/9.5 hangers		6	pcs	Simpson IUS2.37/9.5 hangers	hung ends of East roof joists east of grid 3 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

ENCLOSURE FLOOR EAST OF GRID 3

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson IUS2.37/9.5 hangers		6	pcs	Simpson IUS2.37/9.5 hangers	hung ends of Enclosure floor joists (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

ENCLOSURE FLOOR, GRID 2 TO 3

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson ITS2.37/9.5 hangers		12	pcs	Simpson ITS2.37/9.5 hangers	hung ends of Enclosure floor joists (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

SLOPED ROOF

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson HUS210-2 hangers		1	pcs	Simpson HUS210-2 hangers	hung ends of FOOT (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**
Connectors	Simpson LSSR210-2Z hangers		4	pcs	Simpson LSSR210-2Z hangers	hung ends of SL-2560, SL-3576 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**
Connectors	Simpson LSSR210Z hangers		4	pcs	Simpson LSSR210Z hangers	hung ends of SL-2158, SL-4891 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**
Connectors	Simpson LUS210 hangers		16	pcs	Simpson LUS210 hangers	hung ends of Short joists SJ-N, Short joists SJ-S (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

SLOPED ROOF, SKYLIGHT

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Connectors	Simpson HUS210-2 hangers		4	pcs	Simpson HUS210-2 hangers	hung ends of SKY-H-3756, SKY-H-5569 (rows on T 1.06B)	Hanger schedule T 1.06B (hangers.py)	**ENGINEERING NOT COMPLETE**

ROOF BANDS, PARAPET BASES AND THE STAIR ENCLOSURE ROOF BAND

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Sheathing	DensGlass 5/8" gypsum sheathing 4x8		6	sheets	DensGlass 5/8" gypsum sheathing 4x8 x 6	exterior face of the band, 14.7 m2 measured on the elevations	A004 W1, A200 to A203	12% waste. Bands between the stud walls: missing from T1, which measured DensGlass per wall
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		17	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 17	over the mineral wool at the band	A004 W1	25 mm vented cavity per W1

PARAPETS, OUTSIDE FACE

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Furring	1x3 SPF horizontal furring @ 16" (drainage holes drilled)		13	pcs 8'	1x3 x 8' SPF furring @ 16" (drainage holes drilled) x 13	over the mineral wool on the parapet faces (W2)	A004 W1, W2	25 mm vented cavity

ROOF BANDS, PARAPETS AND THE STAIR ENCLOSURE

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci		71	pcs	Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci	508 sq ft net over the DensGlass, N, S and E elevations and the enclosure faces	A004 W1, W2	THICKNESS TO CONFIRM: 75 mm per the A004 wall schedule; a detail in the set notes 4" exterior Rockwool. 10% waste, openings deducted

ROOF BANDS, PARAPETS AND THE STAIR ENCLOSURE, WEST WALL

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)		6	pcs	Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)	41 sq ft net, the two infill panels beside the curtain wall and the band up to the parapet	A004 W1a	10% waste. Stick-pinned per W1a

STAIR ENCLOSURE WALLS

CAT.	ITEM	CUT	QTY	UNIT	ORDER AS NAMED ON THE ORDER LIST x PCS	WHERE IT GOES	SOURCE	NOTE
Insulation	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.		315	sq ft	R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.	297 sq ft net of stud cavity, openings deducted	A004 W1	5% waste; bag count to suit the brand

BATCH 4 BUDGET AT THE PRICES IN THIS LIST (lines marked to quote excluded) **$12,302 before HST**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

BATCH 4 – ROOFS, PARAPETS, STAIR ENCLOSURE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

NOTES

1. Lower level (architect's 16 Oct model): 2-ply 2x10 drop beam on grid 2, bottom 7'-5 3/8" above the second floor finished floor; 3-ply 2x10 on grid 3; 2-ply 2x10 header H-A at the south edge of the roof-stair opening and H-B / H-C under the enclosure south wall. The enclosure floor between H-A and H-B is not in that model and is added here (2x10 at 16"); east of grid 3 it is 2x6 at 16" as the model draws it. This replaces the flat high middle roof and its 3-ply LVL roof-stair header and trimmers.

2. R-SLOPE: south of the enclosure from grid 2 to the foot beam, about 24 deg (A103: 23.8). Four sloped 2x10 lines (single at the edges, doubled each side of W12), short 2x10 joists between at 16", 2-ply 2x10 headers across the skylight opening (added), the 2-ply foot beam. The south wall and its parapet follow the slope.

3. R-E: the east low roof south of the enclosure, framed flat 2548 above the finished floor to the top of the joists (A302 section 1); the 1:29 falls are in the tapered insulation. Joists hang on H-B and H-C. The heat pump sits on this roof; the outswing window W11 is the access.

4. Enclosure from A103 and the east elevation: 2500 deep to the cladding (962 + 900 + 638), W05 and W06 as a pair on the east wall (W06 north) and again on the west wall (W05 north), W11 in the south wall just east of the roof step, no windows on the north property-line wall. The roof-stair opening in the middle roof is on T 1.05.

5. R-ENC: rafters north-south over the 1903 mm enclosure with the 600 mm overhang to the south (3-A400), two decks as A004 R3 draws it: 5/8" roof sheathing board on the rafters carrying the smart air and vapour barrier membrane, 2x4 purlins on edge at 24" over it for the vented standing-seam cavity, 1/2" plywood over the purlins.

6. Skylight W12: now in the sloped roof (A103, the architect's model), on a 2x6 wedge curb (glass at 14 deg on the 23.8 deg roof). The 2'-0 1/8" knee wall on a flat roof is gone. Read A403 again against the slope.

7. Parapets: 2x4 bottom plate on the joists, 2x6 studs at 16" beside the 150 mm insulation, 2x6 top plate, 3/4" exterior plywood both faces, cant strip and membrane by the roofer. Tie-down to the roof joists is not on the drawings; A35 angles are carried on T 1.06.

8. Roof-stair opening into the enclosure: in the lower level, from the grid-2 drop beam to the grid-3 beam, north wall to H-A. The drop beam and the grid-3 beam are the trimmers.

9. 7/8" roof sheathing board (A004) is unusual; 3/4" T&G; is the usual substitute. Kunaal to confirm before the order.

10. Hurricane ties at every joist and rafter bearing are my recommendation for the flat parapet roofs; see T 1.06.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Roofs and Enclosure – T 1.05

CONNECTORS, FASTENERS, MEMBRANES, SITE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CONNECTORS, CONSOLIDATED BY SKU

Simpson Strong-Tie numbers; MiTek equivalents are fine if that is what the yard stocks. Lines in bold are my recommendation, not on the drawings, for Hossein to confirm.

CONNECTOR	QTY	WHERE	NOTE	UNIT	EXT.
Metal railing brackets and the white oak guardrail (A405 detail 1)	0	Batch 5: fastened to the beam, pre-drilled and countersunk	EXCLUDED: millwork and metal, not framing	to quote	
Plate washers 3" x 3" x 1/4"	26	Batch 1: under every anchor nut		$1.40 est.	$36.40
Simpson H2.5A hurricane ties	78	Batch 2: the east and west end joists only; the property-line walls get stiffeners and blocking instead; Batch 4: every roof joist and rafter at bearing, both ends	**NOT ON DRAWINGS: confirm with Hossein**	$1.25 est.	$97.50
Simpson A35 framing angles	48	Batch 4: parapet bottom plate to the roof joists and LVL end joist, every 24"	**NOT ON DRAWINGS**	$1.35 est.	$64.80
Simpson LSTA24 straps	12	Batch 4: enclosure wall studs to the wall studs below at the corners and jambs	**NOT ON DRAWINGS**	$4.50 est.	$54.00
Simpson HGUS5.50/10 hangers	2	Batch 2: hung ends of FB7-3 (rows on T 1.06B)		$27.99 quote	$55.98
Simpson IUS2.37/9.5 hangers	26	Batch 2: hung ends of TJI tails south of the header, TJI east of the opening, north of the header (rows on T 1.06B); plus 3 spare; Batch 4: hung ends of East roof joists east of grid 3 (rows on T 1.06B); Batch 4: hung ends of Enclosure floor joists (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$6.25 est.	$162.50
Simpson ITS2.37/9.5 hangers	13	Batch 4: hung ends of East roof joists west of grid 3 (rows on T 1.06B); Batch 4: hung ends of Enclosure floor joists (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$7.95 est.	$103.35
Simpson HUS210-2 hangers	9	Batch 4: hung ends of H-A, H-B (rows on T 1.06B); Batch 4: hung ends of FOOT (rows on T 1.06B); Batch 4: hung ends of SKY-H-3756, SKY-H-5569 (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$14.50 est.	$130.50
Simpson HUS410 hangers	1	Batch 4: hung ends of B10-2 (rows on T 1.06B)		$24.99 est.	$24.99
Simpson LSSR210-2Z hangers	4	Batch 4: hung ends of SL-2560, SL-3576 (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$17.50 est.	$70.00
Simpson LSSR210Z hangers	4	Batch 4: hung ends of SL-2158, SL-4891 (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$9.95 est.	$39.80
Simpson LUS210 hangers	16	Batch 4: hung ends of Short joists SJ-N, Short joists SJ-S (rows on T 1.06B)	ENGINEERING NOT COMPLETE	$2.10 est.	$33.60
Simpson LUS26 hangers	22	Batch 5: hung ends of Balcony joists (rows on T 1.06B)		$1.95 est.	$42.90

FASTENERS

20 framing nails per stud, 40 per plate piece, 16 per joist; 90 ring nails per plywood sheet; 60 screws per DensGlass sheet; 50 per subfloor sheet; 14 per hanger. Boxes rounded up with 10 to 20% over.

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
Stainless deck screws #8 x 2 1/2", 350/box	2	boxes	cedar to sleepers, 2 per board per sleeper			$42.00 est.	$84.00
#10 x 6" exterior coated (ACQ-rated) wood screws, 100/box, furring through the 3" mineral wool	13	boxes	about 1,260 screws: 215 furring pieces, one screw at each of the 6 studs a piece crosses	A004 W1	3/4" furring + 3" wool + 5/8" DensGlass leaves 1 5/8" in the stud	$42.00 est.	$546.00
#14 x 8" exterior coated (ACQ-rated) wood screws, 50/box, furring through the 5" mineral wool (west wall)	2	boxes	about 95 screws at the west wall	A004 W1a	3/4" furring + 5" wool + 5/8" DensGlass leaves 1 5/8" in the stud	$38.00 est.	$76.00
3 1/4" x 0.131 strip framing nails (30 deg paper tape), 4000/box	5	boxes	about 15,824 nails: 20 per stud, 40 per plate piece, 16 per joist	OBC 9.23.3	15% over	$72.00 est.	$360.00
2 3/8" x 0.113 ring-shank strip nails, 5000/box	2	boxes	plywood sheathing and roof board, about 90 per sheet, 88 sheets	OBC 9.23.3		$68.00 est.	$136.00

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hardware and Consumables – T 1.06

CONNECTORS, FASTENERS, MEMBRANES, SITE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
1 1/2" x 0.148 joist hanger nails (10d), 5 lb box	6	boxes	223 hangers and ties, about 14 nails each, about 700 nails per 5 lb box, 20% over	Simpson	Box count to confirm with Downtown Lumber. HGUS and HUS take 16d commons, on their own line	$28.00 est.	$168.00
Simpson SDW22338 Strong-Drive SDW EWP-PLY screws (2-ply 1 3/4" LVL), 50/box	1	boxes	22 screws: B10-2 22; 2 rows at 16" o.c. from one face	Simpson SDW, LVL maker's multi-ply table	ply fastening for the side loads (hung members); LVL supplier to confirm the pattern for RigidLam	$38.00 est.	$38.00
Simpson SDW22500 Strong-Drive SDW EWP-PLY screws (3-ply 1 3/4" LVL), 50/box	3	boxes	130 screws: FB5-3 26, FB6-3 26, FB7-3 20, Balcony edge beam 28, B8-3 30; 2 rows at 16" o.c. from one face	Simpson SDW, LVL maker's multi-ply table	ply fastening for the side loads (hung members); LVL supplier to confirm the pattern for RigidLam	$48.00 est.	$144.00
Simpson SDW22638 Strong-Drive SDW EWP-PLY screws (4-ply 1 3/4" LVL), 50/box	1	boxes	30 screws: B9-4 30; 2 rows at 16" o.c. from one face	Simpson SDW, LVL maker's multi-ply table	ply fastening for the side loads (hung members); LVL supplier to confirm the pattern for RigidLam	$58.00 est.	$58.00
16d common nails 0.162" x 3 1/2" galvanized, 5 lb box (about 245)	2	boxes	284 nails for the double-shear hangers: HGUS5.50/10 46 face + 16 joist each, HUS 8 + 8 each	Simpson ESR-2552	HGUS and HUS take 16d commons only; not the 1 1/2" hanger nails	$22.00 est.	$44.00
DensGlass screws #8 x 1 5/8" corrosion-resistant, 1000/box	5	boxes	75 sheets at about 60 screws (8" edges, 8" field per GP)	Georgia-Pacific DensGlass install guide	DensGlass does not take ring nails well; screws only	$58.00 est.	$290.00
Subfloor screws #8 x 2" (square drive), 2000/pail	2	pails	43 subfloor sheets at 50 screws	Taiga note 9		$75.00 est.	$150.00
Tapcon 1/4" x 3 1/4" concrete screws, 50/box	2	boxes	2x12 PT sill at the slab per 2-A403, infill panel bottom plates to the slab	A403		$38.00 est.	$76.00

SILL, WINDOW AND ENVELOPE MEMBRANES

Blueskin SA on the curb with primer and the gasket on top (Marek). Windows get a sill pan and jamb tapes: Extoseal Encore and Huber tape are specified, Blueskin SA 6" is the builder's equivalent. The air barrier over the DensGlass is specified as self-adhered Adhero 3000; building paper, staples and Tuck Tape are the alternative only if Kunaal accepts it. DensGlass needs no paper under either.

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip)	1	roll	isolates the wood from the steel: no condensation or galvanic contact at the bolts	BWD	Provide unless Hossein or Kunaal says it is not required. About 46 LF needed; one roll.	$19.99 quote	$19.99
PL400 subfloor adhesive 828 mL	5	tubes	one tube per 1.5 sheets	Taiga note 9		$13.99 est.	$69.95
PL400 subfloor adhesive 828 mL	5	tubes	one tube per 1.5 sheets	Taiga note 9		$13.99 est.	$69.95
PL400 subfloor adhesive 828 mL	4	tubes	one tube per 1.5 sheets	Taiga note 9		$13.99 est.	$55.96
PL400 subfloor adhesive 828 mL	1	tubes	one tube per 1.5 sheets	Taiga note 9		$13.99 est.	$13.99
PL400 subfloor adhesive 828 mL	2	tubes	one tube per 1.5 sheets	Taiga note 9		$13.99 est.	$27.98
Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside	2	rolls	76 LF of curb	Marek, 21 Oct	over the masonry at the sill; 15% for laps	$135.00 est.	$270.00
Blueskin primer (Blue Prep or Aquatac), 3.78 L	2	pails	primer under the Blueskin on concrete; about 20 m2 per pail	Henry/Bakor data sheet		$78.00 est.	$156.00
Sill gasket 5 1/2" x 82' foam	2	rolls	under every bottom plate on the curb (A406 'sill sealer, bond break')	A406		$19.99 quote	$39.98
Blueskin SA 6" x 75' (window sills, jambs, head laps)	1	rolls	9 exterior openings, about 4.5 m each	A401 det 1, A405 notes	the drawings call for Extoseal Encore at sills and Huber window tape; Blueskin SA is the builder's equivalent	$72.00 est.	$72.00
Blueskin SA 6" x 75' round the skylight W12 curb: up the curb faces and lapped 6" onto the roof board	1	roll	curb perimeter about 19 LF, two courses	A403, A103	The metal step, head and counterflashings are the skylight supplier's curb kit and the roofer's: EXCLUDED, not framing	$72.00 est.	$72.00

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hardware and Consumables – T 1.06

CONNECTORS, FASTENERS, MEMBRANES, SITE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
Tuck Tape (red sheathing tape) 60 mm x 66 m	8	rolls	poly laps, membrane laps, DensGlass temporary weather protection			$17.99 est.	$143.92
Weather-resistant air barrier: Adhero 3000 self-adhered 4' x 100' (as specified, A004 W1)	6	rolls	over the DensGlass and the parapet faces, measured on the elevations, full coverage	A004 W1	SPECIFIED; carried. No building paper under it.	$420.00 est.	$2,520.00
6 mil poly 12' x 300' (slab vapour barrier is Stego 15 mil, separate)	1	roll	temporary protection and interior laps			$34.99 quote	$34.99

TEMPORARY BRACING, SITE LUMBER, BLADES

Enough to brace every tilt-up wall both ways until sheathed, guard the stair opening, build the ramps. Re-used as blocking and furring. DensGlass is scored and snapped; the PCD blade is for the long rips.

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
2x4 x 16' SPF for wall bracing, kickers and the stair-opening guard	24	pcs	temporary diagonal bracing of every tilt-up wall and the parapets until sheathed	OBC 9.23.3 / good practice	re-used as blocking and furring later	$8.99 quote	$215.76
1x4 x 12' let-in style diagonal braces and string-line stakes	30	pcs	temporary			$4.99 est.	$149.70
1/2" plywood 4x8 for guards, ramps and the stair opening cover	4	sheets	temporary			$31.99 quote	$127.96
7 1/4" 24T framing blades	6	pcs				$18.00 est.	$108.00
7 1/4" PCD fibre-cement/gypsum blade (DensGlass cutting) and utility knife blades 100-pack (score and snap)	1	each	DensGlass is scored and snapped; a PCD blade for the long rips	GP install guide		$65.00 est.	$65.00
Utility knife blades, 100-pack	2	packs	DensGlass, membranes			$24.00 est.	$48.00
Reciprocating saw blades, wood with nails, 10-pack	2	packs				$29.00 est.	$58.00

STEEL CONNECTION ALLOWANCES

The engineer has not detailed wood to steel. These are allowances so the order is not short on the day.

ITEM	QTY	UNIT	WHERE / BASIS	SOURCE	NOTE	UNIT PRICE	EXT.
1/2" through-bolts with nut and washer, LSL nailer to the column flange	34	bolts	16 per column at 16" o.c., two columns, 2 spare	Gulf Eng. MF-1	Hossein to give the bolt size and spacing.	$2.75 est.	$93.50
TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers	2	boxes	deck rim and balcony blocking to the steel beams and outriggers	Gulf Eng. 2nd floor	CONNECTION REQUIRES FURTHER DETAILING. Connectors and fasteners for the deck rim, roof end joist and parapet to the steel are not specified on the plans (no MF-1 issued).	$34.00 est.	$68.00
1/2" through-bolts with nut and washer, 2x10 nailer to the W200x36 beam and outrigger flanges	50	bolts	4 nailers x 16' at 16" o.c., 12 each, 2 spare	Gulf Eng. 2nd floor	Hossein to give the bolt size and spacing.	$2.75 est.	$137.50

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hardware and Consumables – T 1.06

EXTERIOR INSULATION AND SHEATHING BY ELEVATION

by William

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

The exterior envelope is measured on the elevations, from the top of the concrete curb to the top of the parapets and the stair enclosure roof, so the floor and roof bands between the stud walls are covered. Wall types from the A004 schedule: W1 75 mm pinned semi-rigid mineral wool R12ci over 16 mm DensGlass, R19 mineral fibre in the 2x6 studs; W1a at the west wall 125 mm; W2 parapets as W1 outside. Phase 1 is the curb to the top of the 2nd floor subfloor; Phase 2 is everything above. Openings are deducted from the insulation.

EXTERIOR MINERAL WOOL BY ELEVATION

net of window and door openings; order quantities are on T 1.07

ELEVATION	PHASE 1 SQ FT	PHASE 2 SQ FT	NET SQ FT	ORDER SQ FT, 10% WASTE	BOARDS 2'x4'
North	220	498	718	790	99
South	220	370	590	650	82
East	65	156	221	245	31
Stair enclosure, south faces above the roof		111	111	125	16
Stair enclosure, west face above the roof		26	26	30	4
Total 3" (75 mm) pinned semi-rigid mineral wool, R12ci	505	1,162	1,667	1,840	232
West wall, 5" (125 mm) stick-pinned semi-rigid (W1a): the two infill panels beside the curtain wall and the band up to the parapet	46	91	138	155	20

R19 MINERAL FIBRE BATTS, 5 1/2" IN THE 2x6 STUDS

stud cavities of the exterior walls; parapets, floors and roofs are separate

PHASE	WHAT IS IN IT	NET SQ FT	ORDER SQ FT, 5% WASTE
Phase 1	1st floor exterior walls	474	500
Phase 2	2nd floor exterior walls	681	715
Phase 2	Stair enclosure walls	297	315

BANDS BETWEEN THE STUD WALLS

added in T2; T1 sheathed the stud walls only

BAND	AREA SQ FT	DENSGLASS SHEETS, 12% WASTE	WHERE
Floor band at the 2nd floor deck, all faces (batch 2)	77	3	between the stud walls; furring and air barrier follow the same area
Roof bands, parapet bases and the stair enclosure roof band (batch 4)	159	6	between the stud walls; furring and air barrier follow the same area

NOTES

1. Mineral wool thickness to confirm: the A004 schedule gives 75 mm, a detail notes 4". Lines are marked confirm until Kunaal answers.

2. Furring is screwed through the mineral wool and the DensGlass into the studs: #10 x 6" exterior coated (ACQ-rated) wood screws through 3", #14 x 8" at the west wall through 5", one at every stud the furring crosses. Insulation pins, 3 per board, hold the boards until the furring is on.

3. Not included: parapet cavities, the R32 mineral wool in the floor and roof assemblies, sound batts in interior partitions, and the corrugated metal cladding.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Envelope by Elevation – T 1.06A

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Every hung end in the takeoff, the member it hangs on and the hanger for it. Hangers are chosen by rule from the two members in the model (product, plies, depth, slope), so a member that changes size changes its hangers on the next build. Simpson Strong-Tie model numbers; an equal MiTek or USP hanger is fine. Members that bear on a wall plate, post or beam top are listed too, so every end is accounted for.

CHANGES SINCE MAREK'S COMMENTS (T2 TO T4)

the hangers and their fastening only; nothing else in the order changed

WHAT	T2 (WHAT MAREK SAW)	NOW	WHY
TJI hangers	IUS2.56/9.5 x 45	**IUS2.37/9.5 x 26, ITS2.37/9.5 x 13**	IUS2.56 is for a 2 1/2" flange (Taiga's PJI-40); the TJI 360 flange is 2 5/16". Top flange where the TJI hangs on a 9 1/4" 2x10 header.
Sloped 2x10 at the slope	LSSU210 x 12	**LSSR210Z x 4, LSSR210-2Z x 4**	LSSU210 is discontinued; the doubled members take one double hanger per end, not two singles.
Stairs	LUS210 x 6, LSC x 6	**none**	No hangers at the stairs.
Grid 2 drop beam	HUS210-2 x 2	**none**	Bears on the P3 posts.
B10-2 east end	HUS410 x 2	**HUS410 x 1**	East end bears on the east wall; one hanger into B9-4, as Taiga.
Enclosure floor east of grid 3, north ends	IUS x 6	**none**	Bear on the north wall.
Balcony joists	LUS26 x 26	**LUS26 x 22**	11 joists in the model; T2 had 13 a side typed.
Nails for HGUS and HUS	SDS screws and 1 1/2" hanger nails	**16d commons**	Simpson: HGUS5.50/10 46-16d face and 16-16d joist; HUS 8 + 8 16d.
Multi-ply LVL ply fastening	not carried	**Simpson SDW EWP-PLY screws**	Every 2-, 3- and 4-ply LVL carrying hung members is screwed together, 2 rows at 16" o.c.

MULTI-PLY LVL CONNECTIONS (TRIPLE LVL AND THE 2- AND 4-PLY BEAMS)

how each end is carried, what hangs on each beam, and how the plies are fastened so a side-hung load reaches every ply

BEAM	WHERE	PLIES	ENDS	CARRIES ON ITS FACES	PLY SCREWS	TO CONFIRM
FB5-3	2nd floor, grid 2 beam line (Taiga FB5-3, engineer's sheet)	3	north end: bears on post P3 (4-2x6) in the north wall; south end: bears on post P3 (4-2x6) in the south wall	stair header FB7-3 on the east face (HGUS5.50/10)	SDW22500 x 26, 2 rows at 16"	
FB6-3	2nd floor, grid 4 beam line (Taiga FB6-3, engineer's sheet)	3	north end: bears on post P2 (3-2x6) in the north wall; south end: bears on post P2 (3-2x6) in the south wall	stair header FB7-3 on the west face (HGUS5.50/10)	SDW22500 x 26, 2 rows at 16"	**Both ends: post P2 is 4 1/2" wide under a 5 1/4" beam, so the outside ply is not fully on the post. Hossein to confirm, or make it a 4-2x6 post (6").**
FB7-3	2nd floor, stair header between the beam lines (Taiga FB7-3)	3	west end: hangs on FB5-3, HGUS5.50/10; east end: hangs on FB6-3, HGUS5.50/10	8 TJI tails on the south face and 3 on the north face (IUS2.37/9.5)	SDW22500 x 20, 2 rows at 16"	
Balcony edge beam	Balcony, laneway edge between the outrigger ends (engineer's sheet)	3	north end: to the end of the north W200x36 outrigger: not detailed; south end: to the end of the south W200x36 outrigger: not detailed	11 balcony 2x6 on the east face (LUS26); guardrail on the west face (A405)	SDW22500 x 28, 2 rows at 16"	**Both ends: wood to steel connection not on the drawings (seat or end plate on the outrigger). Hossein to detail.**
B8-3	Roof, grid 2 beam at the high end of the slope (Taiga B8-3)	3	north end: bears on post P3 in the 2nd floor north wall; south end: bears on post P3 in the 2nd floor south wall	the 4 sloped 2x10 lines on the east face (LSSR210Z, LSSR210-2Z)	SDW22500 x 30, 2 rows at 16"	
B9-4	Lower level, grid 3 beam (Taiga B9-4)	4	north end: bears on a post in the north wall (not on the engineer's sheet: question on T 1.00); south end: bears on a post in the south wall (as north)	H-A and H-B on the west face (HUS210-2), B10-2 on the east face (HUS410)	SDW22638 x 30, 2 rows at 16"	
B10-2	Lower level, under the enclosure south wall (Taiga B10-2)	2	west end: hangs on B9-4, HUS410; east end: bears on the east wall	enclosure floor and east roof TJI on both faces (IUS2.37/9.5)	SDW22338 x 22, 2 rows at 16"	

HANGER SCHEDULE

one row per connection; QTY is the number of hung ends

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
1	2nd floor, stair opening	stair header, 3-ply LVL between the trimmers (Taiga FB7-3) (3-ply LVL 1 3/4 x 9 1/2)	west end	west stair trimmer, 3-ply LVL beam line at grid 2 (Taiga FB5-3)	1	**HGUS5.50/10**	HGUS5.50/10	
2	2nd floor, stair opening	stair header, 3-ply LVL between the trimmers (Taiga FB7-3) (3-ply LVL 1 3/4 x 9 1/2)	east end	east stair trimmer, 3-ply LVL beam line at grid 4 (Taiga FB6-3)	1	**HGUS5.50/10**	HGUS5.50/10	
3	2nd floor, stair opening	TJI tails south of the header, TJI 360 9 1/2"	north end	stair header, 3-ply LVL between the trimmers (Taiga FB7-3)	8	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
4	2nd floor, stair opening	TJI east of the opening, north of the header, TJI 360 9 1/2"	south end	stair header, 3-ply LVL between the trimmers (Taiga FB7-3)	3	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
5	Balcony deck	Balcony joists, 2x6	east end	House-side rim (2x6)	11	**LUS26**	LUS26 (13 per side typed)	**CHANGED. 11 joists in the model; T2 typed 13 a side.**
6	Balcony deck	Balcony joists, 2x6	west end	Balcony LVL edge beam (LVL 1 3/4 x 9 1/2)	11	**LUS26**	LUS26 (13 per side typed)	**CHANGED. 11 joists in the model; T2 typed 13 a side.**
7	Lower level east of grid 2	2-ply 2x10 drop beam on grid 2 under the lower level (2-ply 2x10)	both ends	P3 posts in the north and south walls	2	**none, bears**	HUS210-2	**CHANGED. Bears on the posts; post cap or seat to the engineer. T2 had two HUS210-2 hangers here.**
8	Lower level east of grid 2	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3 (2-ply 2x10)	west end	2-ply 2x10 drop beam on grid 2 under the lower level	1	**HUS210-2**	HUS210-2	Not engineered yet.
9	Lower level east of grid 2	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3 (2-ply 2x10)	east end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS210-2**	HUS210-2	Not engineered yet.
10	Lower level east of grid 2	2-ply 2x10 header under the enclosure south wall, grid 2 to 3 (2-ply 2x10)	west end	2-ply 2x10 drop beam on grid 2 under the lower level	1	**HUS210-2**	HUS210-2	Not engineered yet.
11	Lower level east of grid 2	2-ply 2x10 header under the enclosure south wall, grid 2 to 3 (2-ply 2x10)	east end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS210-2**	HUS210-2	Not engineered yet.
12	Lower level east of grid 2	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2) (2-ply LVL 1 3/4 x 9 1/2)	west end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS410**	HUS410	
13	Lower level east of grid 2	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2) (2-ply LVL 1 3/4 x 9 1/2)	east end	east wall	1	**none, bears**	HUS410	**CHANGED. T2 carried a second HUS410 here.**
14	Enclosure floor, grid 2 to 3	Enclosure floor joists, TJI 360 9 1/2"	north end	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3	6	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**
15	Enclosure floor, grid 2 to 3	Enclosure floor joists, TJI 360 9 1/2"	south end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	6	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**
16	Enclosure floor east of grid 3	Enclosure floor joists, TJI 360 9 1/2"	south end	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2)	6	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
17	Enclosure floor east of grid 3	Enclosure floor joists, TJI 360 9 1/2"	north end	north wall plate	6	**none, bears**	IUS2.56/9.5	**CHANGED. T2 hung these ends too.**
18	East low roof	East roof joists west of grid 3, TJI 360 9 1/2"	north end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	1	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
19	East low roof	East roof joists east of grid 3, TJI 360 9 1/2"	north end	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2)	6	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
20	East low roof	East roof joists, TJI 360 9 1/2"	south end	south wall plate	7	**none, bears**	none	bears, no hanger
21	Sloped roof	2-ply 2x10 foot beam at the bottom of the slope (2-ply 2x10)	north end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	1	**HUS210-2**	HUS210-2	Not engineered yet.
22	Sloped roof	2-ply 2x10 foot beam at the bottom of the slope (2-ply 2x10)	south end	south wall plate	1	**none, bears**	none	bears, no hanger
23	Sloped roof	sloped 2x10, north edge of the slope (2x10, sloped 24 deg)	high end (SL-2158)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
24	Sloped roof	sloped 2x10, north edge of the slope (2x10, sloped 24 deg)	low end (SL-2158)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
25	Sloped roof	sloped 2-ply 2x10, north trimmer of the skylight (2-ply 2x10, sloped 24 deg)	high end (SL-2560)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
26	Sloped roof	sloped 2-ply 2x10, north trimmer of the skylight (2-ply 2x10, sloped 24 deg)	low end (SL-2560)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
27	Sloped roof	sloped 2-ply 2x10, south trimmer of the skylight (2-ply 2x10, sloped 24 deg)	high end (SL-3576)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
28	Sloped roof	sloped 2-ply 2x10, south trimmer of the skylight (2-ply 2x10, sloped 24 deg)	low end (SL-3576)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
29	Sloped roof	sloped 2x10, south edge of the slope (2x10, sloped 24 deg)	high end (SL-4891)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
30	Sloped roof	sloped 2x10, south edge of the slope (2x10, sloped 24 deg)	low end (SL-4891)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
31	Sloped roof	short 2x10 joists between the sloped members, north of the skylight (2x10)	north end	sloped 2x10, north edge of the slope	4	**LUS210**	LUS210	Not engineered yet.
32	Sloped roof	short 2x10 joists between the sloped members, north of the skylight (2x10)	south end	sloped 2-ply 2x10, north trimmer of the skylight	4	**LUS210**	LUS210	Not engineered yet.
33	Sloped roof	short 2x10 joists between the sloped members, south of the skylight (2x10)	north end	sloped 2-ply 2x10, south trimmer of the skylight	4	**LUS210**	LUS210	Not engineered yet.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
34	Sloped roof	short 2x10 joists between the sloped members, south of the skylight (2x10)	south end	sloped 2x10, south edge of the slope	4	**LUS210**	LUS210	Not engineered yet.
35	Sloped roof, skylight	2-ply 2x10 header at the top of the skylight opening (2-ply 2x10)	north end	sloped 2-ply 2x10, north trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
36	Sloped roof, skylight	2-ply 2x10 header at the top of the skylight opening (2-ply 2x10)	south end	sloped 2-ply 2x10, south trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
37	Sloped roof, skylight	2-ply 2x10 header at the bottom of the skylight opening (2-ply 2x10)	north end	sloped 2-ply 2x10, north trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
38	Sloped roof, skylight	2-ply 2x10 header at the bottom of the skylight opening (2-ply 2x10)	south end	sloped 2-ply 2x10, south trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.

HANGERS TO ORDER, T2 AGAINST T4

T4 includes 3 spare IUS2.37/9.5 at the stair, as before

HANGER	FITS	T2 QTY	T4 QTY
HGUS5.50/10	3-ply 1 3/4" LVL, 5 1/4" x 9 1/2"	2	2
HUS210-2	2-ply 2x10	11	9
HUS410	2-ply 1 3/4" LVL	2	1
ITS2.37/9.5	TJI 360 9 1/2", top flange over a shallower header		13
IUS2.37/9.5	TJI 360 9 1/2" (2 5/16" flange), face mount		26
IUS2.56/9.5	2 1/2" flange I-joist (Taiga's PJI-40): not the TJI 360 now carried	45	
LSSR210-2Z	2-ply 2x10, sloped (field-adjustable)		4
LSSR210Z	single 2x10, sloped (field-adjustable)		4
LSSU210	single 2x10 sloped; discontinued by Simpson	12	
LUS210	single 2x10	22	16
LUS26	single 2x6	26	22

NOTES

1. TJI hangers: T2 carried IUS2.56/9.5 from Taiga's layout, which was drawn for a 2 1/2" flange joist (PJI-40). The approved TJI 360 has a 2 5/16" flange, so the hanger is IUS2.37/9.5.
2. Where a TJI (9 1/2") hangs on a 2-ply 2x10 header (9 1/4") a face-mount hanger would sit 1/4" below the header, so those ends take the top-flange ITS2.37/9.5.
3. Sloped members: LSSU210 is discontinued; LSSR210Z replaces it, and the doubled lines at the skylight take one LSSR210-2Z per end, not two singles. The plumb cut of a 24 deg 2x10 is about 10 1/8" deep, deeper than the 9 1/4" foot beam and the 9 1/2" LVL at grid 2: seat or bevel the bottom to suit, Hossein to confirm.
4. Ends that bear, not hang: the grid-2 drop beam on the P3 posts (T2 had two HUS210-2), the east end of B10-2 on the east wall (Taiga lists one HUS410, T2 had two), and the north ends of the enclosure floor joists east of grid 3 on the north wall.
5. Balcony: 11 joists in the model, so 22 LUS26 (T2 had 26 typed); the house-side ones only if the joists do not land on the steel, confirm on the steel shop drawings.
6. Fastening per Simpson (ESR-2552): HGUS5.50/10 46-16d into the carrying beam and 16-16d into the header, driven at 45 deg (double shear); HUS 8-16d + 8-16d. 16d commons (0.162" x 3 1/2") are their own order line. Where a hanger is on the screw-tip face of a multi-ply beam, its face nails must be at least 3" long.
7. Ply screws: Simpson Strong-Drive SDW EWP-PLY, SDW22338 for 2-ply, SDW22500 for 3-ply, SDW22638 for 4-ply 1 3/4" LVL, 2 rows at 16" o.c. from one face (675 plf allowable side load on a 3-ply at that spacing in the LVL maker's table). Taiga to confirm the pattern for RigidLam.
8. Everything east of grid 2 is not engineered yet: the hangers follow the architect's placeholder sizes and change with Hossein's roof sheet.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

One line per product the yard stocks, with the batch split so Marek can call off the delivery per floor. Prices: quote = Downtown Lumber 1 May 2026; est. = estimated price pending re-quote. Five months old and lumber has moved: treat the budget as an order of magnitude until Downtown Lumber re-prices this list.

ORDER SUMMARY BY PRODUCT

PRODUCT	B1 GF WALLS	B2 DECK	B2B BALCONY	B3 2F WALLS	B4 ROOFS	SITE, FAST.	TOTAL	UNIT	UNIT PRICE	SRC	EXT. BEFORE HST
2x4 x 92 5/8" precut	14			52			**66**	pcs	$3.99	est.	$263.34
2x4 x 8'	3			1			**4**	pcs	$4.49	est.	$17.96
2x4 x 104 5/8" precut	45						**45**	pcs	$4.49	quote	$202.05
2x4 x 10'	5			1			**6**	pcs	$5.99	est.	$35.94
2x4 x 12'	6			5			**11**	pcs	$7.49	est.	$82.39
2x4 x 16'	11			7	9	24	**51**	pcs	$8.99	quote	$458.49
2x6 x 92 5/8" precut				54	34		**88**	pcs	$6.49	quote	$571.12
2x6 x 8'	9	4		3	30		**46**	pcs	$7.49	est.	$344.54
2x6 x 104 5/8" precut	29			2			**31**	pcs	$6.25	quote	$193.75
2x6 x 10'	5			6	8		**19**	pcs	$9.49	est.	$180.31
2x6 x 12'	59	3	8	74	18		**162**	pcs	$11.49	est.	$1,861.38
2x6 x 14'				7	6		**13**	pcs	$9.89	quote	$128.57
2x6 x 16'	24		2	24	31		**81**	pcs	$14.99	est.	$1,214.19
2x8 x 8'	3			4			**7**	pcs	$15.49	est.	$108.43
2x8 x 10'	2			1	13		**16**	pcs	$18.98	quote	$303.68
2x8 x 12'					2		**2**	pcs	$22.99	quote	$45.98
2x10 x 8'					11		**11**	pcs	$18.99	est.	$208.89
2x10 x 10'				4	16		**20**	pcs	$24.49	quote	$489.80
2x10 x 12'					3		**3**	pcs	$27.98	quote	$83.94
2x10 x 14'					4		**4**	pcs	$32.99	est.	$131.96
2x10 x 16'		4			2		**6**	pcs	$37.99	est.	$227.94
2x12 PT x 16'	2						**2**	pcs	$54.99	est.	$109.98
2x4 PT x 8'				1			**1**	pcs	$6.49	est.	$6.49
2x4 PT x 12'			7				**7**	pcs	$9.99	est.	$69.93
1x3 x 8' SPF furring @ 16" (drainage holes drilled)	58	8		78	71		**215**	pcs	$2.49	est.	$535.35
1x4 x 12' (let-in diagonal braces and string-line stakes)						30	**30**	pcs	$4.99	est.	$149.70
LVL 1 3/4 x 11 1/4 x 8'					2		**2**	pcs	$63.60	est.	$127.20
LVL 1 3/4 x 11 1/4 x 14'				3			**3**	pcs	$111.30	est.	$333.90
LVL 1 3/4 x 7 1/4 x 20'					4		**4**	pcs	$100.60	est.	$402.40

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Order Summary – T 1.07

ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

PRODUCT	B1 GF WALLS	B2 DECK	B2B BALCONY	B3 2F WALLS	B4 ROOFS	SITE, FAST.	TOTAL	UNIT	UNIT PRICE	SRC	EXT. BEFORE HST
LVL 1 3/4 x 9 1/2 x 12'		3			2		**5**	pcs	$79.08	quote	$395.40
LVL 1 3/4 x 9 1/2 x 16'		6			7		**13**	pcs	$105.44	quote	$1,370.72
LVL 1 3/4 x 9 1/2 x 18'			3		7		**10**	pcs	$118.62	quote	$1,186.20
LSL 1 1/2 x 5 1/2 x 10'	2						**2**	pcs	$49.50	est.	$99.00
LSL 1 1/2 x 5 1/2 x 12'	2						**2**	pcs	$59.40	est.	$118.80
LSL 1 1/4 x 9 1/2 x 12'		12					**12**	pcs	$79.08	est.	$948.96
TJI 360 9 1/2" x 16'		27			13		**40**	pcs	$55.20	est.	$2,208.00
TJI 360 9 1/2" x 18'					4		**4**	pcs	$62.10	est.	$248.40
TJI 360 9 1/2" x 20'					1		**1**	pcs	$69.00	est.	$69.00
1/2" plywood 4x8	30		4	15	7	4	**60**	pcs	$31.99	quote	$1,919.40
3/4" T&G plywood subfloor 4x8		19			4		**23**	pcs	$49.99	quote	$1,149.77
3/4" exterior-grade plywood 4x8					11		**11**	pcs	$52.99	est.	$582.89
5/8" plywood sub-treads and risers 4x8				3	2		**5**	pcs	$42.00	est.	$210.00
5/8" roof sheathing board 4x8 on the rafters					7		**7**	pcs	$42.00	est.	$294.00
7/8" roof sheathing board 4x8 (A004: 22 mm)		1			14		**15**	pcs	$58.00	est.	$870.00
DensGlass 5/8" gypsum sheathing 4x8	21	3		29	22		**75**	pcs	$44.00	est.	$3,300.00
Insulation pins with 2" washers (temporary hold until the furring is on), 100/box						8	**8**	boxes	$55.00	est.	$440.00
Mineral wool board 3" (75 mm) semi-rigid, 2'x4', R12ci	61	9		91	71		**232**	pcs	$24.00	est.	$5,568.00
Mineral wool board 5" (125 mm) semi-rigid, 2'x4' (W1a west wall)	6	1		7	6		**20**	pcs	$40.00	est.	$800.00
R19 mineral fibre batts 5 1/2" for 2x6 at 16" o.c.	500			715	315		**1530**	sq ft	$1.30	est.	$1,989.00
5/4 x 6 cedar decking x 8'			29				**29**	pcs	$21.00	est.	$609.00
Metal railing brackets and the white oak guardrail (A405 detail 1)			0				**0**		to quote	to quote	
Plate washers 3" x 3" x 1/4"	26						**26**	pcs	$1.40	est.	$36.40
Simpson A35 framing angles					48		**48**	pcs	$1.35	est.	$64.80
Simpson H2.5A hurricane ties		8			70		**78**	pcs	$1.25	est.	$97.50
Simpson HGUS5.50/10 hangers		2					**2**	pcs	$27.99	quote	$55.98
Simpson HUS210-2 hangers					9		**9**	pcs	$14.50	est.	$130.50
Simpson HUS410 hangers					1		**1**	pcs	$24.99	est.	$24.99
Simpson ITS2.37/9.5 hangers					13		**13**	pcs	$7.95	est.	$103.35
Simpson IUS2.37/9.5 hangers		14			12		**26**	pcs	$6.25	est.	$162.50
Simpson LSSR210-2Z hangers					4		**4**	pcs	$17.50	est.	$70.00

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Order Summary – T 1.07

ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

PRODUCT	B1 GF WALLS	B2 DECK	B2B BALCONY	B3 2F WALLS	B4 ROOFS	SITE, FAST.	TOTAL	UNIT	UNIT PRICE	SRC	EXT. BEFORE HST
Simpson LSSR210Z hangers					4		**4**	pcs	$9.95	est.	$39.80
Simpson LSTA24 straps					12		**12**	pcs	$4.50	est.	$54.00
Simpson LUS210 hangers					16		**16**	pcs	$2.10	est.	$33.60
Simpson LUS26 hangers			22				**22**	pcs	$1.95	est.	$42.90
Simpson SDW22338 Strong-Drive SDW EWP-PLY screws (2-ply 1 3/4" LVL), 50/box						1	**1**	boxes	$38.00	est.	$38.00
Simpson SDW22500 Strong-Drive SDW EWP-PLY screws (3-ply 1 3/4" LVL), 50/box						3	**3**	boxes	$48.00	est.	$144.00
Simpson SDW22638 Strong-Drive SDW EWP-PLY screws (4-ply 1 3/4" LVL), 50/box						1	**1**	boxes	$58.00	est.	$58.00
#10 x 6" exterior coated (ACQ-rated) wood screws, 100/box, furring through the 3" mineral wool						13	**13**	boxes	$42.00	est.	$546.00
#14 x 8" exterior coated (ACQ-rated) wood screws, 50/box, furring through the 5" mineral wool (west wall)						2	**2**	boxes	$38.00	est.	$76.00
1 1/2" x 0.148 joist hanger nails (10d), 5 lb box						6	**6**	boxes	$28.00	est.	$168.00
16d common nails 0.162" x 3 1/2" galvanized, 5 lb box (about 245)						2	**2**	boxes	$22.00	est.	$44.00
2 3/8" x 0.113 ring-shank strip nails, 5000/box						2	**2**	boxes	$68.00	est.	$136.00
3 1/4" x 0.131 strip framing nails (30 deg paper tape), 4000/box						5	**5**	boxes	$72.00	est.	$360.00
DensGlass screws #8 x 1 5/8" corrosion-resistant, 1000/box						5	**5**	boxes	$58.00	est.	$290.00
Stainless deck screws #8 x 2 1/2", 350/box			2				**2**	boxes	$42.00	est.	$84.00
Subfloor screws #8 x 2" (square drive), 2000/pail						2	**2**	pails	$75.00	est.	$150.00
Tapcon 1/4" x 3 1/4" concrete screws, 50/box						2	**2**	boxes	$38.00	est.	$76.00
6 mil poly 12' x 300' (slab vapour barrier is Stego 15 mil, separate)						1	**1**	roll	$34.99	quote	$34.99
Blueskin SA 12" x 75' self-adhered membrane over the curb top, lapped down the outside	2						**2**	rolls	$135.00	est.	$270.00
Blueskin SA 6" x 75' (window sills, jambs, heads, skylight curb)					1	1	**2**	rolls	$72.00	est.	$144.00
Blueskin primer (Blue Prep or Aquatac), 3.78 L	2						**2**	pails	$78.00	est.	$156.00
Gasket between the LSL nailer and the steel column flange, full height both columns (foam sill gasket 5 1/2" x 82' or a Blueskin SA strip)	1						**1**	roll	$19.99	quote	$19.99
Sill gasket 5 1/2" x 82' foam	2						**2**	rolls	$19.99	quote	$39.98
Tuck Tape (red sheathing tape) 60 mm x 66 m						8	**8**	rolls	$17.99	est.	$143.92
Weather-resistant air barrier: Adhero 3000 self-adhered 4' x 100' (as specified, A004 W1)						6	**6**	rolls	$420.00	est.	$2,520.00
PL400 subfloor adhesive 828 mL		14			3		**17**	tubes	$13.99	est.	$237.83

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Order Summary – T 1.07

ORDER SUMMARY AND BUDGET

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

PRODUCT	B1 GF WALLS	B2 DECK	B2B BALCONY	B3 2F WALLS	B4 ROOFS	SITE, FAST.	TOTAL	UNIT	UNIT PRICE	SRC	EXT. BEFORE HST
1/2" through-bolts with nut and washer (LSL and 2x10 nailers to the steel)	34	50					**84**	bolts	$2.75	est.	$231.00
TEK #12 x 2 3/4" self-drilling screws, 100/box, 2x10 nailer to the W200x36 beam and outriggers		2					**2**	boxes	$34.00	est.	$68.00
7 1/4" 24T framing blades						6	**6**	pcs	$18.00	est.	$108.00
7 1/4" PCD fibre-cement/gypsum blade (DensGlass cutting) and utility knife blades 100-pack (score and snap)						1	**1**	each	$65.00	est.	$65.00
Reciprocating saw blades, wood with nails, 10-pack						2	**2**	packs	$29.00	est.	$58.00
Utility knife blades, 100-pack						2	**2**	packs	$24.00	est.	$48.00
FRAMING PACKAGE BEFORE HST											**$40,497**

ESTIMATED BUDGET

order of magnitude at five-month-old pricing; the yard re-prices the order summary above

	AMOUNT
Lines priced from the 1 May quote	$8,650
Lines priced at estimated prices (re-quote)	$31,847
Lines with no price (to quote)	1 lines, not in the total
Framing package before HST	$40,497
HST 13%	$5,265
Framing package including HST	$45,762
By batch, before HST	B1 $7,189 | B2 $5,496 | B2B $1,412 | B3 $8,029 | B4 $12,302 | site and fasteners $6,069
For comparison: Downtown Lumber quote 3027967, 1 May 2026, earlier design, scan cut off at the lower roof	$19,136.71 + HST = $21,624.48

OPTION: TIMBERSTRAND LSL 1 1/2" X 5 1/2" FOR EVERY 2X6 STUD

Straight, no crown, no twist; what the builder asked about for warp restraint on the 10'-7" walls. Same cut lengths as the SPF list. LSL comes 8', 9', 10', 12', 14', 16' and 20'; order the same stock mix as the SPF studs. Plates stay SPF (or LSL for the 16' top plates on the long walls). Price to quote; budget at about $4.95/LF est.

Total LSL stud length if every 2x6 stud is swapped	1,932 LF
Budget for the LSL at the estimate rate, against the SPF stud lines it replaces	$9,563 before HST, to quote
Where it matters most	The 10'-7" west-zone walls and the parapets, where a twisted stud shows through the corrugated metal. A middle path is LSL on those two groups only.
What stays SPF	Plates, blocking, cripples, headers, interior partitions.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Order Summary – T 1.07

GUARDS AND RAILINGS – SEPARATE ESTIMATE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Guards and railings are finish items by the millwork and metal side, so they are outside the framing list and the framing budget. Kept as a separate estimate so they are not forgotten: quantities from the model, allowances from current Toronto millwork rates (est.), the parapet guard as an option because the drawings do not have one.

GUARDS AND RAILINGS, SEPARATE ESTIMATE

allowances only; not in the framing budget on T 1.07

ITEM	DETAIL	WHAT IT IS	QUANTITY	RATE	ALLOWANCE	NOTE
Balcony guardrail	1-A405	2" white oak cap rail, 1" white oak railing members, metal railing brackets fastened to the LVL edge beam, stainless screws, white oak caps	28 LF	$95 / LF est.	$2,618	Full balcony edge plus the two returns. Millwork and metal; the brackets and their fastening to the beam need the engineer's nod.
Main stair guard and handrail	5-A404	3" white oak cap rail, ends fastened to the stringer and the wall; 3/4" white oak balusters at 4" o.c. mechanically fastened to the joist; 2" cap rail at the well	23 LF, about 70 balusters	$85 / LF est.	$1,971	Rake of the run plus the second-floor well edge. One wall-mounted handrail on the closed side of the run is an OBC requirement and is in this line.
Roof stair guard and handrail	5-A404, A103	Same detail along the roof stair and the roof-level well edge	26 LF, about 79 balusters	$85 / LF est.	$2,208	Placeholder length until the roof stair is laid out (T 1.05).
Parapet guard (OPTION, not on the drawings)	none	42" aluminum picket guard on the parapet cap, posts through the cap into the parapet studs with flashed saddles	79 LF	$140 / LF to quote	to quote	The roof is equipment access through W11, not an amenity space, so the set shows no guard. If the roof is to be used, this is the line; it also means every post is a membrane penetration.

NOTES

1. Rates are allowances for the material and shop work of a white oak guard of this detail; site installation and finishing are extra. Re-quote with the millwork shop once the stair layout is settled.
2. The balcony guard height and baluster spacing are to OBC 9.8.8 (1070 mm above the deck, 100 mm sphere); A405 det 1 is drawn at that height.
3. Nothing on this sheet is ordered from Downtown Lumber.

RECONCILIATION

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Line by line against Downtown Lumber quote 3027967 (1 May 2026, built on the April estimate set and the Taiga layout of 29 April). Same means this list carries the item at about the same quantity; changed, missing and superseded are the lines Marek should look at before he re-orders.

RECONCILIATION

QUOTE / LAYOUT LINE	ITEM AS QUOTED	VERDICT	WHAT THIS LIST DOES AND WHY
1 to 3	1x8x16 (20), 1x2x8 (18), 1x6x16 (10) strapping	**Changed**	W1 calls for 25 mm horizontal furring with drainage holes over the mineral wool. This list carries 1x3 at 16" (184 pcs). Sizes to suit the corrugated metal supplier; confirm before ordering.
5	150 2x6x104 5/8 studs, ground floor	**Changed**	Ground floor exterior studs are 68 1/4" on the curb (two per 2x6x12'). The 104 5/8 precuts are right for the partitions, the west infill panels and the entry door bay only. This list: 73 precuts for the whole house, 201 pcs 2x6x12'.
6	40 2x6x14 #2 (plates)	**Changed**	Plates listed in 16' to reduce splices on the 31'-9" walls: 87 pcs 2x6x16' for the house.
7 to 9	30 2x4x104 5/8, 20 2x4x14, 20 2x4x16	**Same scale**	Partitions: 75 2x4x104 5/8 precuts both floors, 44 2x4x92 5/8, 30 2x4x16, 27 2x4x12.
10	35 1/2" plywood, ground floor	**Same**	Partitions plywood clad both faces (note 16): 30 sheets ground floor, 22 second floor, 1 enclosure.
12 to 16	Main floor: 352 LF I-joist, 176 ft LVL, 4 HUS1.81/10, 4 HGUS410, 50 LT2595	**Superseded, about 22 joists less**	Taiga page 1 is a raised ground floor on LVL ledgers. The engineer's 20 Oct ground floor sheet is a 4" slab on grade, so this whole section goes. It is most of the difference in I-joist count against the quote (about 61 there, 48 here).
17, 18	20 3/4" T&G, 12 adhesive (main floor)	**Superseded**	No subfloor at ground level; the slab is the floor.
19 to 21	2 sill gasket, 2 Typar housewrap, 1 poly	**Changed**	Gasket same. Housewrap: the drawings specify Adhero 3000 over DensGlass; Typar or building paper only if Kunaal accepts it. Add Blueskin SA 12" and primer for the curb.
24 to 29	Second floor: 25 3/4" T&G, 7 rim, 132 ft LVL, 460 LF I-joist, 2 HGUS5.50/10, 25 LT2595	**Same count**	Joists counted one by one from the architect's 3D model: 21 TJI 360 on the deck (8 west bay, 8 stair bay, 5 east bay), ordered as 27 x 16' with 6 spares, 432 LF against the quote's 460. Two 3-ply LVL beam lines plus the stair header, 2 HGUS5.50/10, 14 IUS2.37/9.5 at the stair (11 plus 3 spare; the quote's IUS2.56/9.5 suits a 2 1/2" flange, not the TJI 360). Top-mount LT2595 hangers are not needed with flush beams.
30, 31	4 2x10x12, 6 2x8x12	**Changed**	Balcony framing is 2x6 at 16" per the engineer; 2x10 nailers at the steel (4 x 16'). 2x8 headers are counted per opening in the wall lines.
33 to 41	Second walls: 110 2x6x116 5/8, 60 2x6x92 5/8, 50 2x6x14, 70 2x4x116, 25 2x4x14, 20 2x4x16, 35 1/2" ply, 4 2x10x10, 4 2x8x10	**Changed**	116 5/8 precuts are 6" short for the west zone (122 1/2") and 12" long for the east zone. This list: 90 pcs 2x6x12', 22 2x6x92 5/8 and 11 2x6x104 5/8 for the east zone, 33 2x6x16' plates.
43 to 47	Lower roof: 150 ft LVL, 160 LF I-joist, 5 rim, 1 HGUS410, 25 3/4" T&G	**More here**	Counted from the architect's model: west roof 8 TJI (quote 160 LF, about 10). This list adds the roof east of grid 2 the quote did not carry, now TJI 360 (A004 gives 235 mm joists with no product): east low roof 7, enclosure floor over the W/C 6, enclosure floor between the headers 6 (not in the model). The LVL end joist at the parapets (A400) adds about 190 ft of LVL.
48 on	Cut off on the scan	**Missing**	Upper roof, stair enclosure, parapets, nails and hardware are missing from the copy we have. Ask Downtown Lumber for the full quote. This list carries those batches in full.
	Roof framing over grid 2 to 6	**Not engineered**	No engineer's roof sheet exists. Framed here from the assemblies so the yard can price it. Do not order the roof until Hossein issues it.
Taiga p.1	1st Floor Framing FC1: 19 FJ1 16', LG1 ledgers, 46 LT259	**Superseded**	Raised ground floor from the April design. Slab on grade now.
Taiga p.2	2nd Floor Framing FC2: 19 x 16' + 9 x 14' PJI-40, FB5/6/7, 18 subfloor, 2 HGUS5.50/10, 10 IUS2.56/9.5, 9 LT259	**Changed**	Matches the stair bay and east bay; the 14' joists came from the balcony cut-out, now steel outriggers with 2x6. Product now TJI 360. Re-run needed on the 30 Sep set.
Taiga p.3	Lower roof: 9 RJ1 16', B8-3, B9-4, B10-2, 4 rim, 1 HUS410; rest 'by others'	**Same**	Carried as the west roof. The 'by others' area is the middle and east roof, framed from the assemblies here.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Reconciliation – T 1.08


DETAILS: OPENINGS AND FLASHING

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package


by William

Typical framing at openings, drawn for this takeoff, and the architect's own window and balcony-door details reproduced from A401 at readable size. King, jack, jack on each side of every exterior opening; headers per the engineer's east wall sizes where given. Flashing and tapes exactly as Kunaal drew them; Blueskin SA is the builder's equivalent where Extoseal Encore and Huber tape are named.

Typical window opening, 2×6 exterior wall (W1)

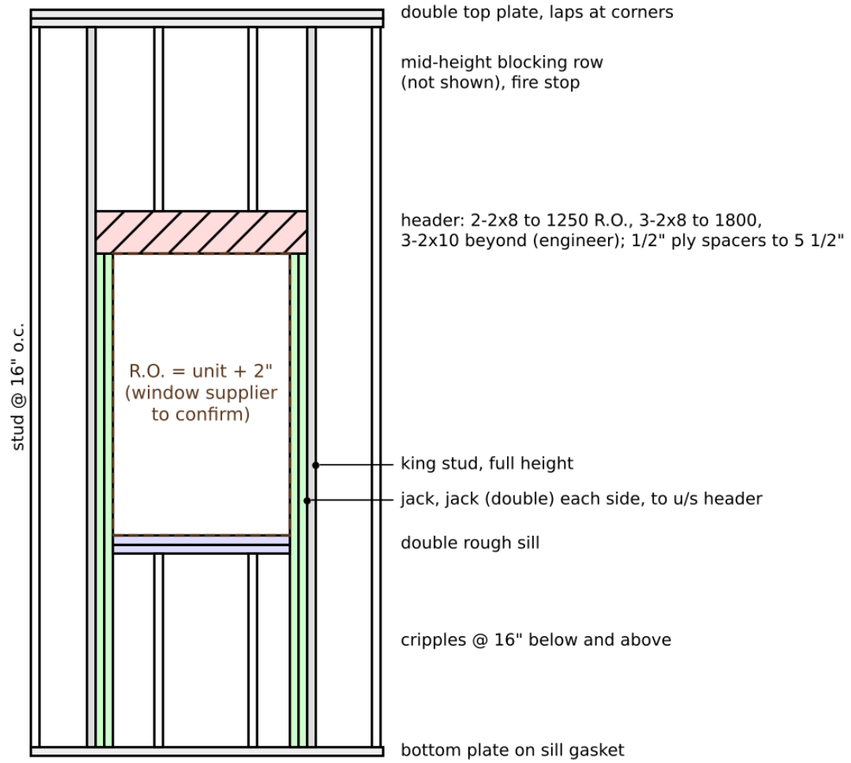

Typical door opening (exterior 2×6 shown)

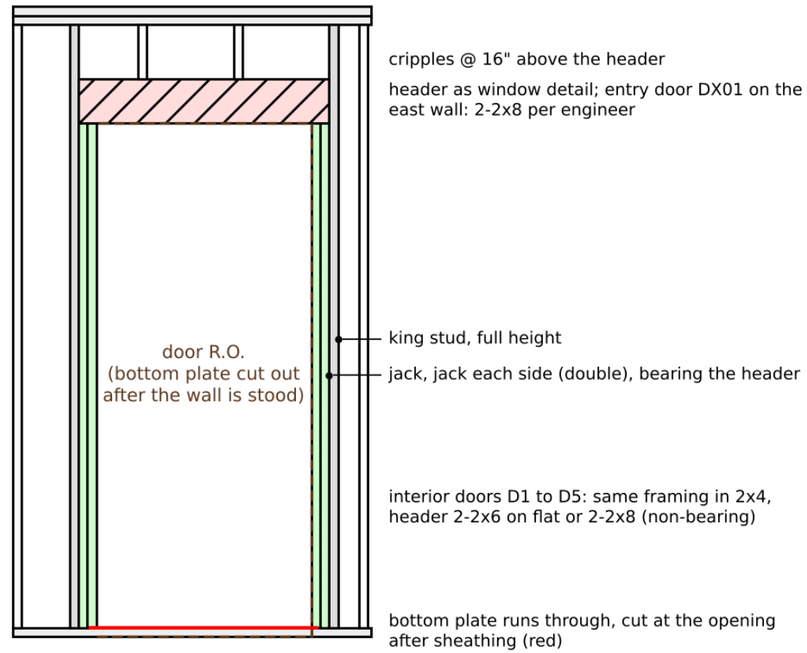

Framing per OBC 9.23. Header sizes from the engineer's 2nd floor framing sheet where shown; others to be confirmed by Gulf Engineering. Not to scale.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026


80 Lamb Ave – Laneway House
Oct 23, 2026

Details, Openings – T 1.09

DETAILS: OPENINGS AND FLASHING


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

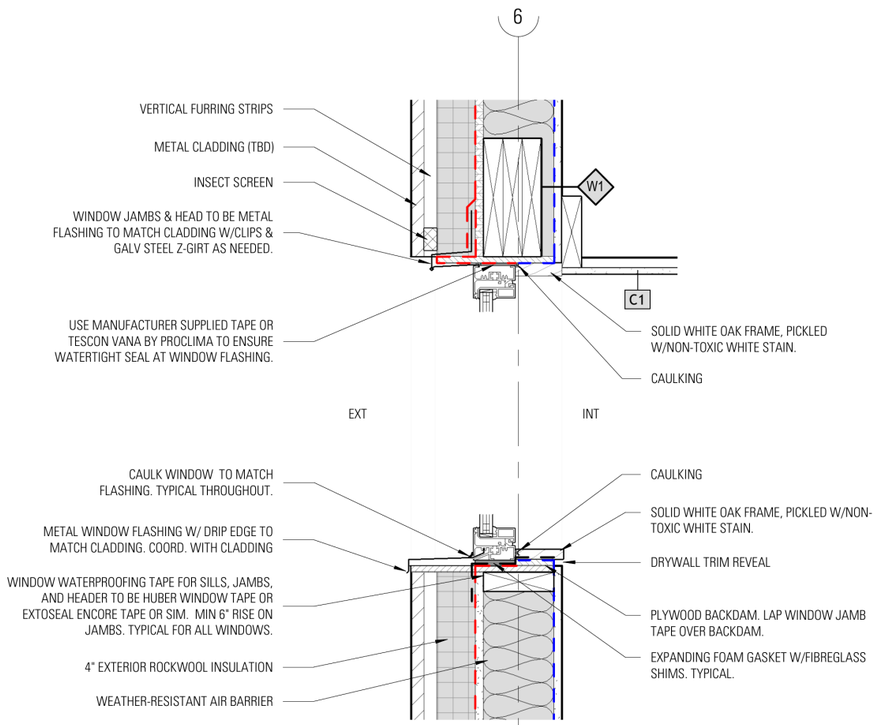

1 **TYP WINDOW**

1 : 10 REF: A301

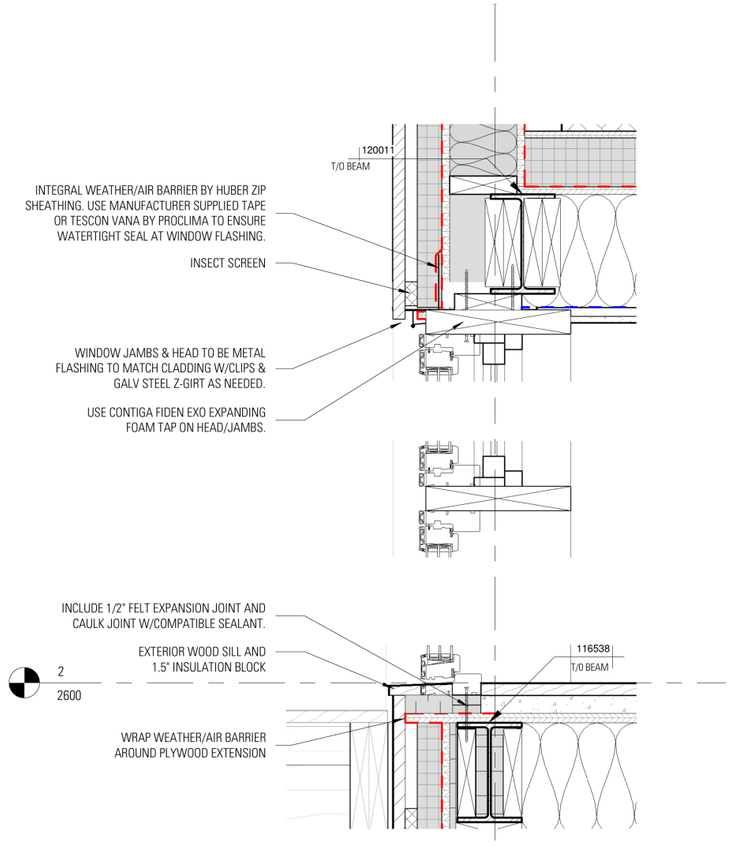

2 **DOUBLE DOOR @ BALCONY**

1 : 10 REF: A300

1-A401 TYP WINDOW, 1:10 (Kunaal Mohan, 100% CD 30 Sep 2026). Plywood back dam, Huber or Tescon Vana tape, Extoseal Encore sill tape with 6" rise, metal head and jamb flashing to match the cladding, Contega Fiden EXO foam tape, 1 1/2" insulation block over the head.

2-A401 DOUBLE DOOR AT BALCONY, 1:10. The DX02 curtain-wall doors at the balcony: exterior wood sill with 1 1/2" insulation block, 1/2" felt expansion joint, weather barrier wrapped around the plywood extension, T/O beam at 12001 and 116538 marked.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026


Details, Openings – T 1.09

DETAILS: PARAPET, OVERHANG, CURB


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

The architect's details at the places the framing has to meet something else: the parapet, the stair-roof overhang, and the curb the walls stand on. Reproduced from A400 and A406 so the framer has them on the same sheets as the counts.

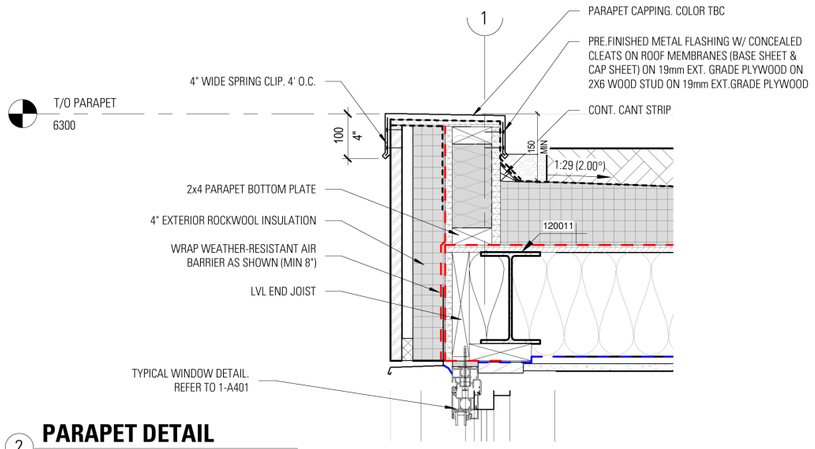

2 **PARAPET DETAIL**
1 : 10 REF: A300

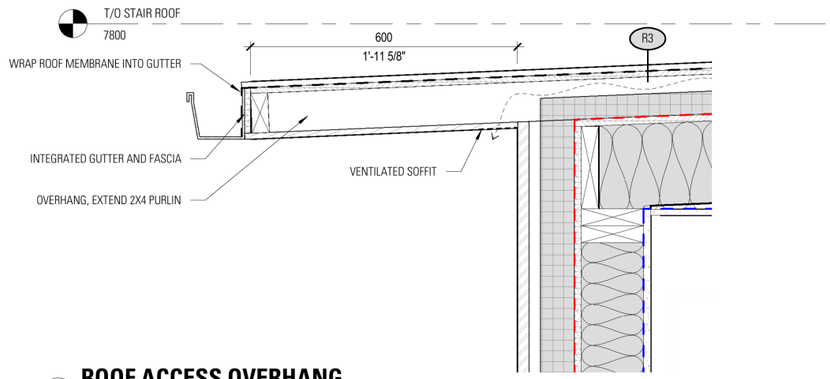

3 **ROOF ACCESS OVERHANG**
1 : 10 REF: A302

2-A400 PARAPET DETAIL, 1:10. 2x4 parapet bottom plate, 2x6 studs on 3/4" exterior plywood both faces, LVL end joist, cant strip, base and cap sheet over the top, pre-finished metal capping on concealed cleats with 4" spring clips at 4' o.c., air barrier wrapped a minimum of 8", 4" exterior mineral wool.

3-A400 ROOF ACCESS OVERHANG, 1:10. The stair roof R3 over the enclosure's south wall: 600 mm overhang, 2x4 purlins extended, integrated gutter and fascia, ventilated soffit, membrane wrapped into the gutter.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026


80 Lamb Ave – Laneway House
Oct 23, 2026

Details, Parapet and Curb – T 1.09A

DETAILS: PARAPET, OVERHANG, CURB

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

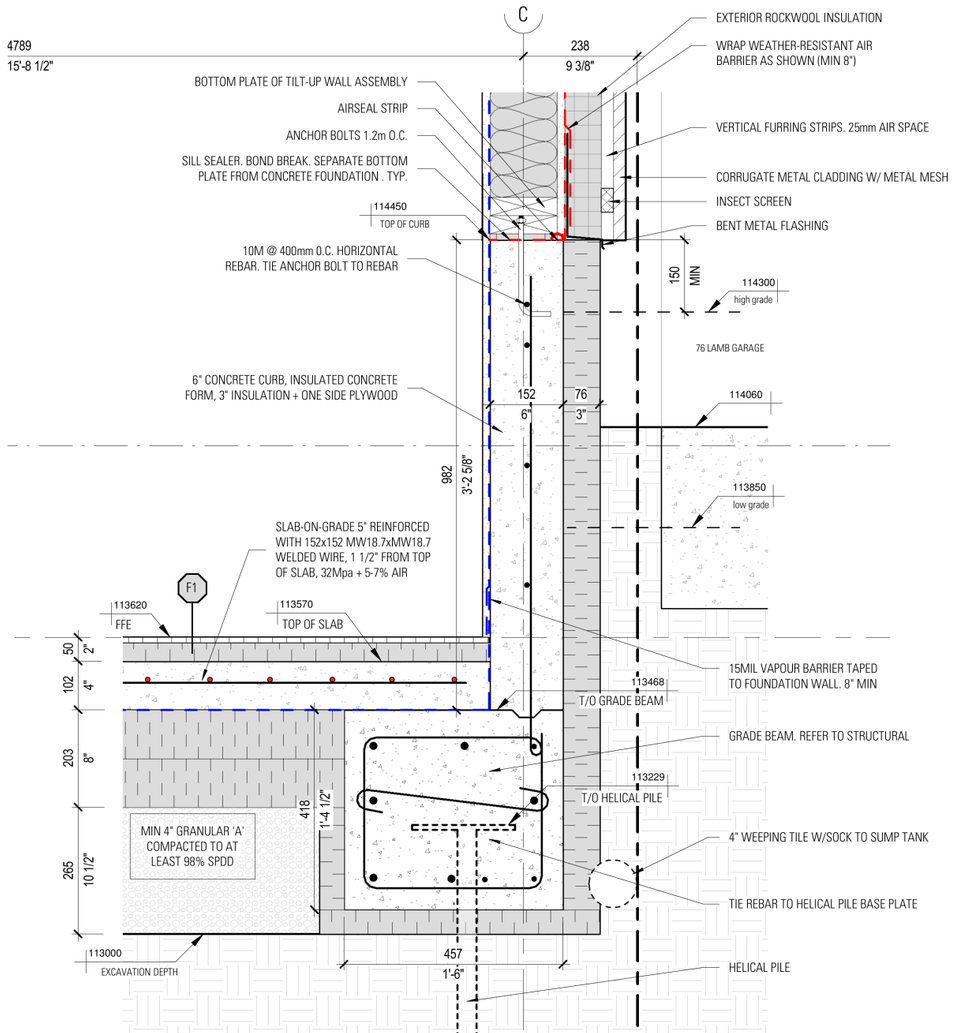

Date
06/02/26

GRADE BEAM DETAILS

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Details, Parapet and Curb – T 1.09A

DETAILS: PARAPET, OVERHANG, CURB

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

A406 GRADE BEAM DETAILS, 1:10, grid C side. Bottom plate of the tilt-up wall on the 6" ICF curb (top of curb 114450, top of slab 113620), sill sealer as a bond break, anchor bolts at 1.2 m tied to the 10M rebar, the 3" ICF insulation outside the curb in line with the wall's mineral wool, bent metal flashing, insect screen, corrugated metal cladding on vertical furring. Blueskin SA over the curb top is Marek's addition and is on T 1.02.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026


Details, Parapet and Curb – T 1.09A


DETAILS: RIM CONNECTION FROM INSIDE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Rim connection at the two property-line walls, where the neighbours' garages leave no access to the outside face of the rim once the walls are up. The joists sit on the plate as usual. Since the rim cannot be nailed into the joists from outside, a web stiffener each side of every joist end is toe-nailed into a TimberStrand LSL rim from inside, and LSL blocking panels in every other cavity are back-nailed into the rim, toe-nailed to the plate and nailed through the stiffener from the open cavity beside them. No hangers. Bearing, stiffener and blocking rules are Weyerhaeuser's; the manufacturer's figures are on T 1.09C.

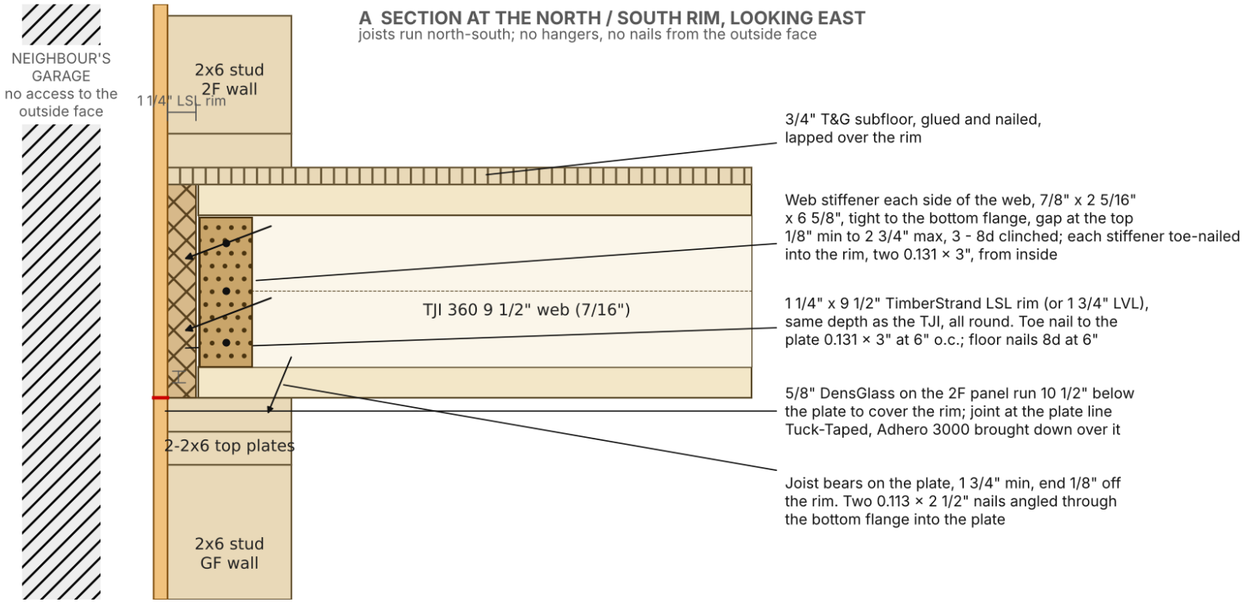

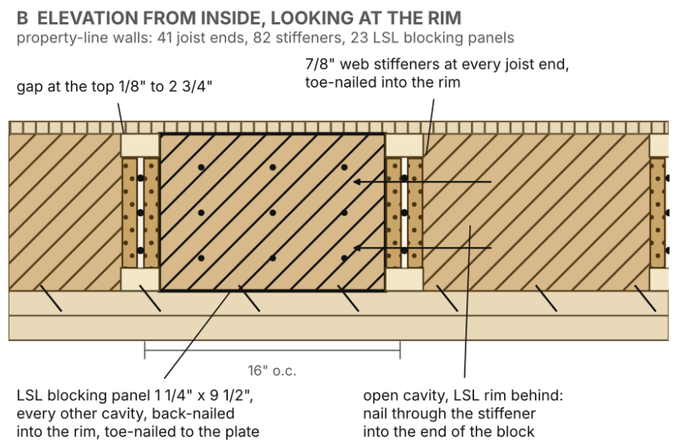

Drawn by By William Design: Weyerhaeuser bearing and web stiffener rules (connector guide W), blocking panels (TJ-9001 A1, B1). Toe nailing through the stiffener is the BWD method, engineer to confirm. Not to scale.

RIM CONNECTION FROM INSIDE, NORTH AND SOUTH WALLS. A: section looking east, joist on the plate against the 1 1/4" LSL rim, stiffener tight to the bottom flange and toe-nailed into the rim. B: inside elevation, joists at 16" o.c. with a blocking panel in every other cavity. Both property-line walls: 41 joist ends, 82 stiffeners, 23 blocking panels, 6 pcs LSL rim (T 1.03).

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Details, Rim Connection – T 1.09B

DETAILS: RIM CONNECTION FROM INSIDE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

RIM AND JOIST CONNECTION RULES, WEYERHAEUSER TJ-9001

Weyerhaeuser Installation Guide for Floor and Roof Framing, TJ-9001, June 2026. The drawn detail on the previous page follows these rules; the manufacturer's figures are on T 1.09C.

ITEM	WEYERHAEUSER TJ-9001 RULE	WHAT WE DO AT 80 LAMB
Rim board to TJI, standard	One 0.131 x 3" nail into each flange, driven through the rim from outside. (Rim board details A3 to A3.4)	Not possible on the north and south walls. Replaced by the stiffener toe nails and blocking below. The east and west rims keep the standard nailing.
Rim board to plate	Toe nail 0.131 x 3" at 6" o.c.; floor panel nails 8d at 6" o.c. into the rim; plate nail 0.131 x 3" at 12" o.c.	As published, all from inside and above. The rim on the two property-line walls is 1 1/4" TimberStrand LSL so the toe nails from the stiffeners and the blocking hold.
TJI to bearing plate	Two 0.113 x 2 1/2" nails driven at an angle into the bottom flange, one each side of the web, at least 1 1/2" from the end. Minimum end bearing 1 3/4".	As published.
Hanger (details H1, H2A)	Face-mount hanger on a TimberStrand LSL or LVL header (H2A). Without stiffeners the hanger sides must laterally support at least 3/8" of the top flange (H1); with stiffeners the hanger must support at least 60% of the joist depth.	Not used at the rim. Used at the stair header and the lower level: Simpson IUS2.37/9.5 for the 2 5/16" TJI 360 flange, ITS2.37/9.5 top flange where the header is shallower than the joist (T 1.06B).
Web stiffener (TJI 230, 360)	7/8" x 2 5/16" minimum each side of the web, three 8d (0.113 x 2 1/2") nails, clinched when possible. Tight to the bottom flange with face-mount hangers; gap at the top 1/8" min, 2 3/4" max. Required where the hanger does not support the top flange.	Two per joist end at both property-line walls, 82 in all, 6 5/8" long, ripped from one sheet of 7/8" plywood. Each stiffener toe-nailed into the rim with two 0.131 x 3" nails (BWD method, Hossein to confirm).
Squash blocks	2x4 minimum, 10d into each flange, matching the bearing area of the post above (detail CS).	Under every post P1 to P3, the enclosure corners and the stair header bearings (T 1.03).
Blocking panels (A1, B1)	Rim board, LSL or a TJI offcut between joists at bearing, toe-nailed to the plate; required with braced walls above or below.	Used: 1 1/4" x 9 1/2" LSL in every other cavity at the north and south rims, 23 panels from 3 pcs 12'. The open cavity gives room to nail through the stiffener into the block. Hossein to confirm the spacing.

NOTES

1. The second-floor wall panels on the property-line sides are sheathed lying down with the DensGlass run 10 1/2" below the bottom plate so the rim and the joint are covered when the wall tilts up. Tuck Tape the horizontal joint; bring the air barrier down over it.

2. TJI 360 is made at 9 1/2" (TJ-9001 lists 9 1/2", 11 7/8", 14" and 16"); confirm regional stock with Downtown Lumber.

3. Connection of the end joists and parapets to the W200x36 columns at the west corners: CONNECTION REQUIRES FURTHER DETAILING, connectors and fasteners are not specified on the plans and MF-1 was never issued. Proposed: a continuous LSL nailer bolted to each column, slab to roof, gasketed from the steel (T 1.02).

4. Detail side-model of this connection in the HTML, animated through the sequence, is on the Rev 2 list.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026


Details, Rim Connection – T 1.09B

MANUFACTURER SPEC: WEYERHAEUSER HANGER DETAILS


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William


Manufacturer's details for the rim connection on T 1.09B, reproduced from the Weyerhaeuser Canada / MiTek connector guide. Where this sheet and T 1.09B differ, this sheet governs.

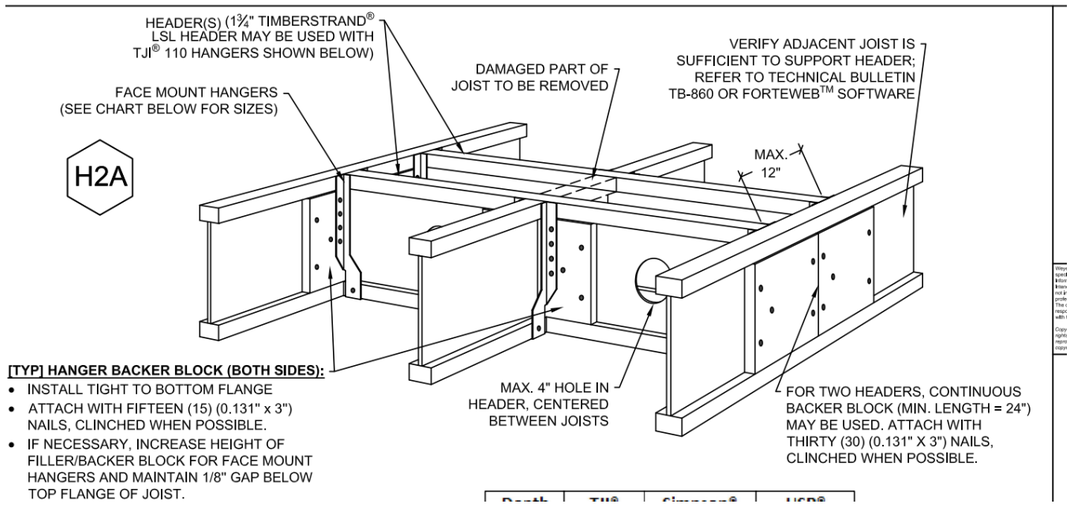


H2A: face-mount hangers on a 1 3/4" LSL header. At 80 Lamb this applies to the stair header hangers; the rim has no hangers (T 1.09B).

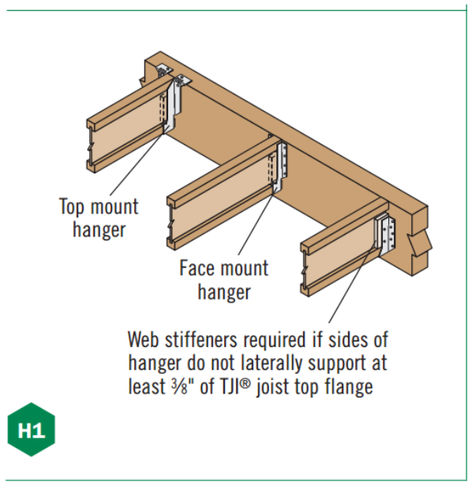

H1: top-mount and face-mount hangers. Web stiffeners required where the hanger sides do not laterally support at least 3/8" of the top flange.

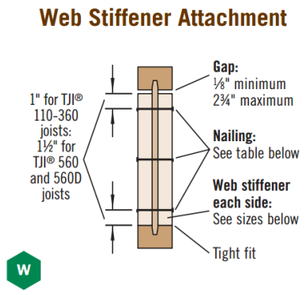

W: web stiffener each side of the web, 7/8" x 2 5/16" minimum for TJI 360, three 8d nails clinched; gap at the top 1/8" min, 2 3/4" max; tight fit at the bottom with face-mount hangers.

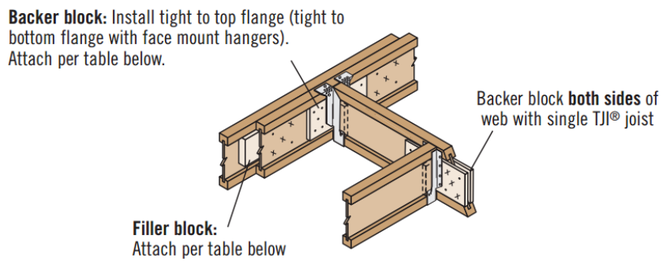

Backer and filler blocks: for hanging off an I-joist web. Not used at 80 Lamb, shown for reference.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Manufacturer Spec – T 1.09C