


1	SECCION	DIMENSIONES				
	1	Α	.12 +.06	В	.06	± .06
	2	Α	.16 + .06 03	В	.06	±.06
	3	A	.12 ±.06	В	AL RAS	±.06
	4	Α	.20 + .05 06	В	AL RAS	±.06
	5	A	VER NOTA 4	В	AL RAS	+ .06 00
	6	Α	.25 ±.06	В	AL RAS	±.06
	9	Α	.20 ± .06	Х	1.36	±.06
	10	Α	. 19 + .06 03			
	. 11	Α	.20 ±.06			
		C	.20 ±.06			
	12	Α	.25 ±.06	В	AL RAS	± .06
	13	A	.18 ± .06			
	14	Α	.12 ±.06	В	AL RAS	± .06
	15	A	.12 + .06	В	AL RAS	± .06
	16	Α	.1106	В	.06	+ .03 06

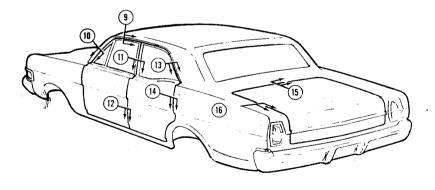

NOTAS:

- 1. Los márgenes deben estar paralelos con tolerancia de .06.
- 2. Reste .02 de dimensiones de margen para cada moldura de ventana.
- Agregue .02 a dimensión X de Sección 9 cuando se use moldura de ventana.
- 4. El margen de guardabarro a panel de estribo debe estar de acuerdo con el margen de guardabarro a puerta.

Fig. 4 — Dimensiones de Holguras de Carrocerías. Típicas

## Fairlane Club de Argentina - Prohibida su venta o comercialización