Sea-Bird Scientific
13431 NE 20th Street
Bellevue, WA 98005
USA

+1 425-643-9866
seabird@seabird.com
www.seabird.com

SENSOR SERIAL NUMBER: 0027
CALIBRATION DATE: 10-Mar-26

Prawler CTD CONDUCTIVITY CALIBRATION DATA
PSS 1978: C(35,15,0) = 4.2914 Siemens/meter

COEFFICIENTS:

```
g =  -9.810083e-01
h =   1.645890e-01
i =  -2.202152e-04
j =   4.636040e-05

CPcor = -9.5700e-008
CTcor =  3.2500e-006
WBOTC =   2.7284e-07
```

BATH TEMP (° C)	BATH SAL (PSU)	BATH COND (S/m)	INSTRUMENT OUTPUT (Hz)	INSTRUMENT COND (S/m)	RESIDUAL (S/m)
22.0000	0.0000	0.00000	2443.32	0.00000	0.00000
1.0000	34.5843	2.95802	4891.60	2.95800	-0.00001
4.5000	34.5665	3.26347	5077.07	3.26348	0.00001
15.0000	34.5298	4.24017	5628.46	4.24017	0.00000
18.5000	34.5227	4.58360	5809.66	4.58361	0.00001
24.0000	34.5159	5.13886	6090.93	5.13884	-0.00002
29.0000	34.5124	5.65812	6342.41	5.65812	0.00001
32.5000	34.5099	6.02857	6515.70	6.02857	0.00000

f = Instrument Output(Hz) * sqrt(1.0 + WBOTC * t) / 1000.0

t = temperature (°C); p = pressure (decibars); δ = CTcor; ε = CPcor;

Conductivity (S/m) = $(g + h * f^2 + i * f^3 + j * f^4) / (1 + \delta * t + \varepsilon * p)$

Residual (Siemens/meter) = instrument conductivity - bath conductivity

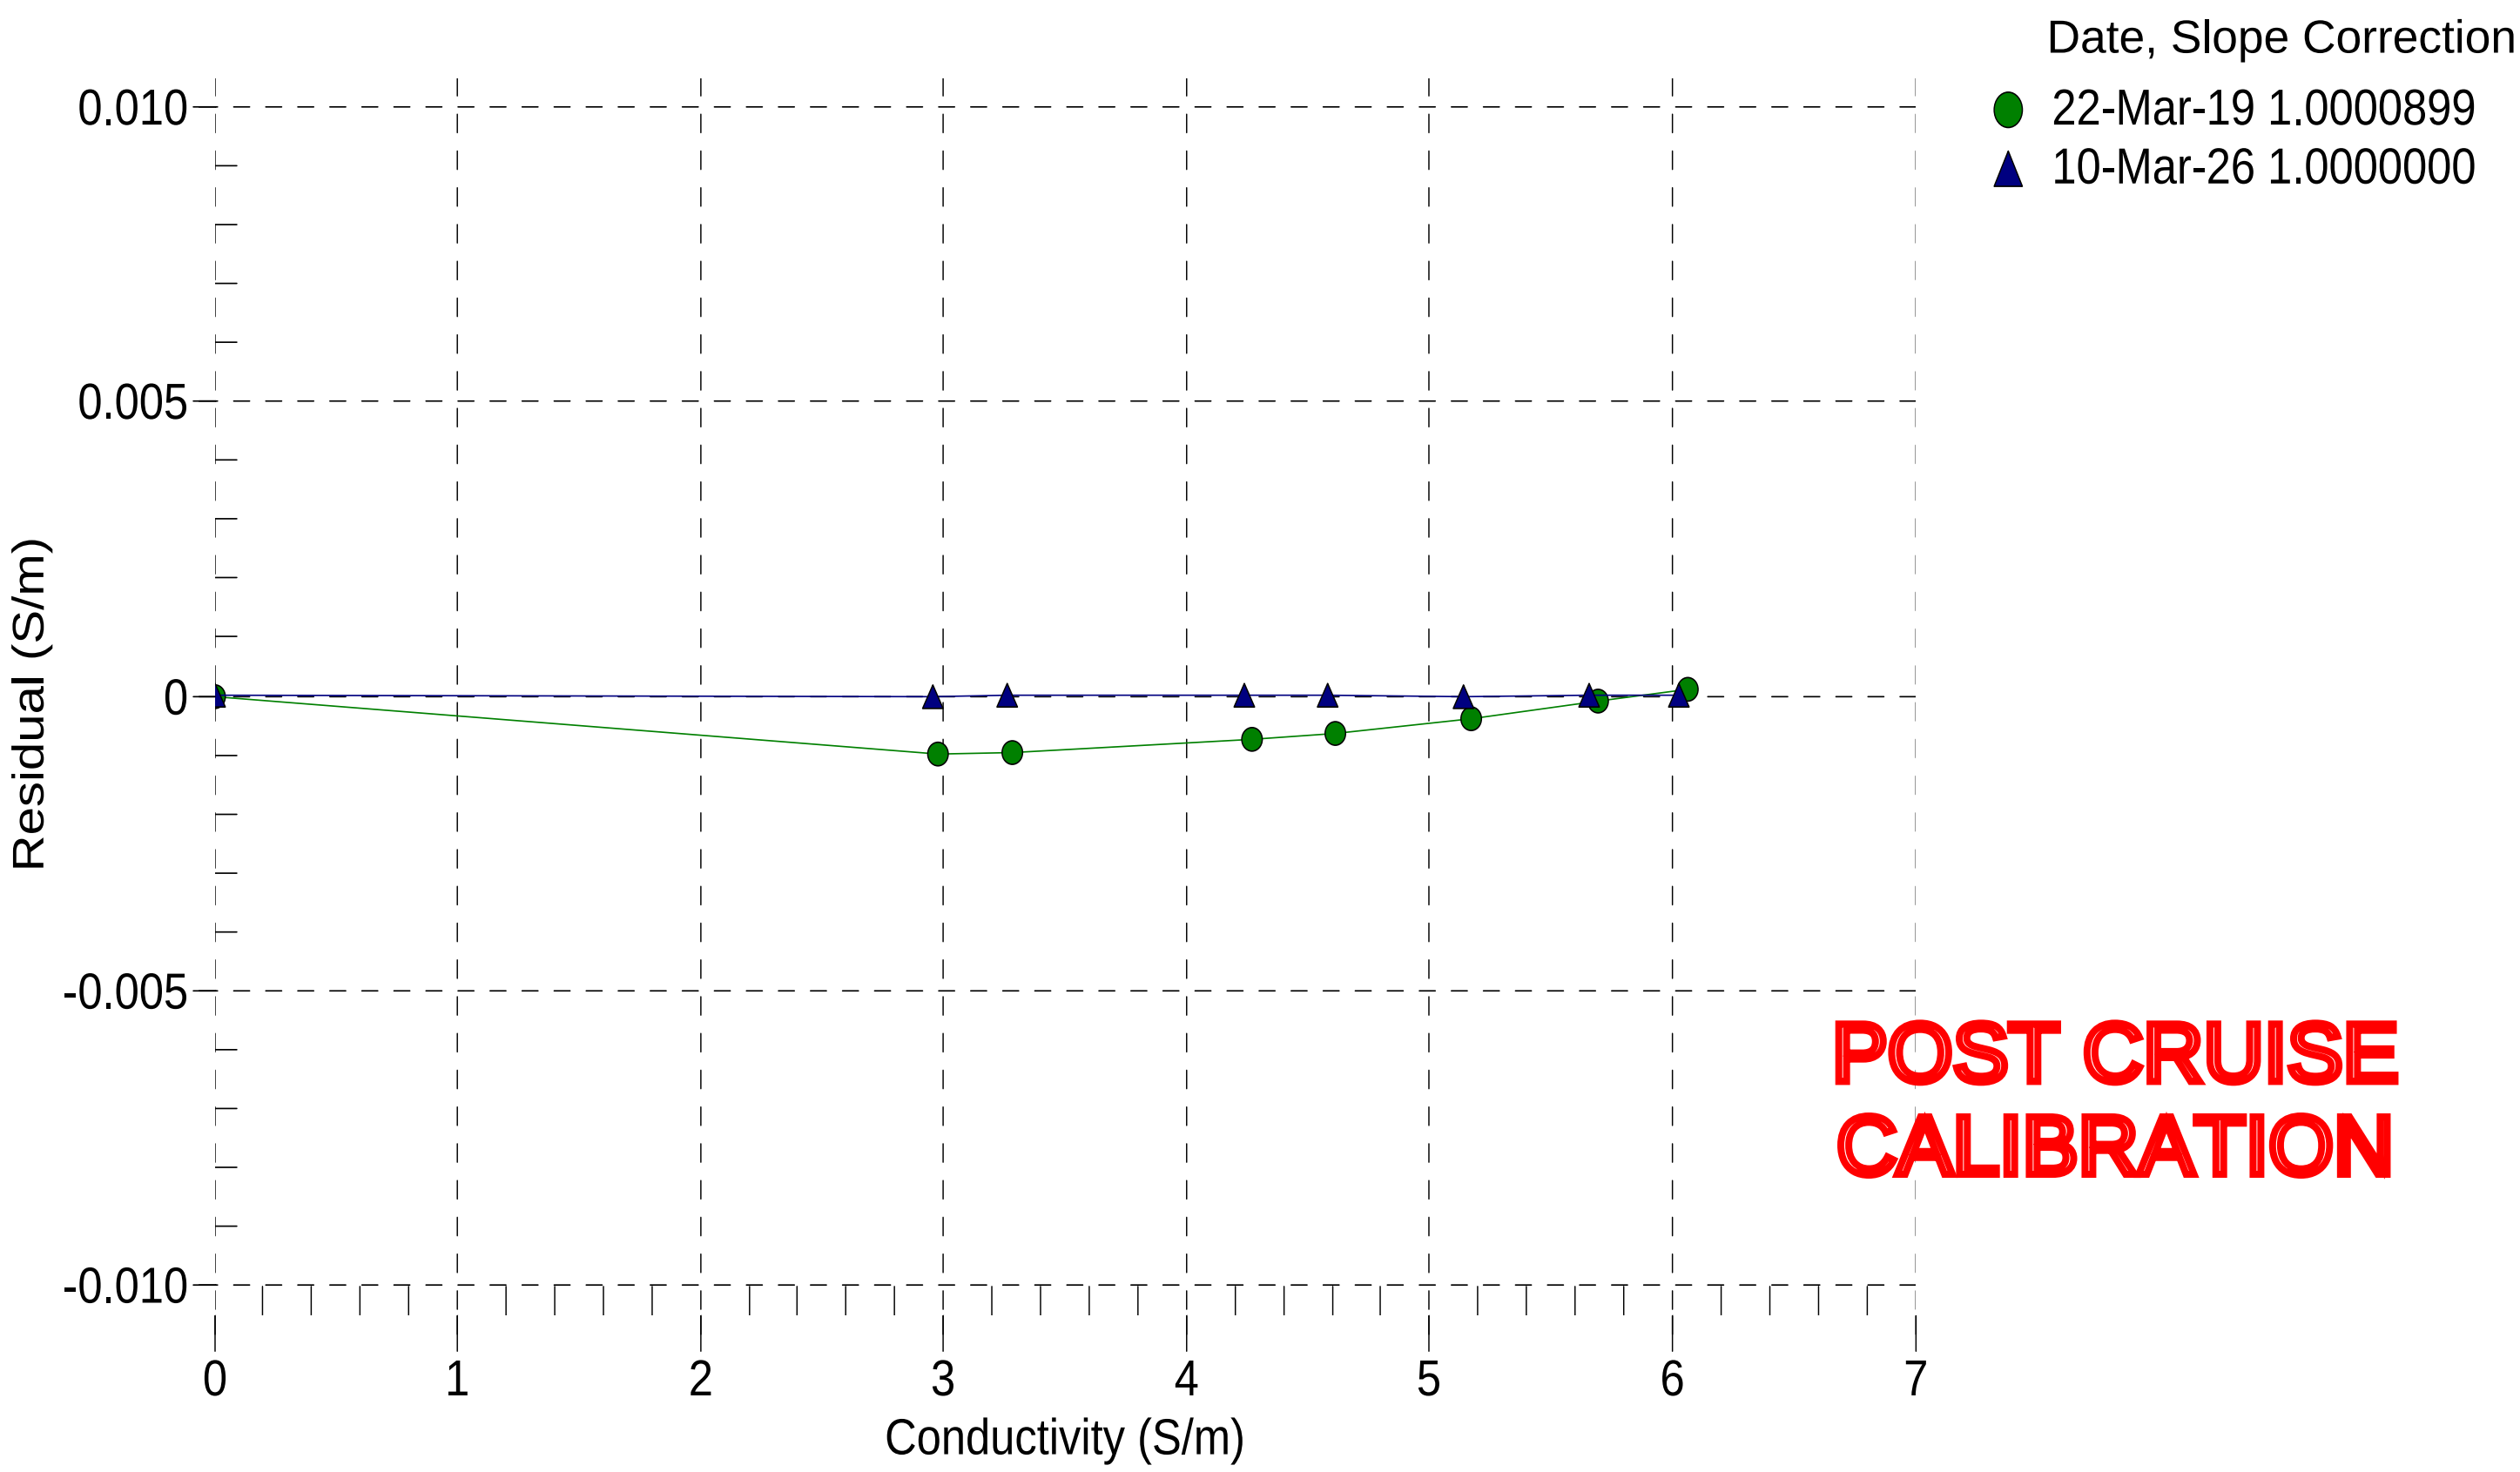

POST CRUISE CALIBRATION