

## **OWNER'S MANUAL**

# **EPAR SENSOR**

Models SQ-612 and SQ-615

Rev: 30-Aug-2022



**APOGEE INSTRUMENTS, INC.** | 721 WEST 1800 NORTH, LOGAN, UTAH 84321, USA TEL: (435) 792-4700 | FAX: (435) 787-8268 | WEB: APOGEEINSTRUMENTS.COM

# TABLE OF CONTENTS

Owner's Manual
Certificates of Compliance
Introduction5
Sensor Models
Specifications
Deployment and Installation
Cable Connectors
Operation and Measurement
Maintenance and Recalibration
Troubleshooting and Customer Support
Return and Warranty Policy18

## CERTIFICATE OF COMPLIANCE

#### **EU Declaration of Conformity**

This declaration of conformity is issued under the sole responsibility of the manufacturer:

Apogee Instruments, Inc. 721 W 1800 N Logan, Utah 84321 USA

for the following product(s):

Models: SQ-612, SQ-615 Type: ePAR Sensor

The object of the declaration described above is in conformity with the relevant Union harmonization legislation:

2014/30/EU Electromagnetic Compatibility (EMC) Directive

2011/65/EU Restriction of Hazardous Substances (RoHS 2) Directive 2015/863/EU Amending Annex II to Directive 2011/65/EU (RoHS 3)

Standards referenced during compliance assessment:

EN 61326-1:2013 Electrical equipment for measurement, control, and laboratory use – EMC requirements EN 63000:2018

Technical documentation for the assessment of electrical and electronic products with

respect to the restriction of hazardous substances

Please be advised that based on the information available to us from our raw material suppliers, the products manufactured by us do not contain, as intentional additives, any of the restricted materials including lead (see note below), mercury, cadmium, hexavalent chromium, polybrominated biphenyls (PBB), polybrominated diphenyls (PBDE), bis (2-ethylhexyl) phthalate (DEHP), butyl benzyl phthalate (BBP), dibutyl phthalate (DBP), and diisobutyl phthalate (DIBP). However, please note that articles containing greater than 0.1 % lead concentration are RoHS 3 compliant using exemption 6c.

Further note that Apogee Instruments does not specifically run any analysis on our raw materials or end products for the presence of these substances, but we rely on the information provided to us by our material suppliers.

Signed for and on behalf of: Apogee Instruments, August 2022

**Bruce Bugbee** President

Apogee Instruments, Inc.



## CERTIFICATE OF COMPLIANCE

### **UK Declaration of Conformity**

This declaration of conformity is issued under the sole responsibility of the manufacturer:

Apogee Instruments, Inc. 721 W 1800 N Logan, Utah 84321 USA

for the following product(s):

Models: SQ-612, SQ-615 Type: ePAR Sensor

The object of the declaration described above is in conformity with the relevant UK Statutory Instruments and their amendments:

2016 No. 1091 The Electromagnetic Compatibility Regulations 2016

2012 No. 3032 The Restriction of the Use of Certain Hazardous Substances in Electrical and Electronic

**Equipment Regulations 2012** 

Standards referenced during compliance assessment:

BS EN 61326-1:2013

BS EN 63000:2018

Electrical equipment for measurement, control, and laboratory use – EMC requirements Technical documentation for the assessment of electrical and electronic products with

respect to the restriction of hazardous substances

Please be advised that based on the information available to us from our raw material suppliers, the products manufactured by us do not contain, as intentional additives, any of the restricted materials including lead (see note below), mercury, cadmium, hexavalent chromium, polybrominated biphenyls (PBB), polybrominated diphenyls (PBDE), bis (2-ethylhexyl) phthalate (DEHP), butyl benzyl phthalate (BBP), dibutyl phthalate (DBP), and diisobutyl phthalate (DIBP). However, please note that articles containing greater than 0.1 % lead concentration are RoHS 3 compliant using exemption 6c.

Further note that Apogee Instruments does not specifically run any analysis on our raw materials or end products for the presence of these substances, but we rely on the information provided to us by our material suppliers.

Signed for and on behalf of: Apogee Instruments, August 2022

Bruce Bugbee President

Apogee Instruments, Inc.



## INTRODUCTION

Radiation that drives photosynthesis is called photosynthetically active radiation (PAR) and, historically, is defined as total radiation across a range of 400 to 700 nm. PAR is almost universally quantified as photosynthetic photon flux density (PPFD) in units of micromoles per square meter per second (µmol m<sup>-2</sup> s<sup>-1</sup>, equal to microEinsteins per square meter per second) summed from 400 to 700 nm (total number of photons from 400 to 700 nm). However, ultraviolet and far-red photons outside the defined PAR range of 400-700 nm can also contribute to photosynthesis and influence plant responses (e.g., flowering).

Data from recent studies indicate that far-red photons synergistically interact with photons in the historically defined PAR range of 400-700 nm to increase photochemical efficiency in leaves (Hogewoning et al., 2012; Murakami et al., 2018; Zhen and van Iersel, 2017; Zhen et al., 2019). Measurements from whole plants and plant canopies indicate adding far-red photons (using far-red LEDs with peaks near 735 nm and outputting photons across a range of about 700-750 nm) to radiation sources outputting photons in the 400-700 nm range increases canopy photosynthesis equal to the addition of the same number of photons in the 400-700 nm range for multiple species, and C3 and C4 photosynthetic pathways, but far-red photons alone are photosynthetically inefficient and result in minimal photosynthesis (Zhen and Bugbee, 2020a; Zhen and Bugbee, 2020b).

This research suggests that far-red photons drive canopy photosynthesis with similar efficiency as photons in the traditional PAR range when they are acting synergistically with photons in the 400-700 nm range, meaning when far-red photons are added to radiation sources outputting 400-700 nm photons. Thus, far-red photons need to be included in the definition of PAR (Zhen et al., 2021).

Sensors that measure PPFD are often called quantum sensors due to the quantized nature of radiation. A quantum refers to the minimum quantity of radiation, one photon, involved in physical interactions (e.g., absorption by photosynthetic pigments). In other words, one photon is a single quantum of radiation. Sensors that function like traditional quantum sensors but measure a wider range of wavelengths can be thought of as an 'extended range' quantum sensor.

Typical applications of traditional quantum sensors include incoming PPFD measurement over plant canopies in outdoor environments or in greenhouses and growth chambers and reflected or under-canopy (transmitted) PPFD measurement in the same environments. The extended photosynthetically active radiation (ePAR) sensor detailed in this manual uses a detector that is sensitive to radiation from 383-757 nm ± 5 nm, which allows it to measure photons from Far-red.

Apogee Instruments SQ-600 series ePAR sensors consist of a cast acrylic diffuser (filter), photodiode, and signal processing circuitry mounted in an anodized aluminum housing. A cable to connect the sensor to a measurement device is also included. SQ-600 series ePAR sensors are designed for continuous photon flux density measurements in indoor or outdoor environments.

Hogewoning et al. 2012. Photosynthetic Quantum Yield Dynamics: From Photosystems to Leaves. *The Plant Cell*, 24: 1921–1935.

Murakami et al. 2018. A Mathematical Model of Photosynthetic Electron Transport in Response to the Light Spectrum Based on Excitation Energy Distributed to Photosystems. *Plant Cell Physiology*. 59(8): 1643–1651.

Zhen and Van Iersel. 2017. Far-red light is needed for efficient photochemistry and photosynthesis. *Journal of Plant Physiology*. 209: 115–122.

Zhen et al. 2019. Far-red light enhances photochemical efficiency in a wavelength-dependent manner. *Physiologia Plantarum*. 167(1):21-33.

Zhen and Bugbee. 2020a. Far-red photons have equivalent efficiency to traditional photosynthetic photons: Implications for redefining photosynthetically active radiation. *Plant Cell and Environment*. 2020; 1–14.

Zhen and Bugbee. 2020b. Substituting Far-Red for Traditionally Defined Photosynthetic Photons Results in Equal Canopy Quantum Yield for CO<sub>2</sub> Fixation and Increased Photon Capture During Long-Term Studies: Implications for Re-Defining PAR. *Frontiers in Plant Science*. 11:1-14.

Zhen et al. 2021. Why Far-Red Photons Should Be Included in the Definition of Photosynthetic Photons and the Measurement of Horticultural Fixture Efficacy. *Frontiers in Plant Science*. 12:1-4.

## **SENSOR MODELS**

This manual covers the amplified voltage output ePAR Sensors, models SQ-612 and SQ-615 (in bold below). Additional models are covered in their respective manuals.

Model	Signal
SQ-610	Self-powered
SQ-612	0-2.5 V
SQ-614	4-20 mA
SQ-615	0-5 V
SQ-616	USB
SQ-617	SDI-12
SQ-618	Modbus



A sensor's model number and serial number are located on the bottom of the sensor. If the manufacturing date of a specific sensor is required, please contact Apogee Instruments with the serial number of the sensor.


## **SPECIFICATIONS**

	SQ-612-SS	SQ-615-SS		
Power Supply	5 to 24 V DC	5.5 to 24 V DC		
Current Draw	12 V is 57 μA			
Sensitivity	0.625 mV per μmol m <sup>-2</sup> s <sup>-1</sup>	1.25 mV per μmol m <sup>-2</sup> s <sup>-1</sup>		
Calibration Factor	1.6 μmol m <sup>-2</sup> s <sup>-1</sup> per mV	0.8 μmol m <sup>-2</sup> s <sup>-1</sup> per mV		
Calibration Uncertainty	± 5 % (see Calibration Traceability below)			
Output Range	0 to 2.5 V	0 to 5 V		
Measurement Range	0 to 4000 μmol m <sup>-2</sup> s <sup>-1</sup>			
Measurement Repeatability	Less than 0.5 %			
Long-term Drift (Non-stability)	Less than 2 % per year			
Non-linearity	Less than 1 % (up to 4000 μmol m <sup>-2</sup> s <sup>-1</sup> )			
Response Time	Less than 1 ms			
Field of View	180°			
Spectral Range	383 to 757 nm ± 5 nm (wavelengths where response is greater than 50 %; see Spectral Response below)			
Directional (Cosine) Response	± 2 % at 45° zenith angle, ± 5 % at 75° zenith angle (see Directional Response below)			
Azimuth Error	Less than 0.5 %			
Tilt Error	Less than 0.5 %			
Temperature Response	-0.11 ± 0.04 % per C			
Uncertainty in Daily Total	Less than 5 %			
Housing	Anodized aluminum body with acrylic diffuser			
IP Rating	IP68			
Operating Environment	-40 to 70 C; 0 to 100 % relative humidity; can be submerged in water up to depths of 30 m			
Dimensions	30.5 mm diameter, 37 mm height			
Mass (with 5 m of cable)	140 g			
Cable	5 m of two conductor, shielded, twisted-pair wire; TPR jacket; pigtail lead wires; stainless steel (316),  M8 connector			
Warranty	4 years against defects in materials and workmanship			

### **Calibration Traceability**

Apogee Instruments SQ-600 series ePAR sensors are calibrated through side-by-side comparison to the mean of four transfer standard sensors under a reference lamp. The transfer standard sensors are recalibrated with a quartz halogen lamp traceable to the National Institute of Standards and Technology (NIST).


#### **Spectral Response**

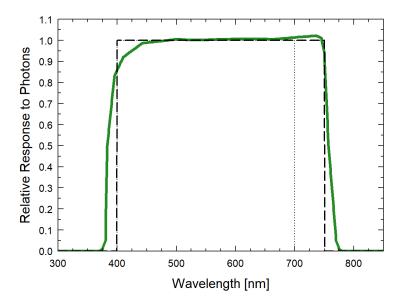


Mean spectral response measurements of four replicate Apogee SQ-600 series ePAR Sensors. Incremental spectral response measurements were made at 10 nm increments across a wavelength range of 370 to 800 nm in a monochromator with an attached electric light source.

Measured spectral data from each quantum sensor were refined and normalized by comparing measured spectral response of the monochromator/electric light combination to measured spectral differences from a quantum sensor reference.

#### **Cosine Response**

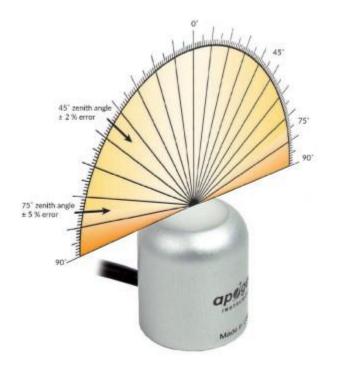

Directional, or cosine, response is defined as the measurement error at a specific angle of radiation incidence. Error for Apogee SQ-600 series ePAR Sensor is approximately  $\pm$  2 % and  $\pm$  5 % at solar zenith angles of 45° and 75°, respectively.

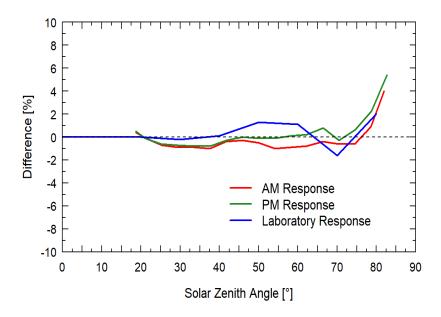


Mean directional (cosine) response of seven Apogee series quantum sensors. Directional response measurements were made on the rooftop of the Apogee building in Logan, Utah. Directional response was calculated as the relative difference of quantum sensors from the mean of replicate reference quantum sensors (LI-COR models LI-190 and LI-190R, Kipp & Zonen model PQS 1). Data were also collected in the laboratory using a reference lamp and positioning the sensor at varying angles.

## DEPLOYMENT AND INSTALLATION

Mount the sensor to a solid surface with the nylon mounting screw provided. To accurately measure photon flux density incident on a horizontal surface, the sensor must be level. An Apogee Instruments model AL-100 leveling plate is recommended for this purpose. To facilitate mounting on a cross arm, an Apogee Instruments model AL-120 mounting bracket is recommended.



To minimize azimuth error, the sensor should be mounted with the cable pointing toward true north in the northern hemisphere or true south in the southern hemisphere. Azimuth error is typically less than 0.5 %, but it is easy to minimize by proper cable orientation.

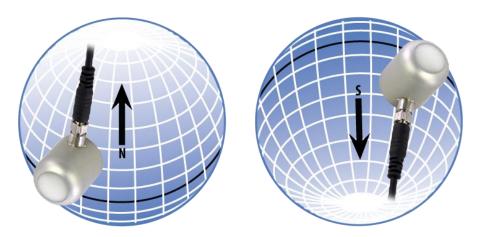

In addition to orienting the cable to point toward the nearest pole, the sensor should also be mounted such that obstructions (e.g., weather station tripod/tower or other instrumentation) do not shade the sensor. **Once mounted, the blue cap should be removed from the sensor.** The blue cap can be used as a protective covering for the sensor when it is not in use.

## CABLE CONNECTORS

Apogee offers cable connectors to simplify the process of removing sensors from weather stations for calibration (the entire cable does not have to be removed from the station and shipped with the sensor).

The ruggedized M8 connectors are rated IP68, made of corrosion-resistant marine-grade stainlesssteel, and designed for extended use in harsh environmental conditions.



Cable connectors are attached directly to the head.

#### **Instructions**

Pins and Wiring Colors: All Apogee connectors have six pins, but not all pins are used for every sensor. There may also be unused wire colors inside the cable. To simplify datalogger connection, we remove the unused pigtail lead colors at the datalogger end of the cable.

If a replacement cable is required, please contact Apogee directly to ensure ordering the proper pigtail configuration.

**Alignment:** When reconnecting a sensor, arrows on the connector jacket and an aligning notch ensure proper orientation.

Disconnection for extended periods: When disconnecting the sensor for an extended period of time from a station, protect the remaining half of the connector still on the station from water and dirt with electrical tape or other method.

**Tightening:** Connectors are designed to be firmly finger-tightened only. There is an o-ring inside the connector that can be overly compressed if a wrench is used. Pay attention to thread alignment to avoid cross-threading. When fully tightened, 1-2 threads may still be visible.

WARNING: Do not tighten the connector by twisting the black cable or sensor head, only twist the metal connector (yellow arrows).



A reference notch inside the connector ensures proper alignment before tightening.



When sending sensors in for calibration, only send the sensor head.




Finger-tighten firmly

## **OPERATION AND MEASUREMENT**

Connect the sensor to a measurement device (meter, datalogger, controller) capable of measuring and displaying or recording a millivolt signal (an input measurement range of approximately 0-2.5 V (SQ-612) or 0-5 V (SQ-615) is required to cover the entire range of ePAR from the sun). To maximize measurement resolution and signal-to-noise ratio, the input range of the measurement device should closely match the output range of the ePAR sensor. **DO NOT connect the sensor to a power source greater than 24 V DC.** 

#### Wiring for SQ-612 and SQ-615

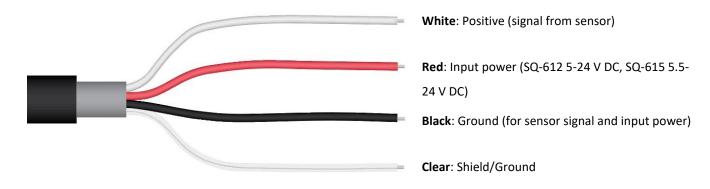

#### **Sensor Calibration**

Apogee SQ-612 and SQ-615 ePAR Sensors have standard calibration factors of exactly:

SQ-612: 1.6  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> per mV SQ-615: 0.8  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> per mV

Multiply the calibration factor by the measured mV signal to convert sensor output to photon flux density in units of  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup>:

Calibration Factor (0.8 μmol m<sup>-2</sup> s<sup>-1</sup> per mV) \* Sensor Output Signal (mV) = Photon Flux Density (μmol m<sup>-2</sup> s<sup>-1</sup>)

0.8 \* 3000 = 2400



Example of photon flux density measurement with an Apogee model ePAR sensor. Full sunlight yields a photon flux density on a horizontal plane of approximately 2400  $\mu mol\ m^{-2}\ s^{-1}$ . This yields an output signal of 3000 mV for the 0-5 V option or an output signal of 1500 mV for the 0-2.5 V option. This signal is converted to photon flux density by multiplying by the calibration factor.

SQ-612 Sensor Output: 1500 mV

Conversion Factor: 1.6  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> per mV

SQ-615 Sensor Output: 3000 mV

Conversion Factor:  $0.8~\mu mol~m^{-2}~s^{-1}$  per mV

#### **Spectral Error**

Quantum sensors are the most common instrument for measuring PPFD, because they are about an order of magnitude lower cost the spectroradiometers, but spectral errors must be considered. The spectral errors in the table below can be used as correction factors for individual radiation sources.

#### Spectral Errors for PPFD Measurements with Apogee SQ-610 Series ePAR Sensors

Radiation Source (Error Calculated Relative to Sun, Clear Sky)	SQ-610 Series PPFD Error [%]
Sun (Clear Sky)	2.5
Sun (Cloudy Sky)	2.6
Cool White Fluorescent (T5)	-0.5
Metal Halide	0.7
Ceramic Metal Halide	0.3
Mogul Base HPS	0.3
Dual-ended HPS	0.6
Cool White LED	-1.0
Warm White LED	-0.4
Blue LED (442 nm)	-2.7
Cyan LED (501 nm)	-0.7
Green LED (529 nm)	-0.7
Amber LED (598 nm)	-0.4
Red LED (666 nm)	-0.3
Far Red LED (737 nm)	4.5

#### **Immersion Effect Correction Factor**

When a radiation sensor is submerged in water, more of the incident radiation is backscattered out of the diffuser than when the sensor is in air (Smith, 1969; Tyler and Smith, 1970). This phenomenon is caused by the difference in the refractive index for air (1.00) and water (1.33) and is called the immersion effect. Without correction for the immersion effect, radiation sensors calibrated in air can only provide relative values underwater (Smith, 1969; Tyler and Smith, 1970). Immersion effect correction factors can be derived by making measurements in air and at multiple water depths at a constant distance from a lamp in a controlled laboratory setting.

Apogee SQ-610 series ePAR sensors have an immersion effect correction factor of 1.25. This correction factor should be multiplied by PPFD measurements made underwater to yield accurate PPFD.

Further information on underwater measurements and the immersion effect can be found on the Apogee webpage (http://www.apogeeinstruments.com/underwater-par-measurements/).

Smith, R.C., 1969. An underwater spectral irradiance collector. Journal of Marine Research 27:341-351.

Tyler, J.E., and R.C. Smith, 1970. Measurements of Spectral Irradiance Underwater. Gordon and Breach, New York, New York. 103 pages.

## MAINTENANCE AND RECALIBRATION

Dust or organic deposits are best removed using water or window cleaner and a soft cloth or cotton swab. Salt deposits should be dissolved with vinegar and removed with a soft cloth or cotton swab.

Blocking of the optical path between the target and detector can cause low readings. Occasionally, accumulated materials on the diffuser of the upward-looking radiometer and in the apertures of the downward-looking radiometer can block the optical path in three common ways:

- 1. Moisture or debris on the diffuser (upward-looking) or in the apertures (downward-looking).
- 2. Dust during periods of low rainfall.
- 3. Salt deposit accumulation from evaporation of sea spray or sprinkler irrigation water.

Apogee Instruments upward-looking sensors have a domed diffuser and housing for improved self-cleaning from rainfall, but active cleaning may be necessary. Dust or organic deposits are best removed using water, or window cleaner, and a soft cloth or cotton swab. Salt deposits should be dissolved with vinegar and removed with a cloth or cotton swab. Salt deposits cannot be removed with solvents such as alcohol or acetone. Use only gentle pressure when cleaning the diffuser with a cotton swab or soft cloth, to avoid scratching the outer surface. The solvent should be allowed to do the cleaning, not mechanical force. Never use an abrasive material or cleaner on the diffuser.

It is recommended that two-band radiometers be recalibrated every two years. See the Apogee webpage for details regarding return of sensors for recalibration (<a href="http://www.apogeeinstruments.com/tech-support-recalibration-repairs/">http://www.apogeeinstruments.com/tech-support-recalibration-repairs/</a>).

## TROUBLESHOOTING AND CUSTOMER SUPPORT

#### **Independent Verification of Functionality**

Apogee SQ-612 and SQ-615 ePAR Sensors provide an amplified voltage output that is proportional to incident photon flux density for the 400-750 nm wavelength range. A quick and easy check of sensor functionality can be determined using a DC power supply and a voltmeter. Power the sensor with a DC voltage by connecting the positive voltage signal to the red wire from the sensor and the negative (or common) to the black wire from the sensor. Use the voltmeter to measure across the white wire (signal output) and black wire (signal ground). Direct the sensor head toward a light source and verify the sensor provides a signal. Increase and decrease the distance from the sensor head to the light source to verify that the signal changes proportionally (decreasing signal with increasing distance and increasing signal with decreasing distance). Blocking all radiation from the sensor should force the sensor signal to zero.

#### **Compatible Measurement Devices (Dataloggers/Controllers/Meters)**

SQ-600 ePAR Sensors are calibrated with a standard calibration factor of 1.6  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> per mV (SQ-612) or 0.8  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> per mV (SQ-615), yielding a sensitivity of 0.6 mV per  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> (SQ-612) or 1.3 mV per  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup> (SQ-615). Thus, a compatible measurement device (e.g., datalogger or controller) should have resolution of at least 0.6 mV (SQ-612) or 1.3 mV (SQ-615) in order to provide photon flux density resolution of 1  $\mu$ mol m<sup>-2</sup> s<sup>-1</sup>.

An example datalogger program for Campbell Scientific dataloggers can be found on the Apogee webpage at <a href="https://www.apogeeinstruments.com/downloads/#datalogger">https://www.apogeeinstruments.com/downloads/#datalogger</a>.

#### **Cable Length**

When the sensor is connected to a measurement device with high input impedance, sensor output signals are not changed by shortening the cable or splicing on additional cable in the field. Tests have shown that if the input impedance of the measurements device is greater than 1 mega-ohm there is negligible effect on the calibration, even after adding up to 100 m of cable. All Apogee sensors use shielded, twisted pair cable to minimize electromagnetic interference. For best measurements, the shield wire must be connected to an earth ground. This is particularly important when using the sensor with long lead lengths in electromagnetically noisy environments.

#### **Modifying Cable Length**

See Apogee webpage for details on how to extend sensor cable length:

(http://www.apogeeinstruments.com/how-to-make-a-weatherproof-cable-splice/).

## RETURN AND WARRANTY POLICY

#### RETURN POLICY

Apogee Instruments will accept returns within 30 days of purchase as long as the product is in new condition (to be determined by Apogee). Returns are subject to a 10 % restocking fee.

#### WARRANTY POLICY

#### What is Covered

All products manufactured by Apogee Instruments are warranted to be free from defects in materials and craftsmanship for a period of four (4) years from the date of shipment from our factory. To be considered for warranty coverage an item must be evaluated by Apogee.

Products not manufactured by Apogee (spectroradiometers, chlorophyll content meters, EE08-SS probes) are covered for a period of one (1) year.

#### What is Not Covered

The customer is responsible for all costs associated with the removal, reinstallation, and shipping of suspected warranty items to our factory.

The warranty does not cover equipment that has been damaged due to the following conditions:

- 1. Improper installation, use, or abuse.
- 2. Operation of the instrument outside of its specified operating range.
- 3. Natural occurrences such as lightning, fire, etc.
- 4. Unauthorized modification.
- 5. Improper or unauthorized repair.

Please note that nominal accuracy drift is normal over time. Routine recalibration of sensors/meters is considered part of proper maintenance and is not covered under warranty.

#### Who is Covered

This warranty covers the original purchaser of the product or another party who may own it during the warranty period.

#### What Apogee Will Do

At no charge Apogee will:

- 1. Either repair or replace (at our discretion) the item under warranty.
- 2. Ship the item back to the customer by the carrier of our choice.

Different or expedited shipping methods will be at the customer's expense.

#### How to Return an Item

- 1. Please do not send any products back to Apogee Instruments until you have received a Return Merchandise Authorization (RMA) number from our technical support department by submitting an online RMA form at <a href="https://www.apogeeinstruments.com/tech-support-recalibration-repairs/">www.apogeeinstruments.com/tech-support-recalibration-repairs/</a>. We will use your RMA number for tracking of the service item. Call (435) 245-8012 or email techsupport@apogeeinstruments.com with questions.
- 2. For warranty evaluations, send all RMA sensors and meters back in the following condition: Clean the sensor's exterior and cord. Do not modify the sensors or wires, including splicing, cutting wire leads, etc. If a connector has been attached to the cable end, please include the mating connector otherwise the sensor connector will be removed in order to complete the repair/recalibration. *Note:* When sending back sensors for routine calibration that have Apogee's standard stainless-steel connectors, you only need to send the sensor with the 30 cm section of cable and one-half of the connector. We have mating connectors at our factory that can be used for calibrating the sensor.
- 3. Please write the RMA number on the outside of the shipping container.
- 4. Return the item with freight pre-paid and fully insured to our factory address shown below. We are not responsible for any costs associated with the transportation of products across international borders.

Apogee Instruments, Inc. 721 West 1800 North Logan, UT 84321, USA

5. Upon receipt, Apogee Instruments will determine the cause of failure. If the product is found to be defective in terms of operation to the published specifications due to a failure of product materials or craftsmanship, Apogee Instruments will repair or replace the items free of charge. If it is determined that your product is not covered under warranty, you will be informed and given an estimated repair/replacement cost.

#### PRODUCTS BEYOND THE WARRANTY PERIOD

For issues with sensors beyond the warranty period, please contact Apogee at <u>techsupport@apogeeinstruments.com</u> to discuss repair or replacement options.

#### OTHER TERMS

The available remedy of defects under this warranty is for the repair or replacement of the original product, and Apogee Instruments is not responsible for any direct, indirect, incidental, or consequential damages, including but not limited to loss of income, loss of revenue, loss of profit, loss of data, loss of wages, loss of time, loss of sales, accruement of debts or expenses, injury to personal property, or injury to any person or any other type of damage or loss.

This limited warranty and any disputes arising out of or in connection with this limited warranty ("Disputes") shall be governed by the laws of the State of Utah, USA, excluding conflicts of law principles and excluding the Convention for the International Sale of Goods. The courts located in the State of Utah, USA, shall have exclusive jurisdiction over any Disputes.

This limited warranty gives you specific legal rights, and you may also have other rights, which vary from state to state and jurisdiction to jurisdiction, and which shall not be affected by this limited warranty. This warranty extends only to you and cannot by transferred or assigned. If any provision of this limited warranty is unlawful, void, or unenforceable, that provision shall be deemed severable and shall not affect any remaining provisions. In case of any inconsistency between the English and other versions of this limited warranty, the English version shall prevail.

This warranty cannot be changed, assumed, or amended by any other person or agreement