



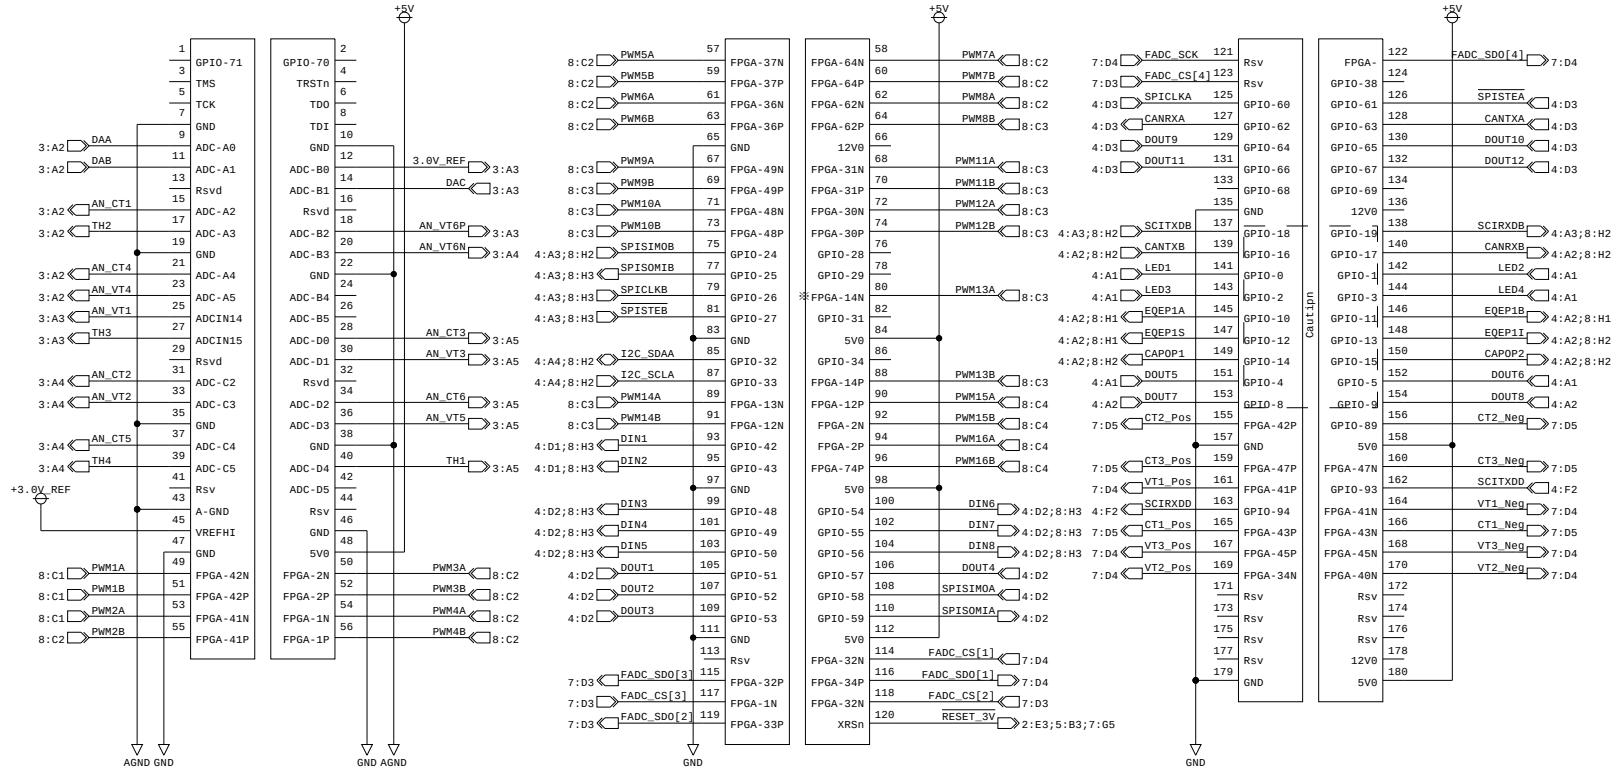
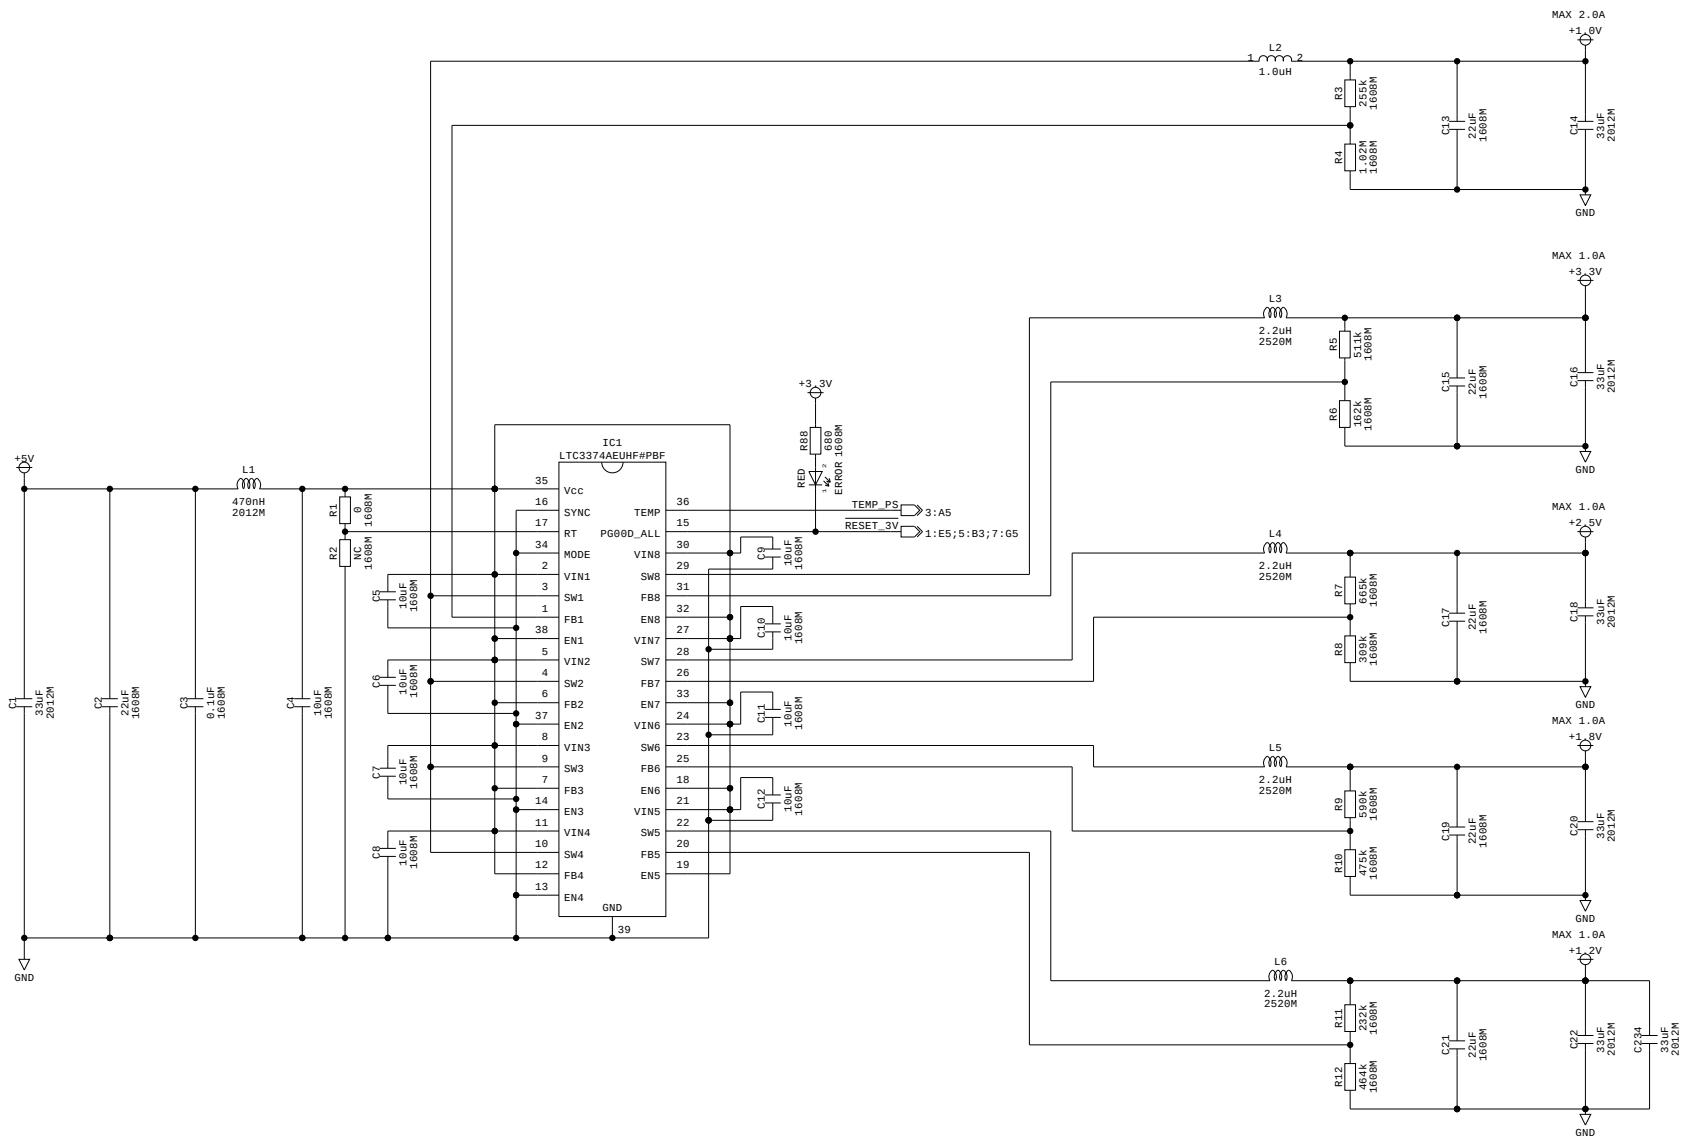
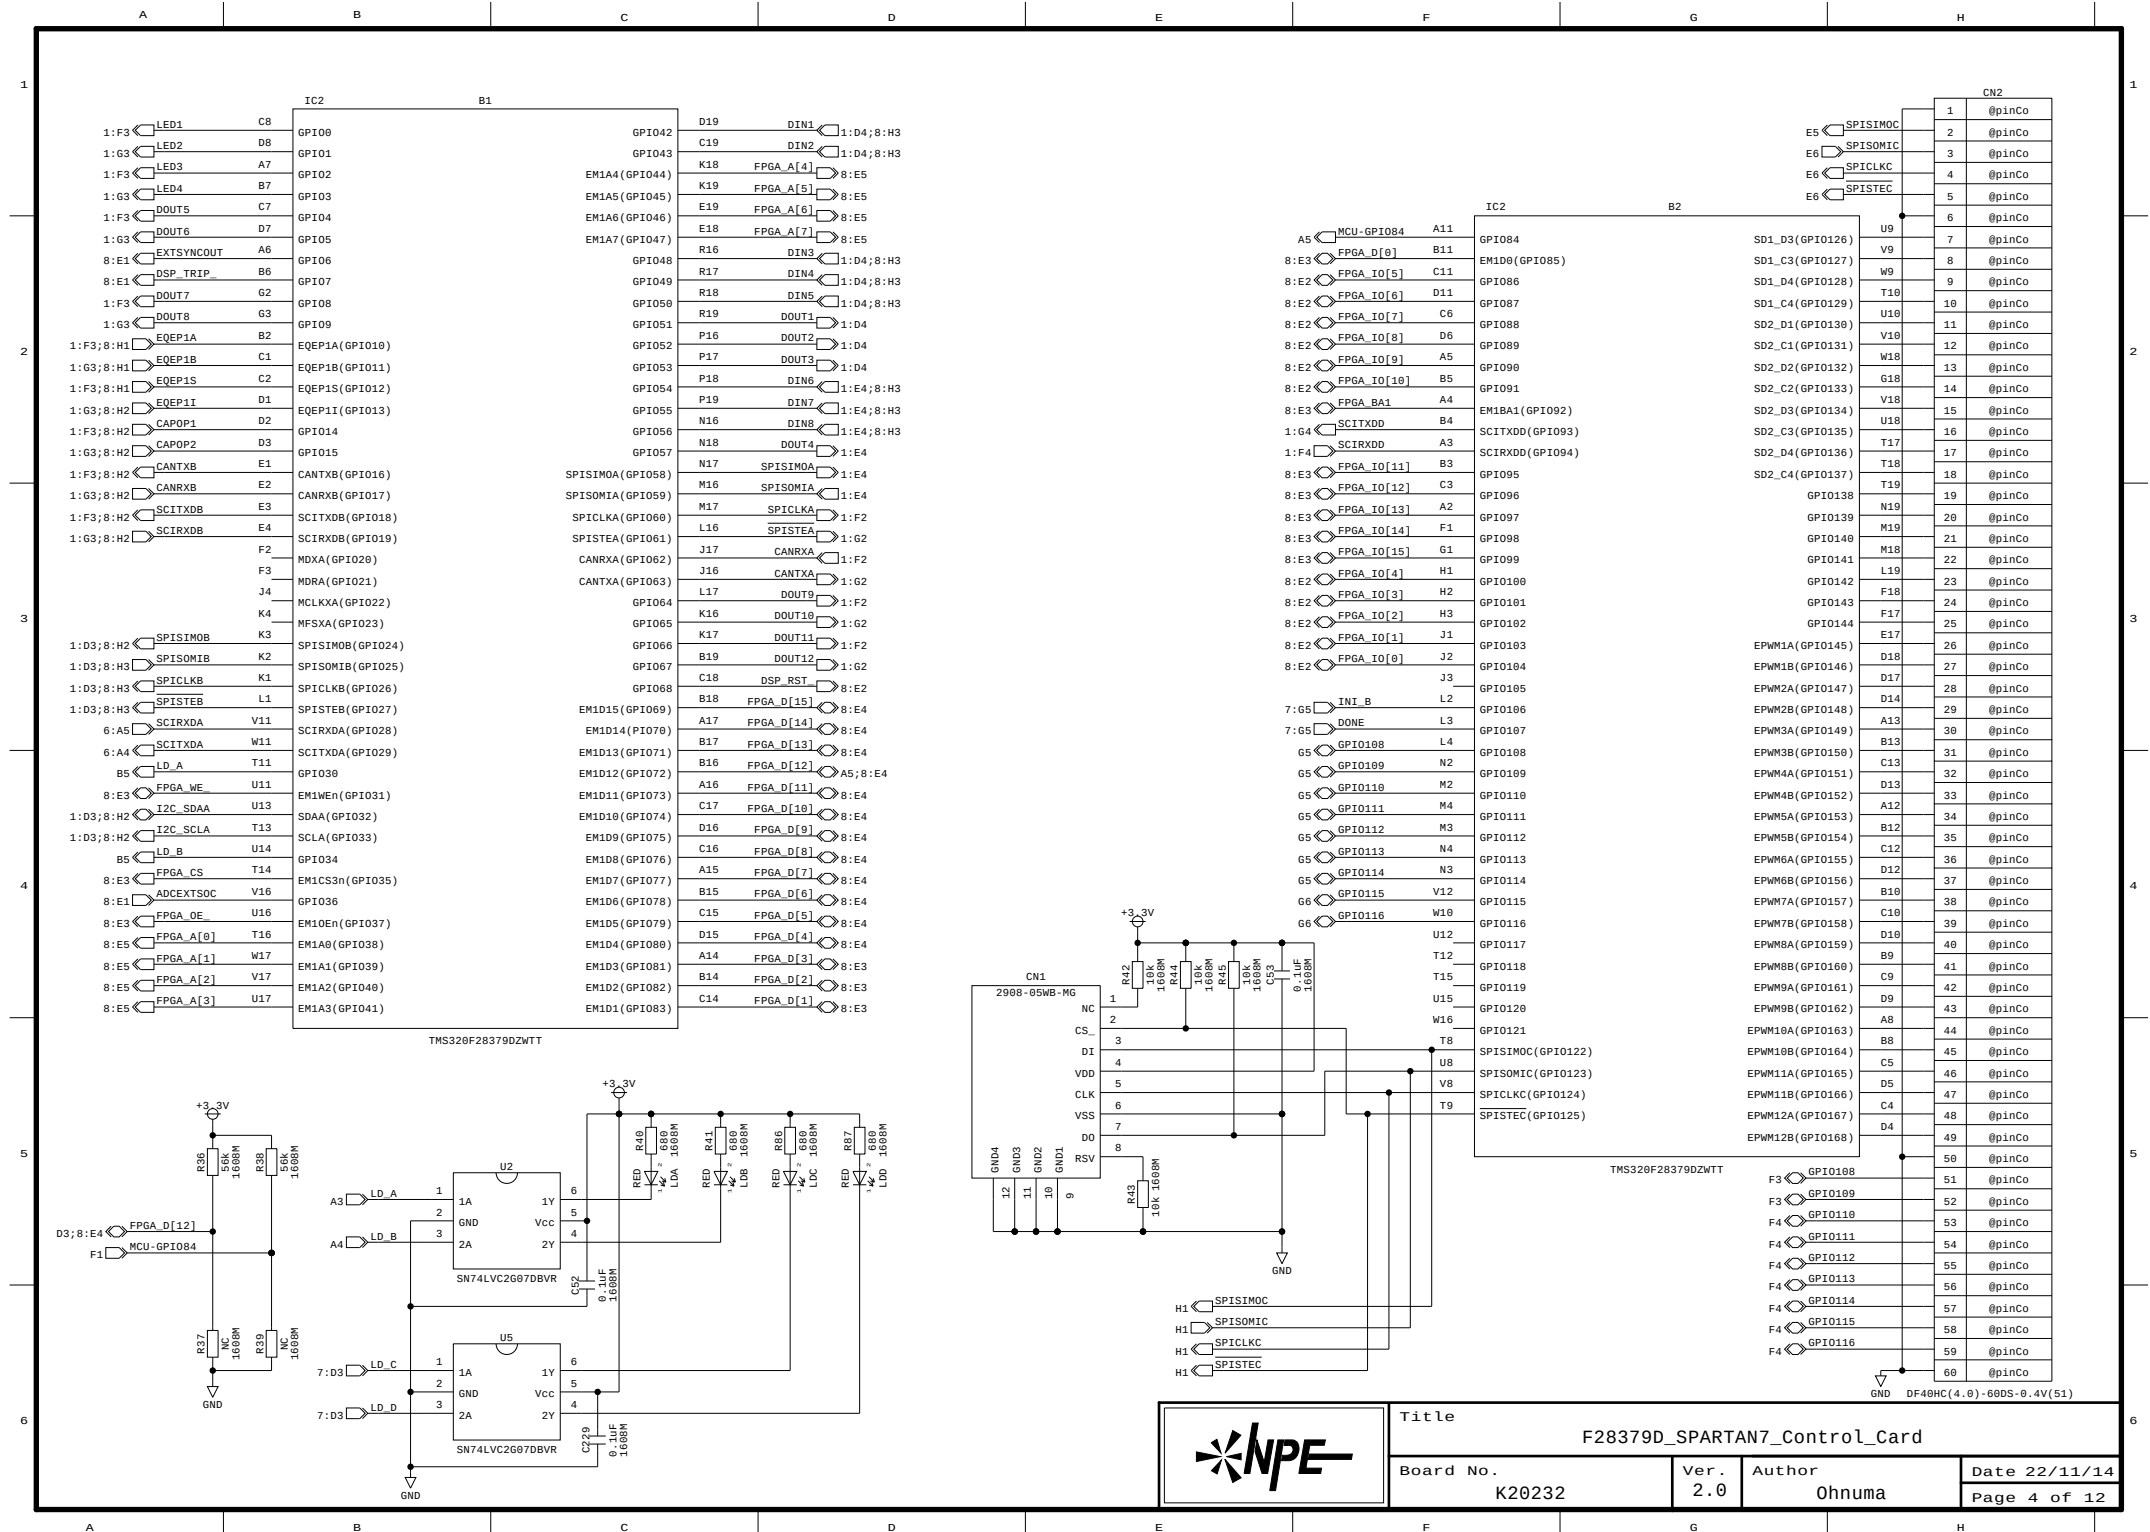


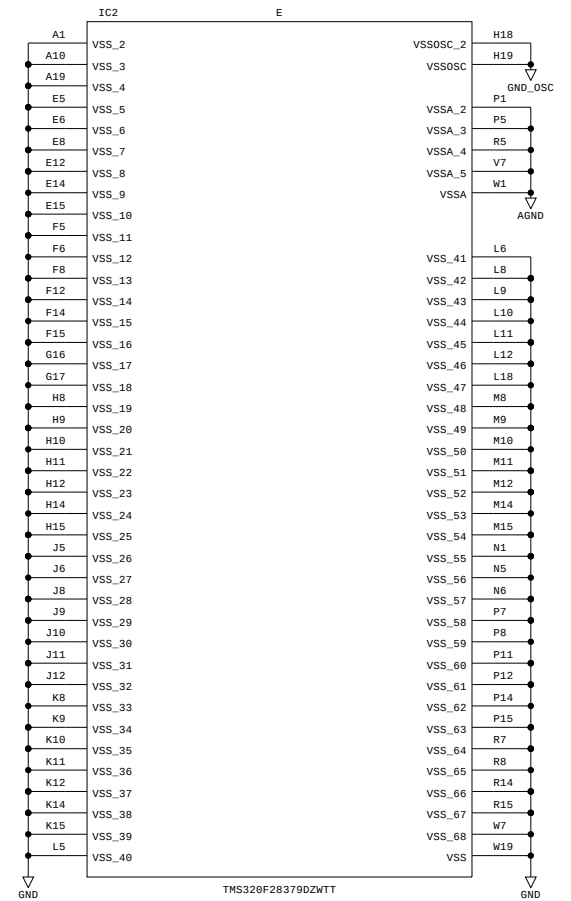

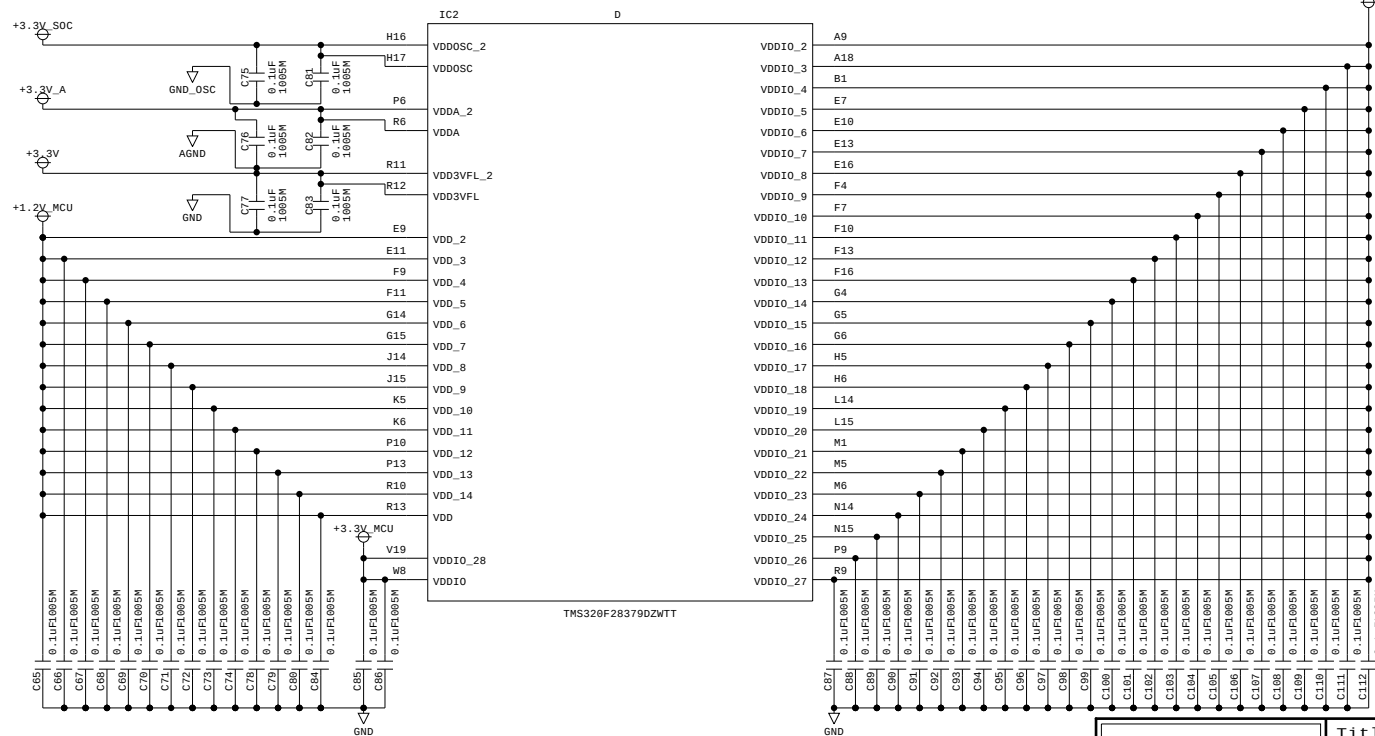


Title			
F28379D-SPARTAN7_Control_Card			
Board No.	Ver.	Author	Date
K20232	2.0	Ohnuma	22/11/14
Page 2 of 12			

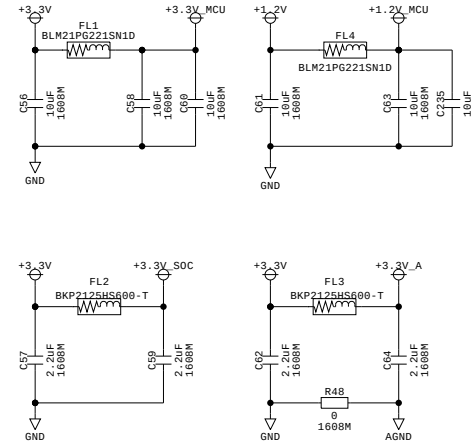


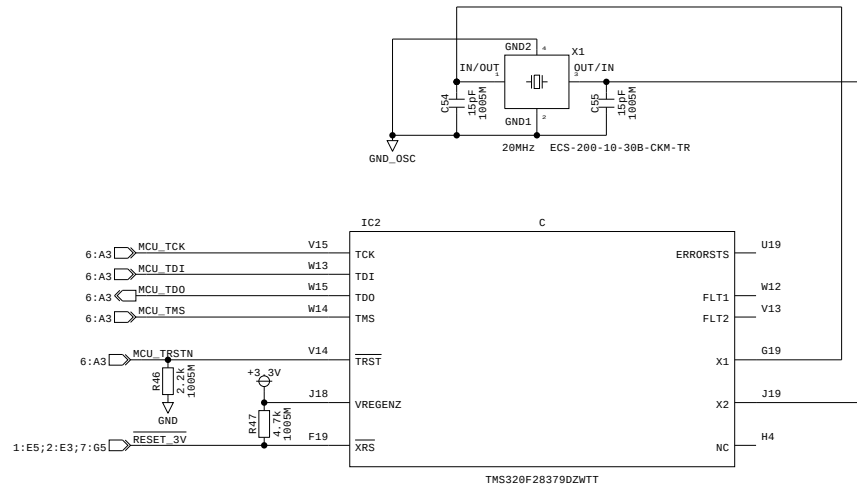

Title			
F28379D_SPARTAN7_Control_Card			
Board No.	Ver.	Author	Date
K20232	2.0	Ohnuma	22/11/14
Page 5 of 12			



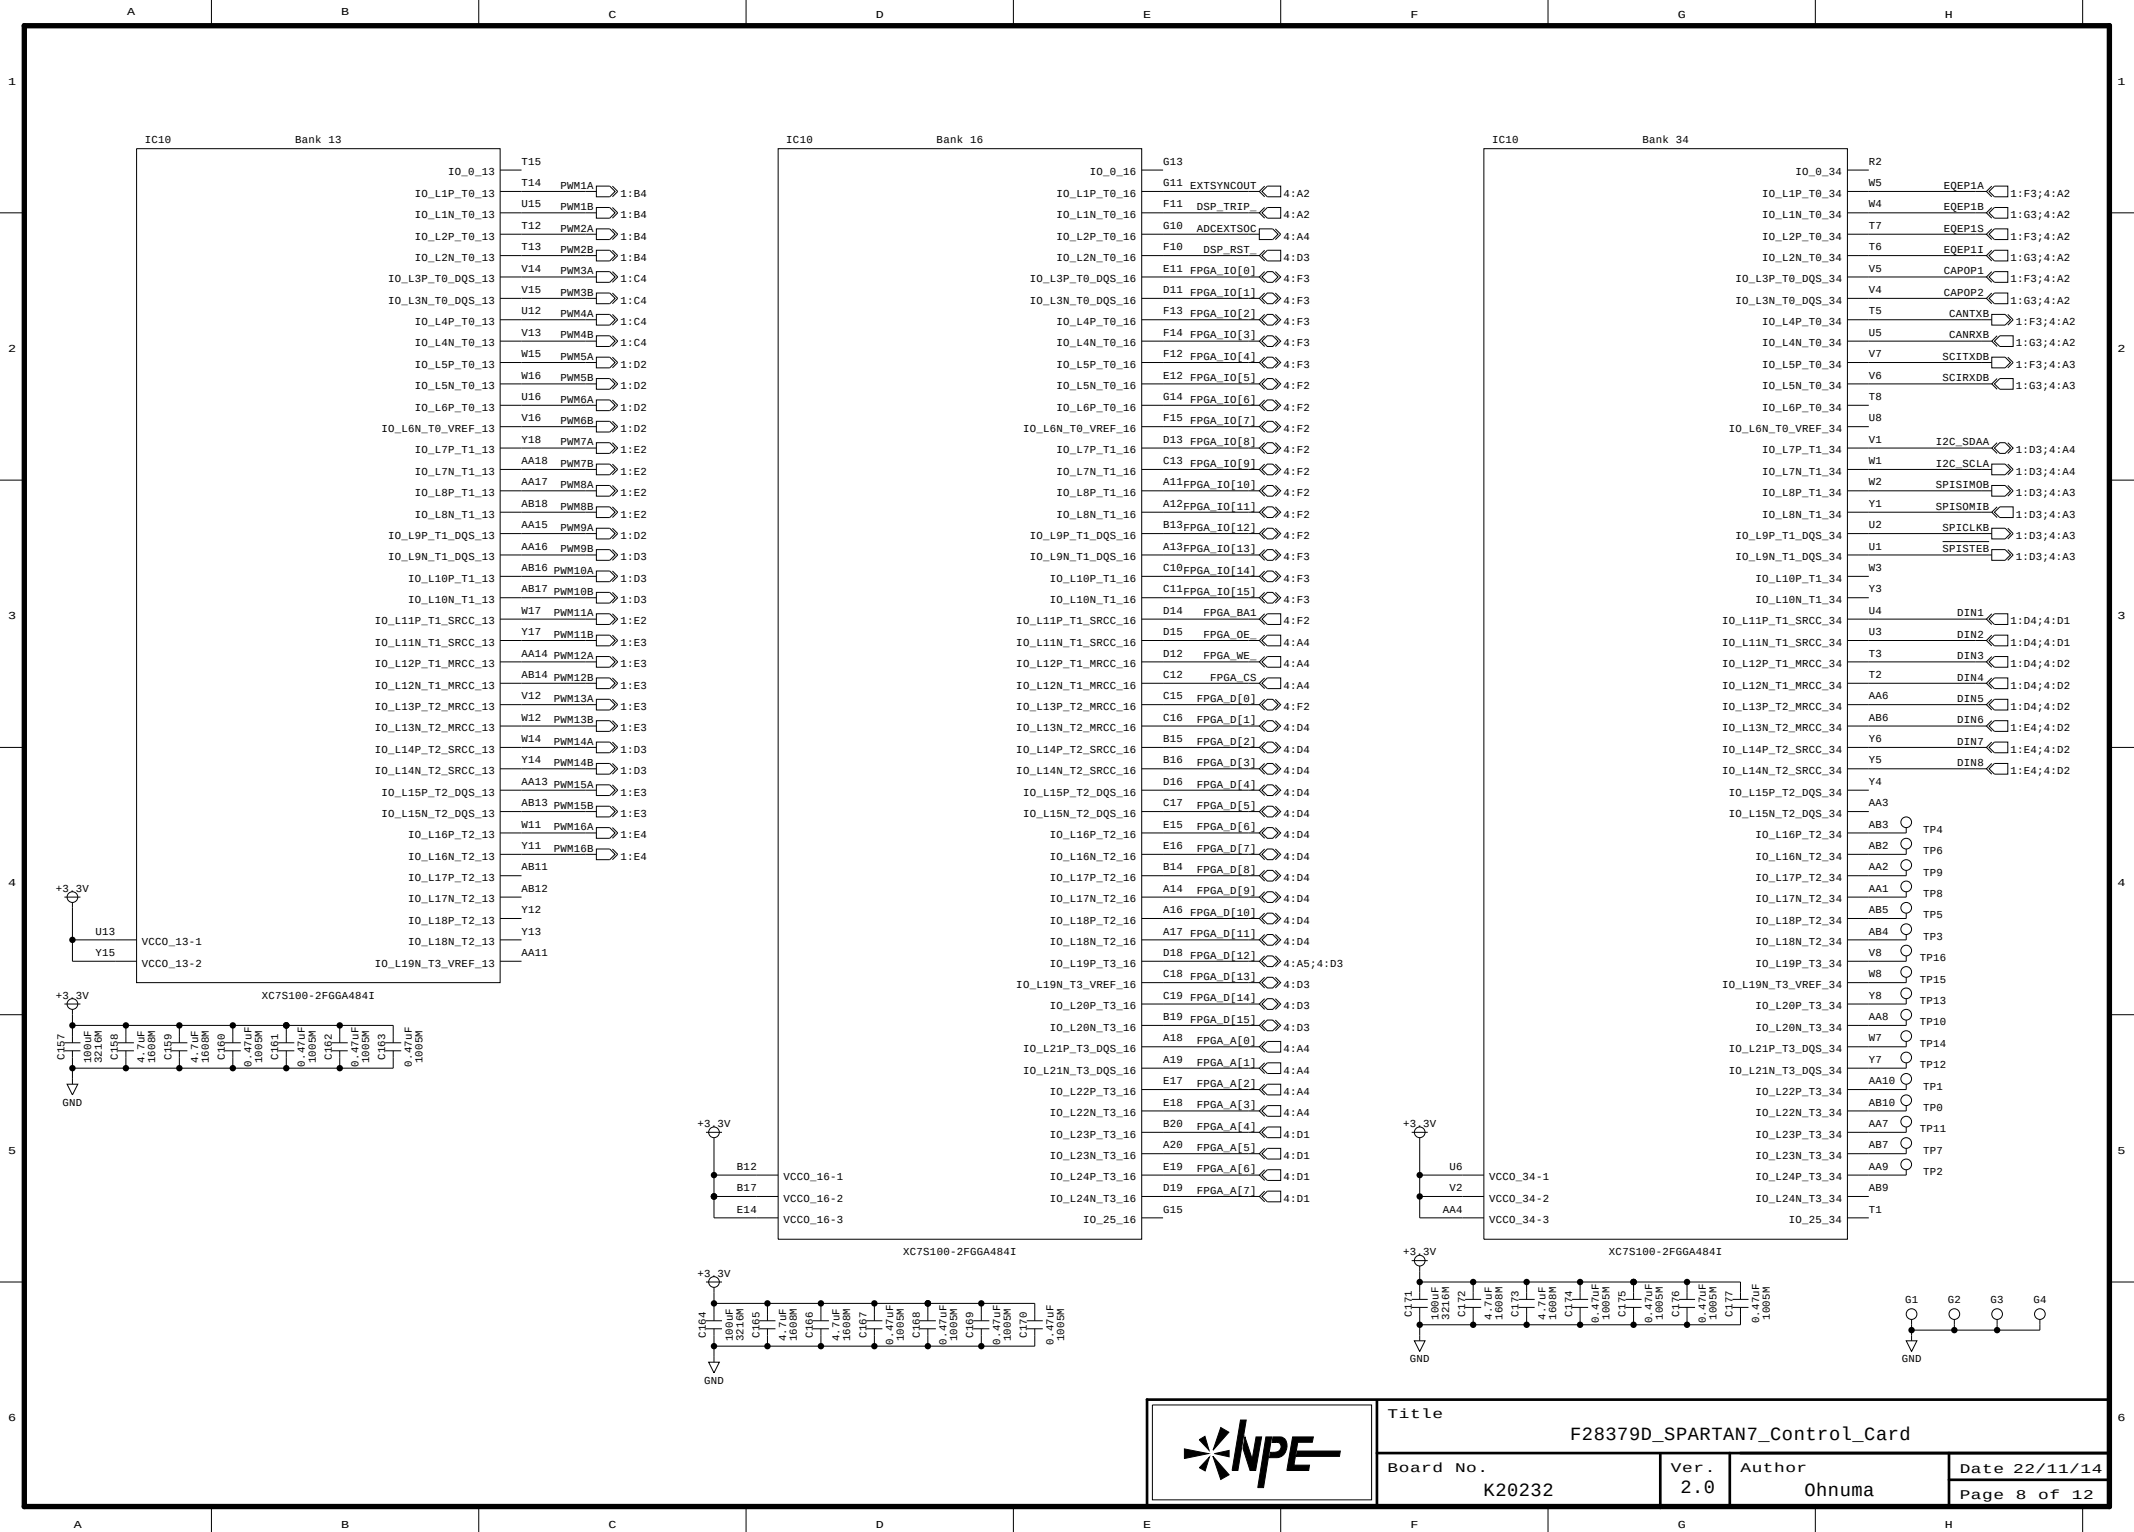


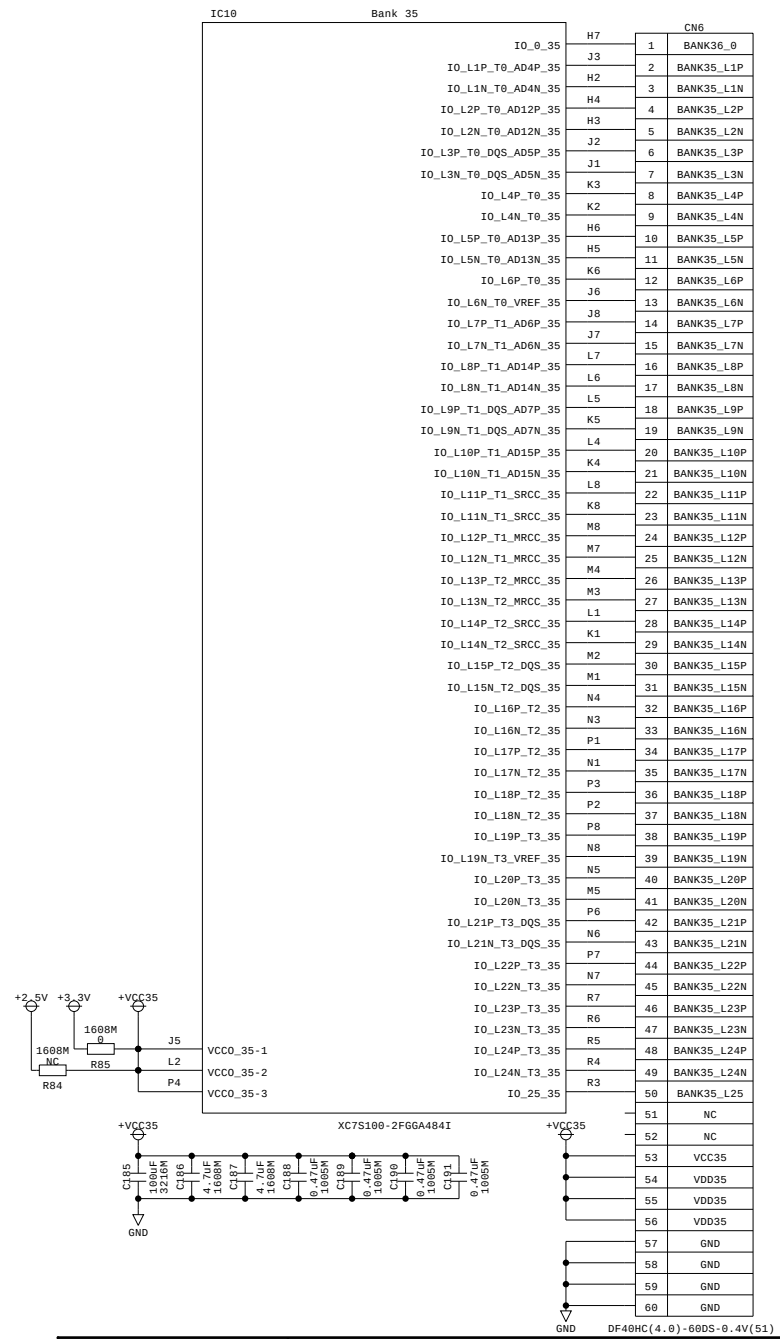



F28379D_SPARTAN7_Control_Card

Date 22/11/14

Page 9 of 12

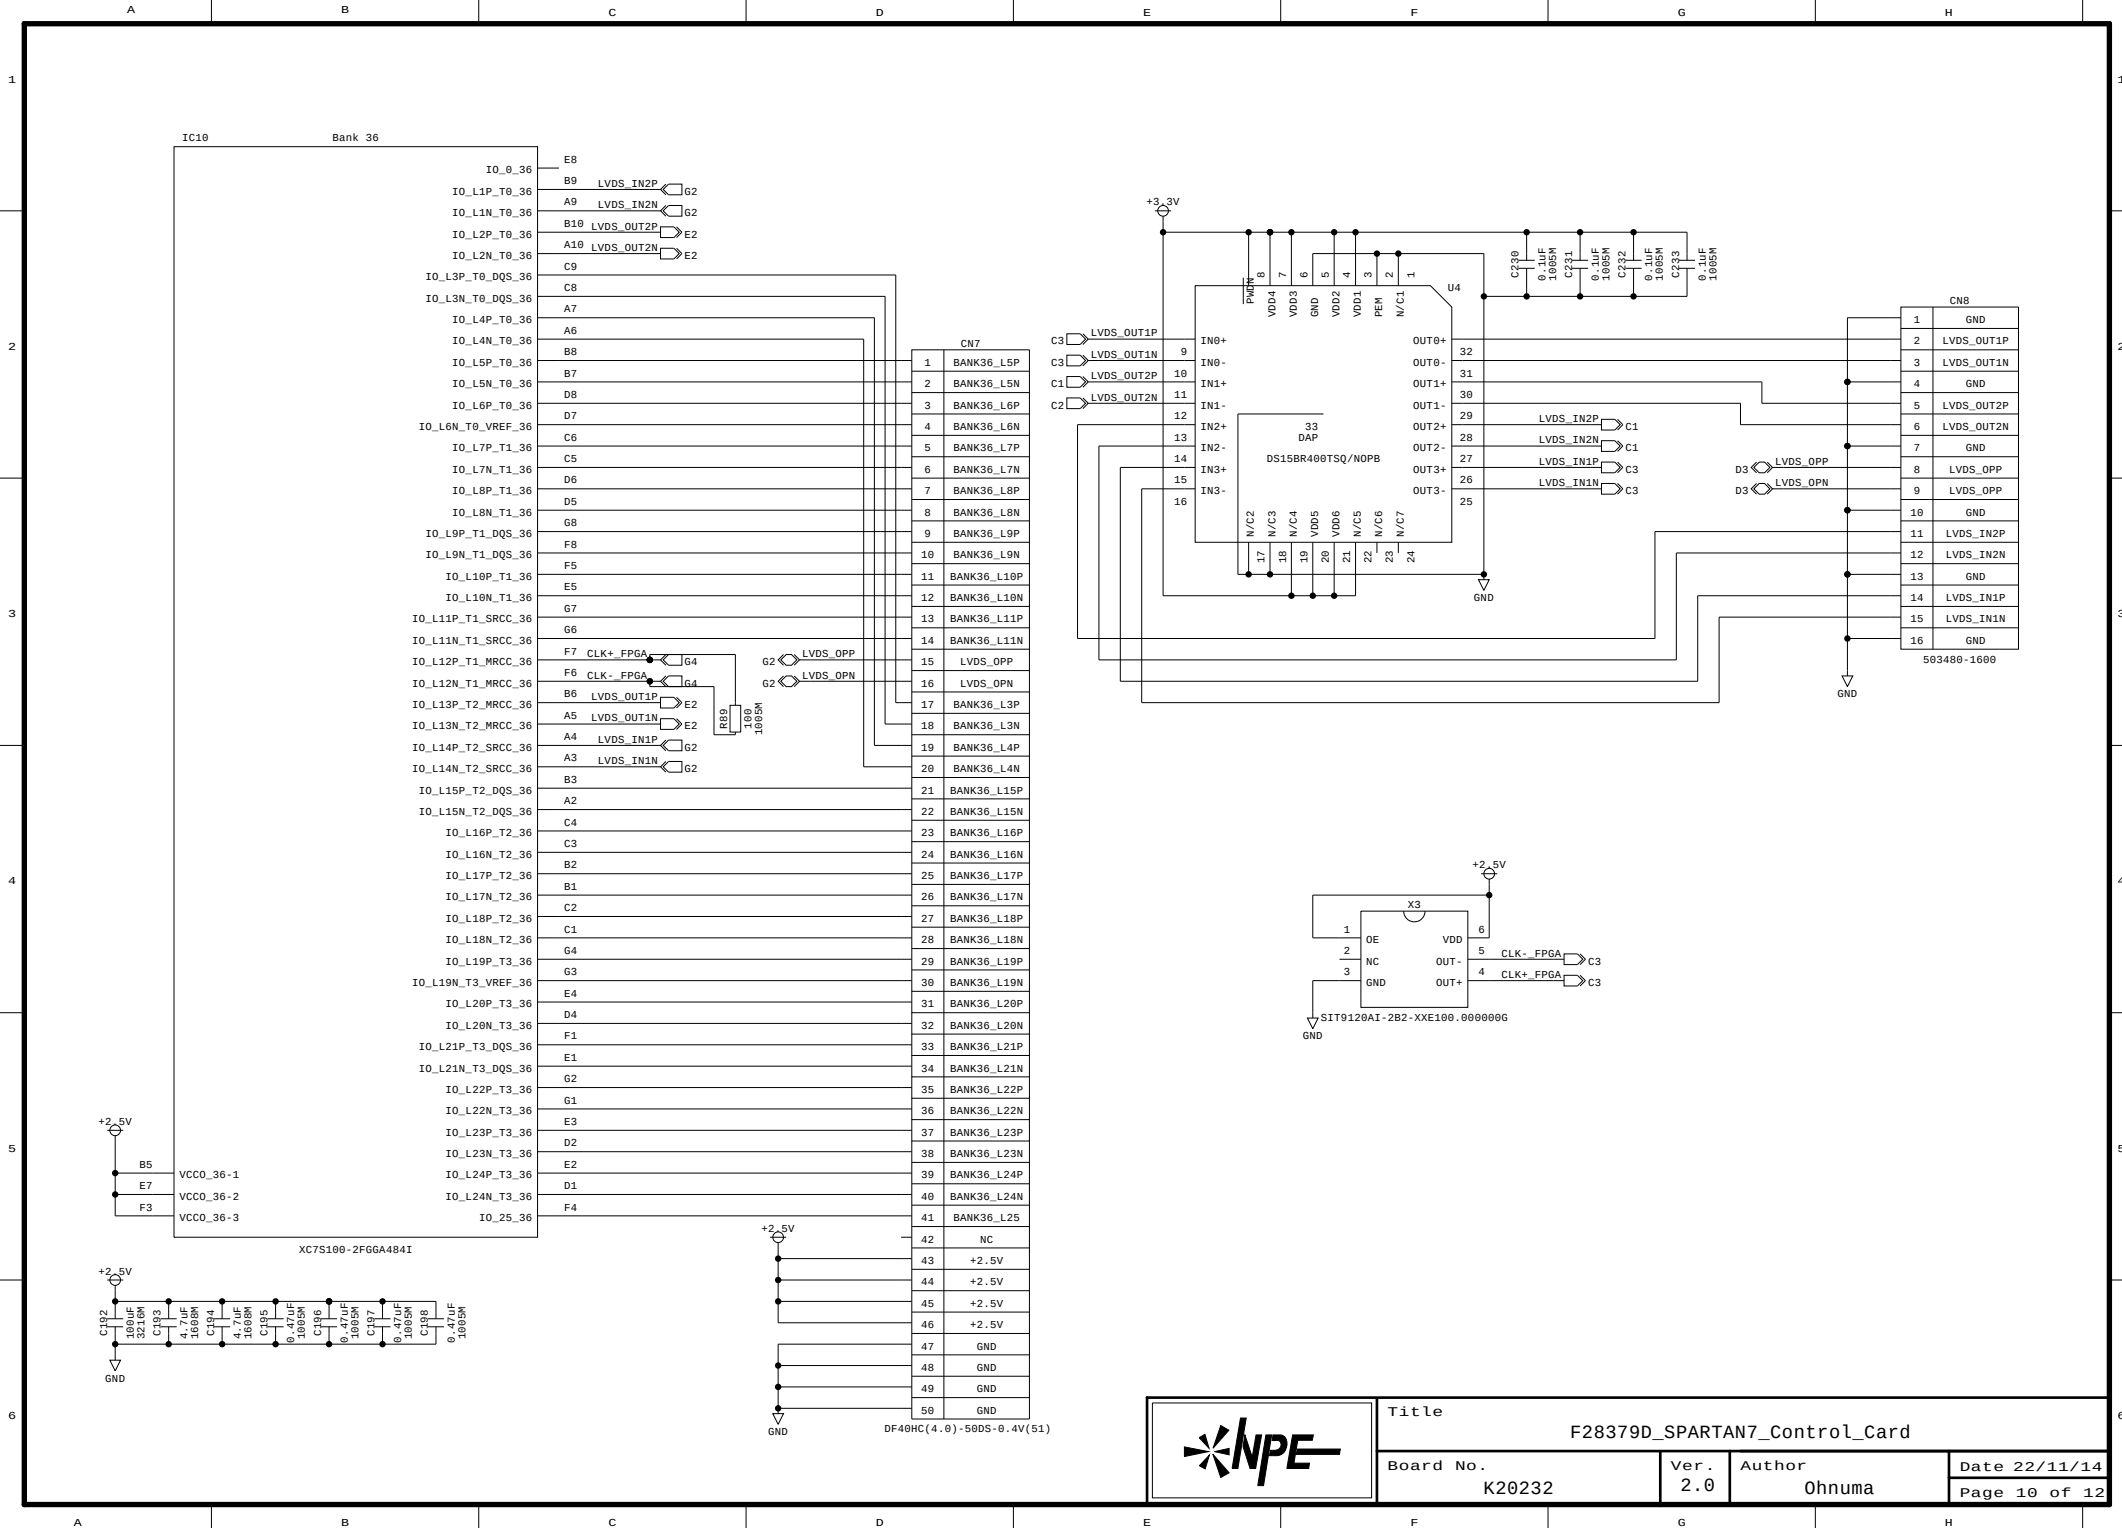

Title			
F28379D-SPARTAN7-Control_Card			
Board No.	Ver.	Author	Date
K20232	2.0	Ohnuma	22/11/14
Page 10 of 12			

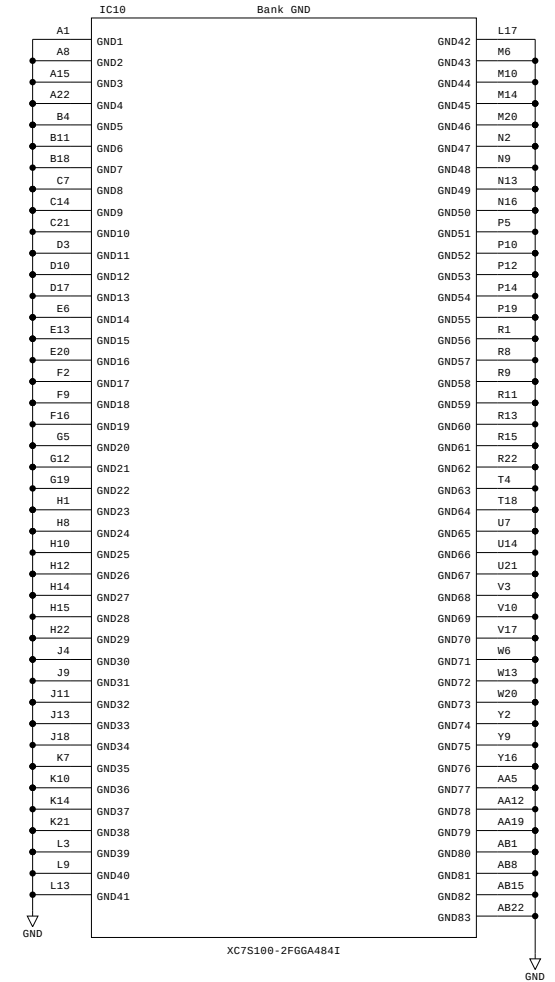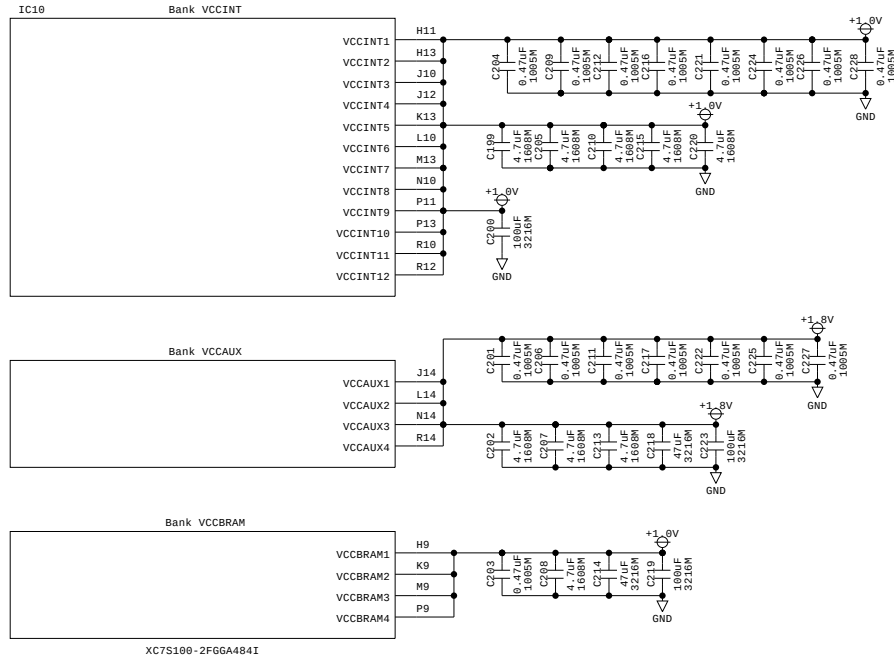

Title			
F28379D_SPARTAN7_Control_Card			
Board No.	Ver.	Author	Date
K20232	2.0	Ohnuma	22/11/14
Page 11 of 12			

変更改廃記録

Ver.	日付	ページ	改定記号	変更箇所	変更内容	変更理由	作図	承認
0.0	20/10/29				新規作成		大沼	宮脇
0.1.1	20/12/18				TPの順番変更およびコンデンサの削除 コンデンサのリファレンス番号シフト		大沼	宮脇
0.1.2	20/12/21	3			コンデンサ追加, コンデンサ番号シフト		大沼	宮脇
		10			バスコンコンデンサ追加			
0.1.3	20/12/21	3			コンデンサ追加, コンデンサ番号シフト		大沼	宮脇
0.1.4	20/12/25	3			アナロググランドAG1を追加		大沼	宮脇
0.1.5	21/01/05	7		R62	puhcピンをプルダウンに変更	起動時にハイインピーダンスに変更	大沼	宮脇
1.0	21/01/14	1-12			初版作成		大沼	宮脇
1.1	21/06/25	10		X3	部品変更	LVDS用の発振器に変更	大沼	宮脇
1.2	22/11/13	2		C234, C235	部品追加	電位安定のため	大沼	宮脇
		6		IC3, IC4, IC5, IC6	同等品に部品変更	入手困難なため		
		6		U3	同等品に部品変更	入手困難なため		
		10		U4	同等品に部品変更	入手困難なため		
		5		X1	同等品に部品変更	生産中止のため		
		6		D7	同等品に部品変更	入手困難なため		
2.0	22/11/14				基板製作		大沼	宮脇

Ver.	日付	ページ	改定記号	変更箇所	変更内容	変更理由	作図	承認

