#### STANDARD DEPARTURE CHART - INSTRUMENT

RJFS / SAGA SID

## SAGA REVERSAL TWO DEPARTURE

RWY11: Climb RWY HDG to 500FT, turn right,...

RWY29: Climb RWY HDG to 500FT, turn left HDG 090° to intercept and proceed...

...via SGE R135 to 9.0DME, turn left, direct to SGE VOR/DME.

Cross SGE VOR/DME at 6000FT.


Note RWY29: 3.5% climb gradient required up to 500FT.

# ARIAKE REVERSAL TWO DEPARTURE

RWY11 : Climb RWY HDG to 500FT, turn right HDG 288°... RWY29 : Climb RWY HDG to 500FT, turn left HDG 198°...

...to intercept and proceed via SGE R243 to 7.0DME, turn right, direct to SGE VOR/DME. Cross SGE VOR/DME at or above 6000FT.

Note RWY29: 3.5% climb gradient required up to 500FT.

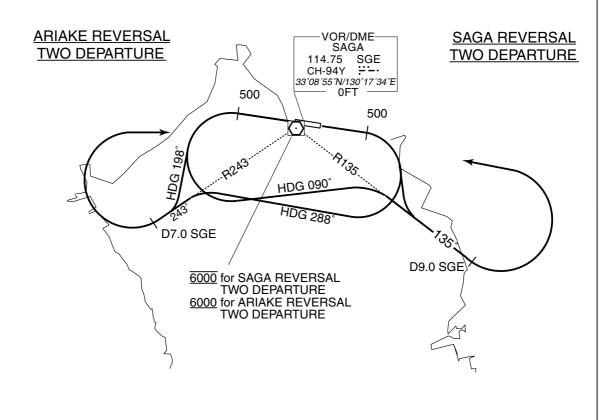

STANDARD DEPARTURE CHART - INSTRUMENT

RJFS / SAGA TRANSITION

## **KUMAMOTO TRANSITION**

From over SGE VOR/DME, via SGE R195 to 18.0DME, turn left, via KUE R271 to KUE VOR/DME.

Cross SGE R195/6.0DME at 6000FT, cross SGE R195/18.0DME at or above 10000FT.

### NAGASAKI TRANSITION

From over SGE VOR/DME, via SGE R195 to 18.0DME, turn right, direct to OLE VOR/DME.

Cross SGE R195/6.0DME at 6000FT, cross SGE R195/18.0DME at or above 10000FT.

