

RJAH / HYAKURI

SID and TRANSITION

OGITU ONE DEPARTURE

RWY 03R/03L: Climb RWY HDG to 600FT,....

RWY 21R/21L: Climb RWY HDG to 600FT, turn right HDG 062° to intercept and

proceed....

....via HUC R032 to OGITU.

Cross HUC R032/5.5DME at or below 7000FT, cross OGITU at or

below 10000FT.

Note: This SID for VOR equipped aircraft only.


IWAKI TRANSITION

From over OGITU, proceed via IXE R213 to IXE VOR/DME.

OKUJI TRANSITION

From over OGITU, via HUC R032 to 32.5DME, turn left to intercept and proceed via HUC 35.2DME counterclockwise ARC to OKUJI.

Cross OKUJI at or above 9000FT.

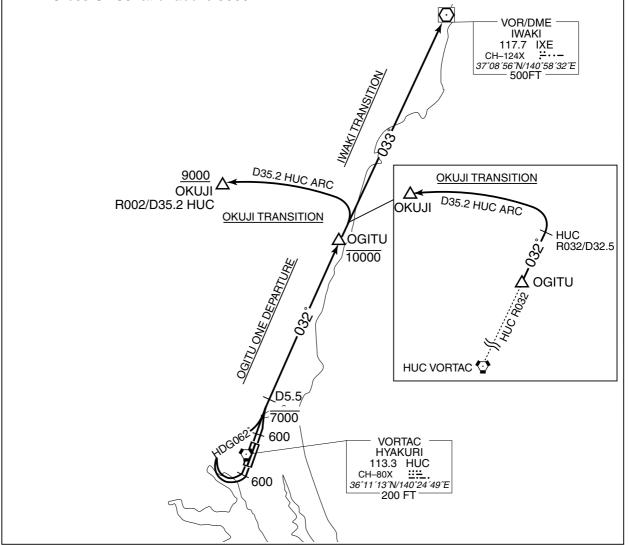

RJAH / HYAKURI

SID and TRANSITION

NAKAH FOUR DEPARTURE

RWY 03R/03L: Turn left within 5.0NM....


RWY 21R/21L: Turn right or left within 6.0NM....

....climb via HUC R002(R001 for using VOR) to NAKAH.

Cross HUC R002(R001 for using VOR) /6.0DME at or below 7000FT.

NIKKO TRANSITION

From over NAKAH, via CVT R342 to 60.9DME, via JD 072° to JD NDB.

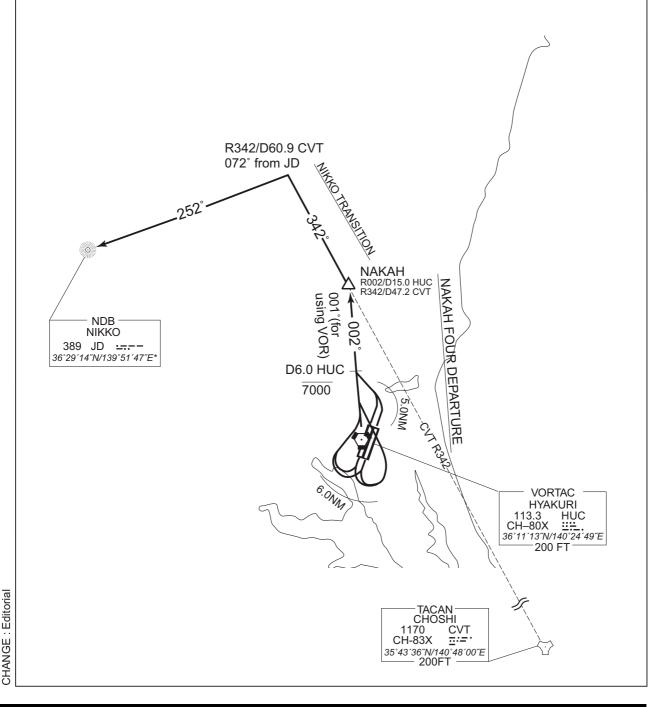

RJAH / HYAKURI

SID and TRANSITION

HOKTA FIVE DEPARTURE

RWY 03R/03L: Climb via RWY HDG until 1.0NM from RWY end/HUC 1.4DME, turn right within 5.0NM....

RWY 21R/21L: Turn left within 6.0NM....

....climb via HUC R071 to HOKTA.

Cross HUC R071/19.3DME at or below 8000FT, cross HOKTA at or above 11000FT.

Note1: Take off RWY 21R/21L, cross HUC R130 at or below 5000FT.

Note2: This SID for TACAN equipped aircraft only.

HOKTA EAST FIVE DEPARTURE

RWY 03R/03L: Climb via RWY HDG until 1.0NM from RWY end/HUC 1.4DME, turn right within 5.0NM....

RWY 21R/21L: Turn left within 6.0NM....

....climb via HUC R091 to HUC 27.0DME, turn left via HUC 27.0DME counterclockwise ARC to HOKTA.

Cross HUC R091/23.0DME at or below 8000FT, cross HOKTA at or above 11000FT.

Note1: Take off RWY 21R/21L, cross HUC R130 at or below 5000FT.

Note2: This SID for TACAN equipped aircraft only.

MATSUSHIMA TRANSITION


From over HOKTA, via CVT R015 to CVT 59.0DME, MXT R195 to MXT TACAN. Cross CVT R015/59.0DME (MXT R195/103.0DME) at assigned altitude.

Note CVT R015/59.0DME (MXT R195/103.0DME): MXT MRA 12000FT.

DAIGO TRANSITION

From over HOKTA, via CVT R015 to DAPPE, via GOT R116 to GOT TACAN.

CHANGE: Update

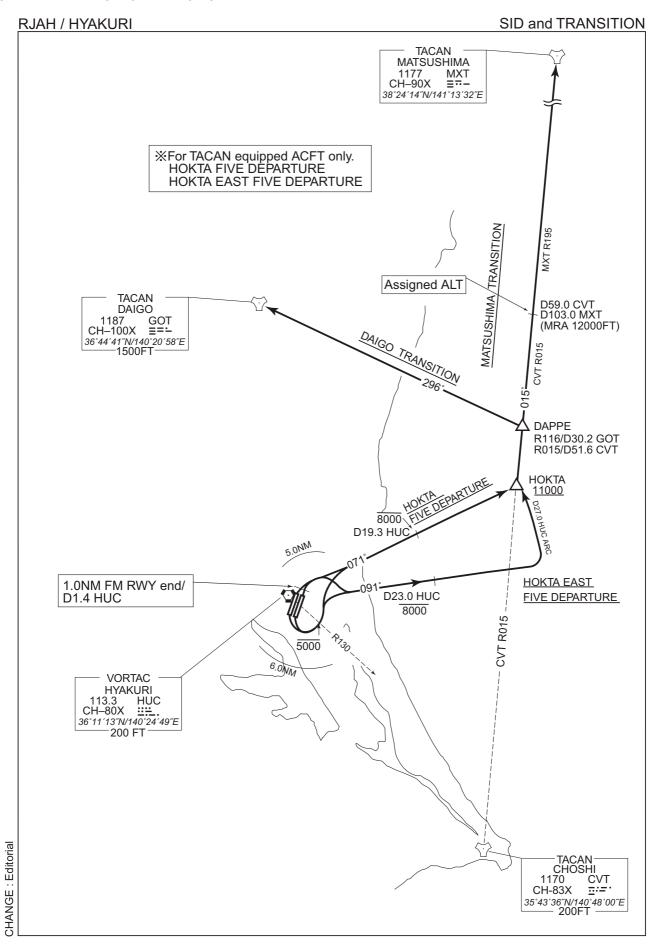

RJAH / HYAKURI

SID and TRANSITION

DAPPE ONE DEPARTURE

RWY 03R/03L: Climb via RWY HDG until 1.0NM from RWY end/HUC 1.4DME,

turn right within 5.0NM....

RWY 21R/21L: Turn left within 6.0NM....

....climb via HUC R055 to DAPPE.

Cross HUC R055/31.0DME at or below 10000FT.

Note1: Take off RWY 21R/21L, cross HUC R130 at or below 5000FT.

Note2: This SID for TACAN equipped aircraft only.

CHOSHI TRANSITION

From over DAPPE, via CVT R015 to CVT TACAN via ANKOH.

Cross ANKOH at or above FL170.

HYAKURI TRANSITION

From over DAPPE, via CVT R015 to ANKOH, via HUC R089 to HUC VORTAC. Cross ANKOH at or above FL170.

CHANGE: ANKOH established



STANDARD ARRIVAL CHART -INSTRUMENT

RJAH / HYAKURI STAR

DAIGO ARRIVAL

From over GOT TACAN, proceed via GOT R120 to JYUOH, turn right via HUC 30.0DME clockwise ARC to intercept and proceed via HUC R080 to TAIYO.

Cross JYUOH at or above 6000FT.

