CHANGE : CHIDORI TWO DEPARTURE, CHIDORI TRANSITION abolished. TIDRI ONE DEPARTURE, VASHU TRANSITION established

STANDARD DEPARTURE CHART - INSTRUMENT

RJAW / IWOTO

SID and TRANSITION

IWO TWO DEPARTURE

RWY 07/25 : Climb RWY HDG to 1000FT or above, then proceed as directed by ATC. Remarks: IWO TWO DEPARTURE is not illustrated.

TIDRI ONE DEPARTURE

RWY 07 : Climb RWY HDG to 1000FT or above, turn left HDG306° to intercept


and proceed via IJT R336 (337° from OX) to TIDRI.

RWY 25 : Climb RWY HDG to 1000FT or above, turn right HDG006° to intercept

and proceed via IJT R336 (337° from OX) to TIDRI.

VASHU TRANSITION

From over TIDRI, proceed via IJT R336 (337° from OX) to VASHU. Cross VASHU at assigned altitude.

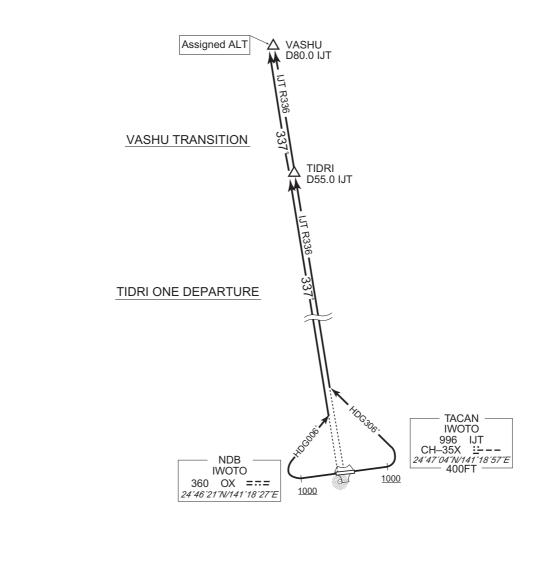



STANDARD ARRIVAL CHART - INSTRUMENT

RJAW / IWOTO STAR

KANGO ARRIVAL

From over VASHU, proceed via IJT R336 to IJT R336/15.0DME, then turn right via IJT 15.0DME counterclockwise ARC to KANGO.

Cross TIDRI at altitude specified by ATC.

SAUNA ARRIVAL

From over VASHU, proceed via IJT R336 to IJT R336/15.0DME, then turn left via IJT 15.0DME clockwise ARC to SAUNA.

Cross TIDRI at altitude specified by ATC.

