CHANGE: PROC renamed, PROC course, Note(HOFU REVERSAL THREE DEPARTURE, KUGA FOUR DEPARTURE)

RJOF / HOFU SID

## HOFU REVERSAL THREE DEPARTURE

RWY 12 : Climb ...

STANDARD DEPARTURE CHART -INSTRUMENT

RWY 30 : Climb RWY HDG until 2.0NM from RWY end(2.4DME from FMT), turn left ...

...via FMT R116 to 2500FT or above, turn right direct to FMT

TACAN within FMT 10.4DME.

Cross FMT TACAN at 4000FT or specified altitude.

Note RWY 12: Minimum rate of climb 410FT/NM until 2500FT. RWY 30: Minimum rate of climb 360FT/NM until 1500FT.

# YASAKA TRANSITION

From over FMT TACAN, via FMT R348 to intercept and proceed via FMT 13DME clockwise ARC to YASAK, proceed via IWT R299 to IWT TACAN. Maintain 4000FT or specified altitude until FMT 3DME, cross FMT 10DME at 6000FT or above and cross YASAK at assigned or specified altitude.

#### YAMAGUCHI TRANSITION

From over FMT TACAN, via FMT R348 to YUDAR, maintain 4000FT or specified altitude until FMT 3DME, then make left procedure turn to YUDAR within FMT 15DME, cross YUDAR at assigned altitude, then proceed to FMT TACAN.

#### KUGA FOUR DEPARTURE

RWY 12 : Climb ...


RWY 30 : Climb RWY HDG until 2.0NM from RWY end(2.4DME from FMT), turn left ...

...via FMT R116 to intercept and proceed via FMT 8DME counter-clockwise ARC to intercept FMT R093, turn right, proceed via FMT R093 to IWT TACAN.

Cross FMT R093/19DME at assigned altitude.

Note RWY 12 : Minimum rate of climb 410FT/NM until 1500FT. RWY 30 : Minimum rate of climb 360FT/NM until 1500FT.

### STANDARD DEPARTURE CHART -INSTRUMENT

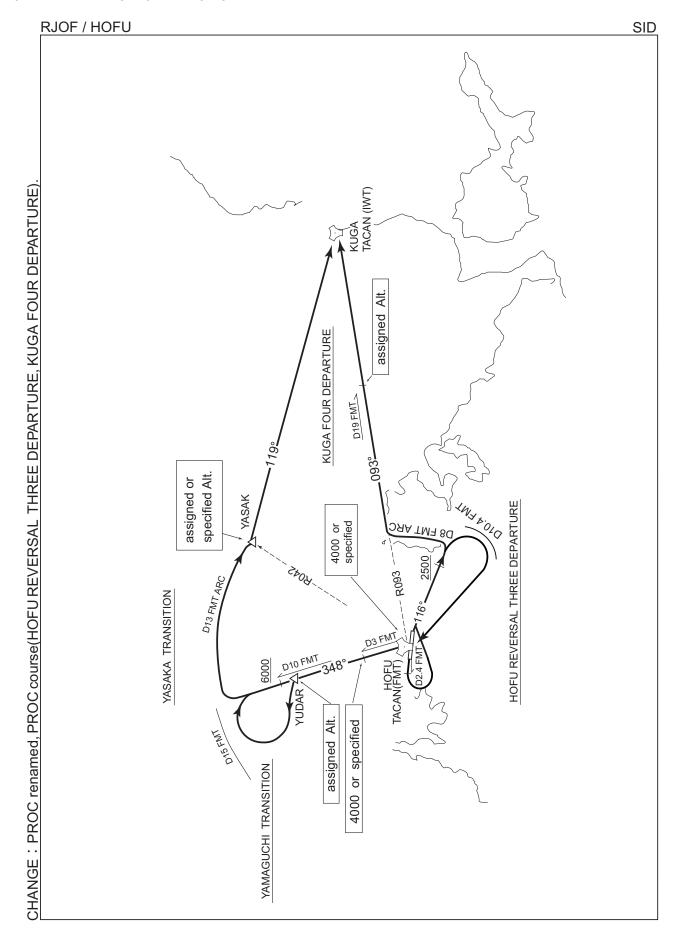

#### **INSTRUMENT APPROACH CHART**

