STANDARD DEPARTURE CHART - INSTRUMENT

RJAW / IWOTO

SID and TRANSITION

IWO TWO DEPARTURE

RWY 07/25 : Climb RWY HDG to 1000' or above, then proceed as directed by ATC. Remarks: IWO TWO DEPARTURE is not illustrated.

CHIDORI TWO DEPARTURE

RWY 07 : Climb RWY HDG to 1000 $\acute{}$ or above, turn left HDG305 $\acute{}$ to intercept


and proceed via IJT R-335 (336° from OX) to CHIDORI.

RWY 25 : Climb RWY HDG to 1000' or above, turn right HDG005° to intercept

and proceed via IJT R-335 (336° from OX) to CHIDORI.

CHIDORI TRANSITION

After CHIDORI, proceed via IJT R-335 (336° from OX) to NORTH CHIDORI. Cross NORTH CHIDORI at assigned altitude.

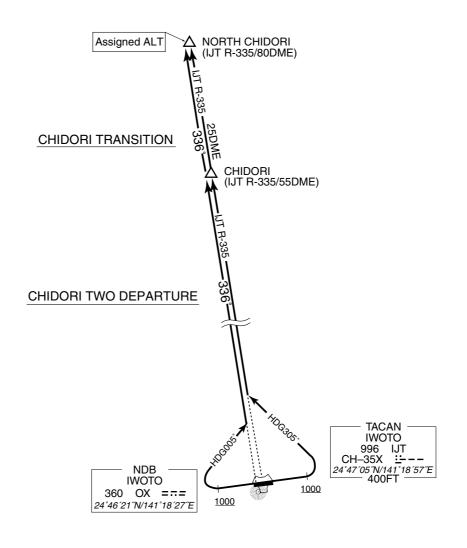

STANDARD ARRIVAL CHART - INSTRUMENT

RJAW / IWOTO STAR

CHIDORI ARRIVAL

From over NORTH CHIDORI, proceed via IJT R-335 to IJT R-335/15DME, then turn right (left) via IJT 15DME counter-clockwise (clockwise) arc to KANGO (SAUNA).

Cross CHIDORI at altitude specified by ATC.

