



RJTY / YOKOTA

AD CHART

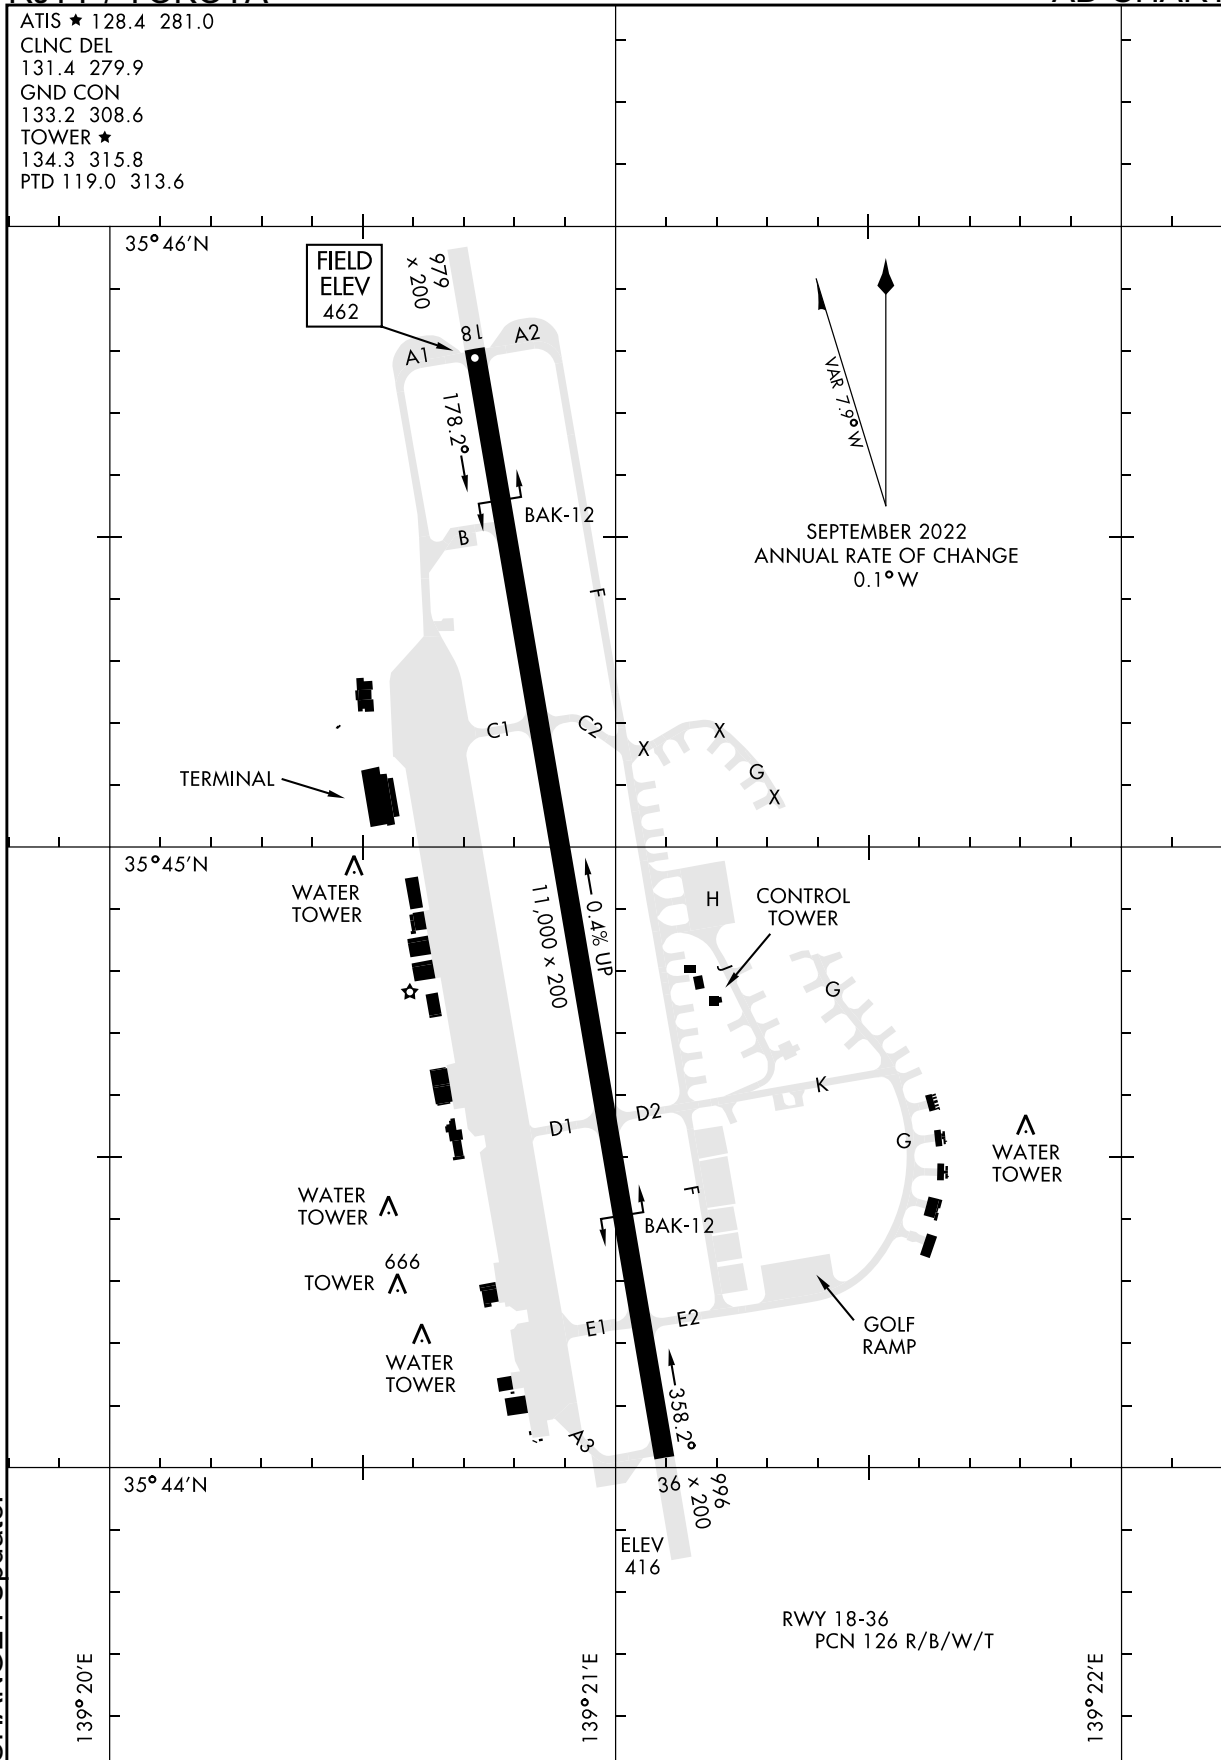

NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

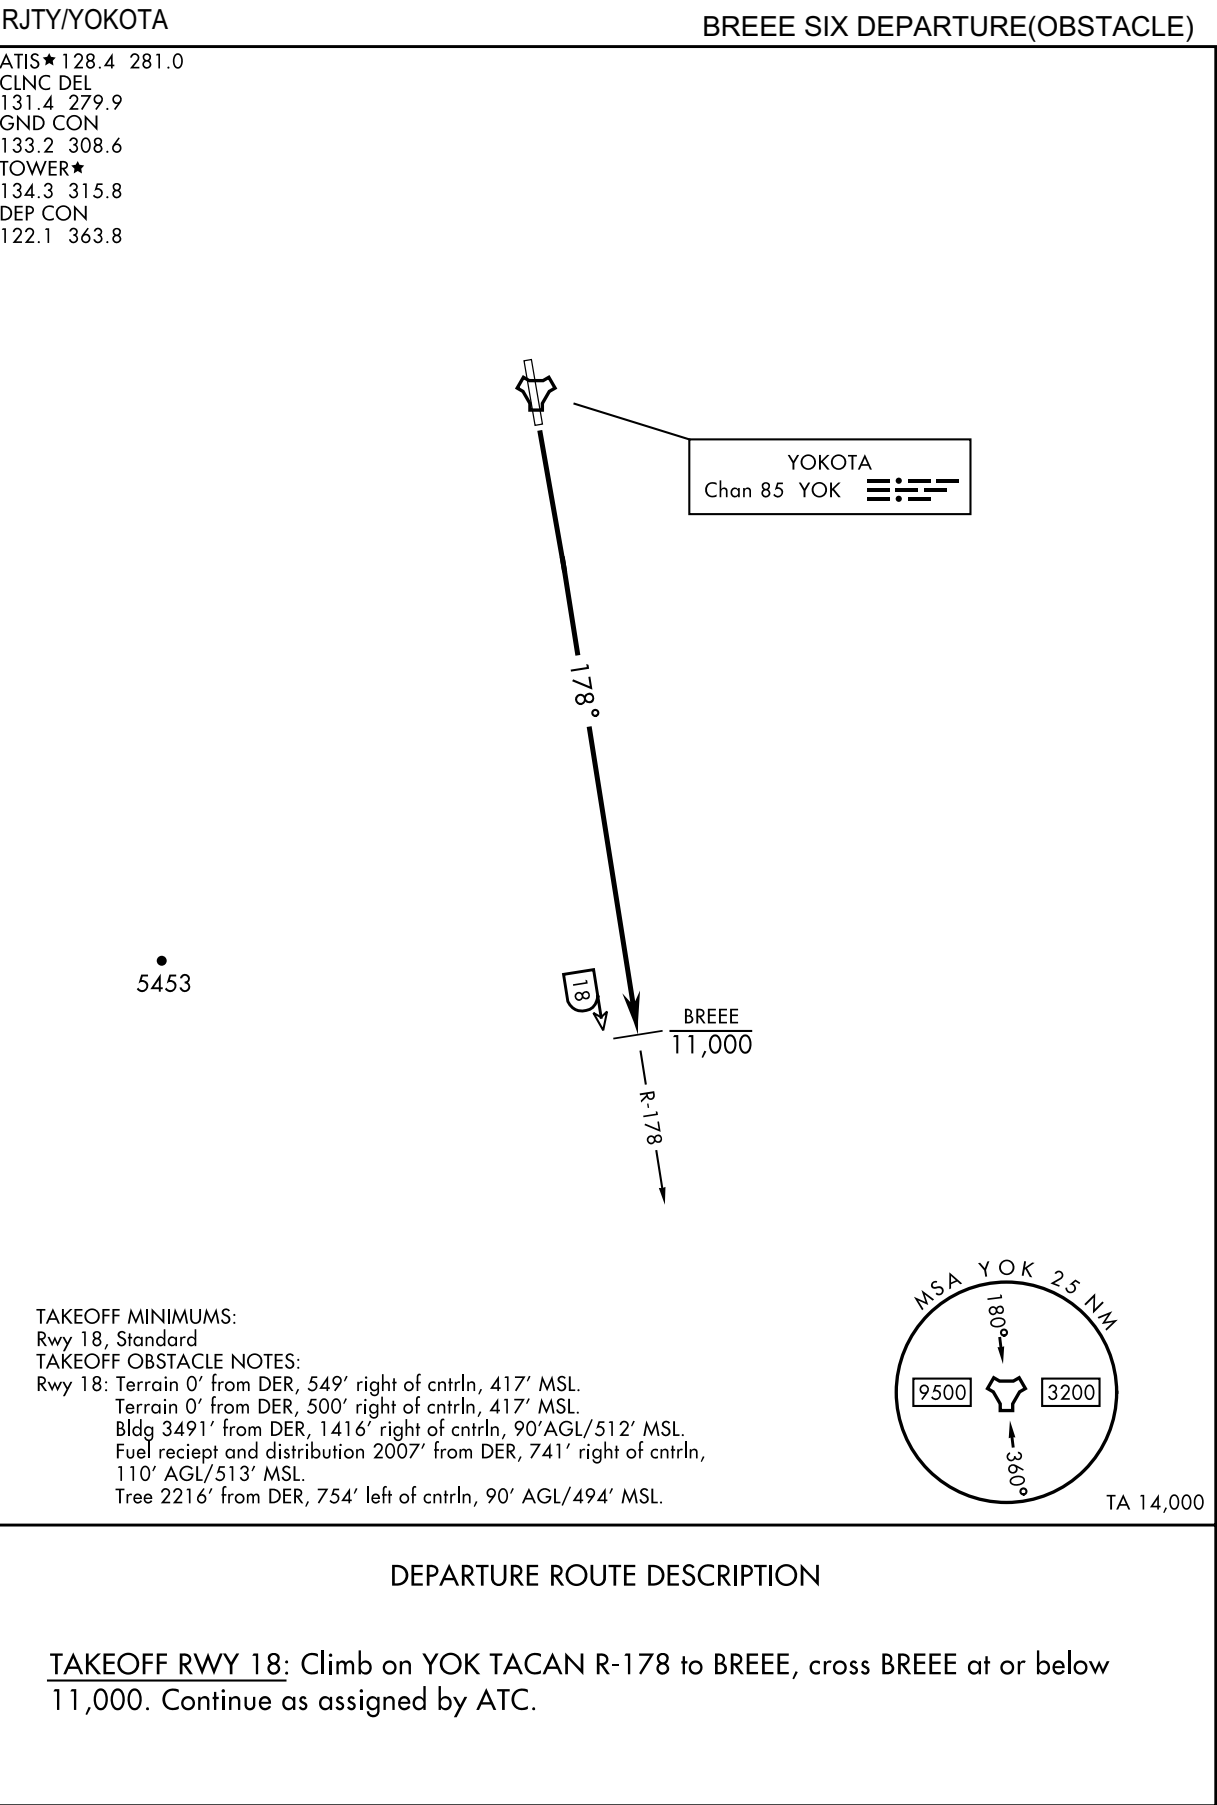


STANDARD DEPARTURE CHART - INSTRUMENT

RJTY / YOKOTA

TIMAP FIVE DEPARTURE(OBSTACLE)

ATIS★128.4 281.0
 CLNC DEL
 131.4 279.9
 GND CON
 133.2 308.6
 TOWER★
 134.3 315.8
 DEP CON
 122.1 363.8

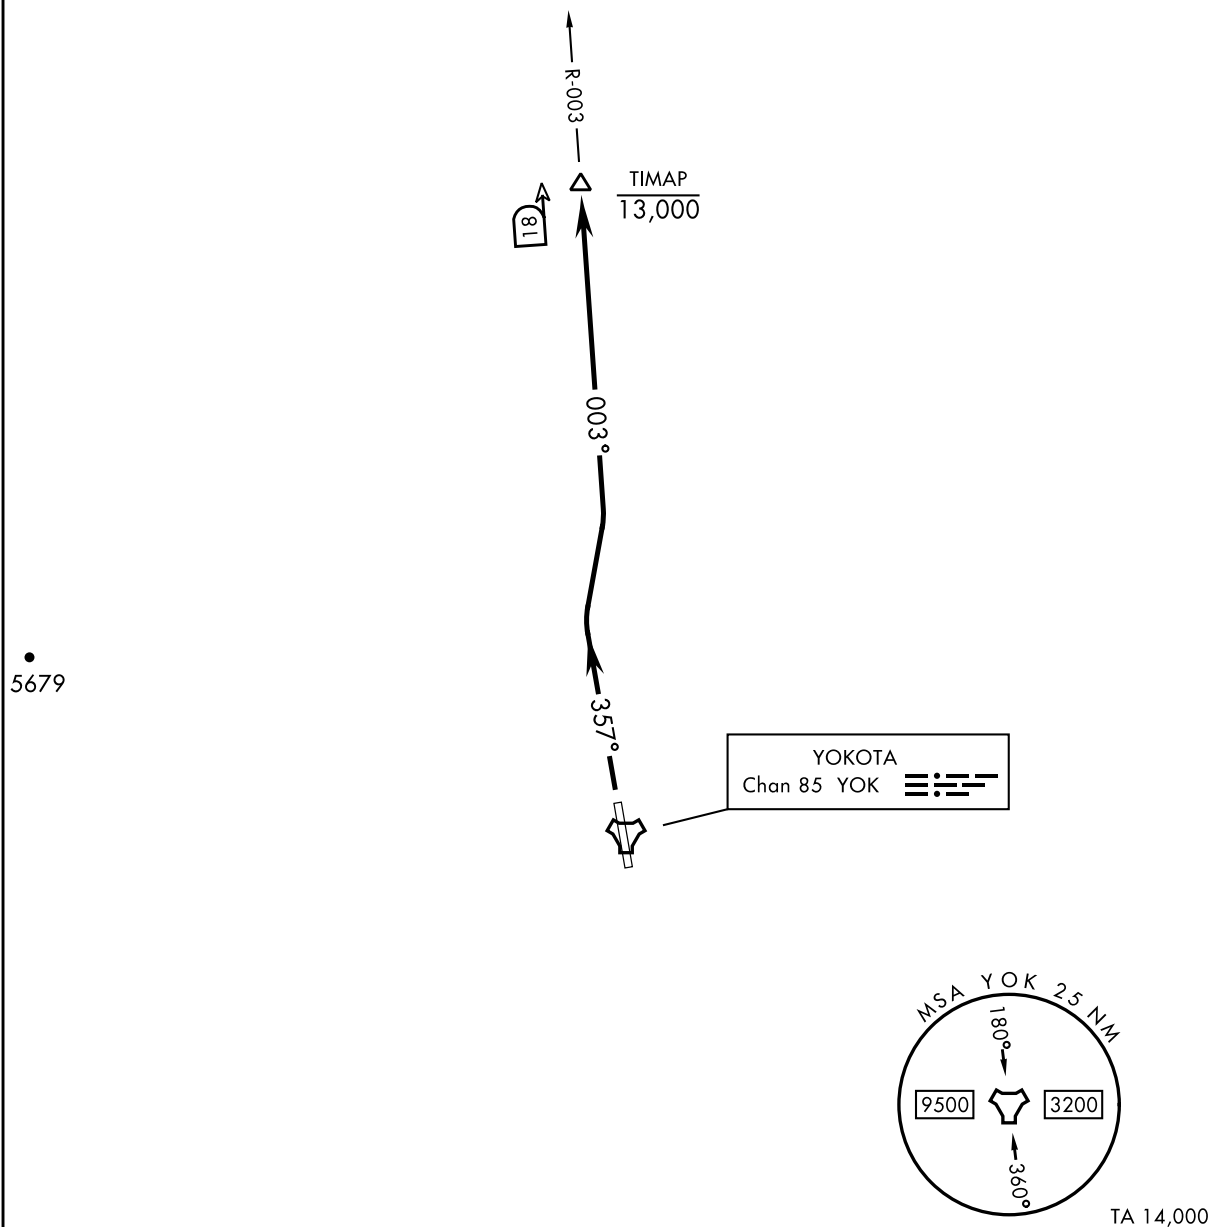

CHANGE : Update.



DEPARTURE ROUTE DESCRIPTION

TAKEOFF RWY 36: Climb to 4000, turn right to intercept YOK TACAN R-003 to TIMAP.
 Cross TIMAP at or below 13,000. Continue as assigned by ATC.

NOTE: REPRINTING DOD FLIP

RJTY / YOKOTA

BUSYU TWO DEPARTURE

Rwy	Knots	60	120	180	240	300	360
* 18 (a)	V/V(fpm)	360	720	1080	1440	1800	2160
† 18 (b)	V/V(fpm)	465	930	1395	1860	2325	2790
* 36 (c)	V/V(fpm)	383	766	1149	1532	1915	2298
† 36 (b)	V/V(fpm)	476	952	1428	1904	2380	2856

© to 7900

MSA YOK 25 NN

18

BUSYU 2
283°

253°

R-283

323°

YOKOTA
Chan 85 YOK

Fuel Gauge Icon

TLv FL140
TA 14,000


DEPARTURE ROUTE DESCRIPTION

TAKEOFF RWY 36: Climbing left turn to intercept YOK TACAN R-283 to BUSYU. Cross BUSYU at or above 13,400. Maintain ATC assigned altitude.

CHANGE : Update.

NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

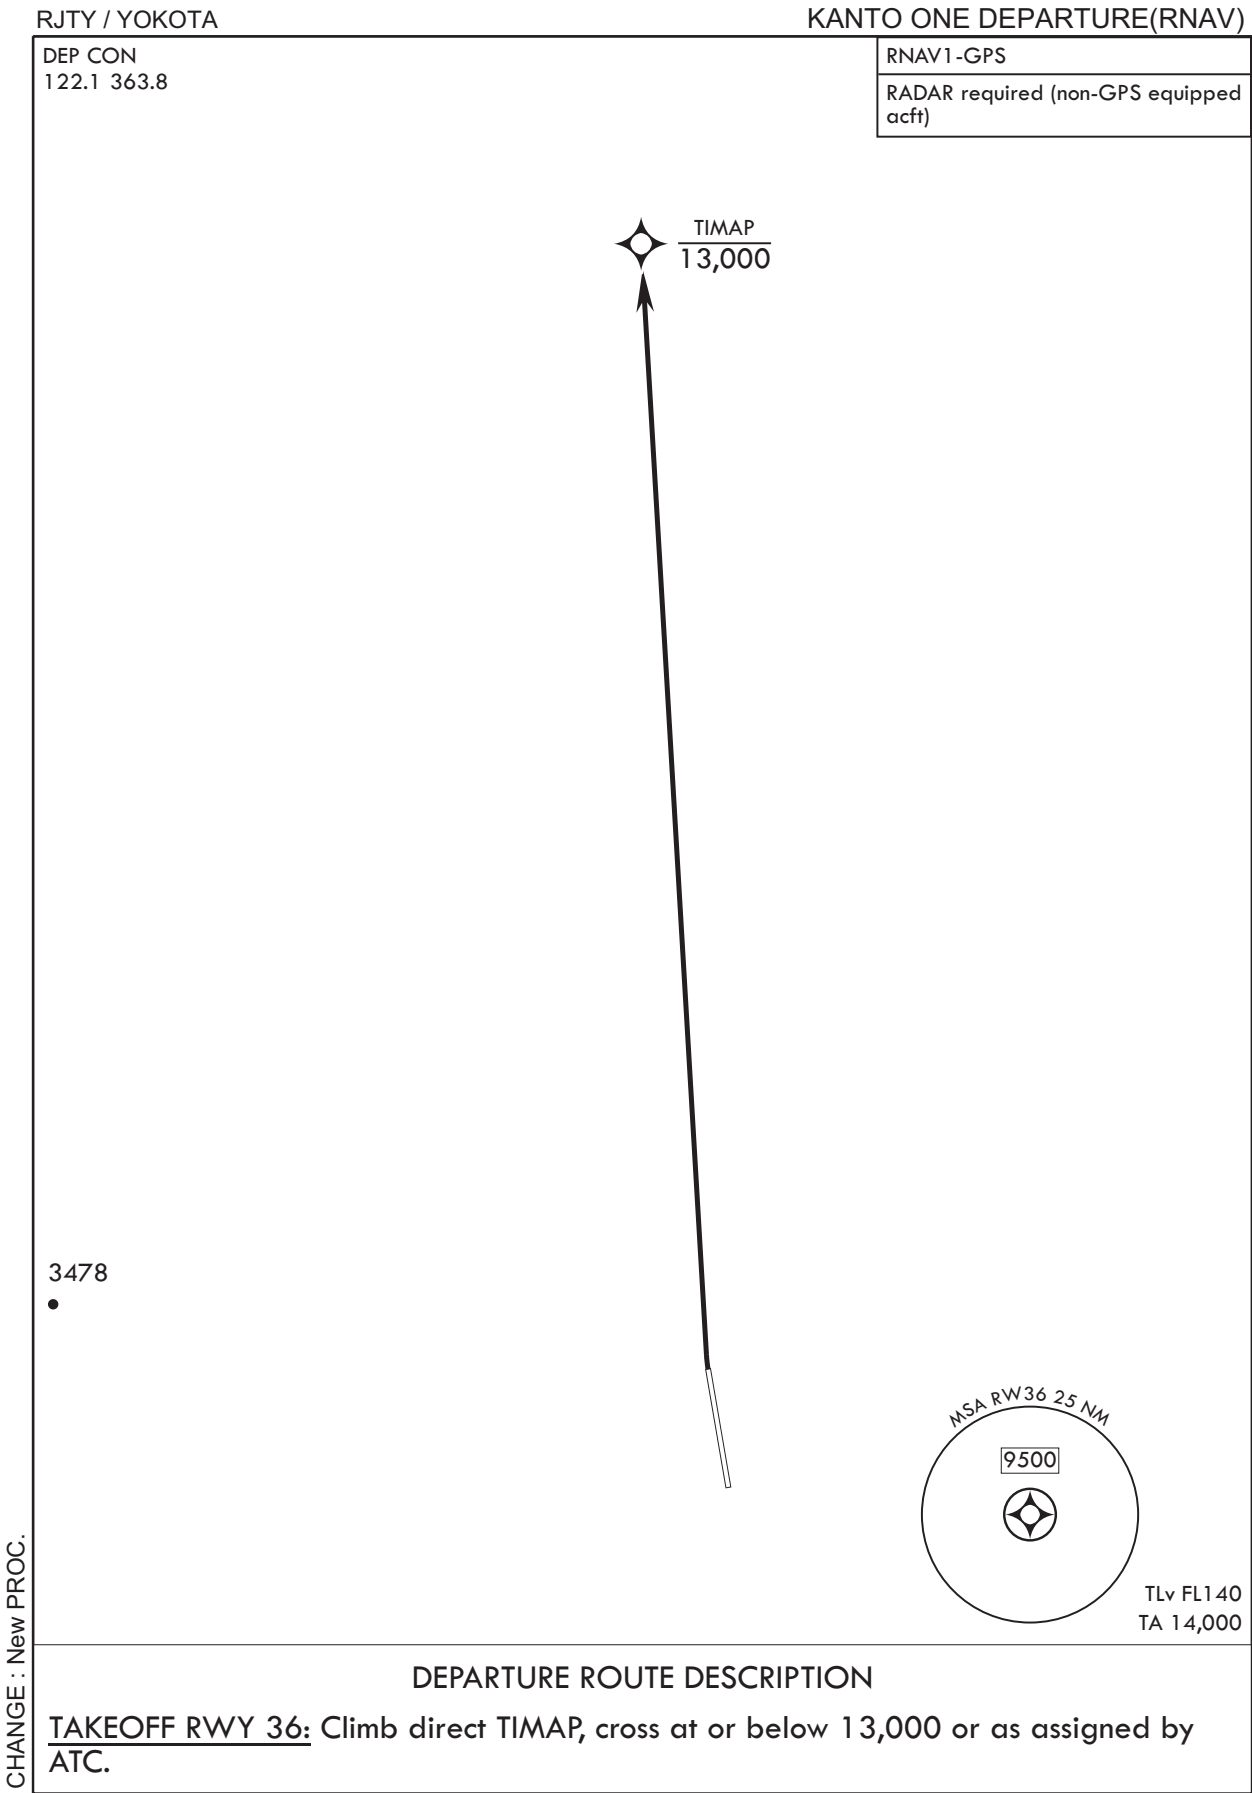


CHANGE : New PROC.

NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

RJTY / YOKOTA

FUSSA TWO DEPARTURE(RNAV)

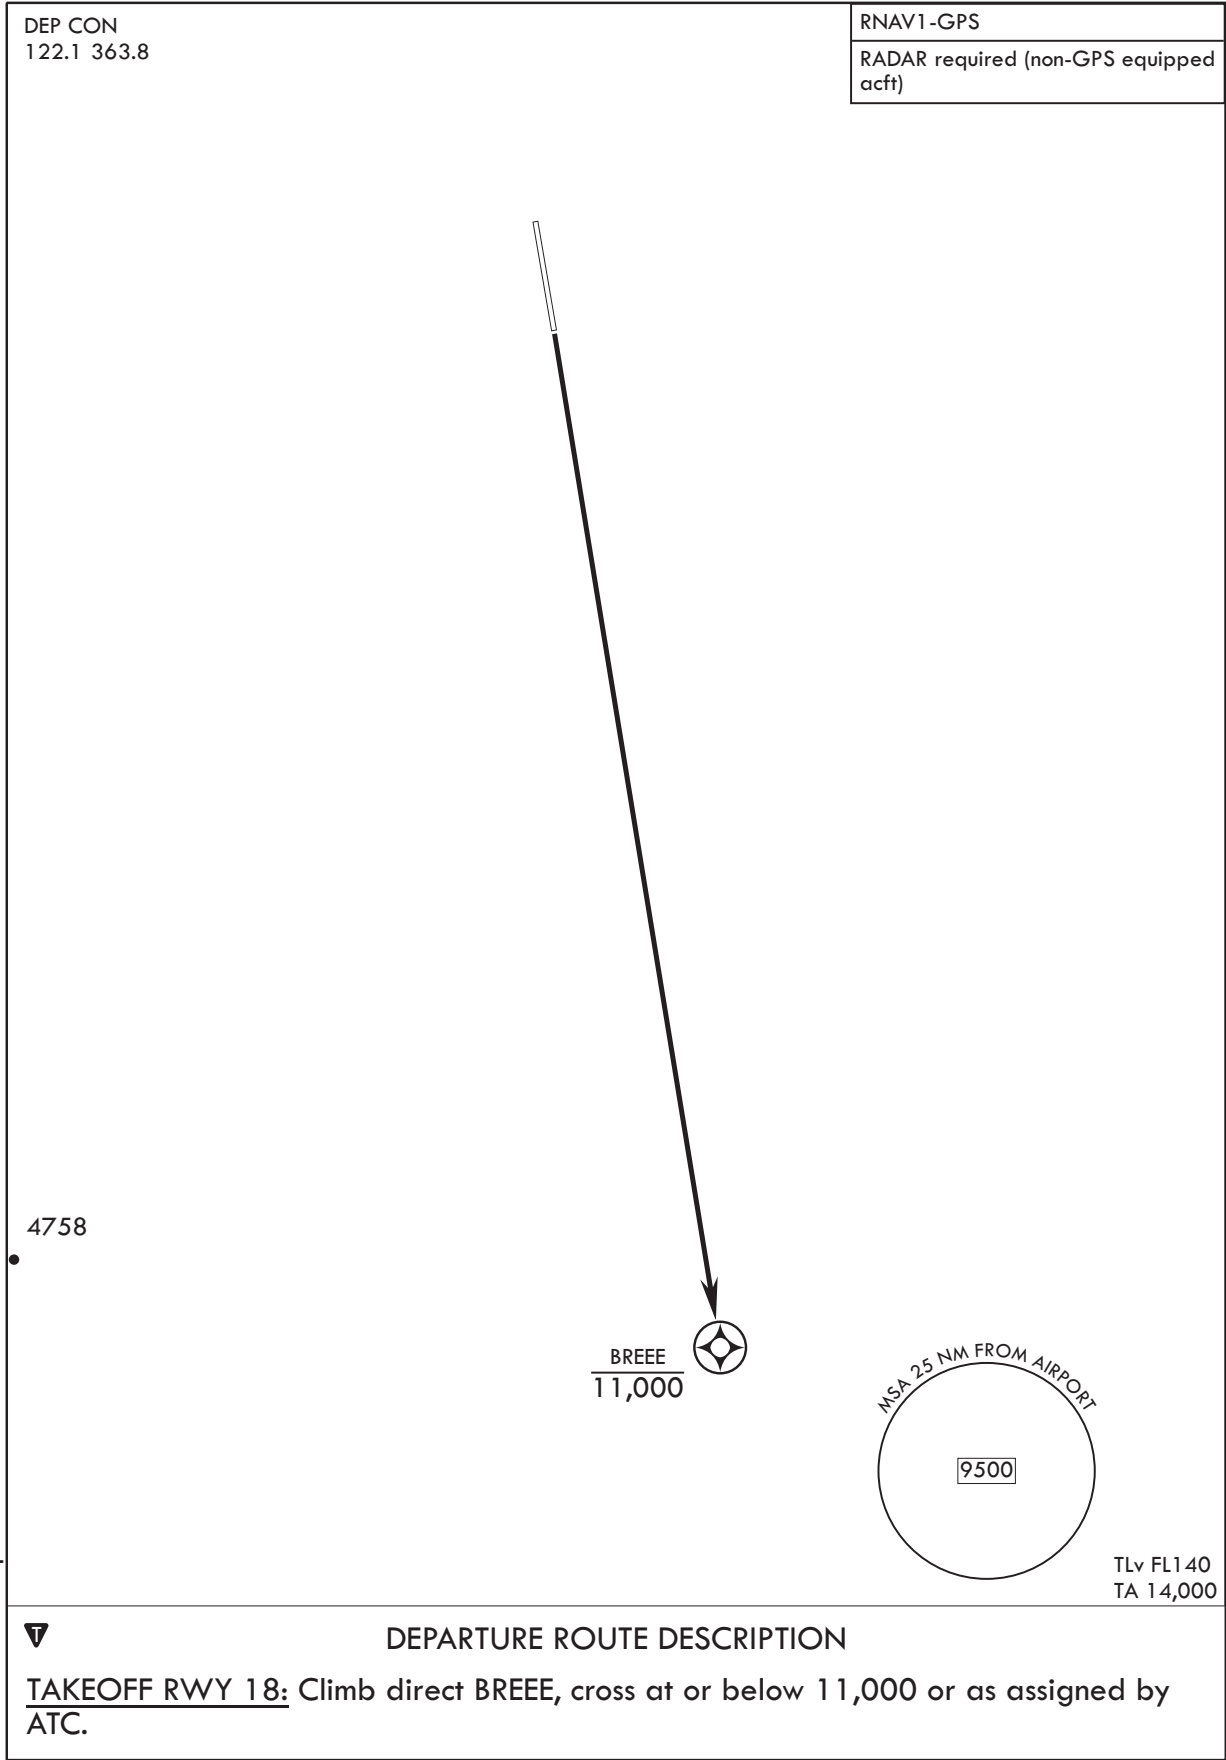


CHANGE : Update.

NOTE: REPRINTING DOD FLIP


INTENTIONALLY LEFT BLANK

INSTRUMENT APPROACH CHART

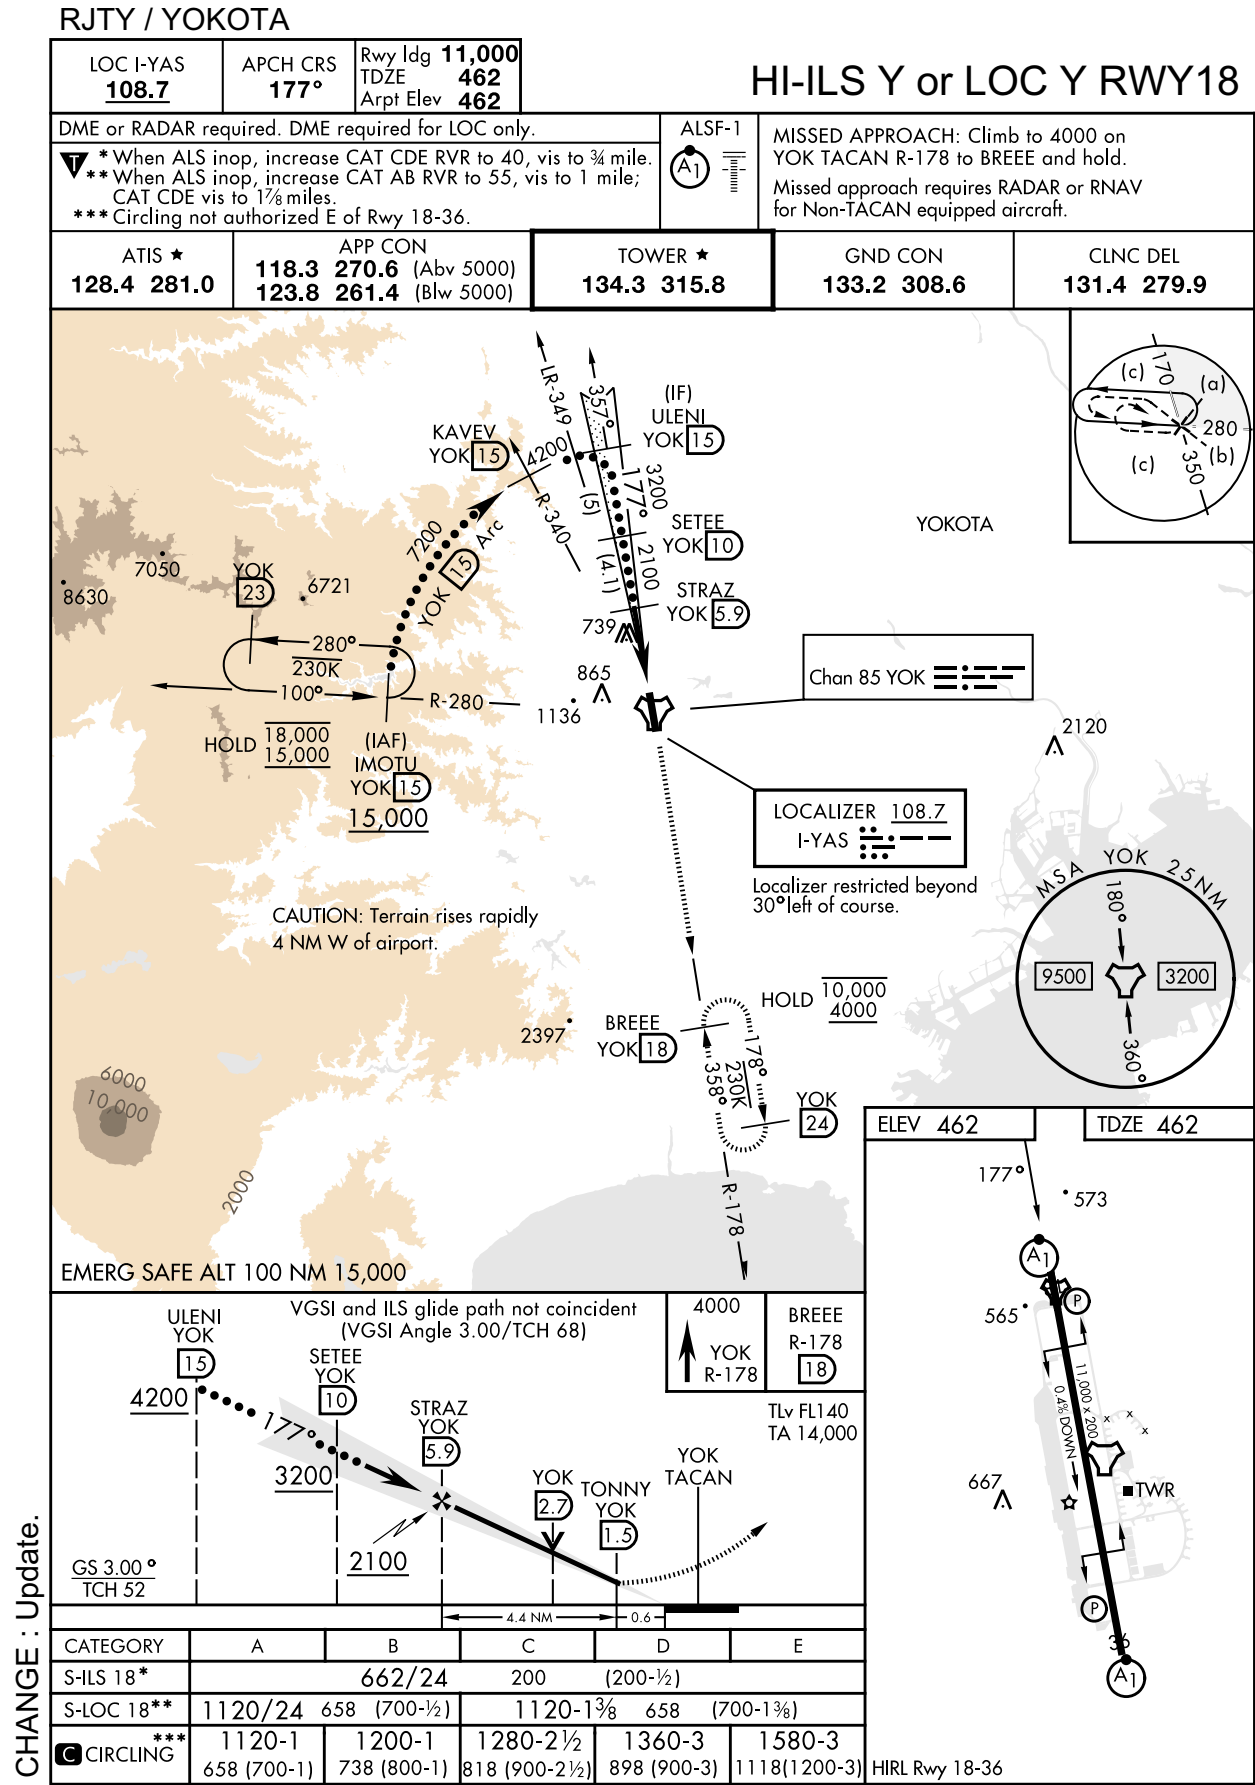

INSTRUMENT APPROACH CHART


RJTY / YOKOTA

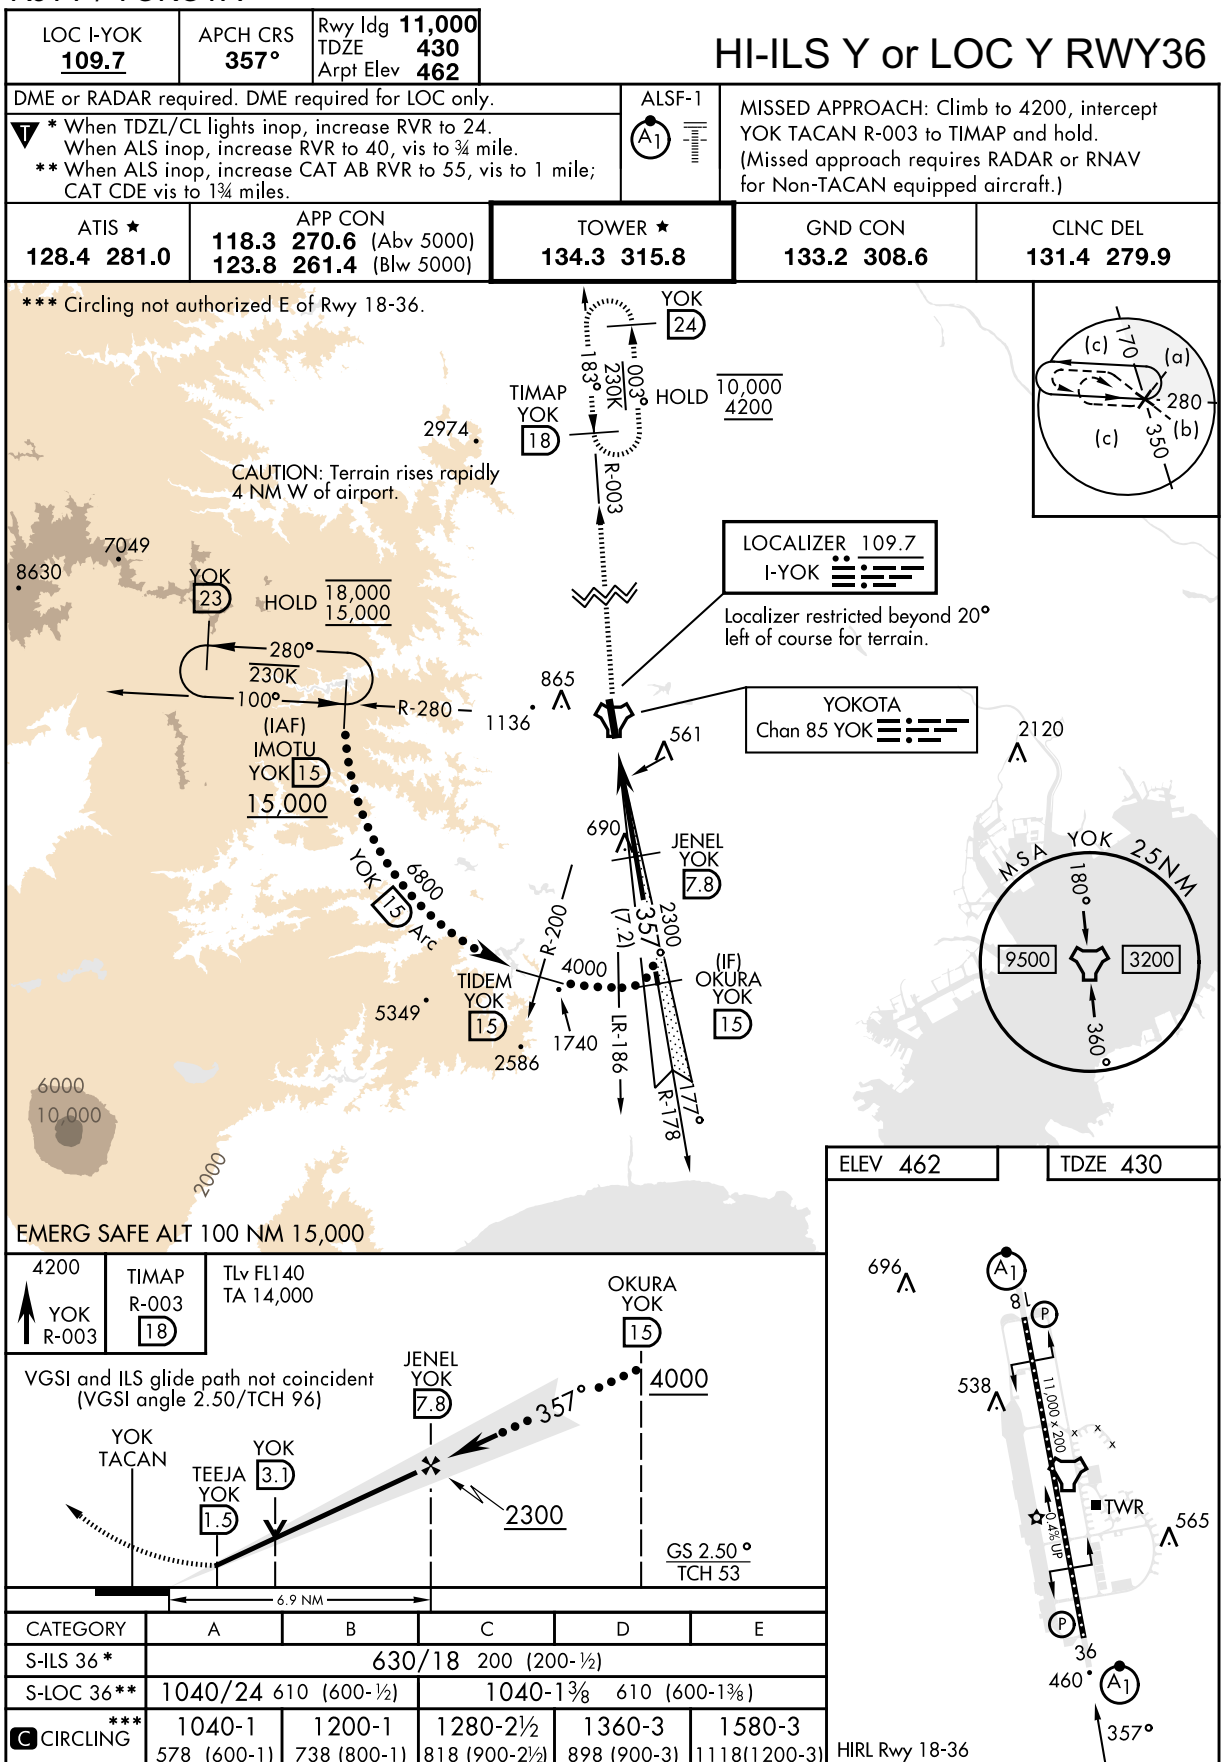

NOTE: REPRINTING DOD FLIP

INSTRUMENT APPROACH CHART

RJTY / YOKOTA

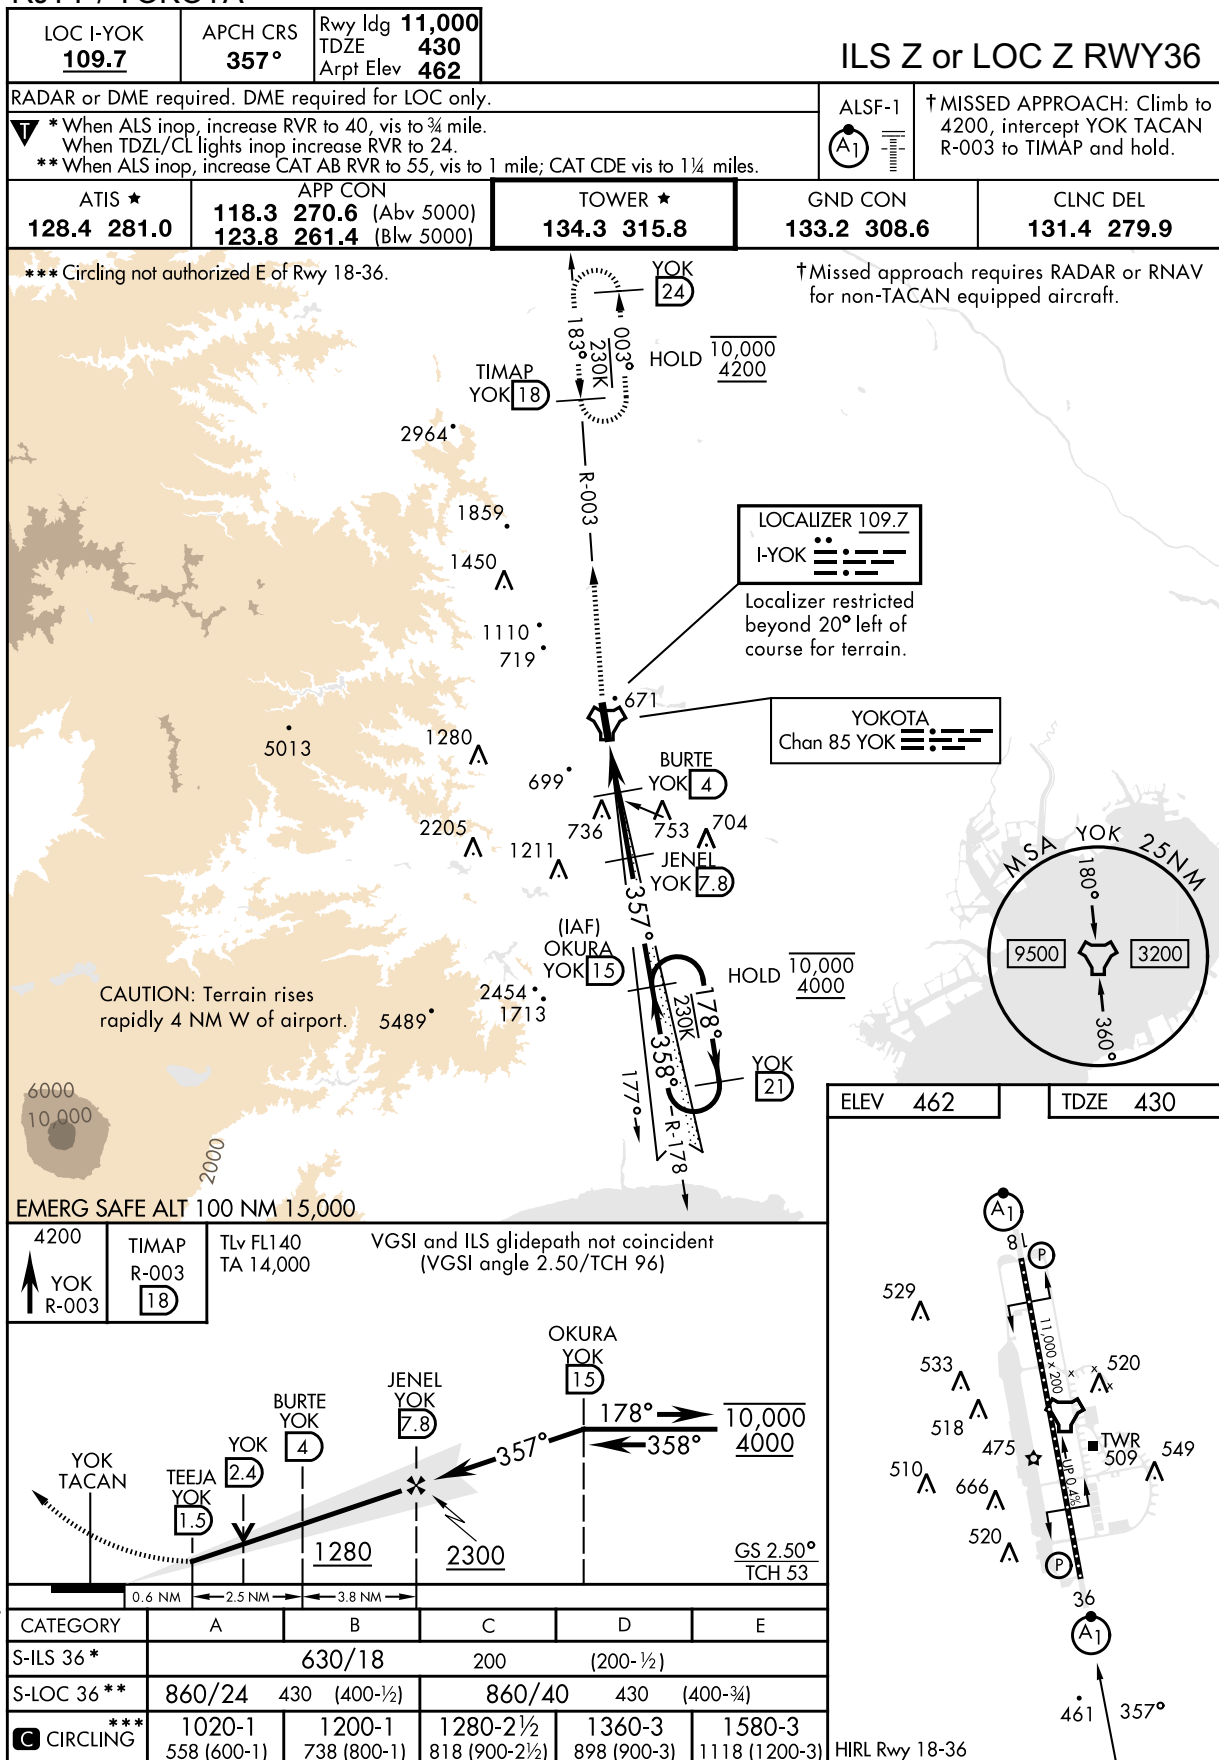

NOTE: REPRINTING DOD FLIP

RJTY / YOKOTA

RNAV(GPS)RWY18

CHANGE : Update.

10/7/25

RJTY / YOKOTA

RNAV(GPS)RWY36

MISSED APPROACH: Climb to 4200 direct BODAI and hold.

10,000
4,000

4 NM

177°

357°

230K

BODAI

1412

2974

1860

899

784

565

RW36

655

FONUD

(FAF) KARMN

2200

(8)

357°

4000 NoPT

271°

(8.6)

(IAF) WHILY

4000

177°

357°

230K

4 NM

10,000
4,000

EMERG SAFE ALT 100 NM 15,000

CAUTION: Terrain rises rapidly 4 NM W of airport.

DME/DME RNP-0.3 NA

MSA RW36 25 NM

9500

4200 BODAI VGSIs and descent angles not not coincident (VGSIs Angle 2.50/TCH 96).

TLv FL140
TA 14,000

RW36 1.5 NM to RW36

FONUD 1360

KARMN 2200

MESTR 4 NM Holding Pattern

177° 10,000
357° 4000

3.1 NM 2.9 NM

≤ 2.68°
TCH 75

CATEGORY	A	B	C	D
LNAV MDA*	900/24 470 (500-1/2)	900/50 470 (500-1)		
CIRCLING**	1020-1 558 (600-1)	1200-1 738 (800-1)	1280-2 1/2 818 (900-2 1/2)	1360-3 898 (900-3)

10/7/25