


RJTY / YOKOTA

AD CHART

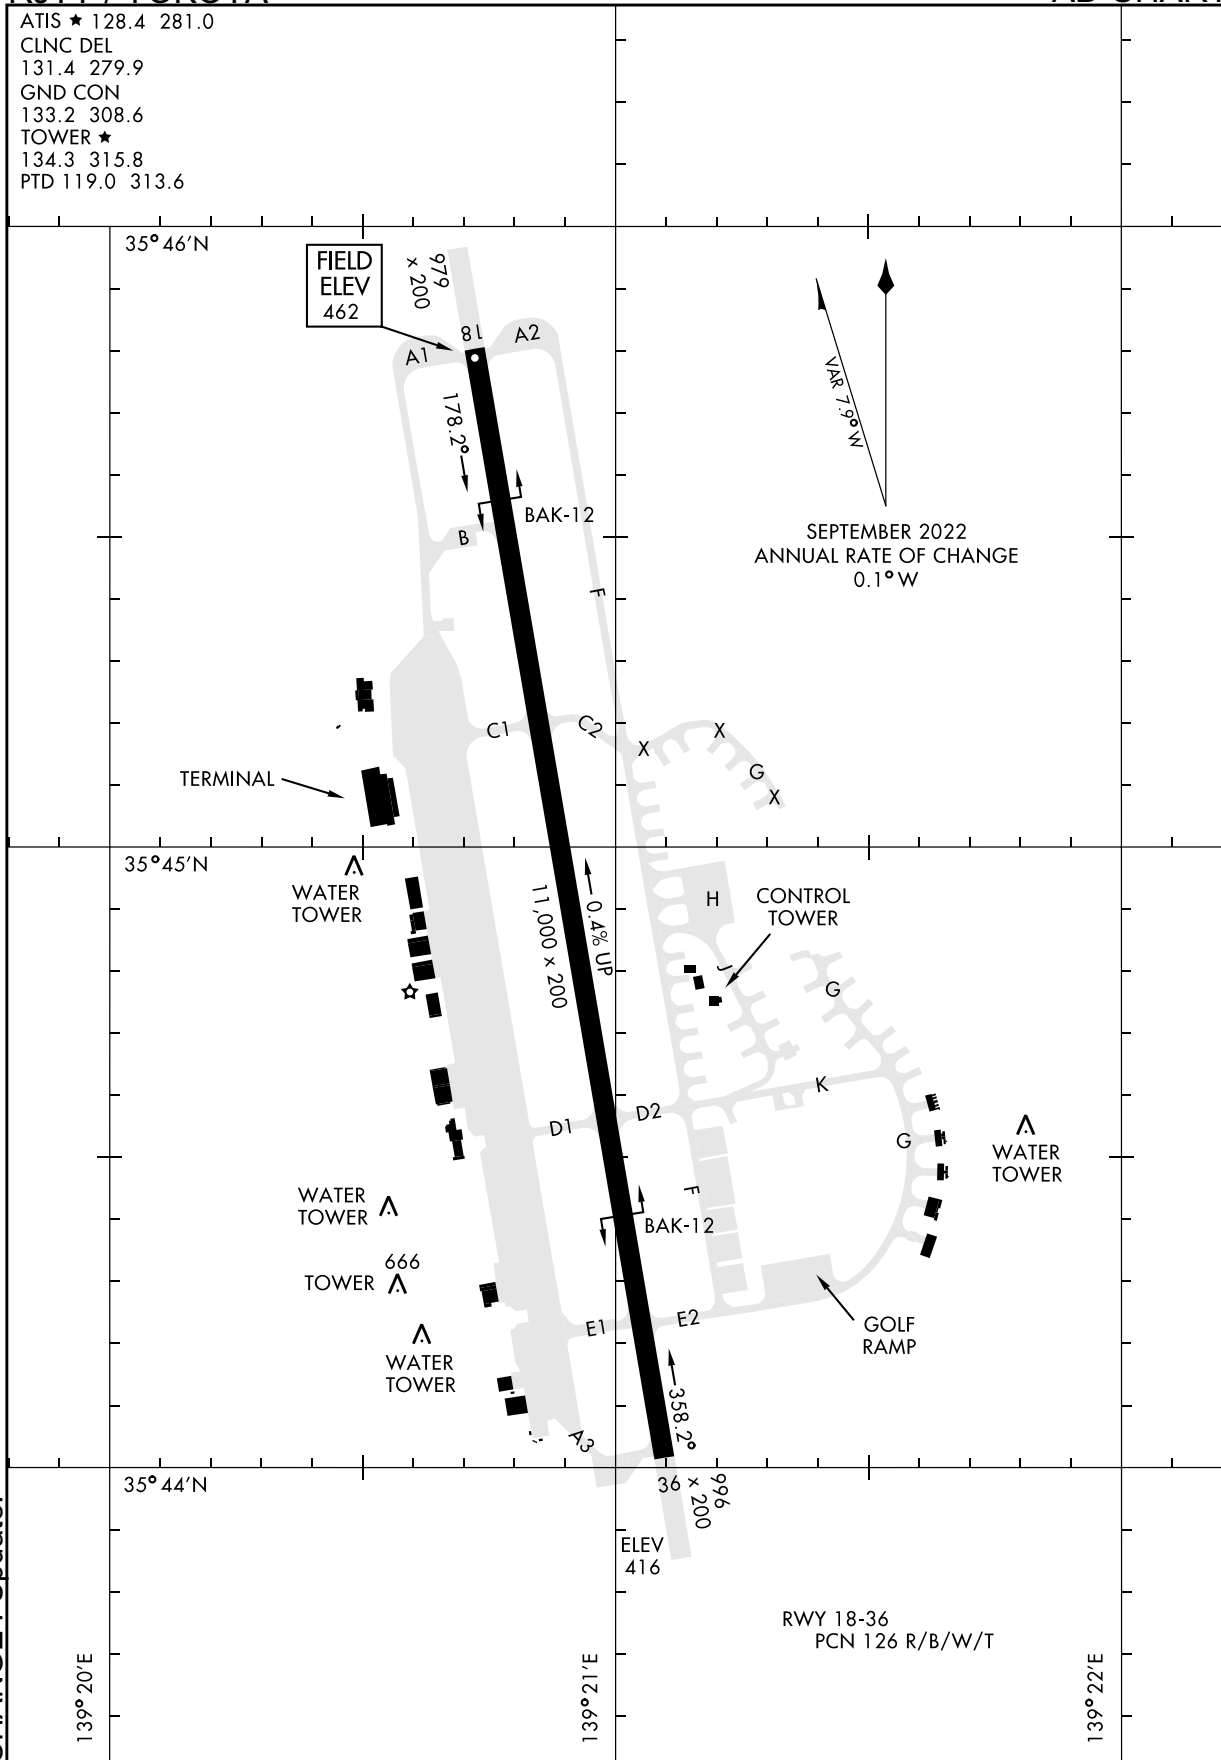


NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

RJTY/YOKOTA

BREEE SIX DEPARTURE(OBSTACLE)

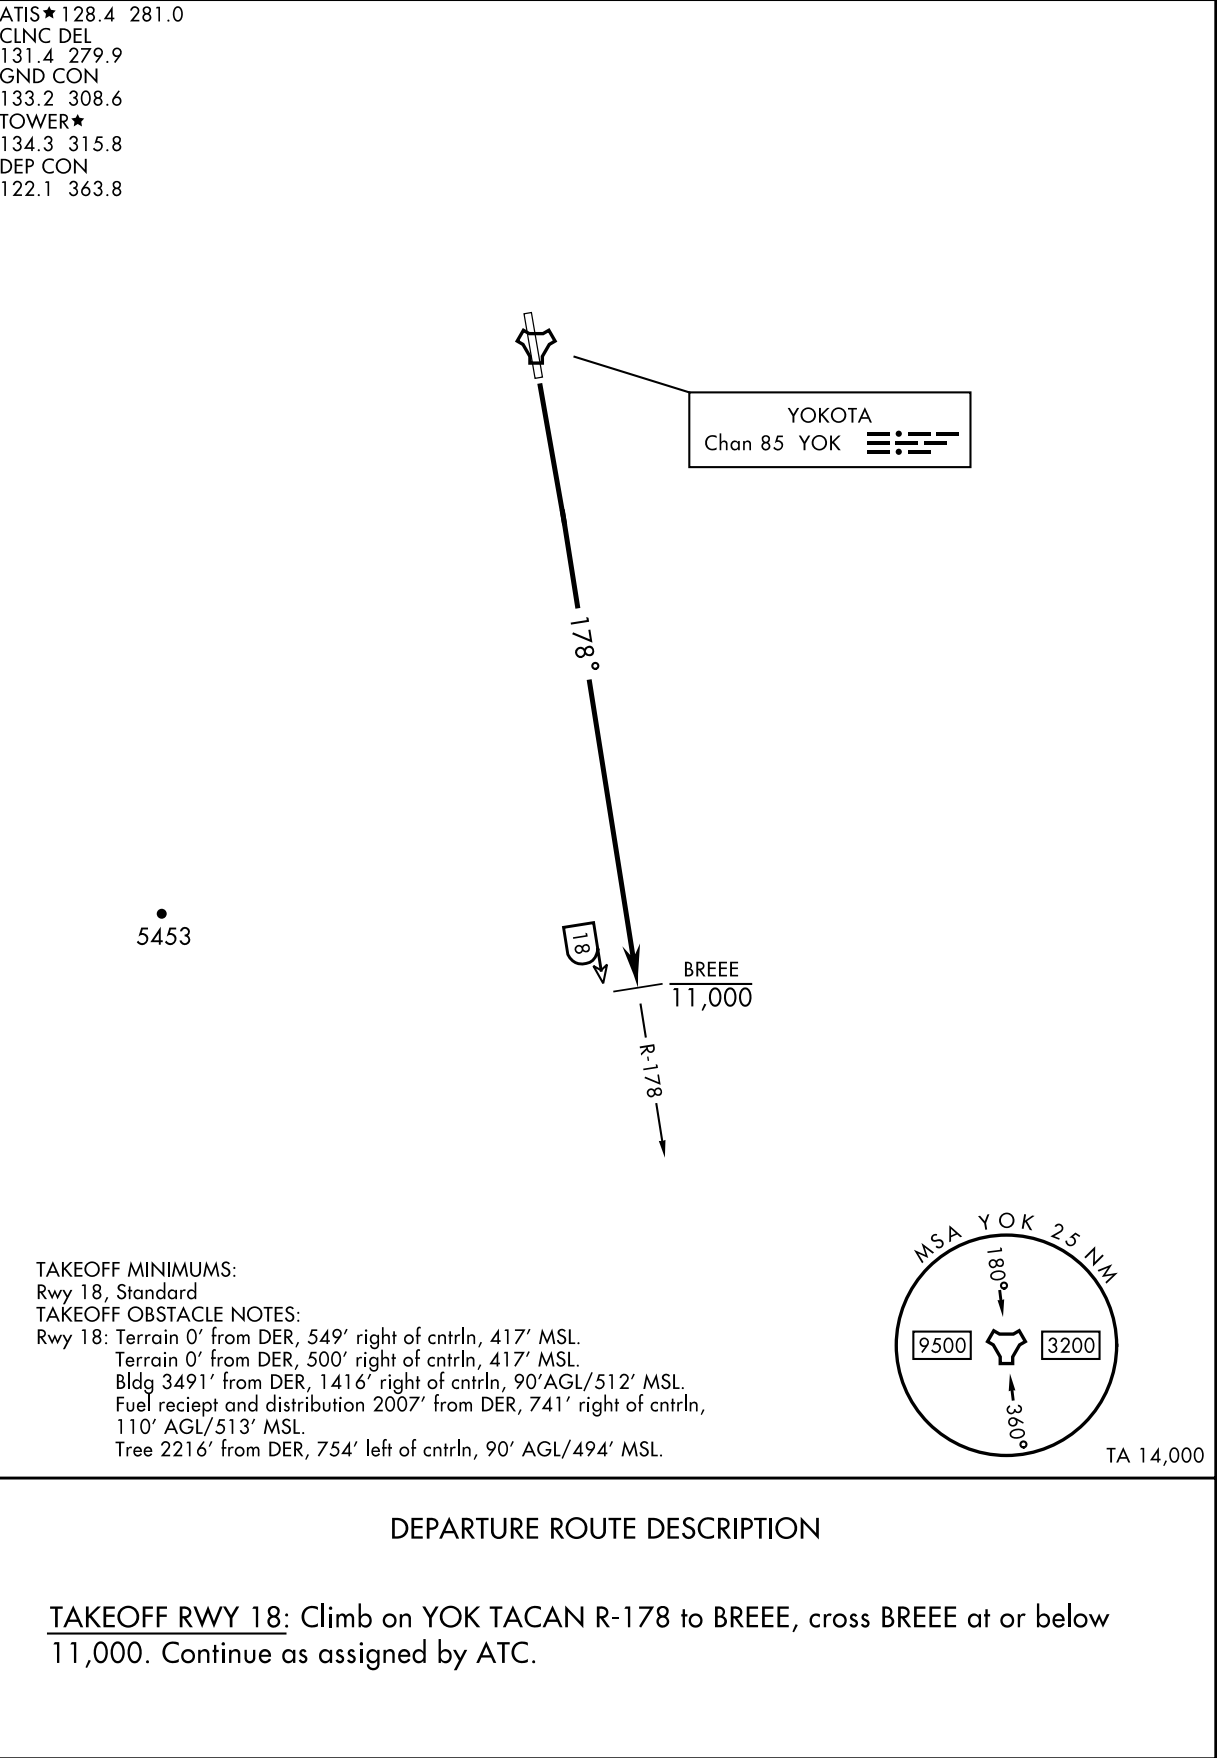


NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

RJTY / YOKOTA

TIMAP FIVE DEPARTURE(OBSTACLE)

ATIS★128.4 281.0
 CLNC DEL
 131.4 279.9
 GND CON
 133.2 308.6
 TOWER★
 134.3 315.8
 DEP CON
 122.1 363.8

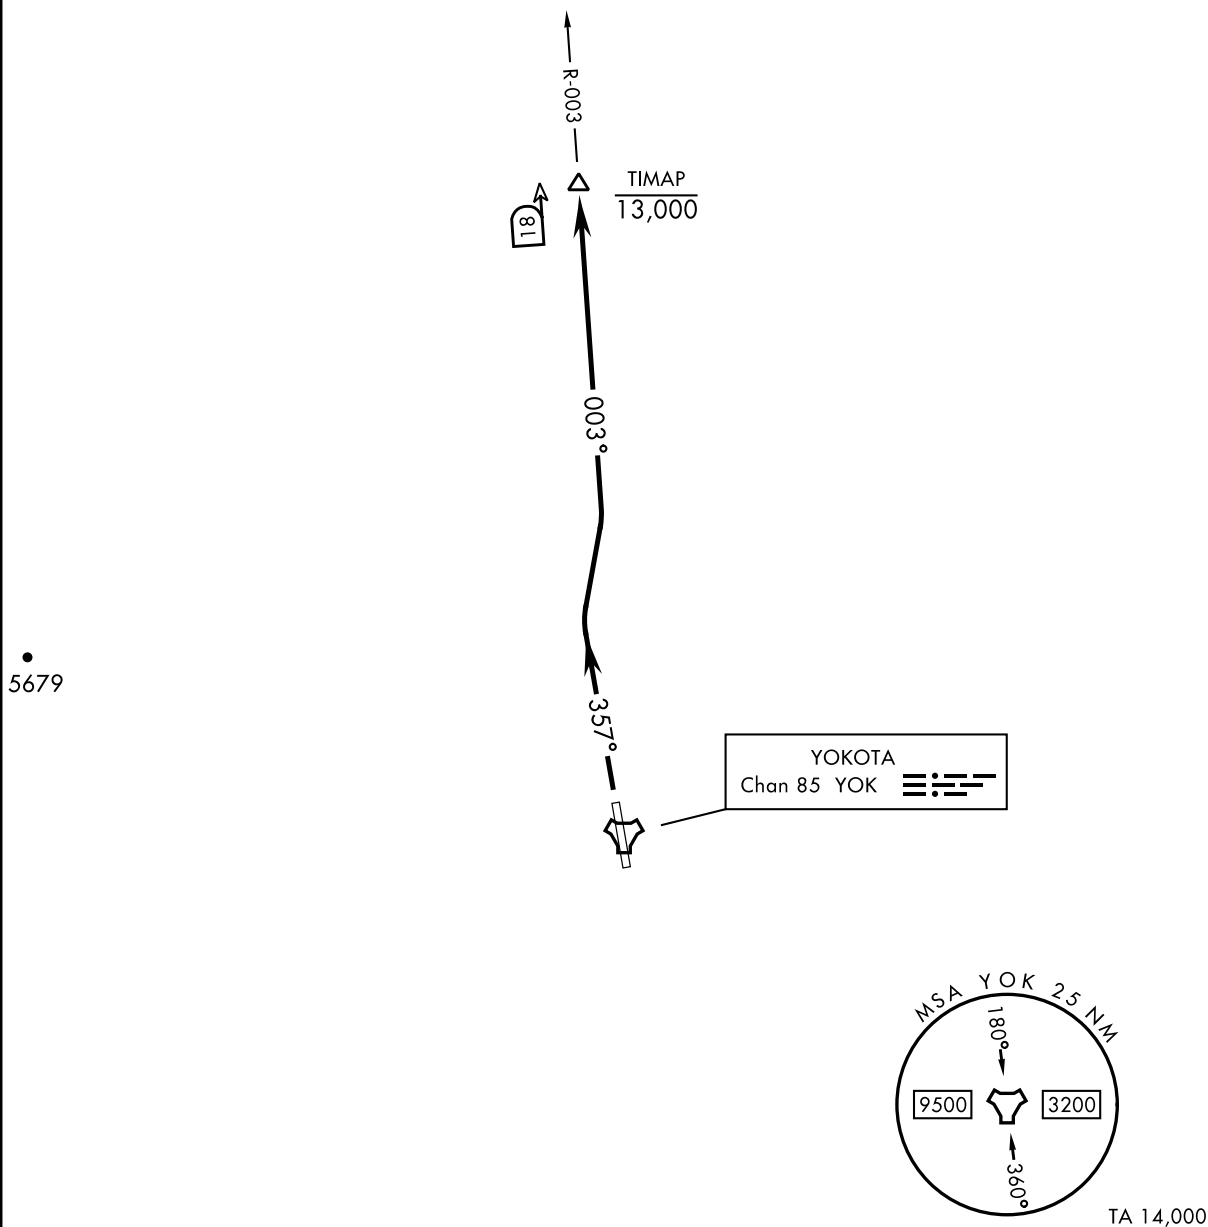

CHANGE : Update.



DEPARTURE ROUTE DESCRIPTION

TAKEOFF RWY 36: Climb to 4000, turn right to intercept YOK TACAN R-003 to TIMAP.
 Cross TIMAP at or below 13,000. Continue as assigned by ATC.


NOTE: REPRINTING DOD FLIP

RJTY / YOKOTA

BUSYU TWO DEPARTURE

Rwy	Knots	60	120	180	240	300	360
* 18 (a)	V/V(fpm)	360	720	1080	1440	1800	2160
† 18 (b)	V/V(fpm)	465	930	1395	1860	2325	2790
* 36 (c)	V/V(fpm)	383	766	1149	1532	1915	2298
† 36 (d)	V/V(fpm)	476	952	1428	1904	2380	2856

© to 7900

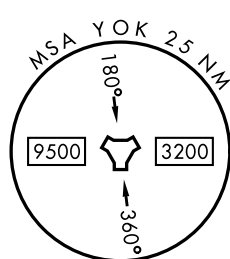

YOKOTA
Chan 85 YOK 

TLv FL140
TA 14,000

DEPARTURE ROUTE DESCRIPTION


TAKEOFF RWY 18: Climbing right turn to intercept YOK TACAN R-283 to BUSYU. Cross BUSYU at or above 13,400. Maintain ATC assigned altitude.

TAKEOFF RWY 36: Climbing left turn to intercept YOK TACAN R-283 to BUSYU. Cross BUSYU at or above 13,400. Maintain ATC assigned altitude.

CHANGE : Update.

NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

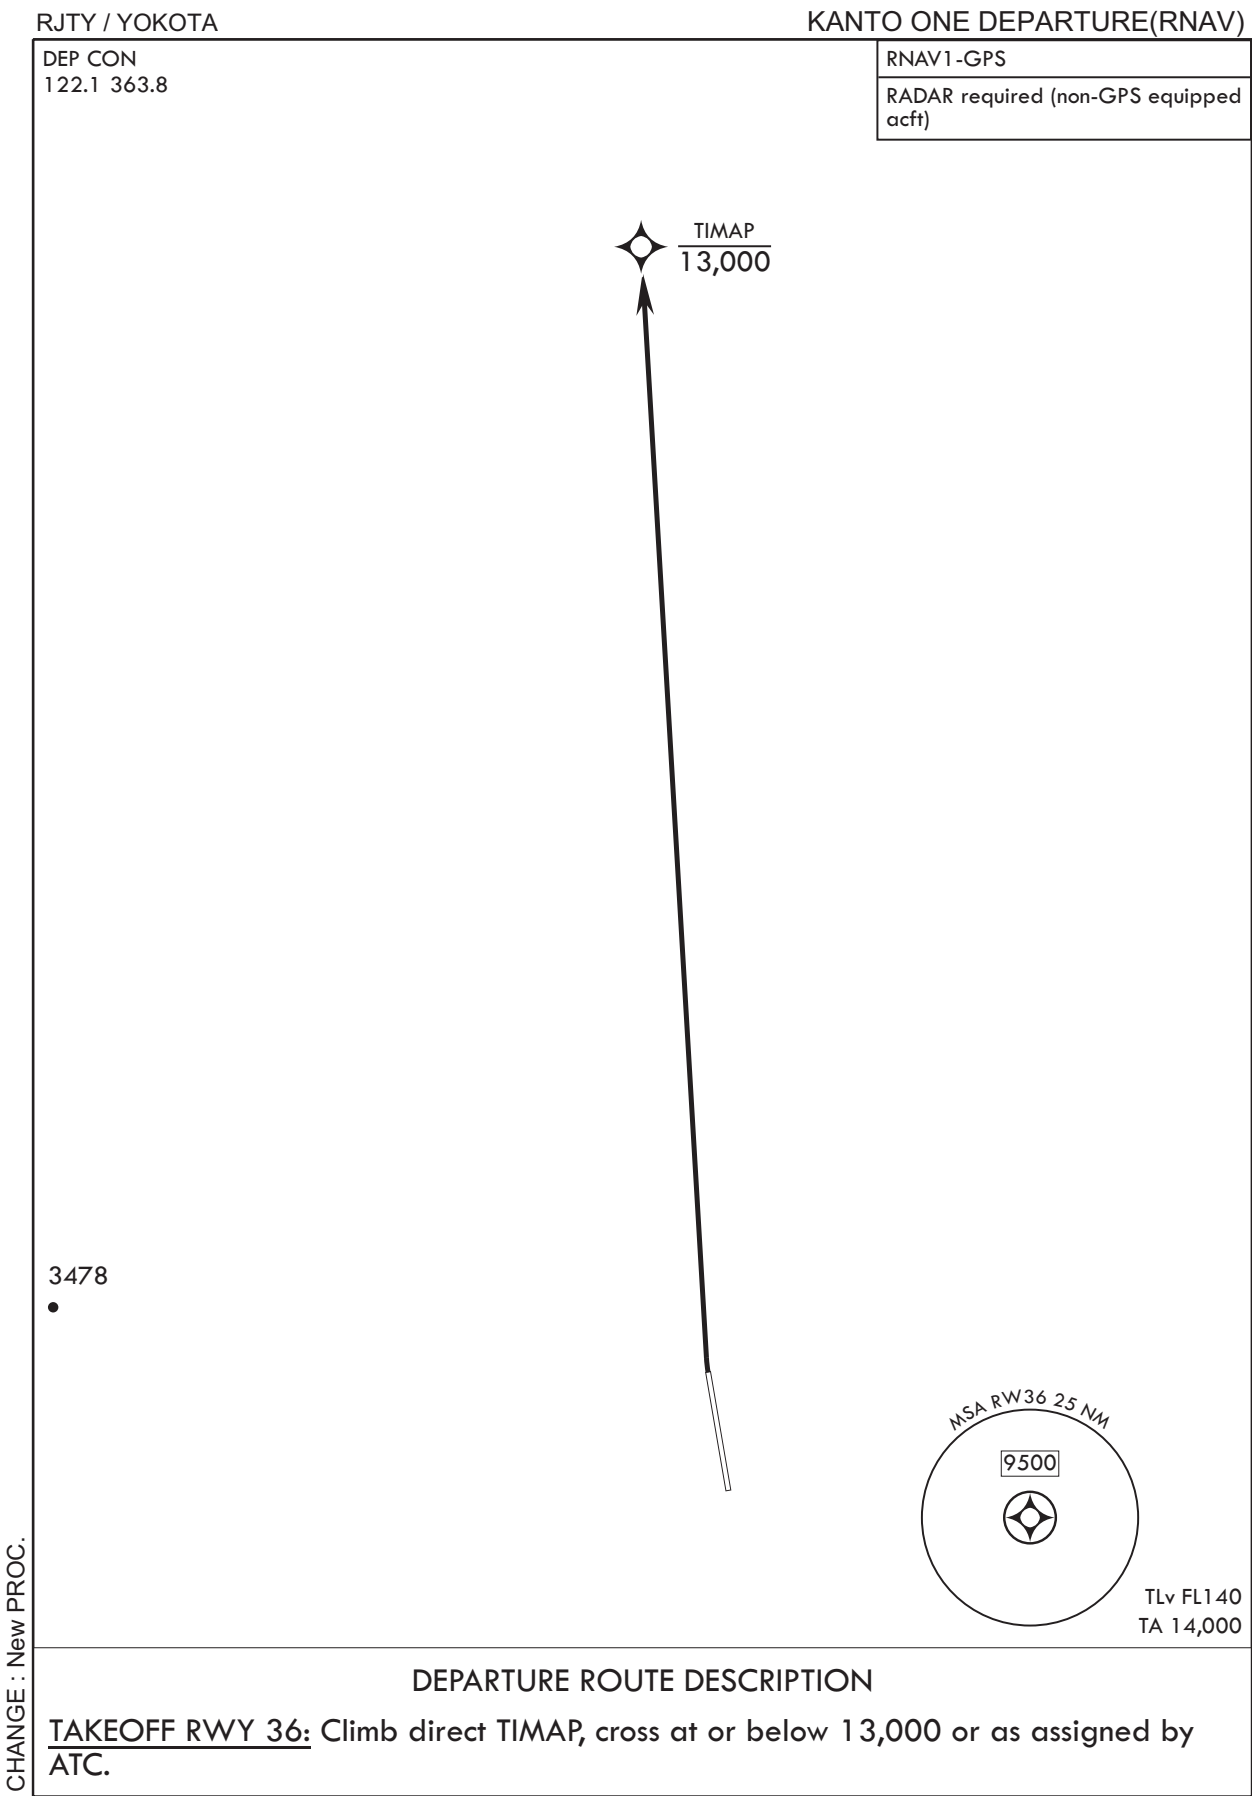


NOTE: REPRINTING DOD FLIP

STANDARD DEPARTURE CHART - INSTRUMENT

RJTY / YOKOTA

FUSSA TWO DEPARTURE(RNAV)

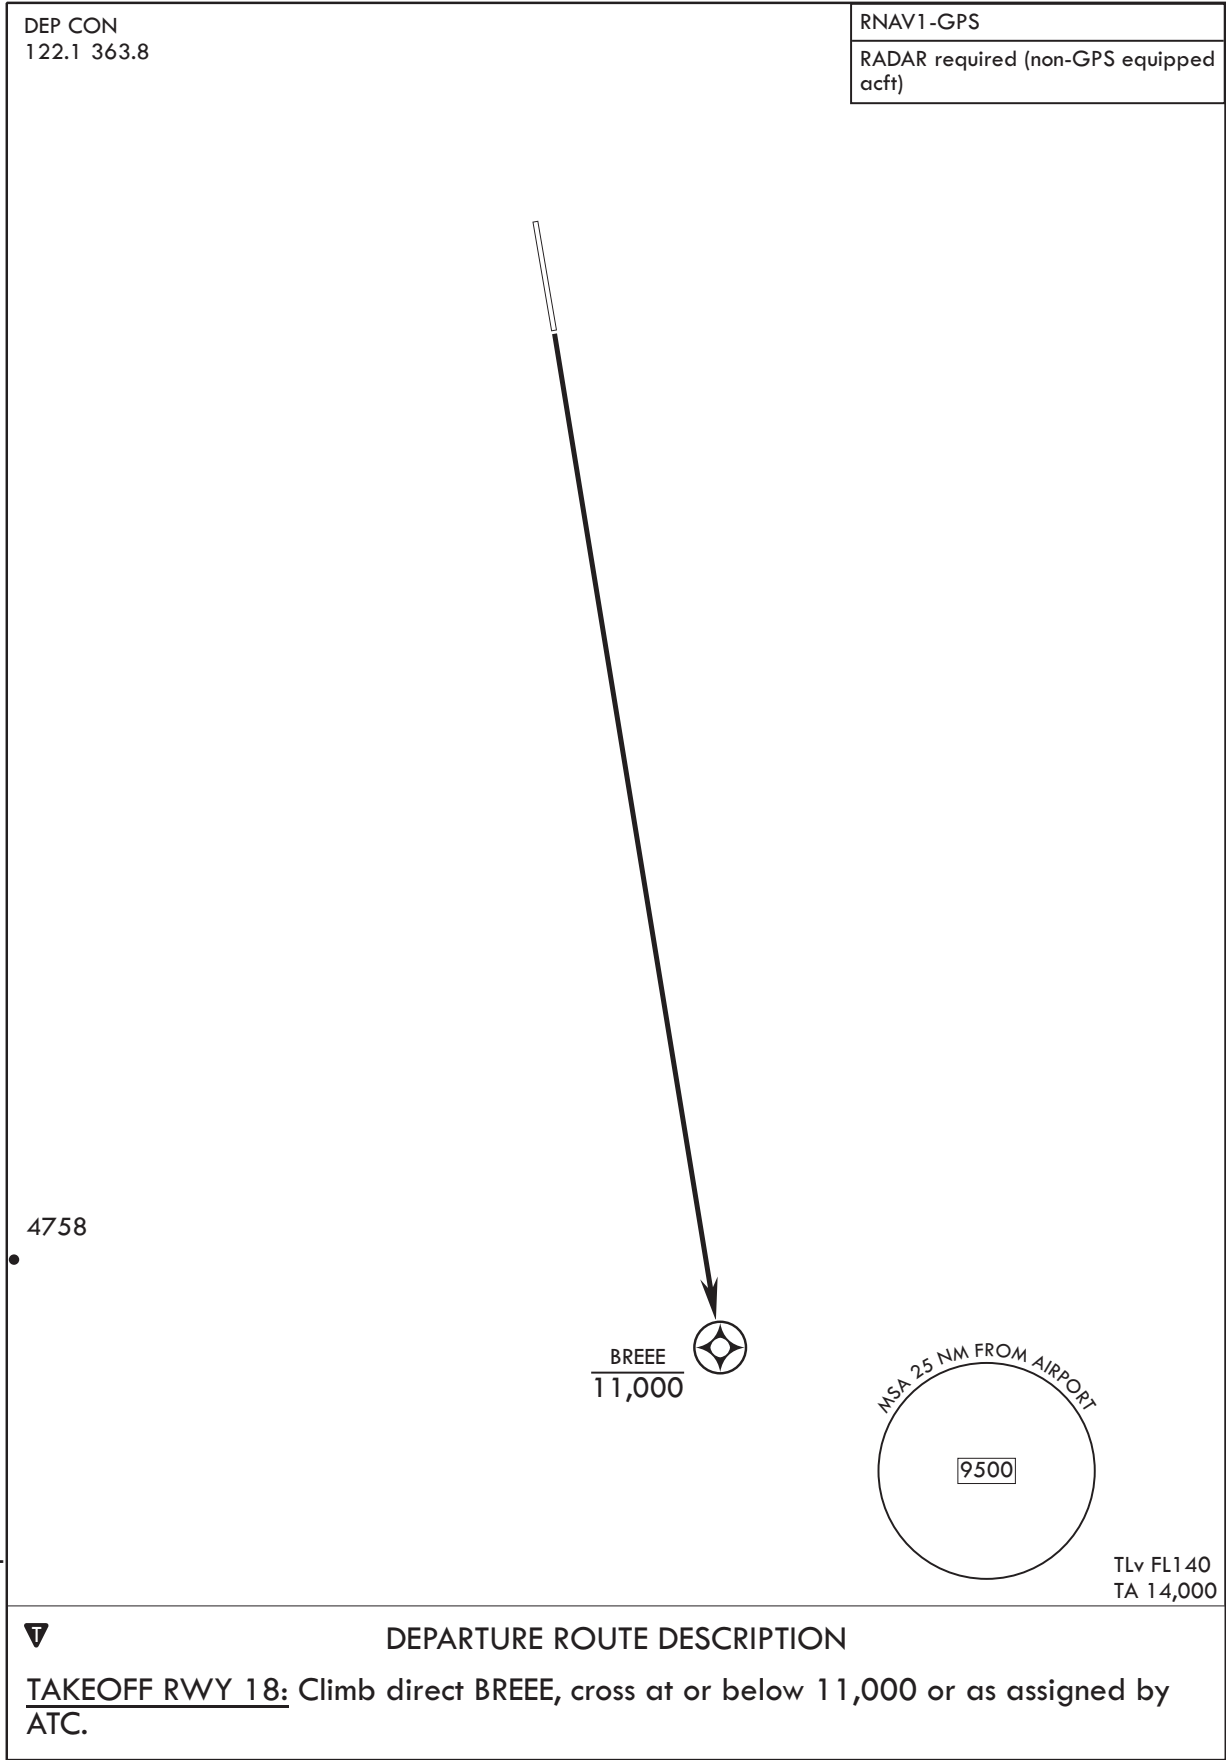


CHANGE : Update.

NOTE: REPRINTING DOD FLIP

INTENTIONALLY LEFT BLANK


INSTRUMENT APPROACH CHART

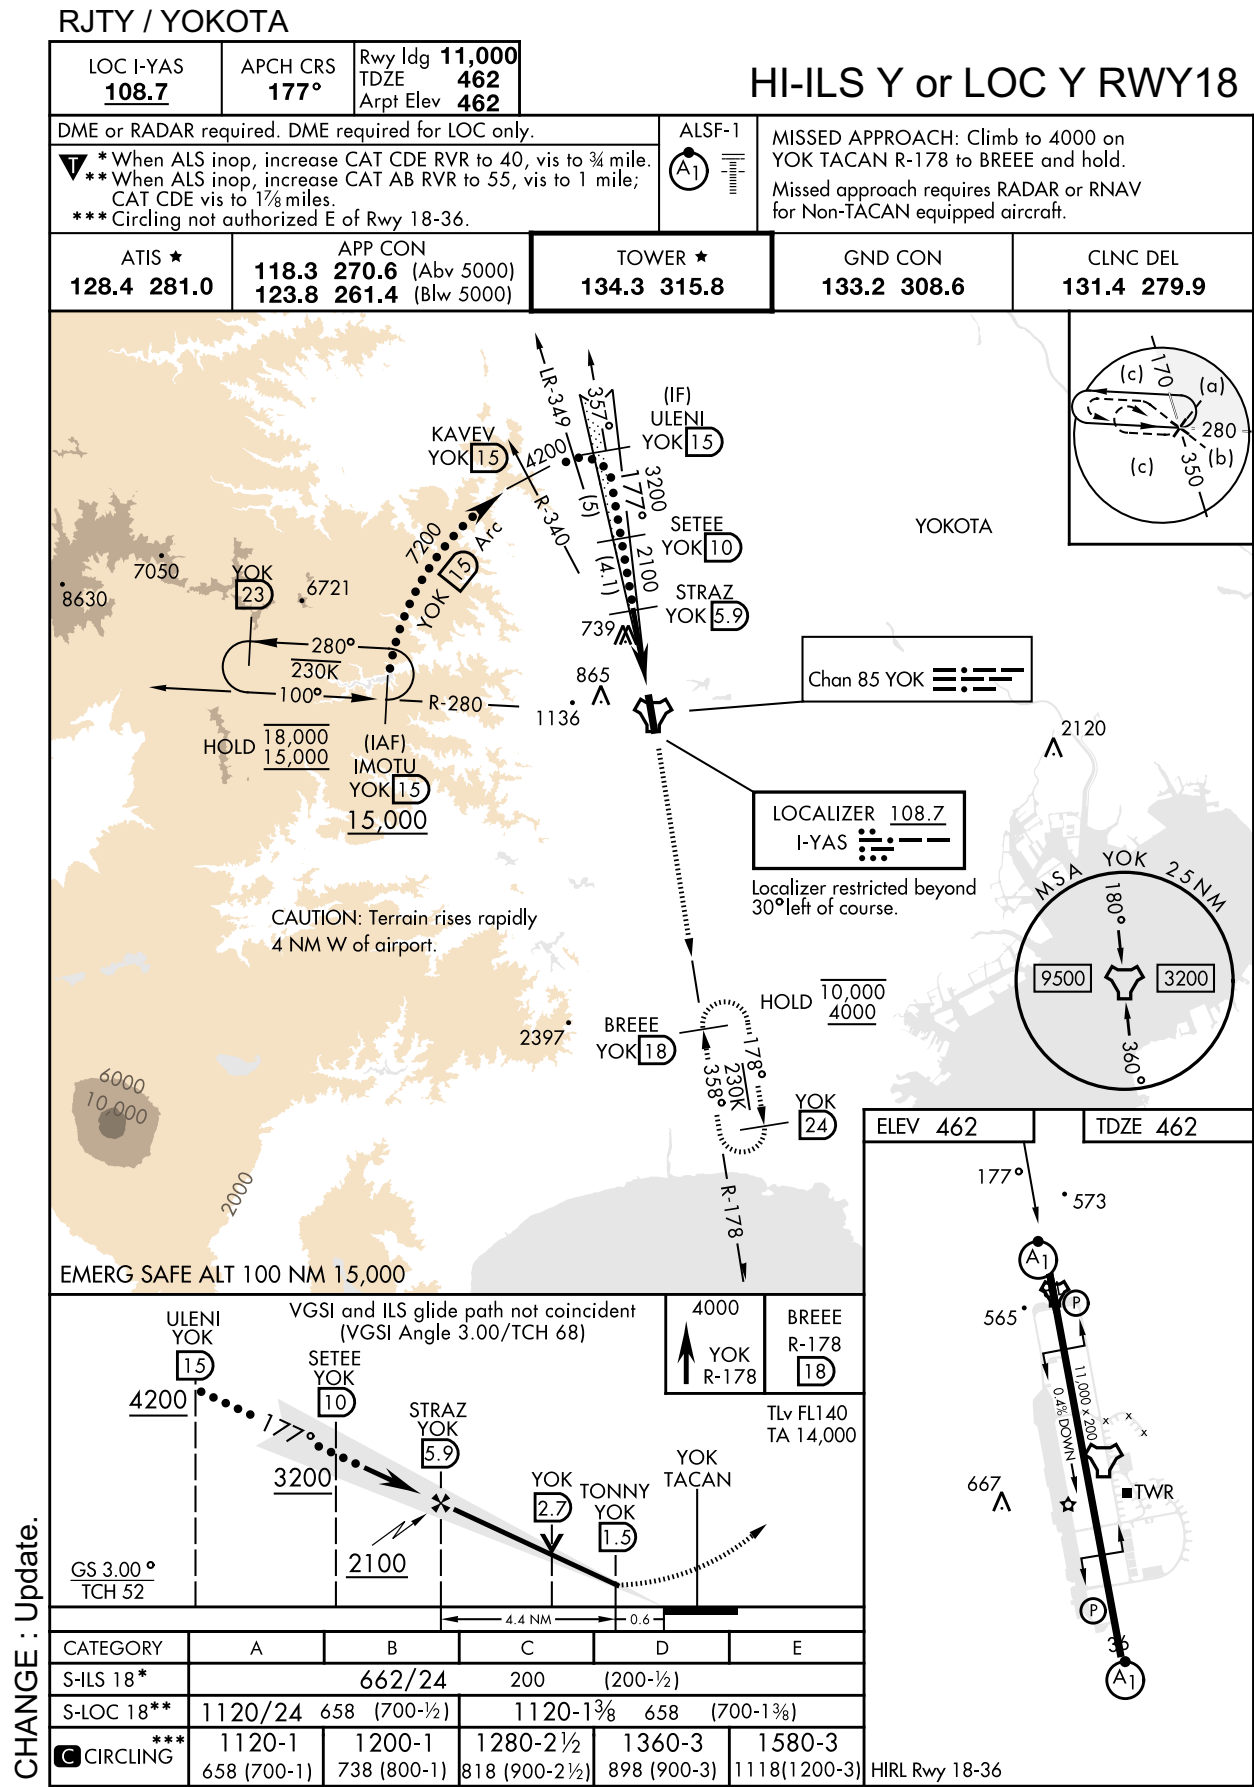


NOTE: REPRINTING DOD FLIP

INSTRUMENT APPROACH CHART


RJTY/YOKOTA

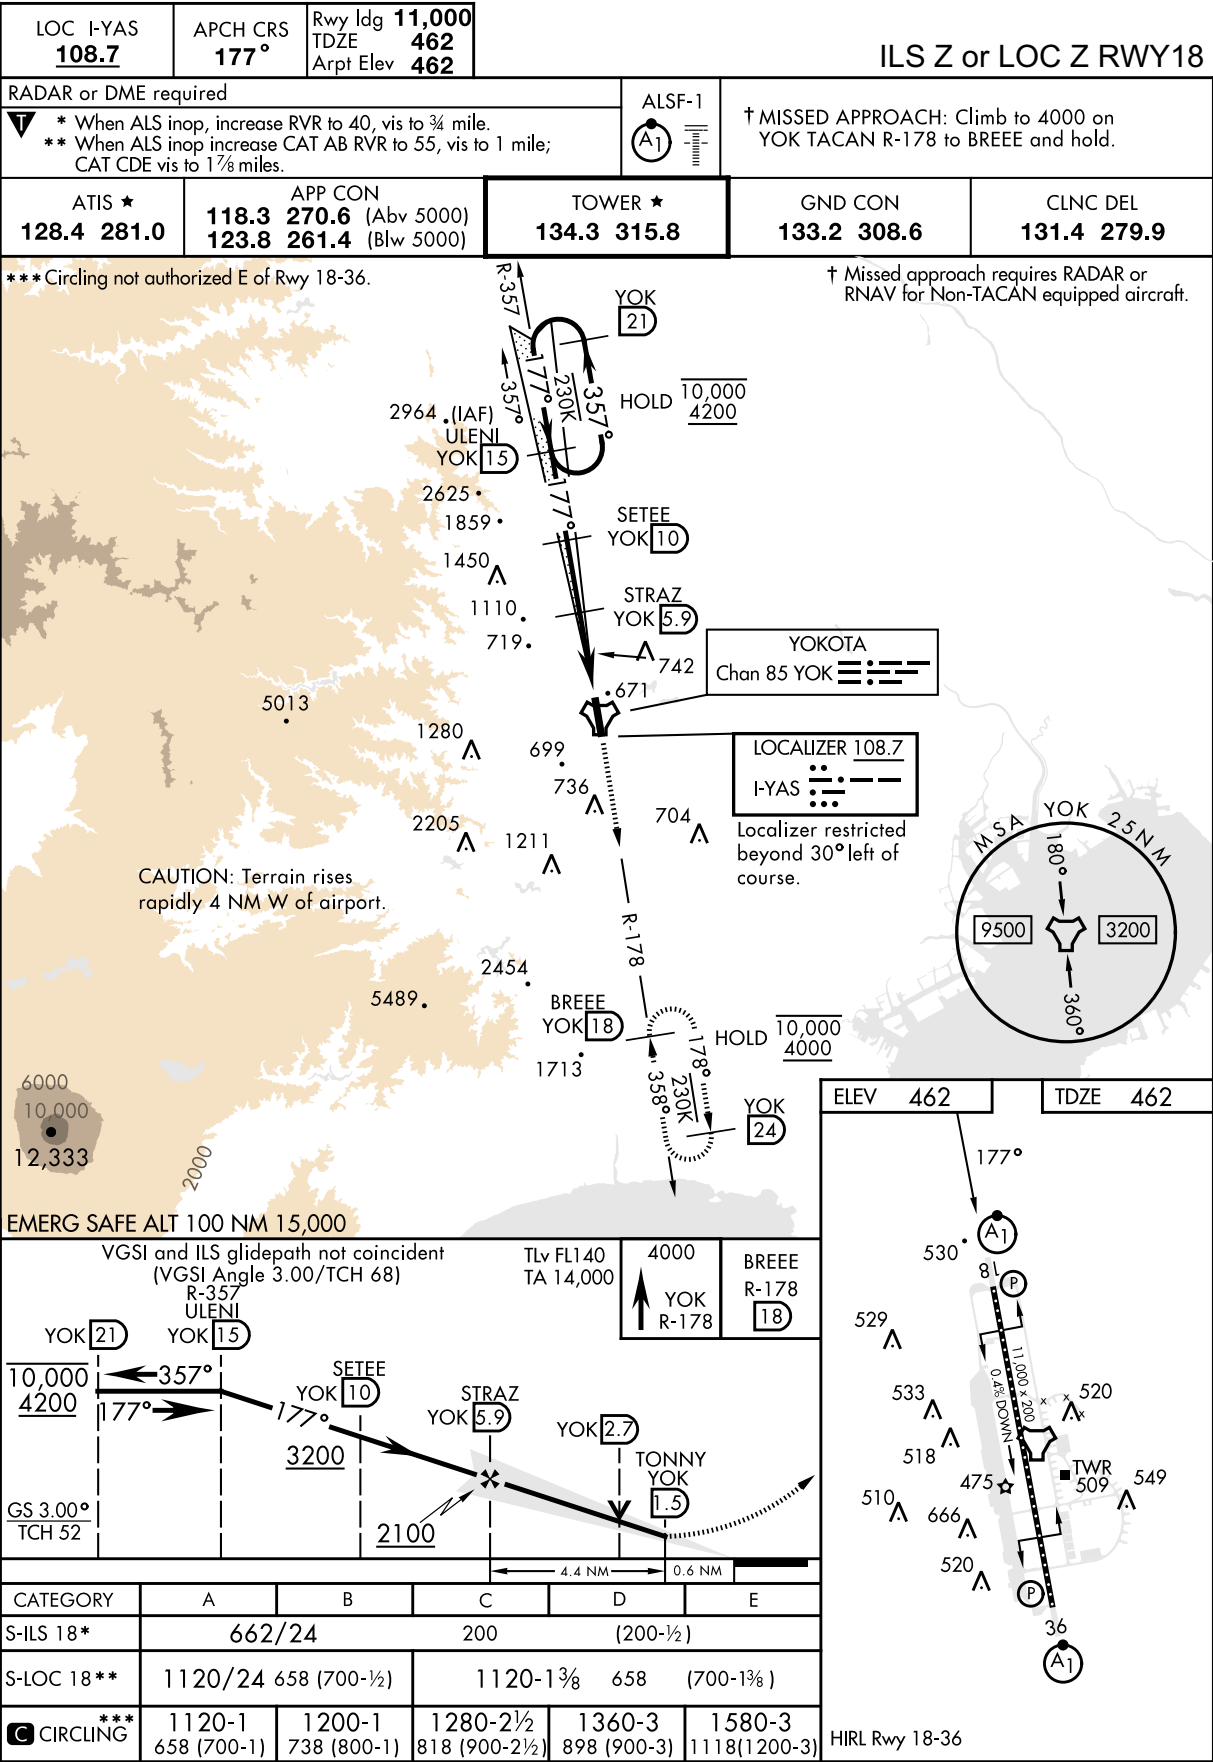

INSTRUMENT APPROACH CHART

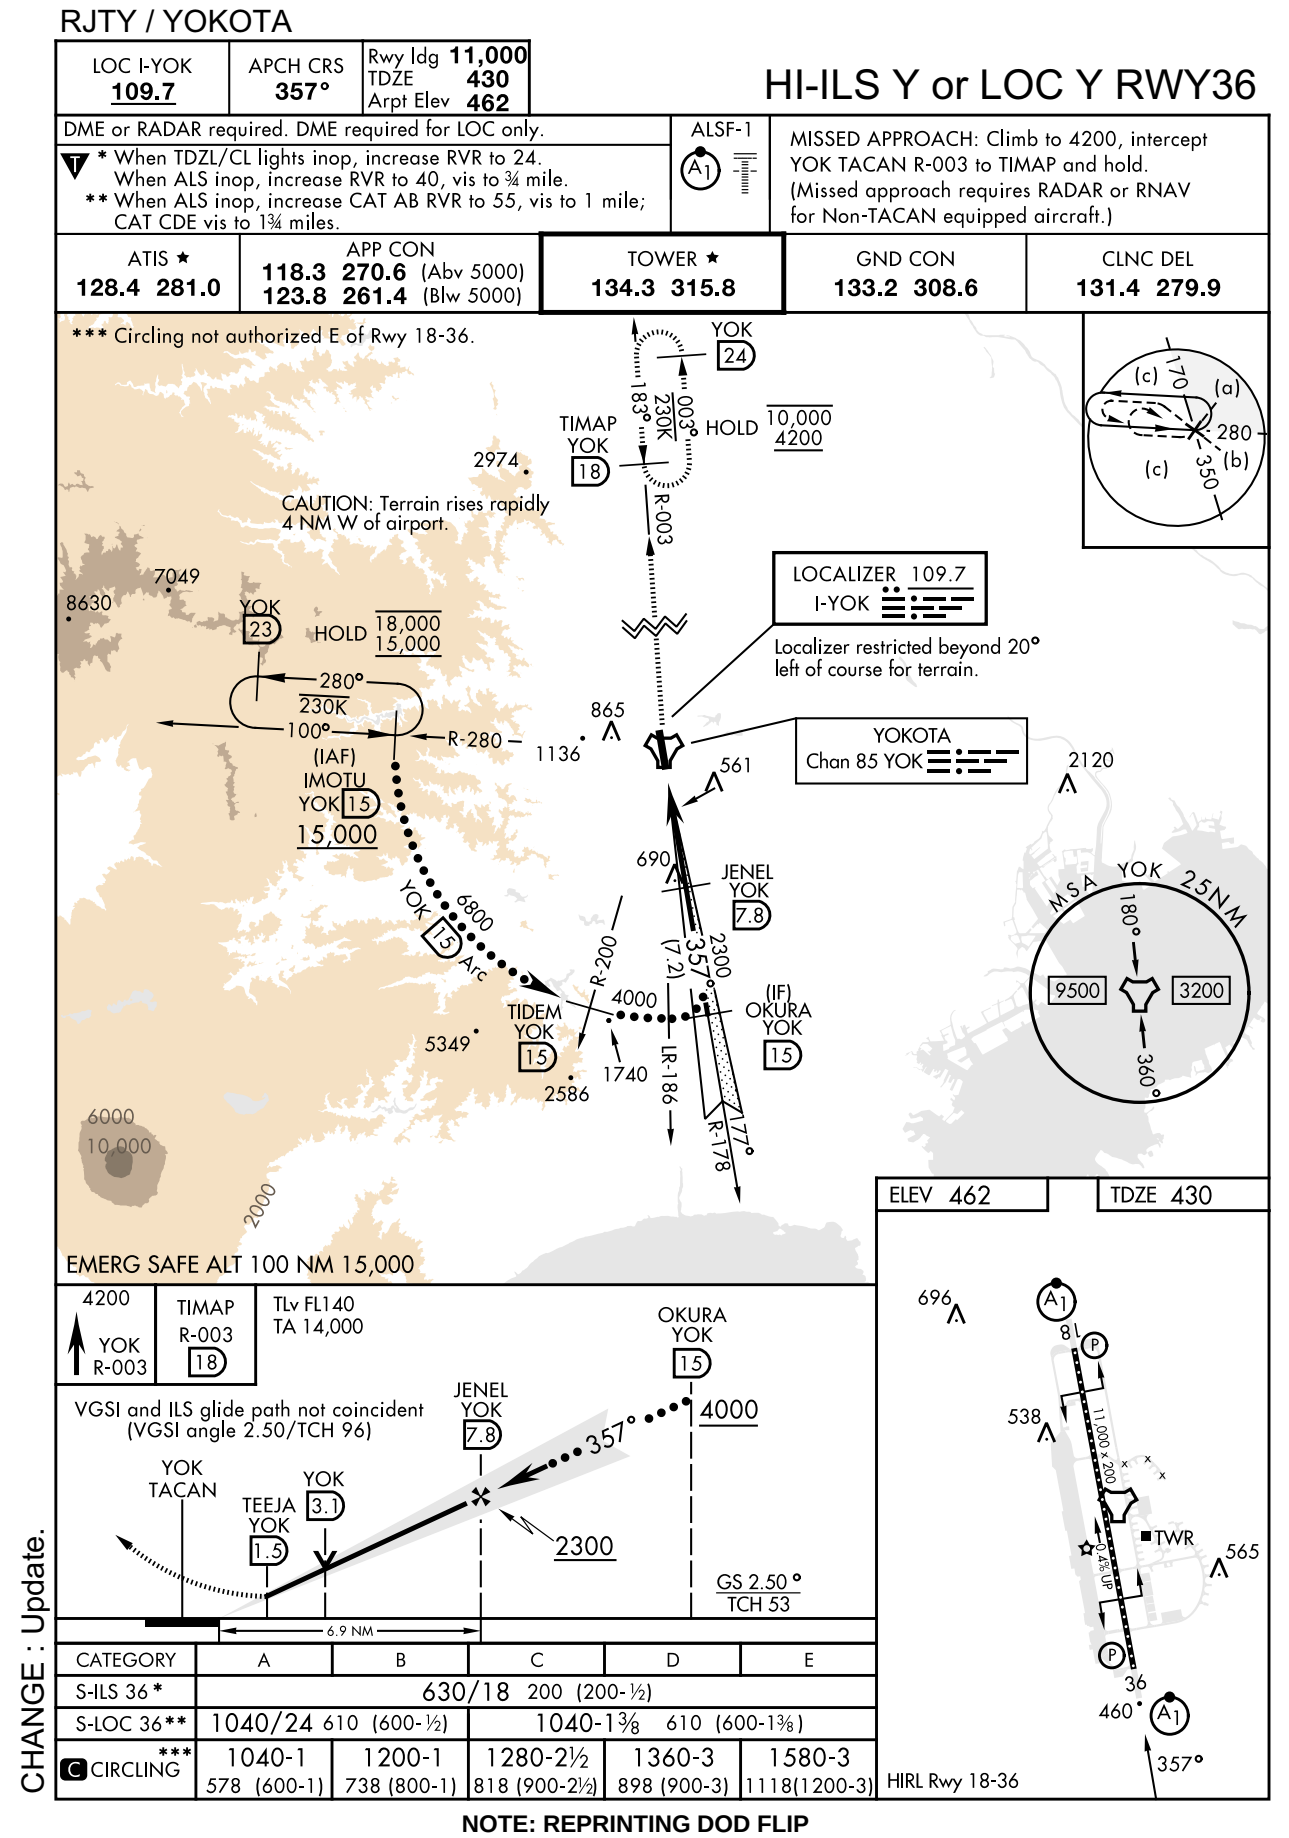

INSTRUMENT APPROACH CHART

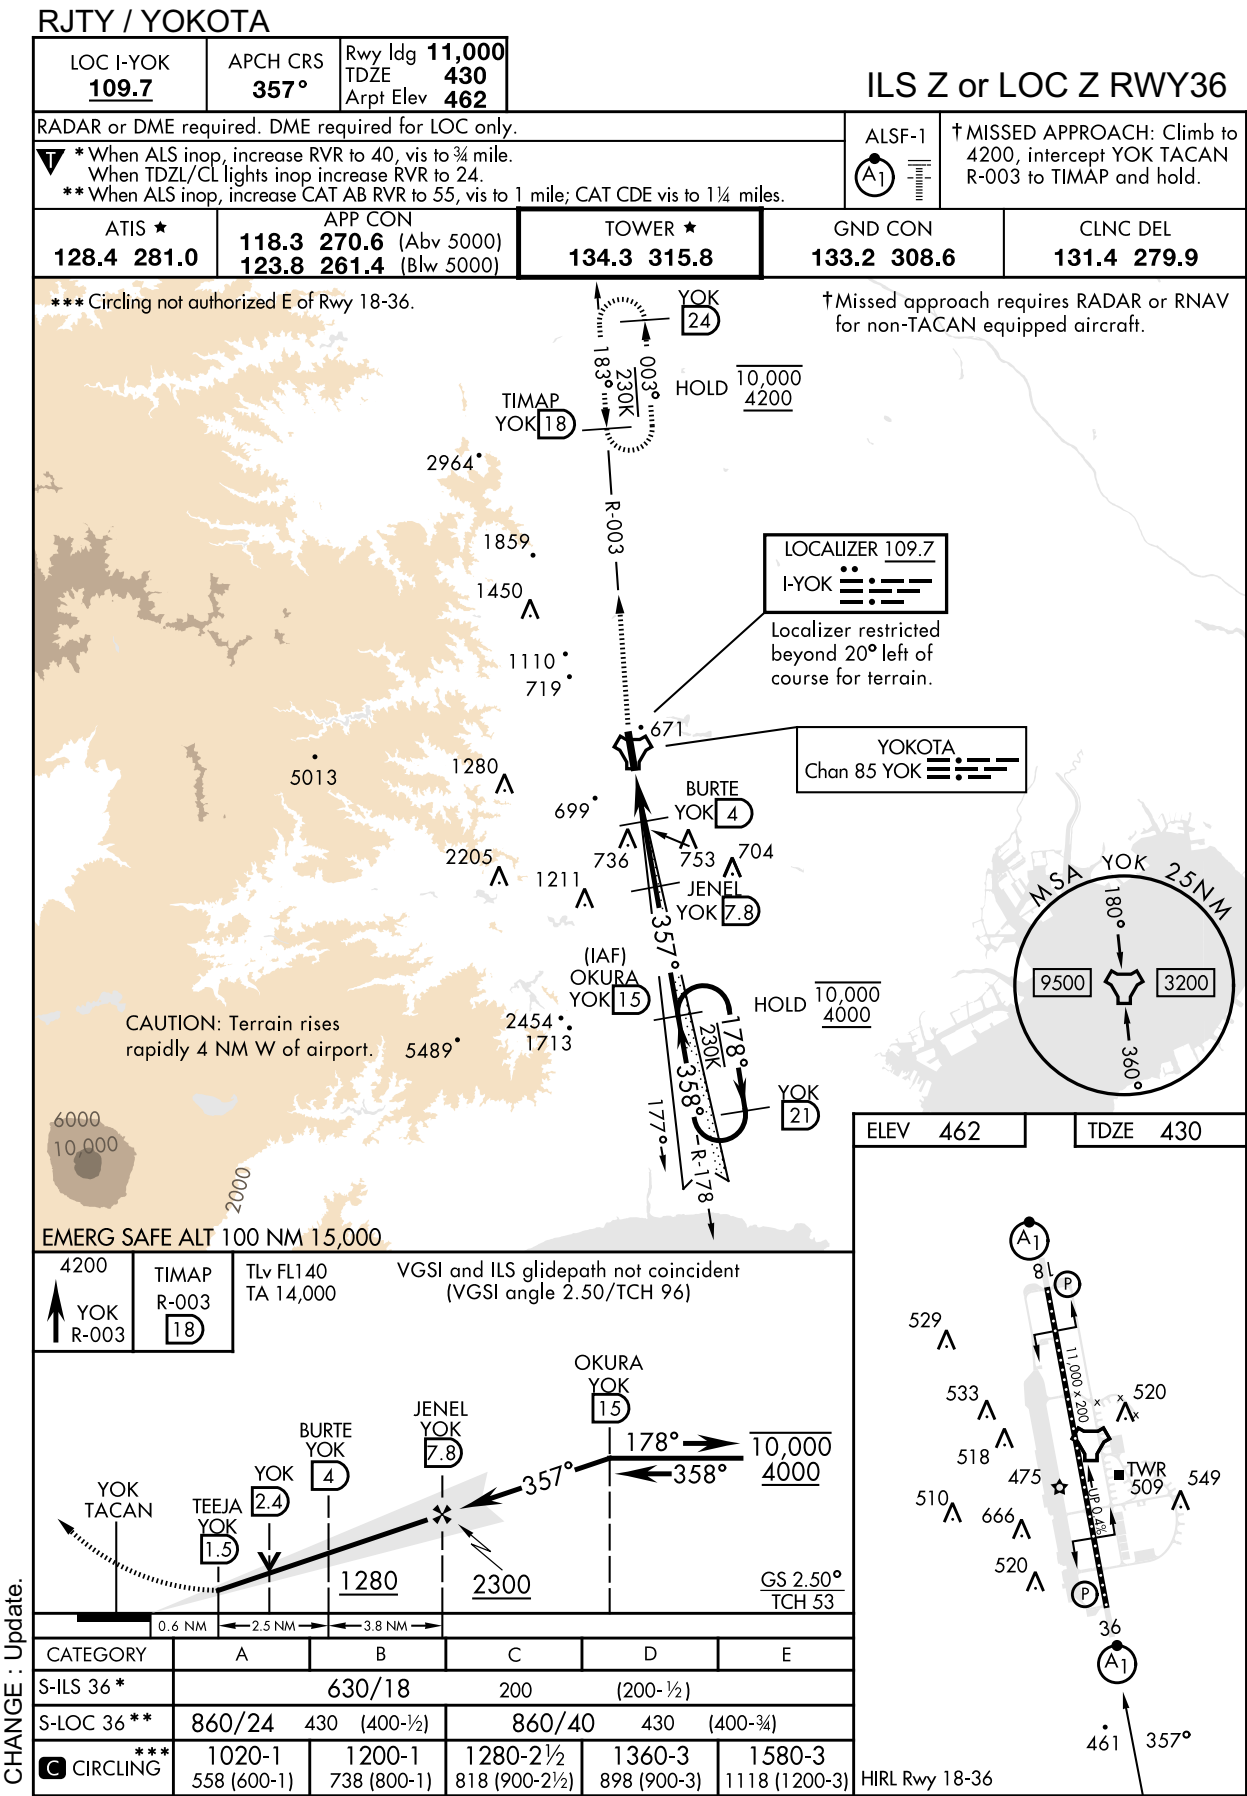

RJTY / YOKOTA

RNAV(GPS)RWY18

CHANGE : Update.

NOTE: REPRINTING DOD FLIP

INSTRUMENT APPROACH CHART


RJTY / YOKOTA

APCH CRS 357°	Rwy Idg 11,000
	TDZE 430
	Arpt Elev 462

RNAV(GPS)RWY36

▽ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CD vis to 1 3/8 miles. ** Circling not authorized East of Rwy 18-36.	ALSIF-1 	MISSED APPROACH: Climb to 4200 direct BODAI and hold.
---	--	--

ATIS★ 128.4 281.0	APP CON 118.3 270.6 (ABV 5000MSL) 123.8 261.4 (BLW 5000MSL)	TOWER★ 134.3 315.8	GND CON 133.2 308.6	CLNC DEL 131.4 279.9
-------------------------------------	--	--------------------------------------	---------------------------------------	--

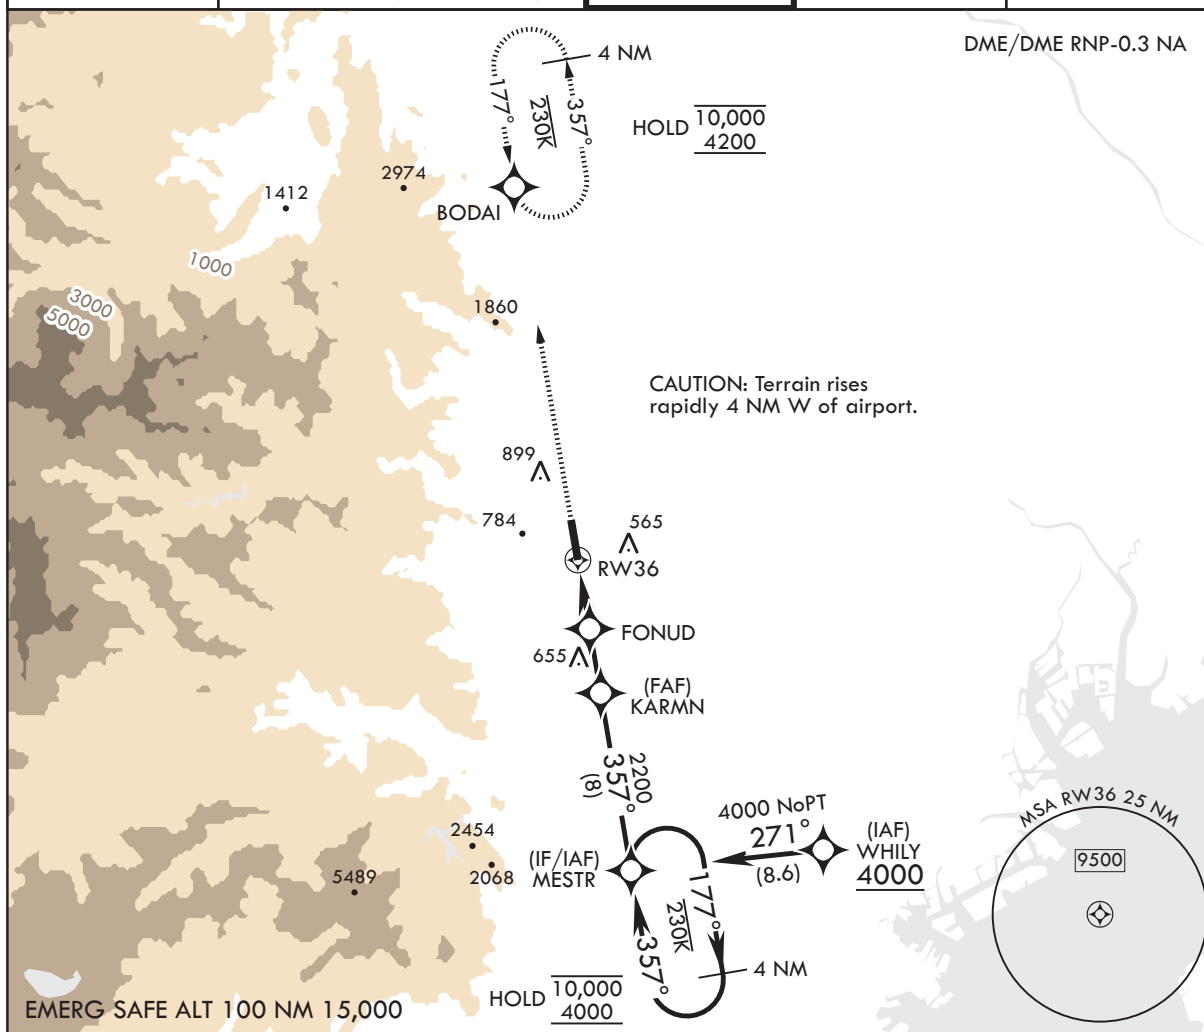

4200 BODAI  TLv FL140 TA 14,000	VGSI and descent angles not not coincident (VGSI Angle 2.50/TCH 96).	4 NM Holding Pattern MESTR 177° → 10,000 ← 357° 4000	ELEV 462 	TDZE 430
RWY36 1.5 NM to RWY36 3.1 NM 2.9 NM	FONUD 2200 1360	KARMN 2200	529 533 518 510 475 666 666 520 36 357°	520 509 549
CATEGORY	A	B	C	D
LNAV MDA*	900/24 470 (500-1/2)	900/50 470 (500-1)	900/50 470 (500-1)	900/50 470 (500-1)
 CIRCLING**	1020-1 558 (600-1)	1200-1 738 (800-1)	1280-2 1/2 818 (900-2 1/2)	1360-3 898 (900-3)

CHANGE : Update.

NOTE: REPRINTING DOD FLIP