

B - B O X 製 品 検 査 表

No. 1 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
①-1	K-1CX5Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合		
実測値	950	949	951	951	952	952	953	952	-0.5	0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	0	-1	+1	+1	+2	+2	+3	+2	-0.5	0	1.5						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
①-2	K-1CX10Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合		
実測値	951	950	951	950	951	951	950	949	+1.0	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	+1	0	+1	0	+1	+1	0	-1	+1.0	+1.0	0.5						

B - B O X 製品検査表

No. 2 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番		柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9	
②	K-1CX7Y14					設計値	7,003.0	設計値	1,253.0	2,257.0								
						実測値	7,005.0	実測値	1,253.0	2,255.0								
						許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003						差	+2.0	差	0	-2.0								
	断 面 寸 法									曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚													
	N	S	E	W	N	S	E	W	E面	S面	δ							
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合		9/2	
実測値	950	950	952	951	949	949	952	950	+1.5	-1.0	1.0							
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0							
差	0	0	+2	+1	-1	-1	+2	0	+1.5	-1.0	1.0							
品番		柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9	
③-1	K-1CX8Y14					設計値	7,003.0	設計値	1,253.0	2,257.0								
						実測値	7,006.0	実測値	1,253.0	2,255.0								
						許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 40 / 40 × 7,003						差	+3.0	差	0	-2.0								
	断 面 寸 法									曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚													
	N	S	E	W	N	S	E	W	E面	S面	δ							
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合		9/2	
実測値	950	951	951	950	949	951	951	951	+1.5	-1.5	3.5							
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0							
差	0	+1	+1	0	-1	+1	+1	+1	+1.5	-1.5	3.5							

B - B O X 製品検査表

No. 3 / 19

受注No. : 25-1050

工事名：八重洲二丁目中地区再開発事業新築工事(1節)

持込先： 株式会社 北川組鉄工所

品番		柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9	
③-2	K-1CX9Y14					設計値	7,003.0	設計値	1,253.0	2,257.0								
						実測値	7,006.0	実測値	1,254.0	2,256.0								
						許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 40 / 40 × 7,003						差	+3.0	差	+1.0	-1.0								
	断 面 寸 法									曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚													
	N	S	E	W	N	S	E	W	E面	S面	δ							
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合		9/5	
実測値	949	951	951	950	950	951	952	951	-0.5	-1.0	0.5							
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0							
差	-1	+1	+1	0	0	+1	+2	+1	-0.5	-1.0	0.5							
品番		柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9	
④	K-1CX4Y11					設計値	7,003.0	設計値	1,253.0	2,257.0								
						実測値	7,006.0	実測値	1,253.0	2,256.0								
						許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003						差	+3.0	差	0	-1.0								
	断 面 寸 法									曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚													
	N	S	E	W	N	S	E	W	E面	S面	δ							
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合		9/3	
実測値	899	899	901	900	899	898	901	901	+1.5	-0.5	3.0							
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0							
差	-1	-1	+1	0	-1	-2	+1	+1	+1.5	-0.5	3.0							

B - B O X 製品検査表

No. 4 / 19

受注No. : 25-1050

工事名：八重洲二丁目中地区再開発事業新築工事(1節)

持込先： 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑤-1	K-1CX4Y12				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003					差	+3.0	差	0	0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合	8/28	
実測値	901	898	901	900	899	901	901	902	+1.0	+0.5	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	+1	-2	+1	0	-1	+1	+1	+2	+1.0	+0.5	1.0						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑤-2	K-1CX4Y13A				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,005.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003					差	+2.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合	9/4	
実測値	898	901	899	900	899	901	901	901	+0.5	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	-2	+1	-1	0	-1	+1	+1	+1	+0.5	+1.0	0.5						

B - B O X 製品検査表

No. 5 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先：株式会社 北川組鉄工所

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑥	K-1CX2Y12				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	7/31	
実測値	800	801	800	801	799	801	801	801	-1.0	-2.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+1	0	+1	-1	+1	+1	+1	-1.0	-2.0	1.0						
品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑦	K-1CX3Y12				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,994.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+1.0	差	0	0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	7/31	
実測値	800	799	801	800	800	800	801	801	-1.0	+1.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-1	+1	0	0	0	+1	+1	-1.0	+1.0	1.0						

B - B O X 製品検査表




No. 1 / 19

受注No. :	25-1050
---------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

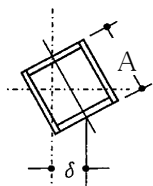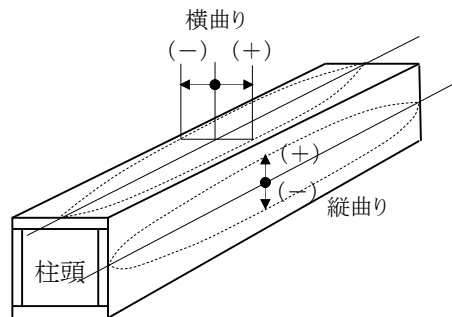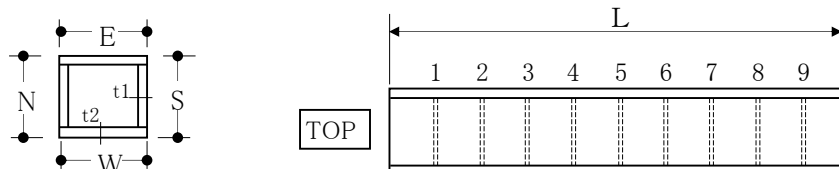

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)


品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
①-1	K-1CX5Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合	9/4	
実測値	950	949	951	951	952	952	953	952	-0.5	0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	0	-1	+1	+1	+2	+2	+3	+2	-0.5	0	1.5						

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
①-2	K-1CX10Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合	9/2	
実測値	951	950	951	950	951	951	950	949	+1.0	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	+1	0	+1	0	+1	+1	0	-1	+1.0	+1.0	0.5						




No. 2 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

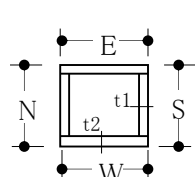

[TOP](#)

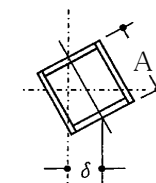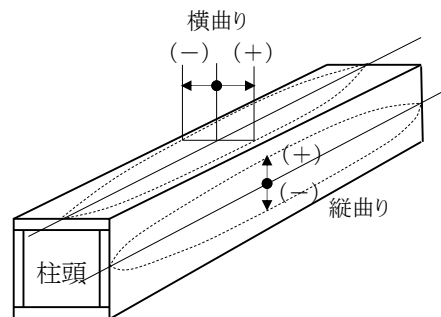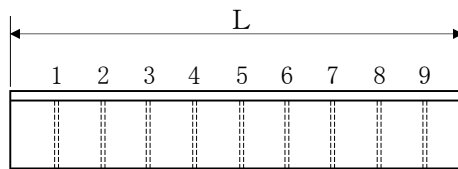

承認	検査
後藤	井上

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)




品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
②	K-1CX7Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,005.0	実測値	1,253.0	2,255.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 50 / 50 × 7,003					差	+2.0	差	0	-2.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合	9/2	
実測値	950	950	952	951	949	949	952	950	+1.5	-1.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	0	0	+2	+1	-1	-1	+2	0	+1.5	-1.0	1.0						

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
③-1	K-1CX8Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,255.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 40 / 40 × 7,003					差	+3.0	差	0	-2.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合	9/2	
実測値	950	951	951	950	949	951	951	951	+1.5	-1.5	3.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	0	+1	+1	0	-1	+1	+1	+1	+1.5	-1.5	3.5						

No. 3 / 19

持込先：株式会社 北川組鉄工所

神栄鉄鋼株式会社

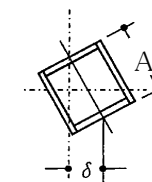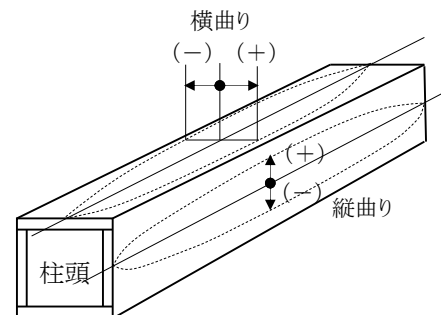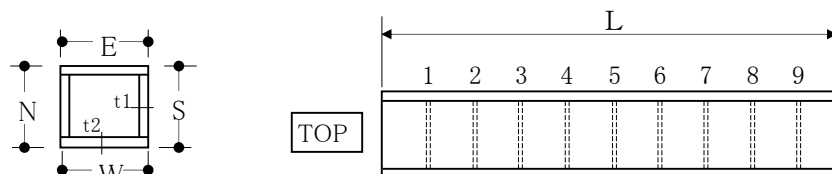

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)




品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
③-2	K-1CX9Y14				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 950 × 950 × 40 / 40 × 7,003					差	+3.0	差	+1.0	-1.0								
	断面寸法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱頭				柱脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	950	950	950	950	950	950	950	950	0	0	0	適	適	適	合	9/5	
実測値	949	951	951	950	950	951	952	951	-0.5	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	-1	+1	+1	0	0	+1	+2	+1	-0.5	-1.0	0.5						

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
④	K-1CX4Y11				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003					差	+3.0	差	0	-1.0								
	断面寸法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱頭				柱脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合	9/3	
実測値	899	899	901	900	899	898	901	901	+1.5	-0.5	3.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	-1	-1	+1	0	-1	-2	+1	+1	+1.5	-0.5	3.0						

No. 4 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

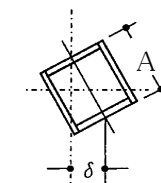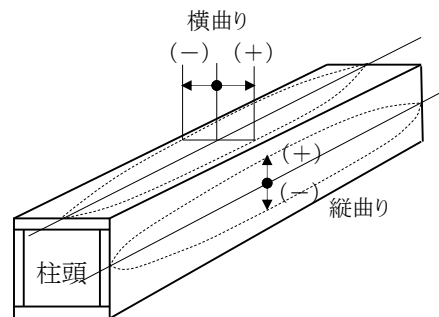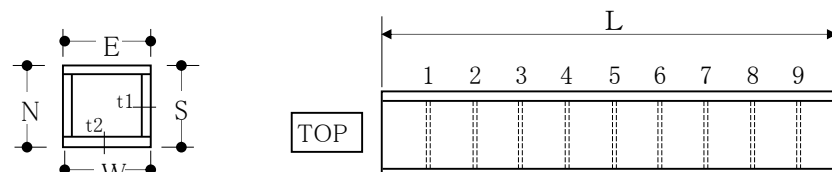




(単位:mm)

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑤-1	K-1CX4Y12				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003					差	+3.0	差	0	0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合	8/28	
実測値	901	898	901	900	899	901	901	902	+1.0	+0.5	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	+1	-2	+1	0	-1	+1	+1	+2	+1.0	+0.5	1.0						
品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑤-2	K-1CX4Y13A				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,005.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 900 × 900 × 45 / 45 × 7,003					差	+2.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	900	900	900	900	900	900	900	900	0	0	0	適	適	適	合	9/4	
実測値	898	901	899	900	899	901	901	901	+0.5	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	5.0						
差	-2	+1	-1	0	-1	+1	+1	+1	+0.5	+1.0	0.5						

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

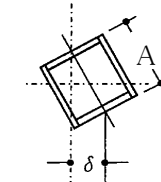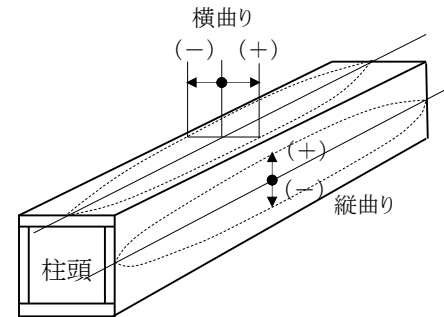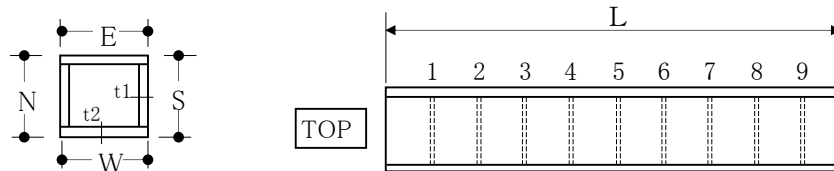

神栄鉄鋼株式会社

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑥	K-1CX2Y12				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
					差	+2.0	差	+1.0	-1.0								
□ 800 × 800 × 40 / 40 × 6,993																	
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0						
実測値	800	801	800	801	799	801	801	801	-1.0	-2.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+1	0	+1	-1	+1	+1	+1	-1.0	-2.0	1.0						

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑦	K-1CX3Y12				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,994.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
					差	+1.0	差	0	0								
□ 800 × 800 × 40 / 40 × 6,993																	
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0						
実測値	800	799	801	800	800	800	801	801	-1.0	+1.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-1	+1	0	0	0	+1	+1	-1.0	+1.0	1.0						

B - B O X 製 品 検 査 表




No. 1 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

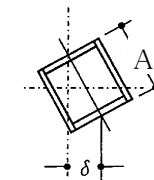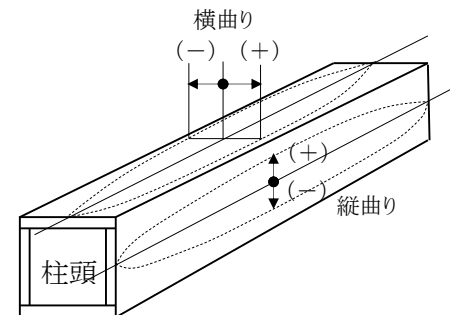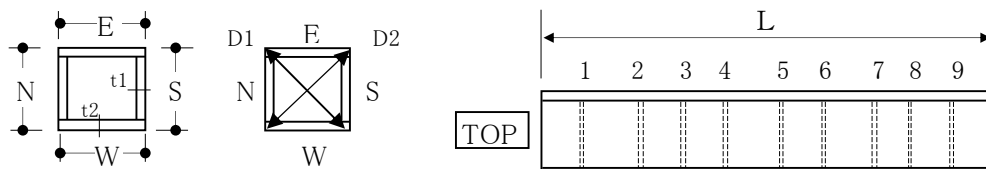

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)



品番		柱マーク			全長		ダイアフラム位置（累積）													
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9				
①-1	K-1CX5Y14				設計値	7,003.0	設計値	1,253.0	2,257.0											
					実測値	7,006.0	実測値	1,254.0	2,256.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	+1.0	-1.0											
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適	適	合	9/4
設計値	950	950	950	950	950	950	950	950	1344	1344	1202	1202	0	0	0	適				
実測値	950	949	951	951	952	952	953	952					-0.5	0	1.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0					
差	0	-1	+1	+1	+2	+2	+3	+2					-0.5	0	1.5					
品番		柱マーク			全長		ダイアフラム位置（累積）													
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9				
①-2	K-1CX10Y14				設計値	7,003.0	設計値	1,253.0	2,257.0											
					実測値	7,006.0	実測値	1,253.0	2,256.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 950 × 950 × 50 / 50 × 7,003					差	+3.0	差	0	-1.0											
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質 <td rowspan="4">適</td> <td rowspan="4">適</td> <td rowspan="4">合</td> <td rowspan="4">9/2</td>	適	適	合	9/2
設計値	950	950	950	950	950	950	950	950	1344	1344	1202	1202	0	0	0	適				
実測値	951	950	951	950	951	951	950	949					+1.0	+1.0	0.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0					
差	+1	0	+1	0	+1	+1	0	-1					+1.0	+1.0	0.5					

受注No. :	25-1050
---------	---------

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

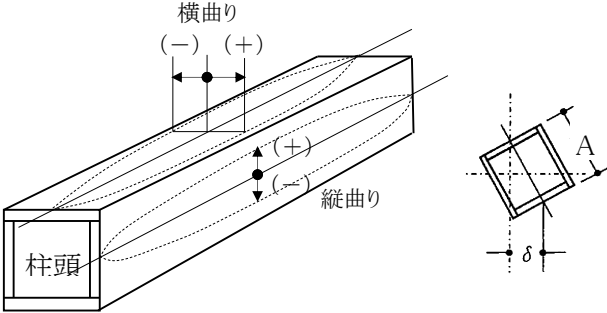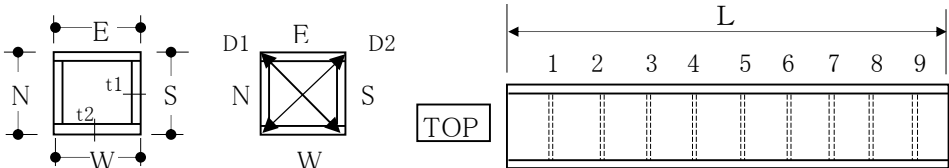

承認	検査

対角寸法
(断面寸法) (開先有のときは内寸法) (全長・ダイヤフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイヤフラム位置（ 累積 ）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
②	K-1CX7Y14	設計値	7,003.0	設計値	1,253.0	2,257.0							
		実測値	7,005.0	実測値	1,253.0	2,255.0							
		許容値	±3.0	許容値	±3.0	±3.0							
□	950 × 950 × 50 / 50 × 7,003	差	+2.0	差	0	-2.0							

	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部 開先 加工	端部 直角度	外観 検査	検査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	合否			
設計値	950	950	950	950	950	950	950	950	1344	1344	1202	1202	0	0	0	適	適	適	適	9/2
実測値	950	950	952	951	949	949	952	950					+1.5	-1.00	1.0	適			合	
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0	適				
差	0	0	+2	+1	-1	-1	+2	0					+1.5	-1.0	1.0					

品番	柱マーク	全長		ダイアフラム位置（ 累積 ）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
③-1	K-1CX8Y14	設計値	7,003.0	設計値	1,253.0	2,257.0							
		実測値	7,006.0	実測値	1,253.0	2,255.0							
		許容値	±3.0	許容値	±3.0	±3.0							
□ 950 × 950 × 40 / 40 × 7,003		差	+3.0	差	0	-2.0							

	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部 開先 加工	端部 直角度	外観 検査 可否	検査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	950	950	950	950	950	950	950	950	1344	1344	1230	1230	0	0	0	適	適	適	9/2	
実測値	950	951	951	950	949	951	951	951					+1.5	-1.50	3.5					合
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0	適				
差	0	+1	+1	0	-1	+1	+1	+1					+1.5	-1.5	3.5					

B - B O X 製 品 検 査 表




No. 3 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

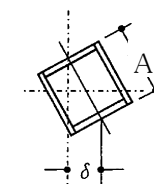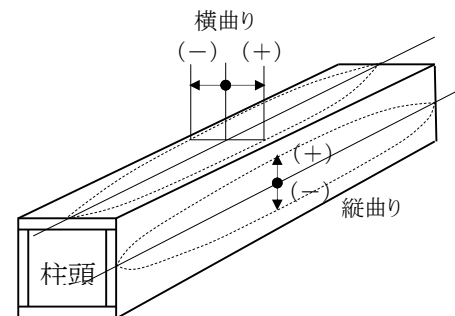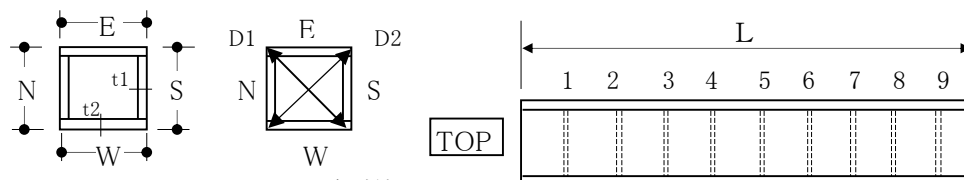

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番		柱マーク		全長		ダイアフラム位置（累積）										対角寸法		曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
寸法：W × F × t1 / t2 × L				L			1	2	3	4	5	6	7	8	9			E面	S面	δ	材質			適合	
③-2	K-1CX9Y14	設計値	7,003.0	設計値	1,253.0	2,257.0												0	0	0	適	適	適	合	9/5
		実測値	7,006.0	実測値	1,254.0	2,256.0												-0.5	-1.0	0.5	適				
		許容値	±3.0	許容値	±3.0	±3.0												±4.5	±4.5	5.0	適				
		差	+3.0	差	+1.0	-1.0											-0.5	-1.0	0.5						
□ 950 × 950 × 40 / 40 × 7,003				断面寸法		柱頭		柱脚		柱頭		柱脚		曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日				
				N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			適合			
設計値	950	950	950	950	950	950	950	950	1344	1344	1230	1230	0	0	0	適			適						
実測値	949	951	951	950	950	951	952	951					-0.5	-1.0	0.5	適			合						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0	適									
差	-1	+1	+1	0	0	+1	+2	+1					-0.5	-1.0	0.5										

品番		柱マーク		全長		ダイアフラム位置（累積）										対角寸法		曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
寸法：W × F × t1 / t2 × L				L			1	2	3	4	5	6	7	8	9			E面	S面	δ	材質			適合	
④	K-1CX4Y11	設計値	7,003.0	設計値	1,253.0	2,257.0												0	0	0	適	適	適	合	9/3
		実測値	7,006.0	実測値	1,253.0	2,256.0												+1.5	-0.5	3.0	適				
		許容値	±3.0	許容値	±3.0	±3.0												±4.5	±4.5	5.0	適				
		差	+3.0	差	0	-1.0											+1.5	-0.5	3.0						
□ 900 × 900 × 45 / 45 × 7,003				断面寸法		柱頭		柱脚		柱頭		柱脚		曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日				
				N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			適合			
設計値	900	900	900	900	900	900	900	900	1273	1273	1146	1146	0	0	0	適			適						
実測値	899	899	901	900	899	898	901	901					+1.5	-0.5	3.0	適			合						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0	適									
差	-1	-1	+1	0	-1	-2	+1	+1					+1.5	-0.5	3.0										

B - B O X 製 品 検 査 表



No. 4 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

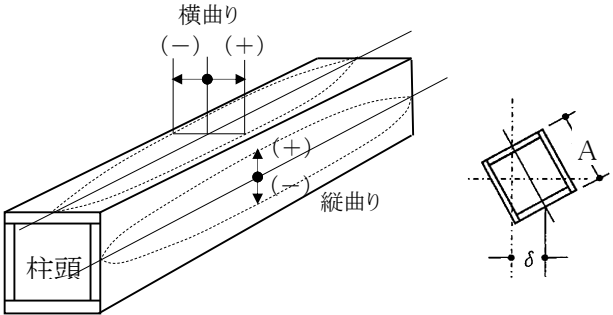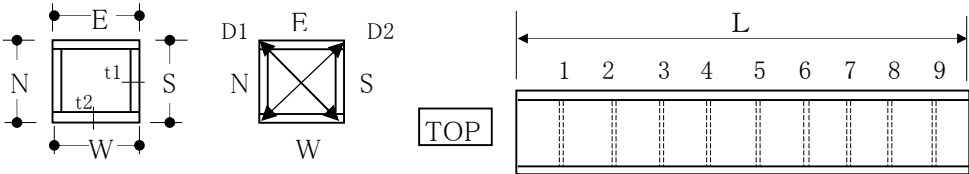

承認	検査

対角寸法 (断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番		柱マーク			全長		ダイアフラム位置（累積）													
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑤-1	K-1CX4Y12				設計値	7,003.0	設計値	1,253.0	2,257.0											
					実測値	7,006.0	実測値	1,253.0	2,257.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 900 × 900 × 45 / 45 × 7,003					差	+3.0	差	0	0											
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適合	検査日		
設計値	900	900	900	900	900	900	900	900	1273	1273	1146	1146	0	0	0	適	適	適	8/28	
実測値	901	898	901	900	899	901	901	902					+1.0	+0.5	1.0					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0					
差	+1	-2	+1	0	-1	+1	+1	+2					+1.0	+0.5	1.0	適				
品番		柱マーク			全長		ダイアフラム位置（累積）													
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑤-2	K-1CX4Y13A				設計値	7,003.0	設計値	1,253.0	2,257.0											
					実測値	7,005.0	実測値	1,253.0	2,256.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 900 × 900 × 45 / 45 × 7,003					差	+2.0	差	0	-1.0											
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適合	検査日		
設計値	900	900	900	900	900	900	900	900	1273	1273	1146	1146	0	0	0	適	適	適	9/4	
実測値	898	901	899	900	899	901	901	901					+0.5	+1.0	0.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	5.0					
差	-2	+1	-1	0	-1	+1	+1	+1					+0.5	+1.0	0.5	適				

B - B O X 製 品 検 査 表





No. 5 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

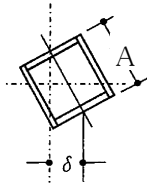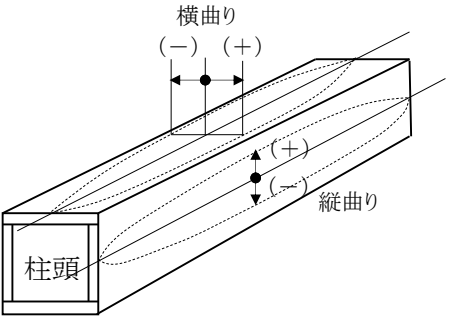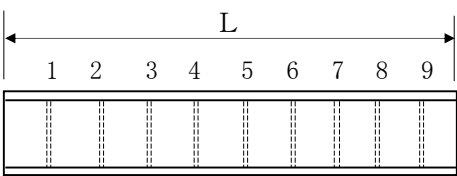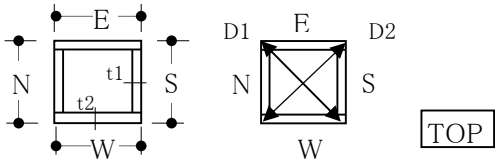

承認	検査

対角寸法				(断面寸法)				(開先有のときは内寸法)				(全長・ダイアフラム位置)				(曲 り)				(ねじれ)				(単位 mm)							
品番		柱マーク				全長				ダイアフラム位置 (累積)																					
寸法 : W × F × t1 / t2 × L						L						1		2		3		4		5		6		7		8		9			
⑥	K-1CX2Y12					設計値		6,993.0		設計値		1,253.0		2,257.0																	
						実測値		6,995.0		実測値		1,254.0		2,256.0																	
						許容値		±3.0		許容値		±3.0		±3.0																	
□ 800 × 800 × 40 / 40 × 6,993						差		+2.0		差		+1.0		-1.0																	
		断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査 合否	検 査 日										
		柱 頭				柱 脚				柱頭		柱脚																			
		N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面							δ	材質								
設計値		800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	7/31												
実測値		800	801	800	801	799	801	801	801					-1.0	-2.0	1.0															
許容値		±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5															
差		0	+1	0	+1	-1	+1	+1	+1					-1.0	-2.0	1.0	適														
品番		柱マーク				全長				ダイアフラム位置 (累積)																					
寸法 : W × F × t1 / t2 × L						L						1		2		3		4		5		6		7		8		9			
⑦	K-1CX3Y12					設計値		6,993.0		設計値		1,253.0		2,257.0																	
						実測値		6,994.0		実測値		1,253.0		2,257.0																	
						許容値		±3.0		許容値		±3.0		±3.0																	
□ 800 × 800 × 40 / 40 × 6,993						差		+1.0		差		0		0																	
		断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査 合否	検 査 日										
		柱 頭				柱 脚				柱頭		柱脚																			
		N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面							δ	材質								
設計値		800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	7/31												
実測値		800	799	801	800	800	800	801	801					-1.0	+1.0	1.0															
許容値		±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5															
差		0	-1	+1	0	0	0	+1	+1					-1.0	+1.0	1.0	適														

B - B O X 製 品 檢 查 表

No. 6 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑧-1	K-1CX1Y11				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0							
					実測値	6,996.0	実測値	680.0	1,253.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	0	-1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/21	
実測値	800	800	801	801	800	800	801	801	0	0	2.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	0	0	+1	+1	0	0	2.5						

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑧-2	K-1CX1Y12				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0							
					実測値	6,995.0	実測値	679.0	1,253.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/2	
実測値	800	800	801	800	800	799	800	800	0	+0.5	3.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	0	0	-1	0	0	0	+0.5	3.0						

B - B O X 製 品 檢 查 表

No. 7 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先：株式会社 北川組鉄工所

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑨	K-1CX1Y15				設計値	6,993.0	設計値	1,253.0	2,057.0	2,257.0	2,656.0	2,910.0					
					実測値	6,996.0	実測値	1,253.0	2,057.0	2,257.0	2,657.0	2,912.0					
					許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0	±3.0					
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0	0	+1.0	+2.0					
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/25	
実測値	801	801	800	801	800	800	801	802	+1.5	-0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	+1	0	+1	0	0	+1	+2	+1.5	-0.5	0.5						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑩	K-1CX2Y15				設計値	6,993.0	設計値	1,253.0	1,845.0	2,257.0							
					実測値	6,995.0	実測値	1,253.0	1,844.5	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	-0.5	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	800	801	800	799	799	800	800	-1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	+1	0	-1	-1	0	0	-1.0	-1.0	0.5						

B - B O X 製 品 檢 查 表

No.8 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊦-1	K-1CX1Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	800	800	800	802	801	799	801	801	-0.5	0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	0	+2	+1	-1	+1	+1	-0.5	0	1.0						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊦-2	K-1CX1Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,254.0	2,256.5								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	-0.5								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	798	801	800	799	798	801	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-2	+1	0	-1	-2	+1	+1	+1.0	-1.0	0.5						

B - B O X 製 品 檢 查 表

No.9 / 19

受注No. : 25-1050

工事名：八重洲二丁目中地区再開発事業新築工事(1節)

持込先：株式会社 北川組鉄工所

品番	柱マーク				全長		ダイアフラム位置（ 累積 ）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑪-3	K-1CX3Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/21	
実測値	800	801	800	800	800	800	801	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+1	0	0	0	0	+1	+1	+1.0	-1.0	0.5						
品番	柱マーク				全長		ダイアフラム位置（ 累積 ）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑫	K-1CX2Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	799	800	800	800	799	800	801	802	+1.0	-1.0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	0	0	-1	0	+1	+2	+1.0	-1.0	1.5						

B - B O X 製 品 檢 查 表

No. 10 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先：株式会社 北川組鉄工所



品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑬-1	K-1CX2Y11				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	800	801	801	799	800	802	800	-1.0	0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	+1	+1	-1	0	+2	0	-1.0	0	1.0						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑬-2	K-1CX2Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	801	801	800	799	801	801	-0.5	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	0	-1	+1	+1	-0.5	+0.5	0.5						

No. 6 / 19

持込先 : 株式会社 北川組鉄工所

A diagram of a rectangular plate with width A and thickness δ . The plate is tilted at an angle relative to a horizontal dashed line. A vertical dashed line passes through the center of the plate. The thickness δ is indicated by a dimension line at the bottom, and the width A is indicated by a dimension line on the right side.

承認	検査
後藤	井上

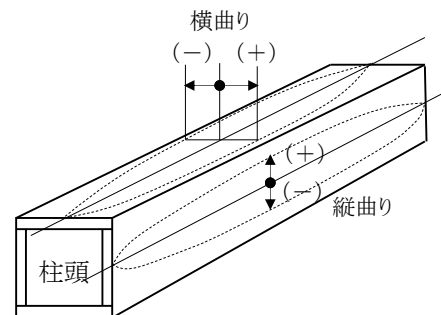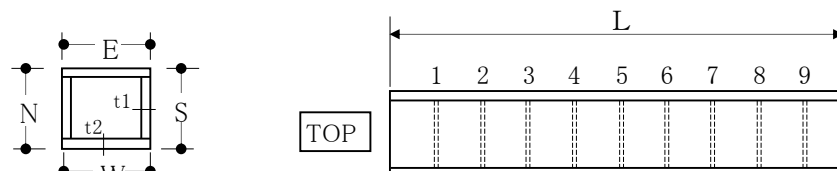

(单位:mm)

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑧-1	K-1CX1Y11				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0							
					実測値	6,996.0	実測値	680.0	1,253.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	0	-1.0							
	断面寸法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱頭				柱脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/21	
実測値	800	800	801	801	800	800	801	801	0	0	2.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	0	0	+1	+1	0	0	2.5						

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑧-2	K-1CX1Y12				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0							
					実測値	6,995.0	実測値	679.0	1,253.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	0	0							
	断面寸法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱頭				柱脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/2	
実測値	800	800	801	800	800	799	800	800	0	+0.5	3.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	0	0	-1	0	0	0	+0.5	3.0						

B - B O X 製品検査表




No. 7 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

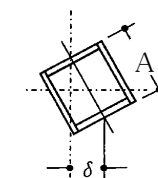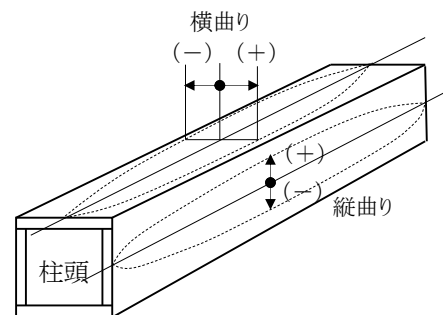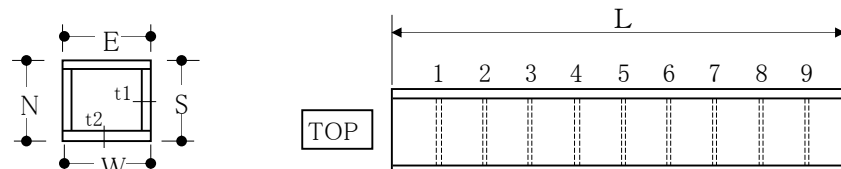





(断面寸法)					(全長・ダイアフラム位置)				(曲がり)			(ねじれ)				(単位:mm)	
品番	柱マーク				全長		ダイアフラム位置 (累積)										
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑨	K-1CX1Y15				設計値	6,993.0	設計値	1,253.0	2,057.0	2,257.0	2,656.0	2,910.0					
					実測値	6,996.0	実測値	1,253.0	2,057.0	2,257.0	2,657.0	2,912.0					
					許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0	±3.0					
□	800 ×	800 ×	40 /	40 ×	6,993	差	+3.0	差	0	0	0	+1.0	+2.0				
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/25	
実測値	801	801	800	801	800	800	801	802	+1.5	-0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	+1	0	+1	0	0	+1	+2	+1.5	-0.5	0.5						
品番	柱マーク				全長		ダイアフラム位置 (累積)										
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑩	K-1CX2Y15				設計値	6,993.0	設計値	1,253.0	1,845.0	2,257.0							
					実測値	6,995.0	実測値	1,253.0	1,844.5	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□	800 ×	800 ×	40 /	40 ×	6,993	差	+2.0	差	0	-0.5	0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	800	801	800	799	799	800	800	-1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	+1	0	-1	-1	0	0	-1.0	-1.0	0.5						

受注No. :	25-1050
---------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

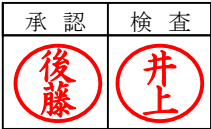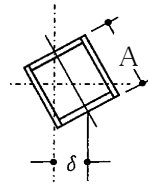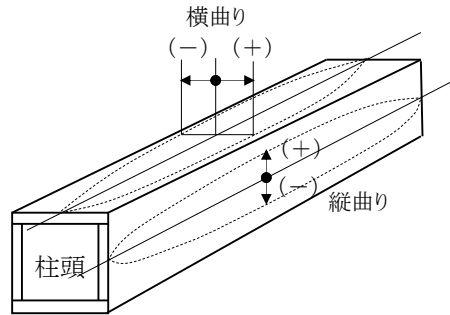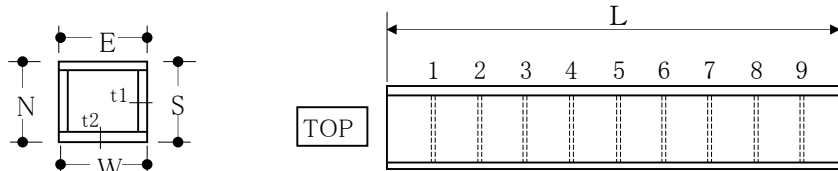

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(单位:mm)




品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑪-1	K-1CX1Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	800	800	800	802	801	799	801	801	-0.5	0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	0	+2	+1	-1	+1	+1	-0.5	0	1.0						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑪-2	K-1CX1Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,254.0	2,256.5								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	-0.5								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	798	801	800	799	798	801	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-2	+1	0	-1	-2	+1	+1	+1.0	-1.0	0.5						

受注No. :	25-1050
---------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

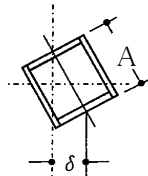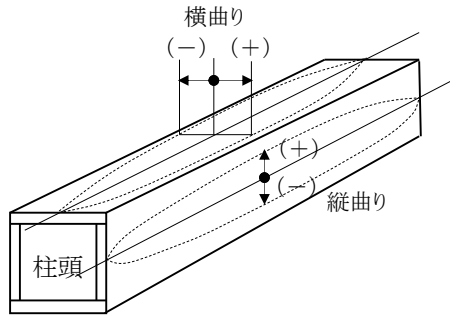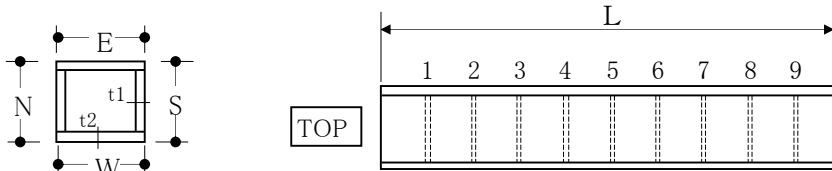

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)





(单位:mm)

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑪-3	K-1CX3Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/21	
実測値	800	801	800	800	800	800	801	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+1	0	0	0	0	+1	+1	+1.0	-1.0	0.5						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑫	K-1CX2Y14				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,995.0	実測値	1,254.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	+1.0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	799	800	800	800	799	800	801	802	+1.0	-1.0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	0	0	-1	0	+1	+2	+1.0	-1.0	1.5						

No. 10 / 19

持込先：株式会社 北川組鉄工所

神栄鉄鋼株式会社

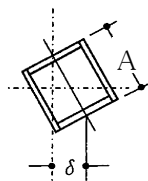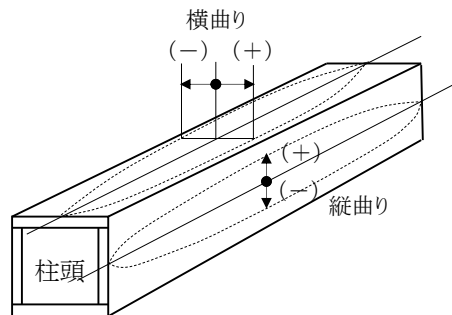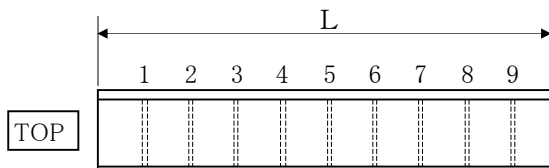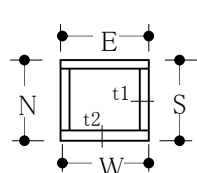

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-1	K-1CX2Y11				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	800	801	801	799	800	802	800	-1.0	0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	+1	+1	-1	0	+2	0	-1.0	0	1.0						

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-2	K-1CX2Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	可否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	801	801	800	799	801	801	-0.5	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	0	-1	+1	+1	-0.5	+0.5	0.5						

B - B O X 製 品 検 査 表




No. 6 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

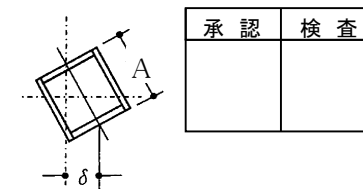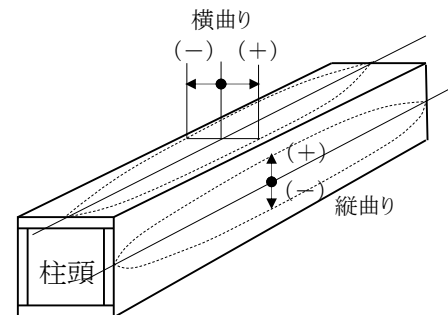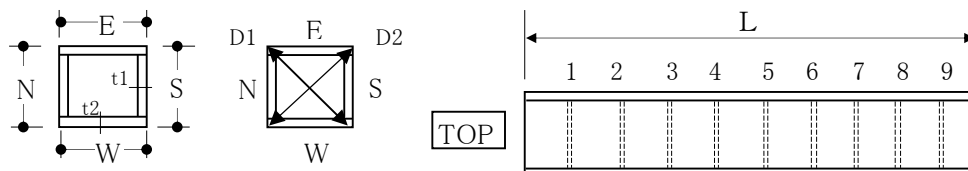

対角寸法 (断面寸法) (開先有のときは内寸法)				(全長・ダイアフラム位置)				(曲 り)				(ねじれ)				(単位 mm)				
品番	柱マーク				全長		ダイアフラム位置 (累積)													
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑧-1	K-1CX1Y11				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0										
					実測値	6,996.0	実測値	680.0	1,253.0	2,256.0										
					許容値	±3.0	許容値	±3.0	±3.0	±3.0										
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	0	-1.0										
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直 角 度	外観 検査	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/21
実測値	800	800	801	801	800	800	801	801					0	0	2.5	適				
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	0	0	+1	+1	0	0	+1	+1					0	0	2.5					
品番	柱マーク				全長		ダイアフラム位置 (累積)													
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑧-2	K-1CX1Y12				設計値	6,993.0	設計値	679.0	1,253.0	2,257.0										
					実測値	6,995.0	実測値	679.0	1,253.0	2,257.0										
					許容値	±3.0	許容値	±3.0	±3.0	±3.0										
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	0	0										
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直 角 度	外観 検査	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/2
実測値	800	800	801	800	800	799	800	800					0	+0.5	3.0	適				
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	0	0	+1	0	0	-1	0	0					0	+0.5	3.0					

B - B O X 製 品 検 査 表




No. 7 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

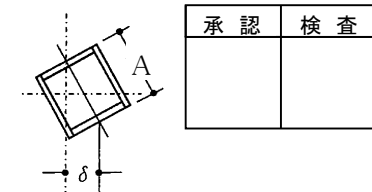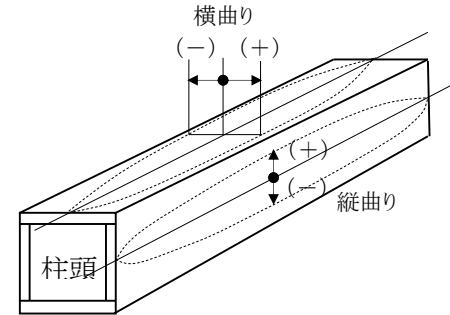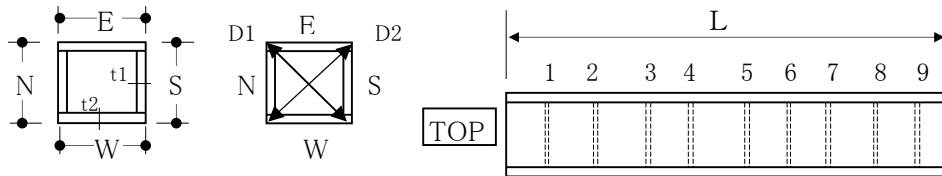

承認	検査




(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク				全長		ダイアフラム位置（累積）																											
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9																		
⑨	K-1CX1Y15				設計値	6,993.0	設計値	1,253.0	2,057.0	2,257.0	2,656.0	2,910.0																						
					実測値	6,996.0	実測値	1,253.0	2,057.0	2,257.0	2,657.0	2,912.0																						
					許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0	±3.0																						
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0	0	+1.0	+2.0																						
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日														
	柱 頭				柱 脚				柱頭		柱脚																							
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			合否															
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	適	適	適	適	適	8/25									
実測値	801	801	800	801	800	800	801	802					+1.5	-0.5	0.5																			
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5																			
差	+1	+1	0	+1	0	0	+1	+2					+1.5	-0.5	0.5																			
品番	柱マーク				全長		ダイアフラム位置（累積）																											
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9																		
⑩	K-1CX2Y15				設計値	6,993.0	設計値	1,253.0	1,845.0	2,257.0																								
					実測値	6,995.0	実測値	1,253.0	1,844.5	2,257.0																								
					許容値	±3.0	許容値	±3.0	±3.0	±3.0																								
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	-0.5	0																								
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日														
	柱 頭				柱 脚				柱頭		柱脚																							
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			合否															
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	適	適	適	適	8/22										
実測値	799	800	801	800	799	799	800	800					-1.0	-1.0	0.5																			
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5																			
差	-1	0	+1	0	-1	-1	0	0					-1.0	-1.0	0.5																			

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

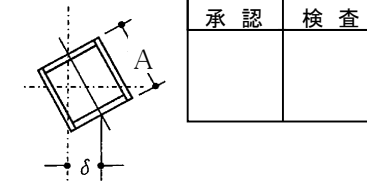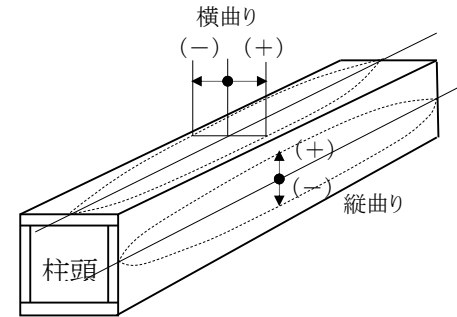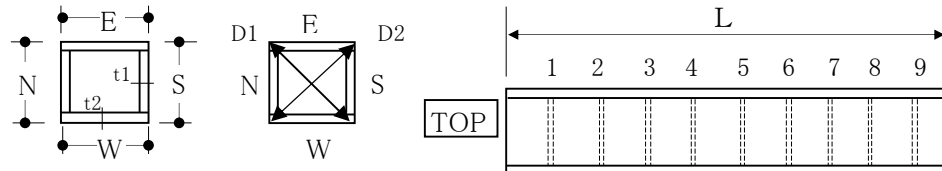

神栄鉄鋼株式会社

(断面寸法) (開先有のときは内寸法)

(全長・ダイアフラム位置)

(曲 り)

(ねじれ)

(単位 mm)

品番	柱マーク	全長		ダイアフラム位置（累積）																	
寸法：W×F×t1/t2×L				L			1	2	3	4	5	6	7	8	9						
⑪-1	K-1CX1Y13	設計値	6,993.0	設計値	1,253.0	2,257.0															
		実測値	6,995.0	実測値	1,253.0	2,256.0															
		許容値	±3.0	許容値	±3.0	±3.0															
		差	+2.0	差	0	-1.0															
□ 800 × 800 × 40 / 40 × 6,993																					
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日	
	柱 頭				柱 脚				柱頭		柱脚										
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			合否		
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/20	
実測値	800	800	800	802	801	799	801	801					-0.5	0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適					
差	0	0	0	+2	+1	-1	+1	+1					-0.5	0	1.0						
品番	柱マーク	全長		ダイアフラム位置（累積）																	
寸法：W×F×t1/t2×L				L			1	2	3	4	5	6	7	8	9						
⑪-2	K-1CX1Y14	設計値	6,993.0	設計値	1,253.0	2,257.0															
		実測値	6,996.0	実測値	1,254.0	2,256.5															
		許容値	±3.0	許容値	±3.0	±3.0															
		差	+3.0	差	+1.0	-0.5															
□ 800 × 800 × 40 / 40 × 6,993																					
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日	
	柱 頭				柱 脚				柱頭		柱脚										
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質			合否		
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/19	
実測値	800	798	801	800	799	798	801	801					+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適					
差	0	-2	+1	0	-1	-2	+1	+1					+1.0	-1.0	0.5						

B - B O X 製 品 検 査 表




No.9 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

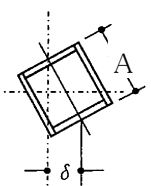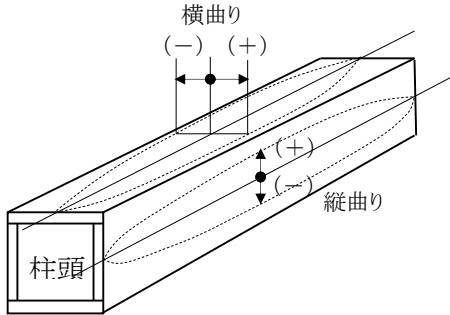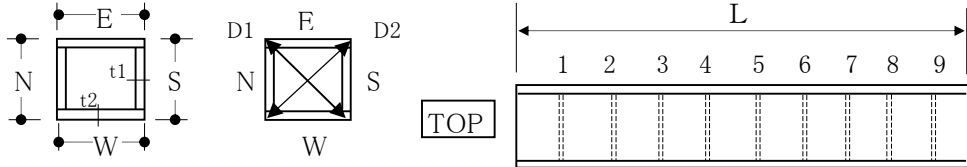

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク				全長		ダイアフラム位置（累積）													
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑪-3	K-1CX3Y14				設計値	6,993.0	設計値	1,253.0	2,257.0											
					実測値	6,996.0	実測値	1,254.0	2,256.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	+1.0	-1.0											
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査 可否	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面						
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/21
実測値	800	801	800	800	800	800	801	801					+1.0	-1.0	0.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	0	+1	0	0	0	0	+1	+1					+1.0	-1.0	0.5					
品番	柱マーク				全長		ダイアフラム位置（累積）													
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9				
⑫	K-1CX2Y14				設計値	6,993.0	設計値	1,253.0	2,257.0											
					実測値	6,995.0	実測値	1,254.0	2,256.0											
					許容値	±3.0	許容値	±3.0	±3.0											
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	+1.0	-1.0											
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査 可否	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面						
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/20
実測値	799	800	800	800	799	800	801	802					+1.0	-1.0	1.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	-1	0	0	0	-1	0	+1	+2					+1.0	-1.0	1.5					

B - B O X 製 品 検 査 表




No. 10 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

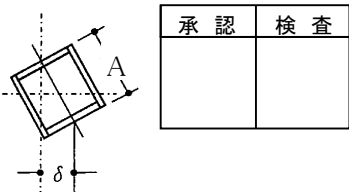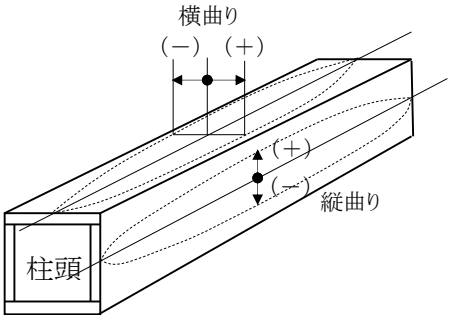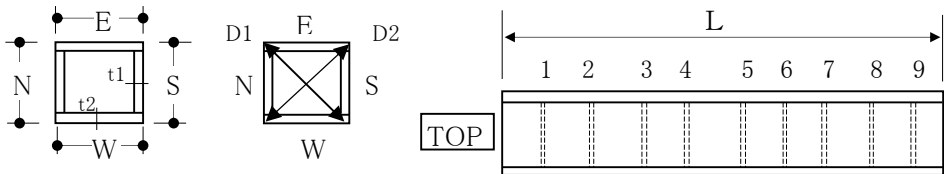

対角寸法				(断面寸法)				(開先有のときは内寸法)				(全長・ダイアフラム位置)				(曲り)				(ねじれ)				(単位 mm)			
品番		柱マーク				全長		ダイアフラム位置 (累積)																			
寸法 : W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9										
⑬-1	K-1CX2Y11					設計値	6,993.0	設計値	1,253.0	2,257.0																	
						実測値	6,996.0	実測値	1,253.0	2,256.0																	
						許容値	±3.0	許容値	±3.0	±3.0																	
□ 800 × 800 × 40 / 40 × 6,993						差	+3.0	差	0	-1.0																	
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査	検 査 日							
	柱 頭				柱 脚				柱頭		柱脚																
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質											
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/22							
実測値	799	800	801	801	799	800	802	800					-1.0	0	1.0	適											
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適											
差	-1	0	+1	+1	-1	0	+2	0					-1.0	0	1.0												
品番		柱マーク				全長		ダイアフラム位置 (累積)																			
寸法 : W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9										
⑬-2	K-1CX2Y13					設計値	6,993.0	設計値	1,253.0	2,257.0																	
						実測値	6,996.0	実測値	1,253.0	2,256.0																	
						許容値	±3.0	許容値	±3.0	±3.0																	
□ 800 × 800 × 40 / 40 × 6,993						差	+3.0	差	0	-1.0																	
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査	検 査 日							
	柱 頭				柱 脚				柱頭		柱脚																
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質											
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	合	8/19							
実測値	800	800	801	801	800	799	801	801					-0.5	+0.5	0.5	適											
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適											
差	0	0	+1	+1	0	-1	+1	+1					-0.5	+0.5	0.5												

B - B O X 製 品 検 査 表

No. 11 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑭-1	K-1CX3Y11				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	802	801	799	799	800	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+2	+1	-1	-1	0	+1	+1.0	-1.0	0.5						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑭-2	K-1CX3Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	801	801	799	799	800	801	0	-0.5	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	-1	-1	0	+1	0	-0.5	1.0						

B - B O X 製 品 檢 查 表

No. 12 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先：株式会社 北川組鉄工所

品番		柱マーク			全長		ダイアフラム位置（ 累積 ）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑮	K-1CX0Y15				設計値	6,993.0	設計値	1,253.0	1,707.0	1,957.0	2,257.0						
					実測値	6,996.0	実測値	1,252.0	1,707.0	1,959.0	2,258.0						
					許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	-1.0	0	+2.0	+1.0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	801	801	800	800	799	799	801	800	-1.0	+0.5	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	+1	0	0	-1	-1	+1	0	-1.0	+0.5	1.5						
品番		柱マーク			全長		ダイアフラム位置（ 累積 ）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑯-1	K-1CX0Y11				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,708.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+1.0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	799	801	801	800	799	801	801	0	0	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	+1	+1	0	-1	+1	+1	0	0	2.0						

B - B O X 製 品 檢 查 表

No. 13 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先： 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑩-2	K-1CX0Y12				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,708.0	2,258.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+1.0	+1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/26	
実測値	800	802	801	800	800	801	800	801	-0.5	+0.5	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+2	+1	0	0	+1	0	+1	-0.5	+0.5	1.5						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑩-3	K-1CX0Y13				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,707.5	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+0.5	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	801	799	800	801	800	798	801	801	+0.5	-1.0	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	-1	0	+1	0	-2	+1	+1	+0.5	-1.0	2.0						

B - B O X 製 品 檢 查 表

No. 14 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑬-4	K-1CX0Y14				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,995.0	実測値	1,252.5	1,707.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	-0.5	0	-1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	800	799	801	800	800	800	801	800	+1.0	-0.5	3.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-1	+1	0	0	0	+1	0	+1.0	-0.5	3.5						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑰	K-1CX6Y15-2				設計値	892.0	設計値	548.0									
					実測値	893.0	実測値	548.0									
					許容値	±3.0	許容値	±3.0									
□ 800 × 800 × 40 / 40 × 892					差	+1.0	差	0									
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/11	
実測値	801	799	801	802	801	800	800	801	0	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±0.5	±0.5	4.5						
差	+1	-1	+1	+2	+1	0	0	+1	0	+0.5	0.5						

No. 15 / 19




持込先 : 株式会社 北川組鉄工所

品番		柱マーク				全長		ダイヤフラム位置（ 累積 ）									
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9
⑬-1	K-1CX8Y15					設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
						実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0						
						許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993						差	+2.0	差	0	0	-1.0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合		
実測値	799	799	800	800	798	798	800	800	0	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	0	-2	-2	0	0	0	+1.0	0.5						
品番		柱マーク				全長		ダイヤフラム位置（ 累積 ）									
寸法：W × F × t1 / t2 × L						L			1	2	3	4	5	6	7	8	9
⑬-2	K-1CX9Y15					設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
						実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0						
						許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993						差	+2.0	差	0	0	-1.0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合		
実測値	799	800	800	800	799	798	801	799	-1.0	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	0	0	-1	-2	+1	-1	-1.0	+0.5	0.5						

No. 11 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

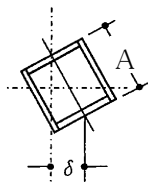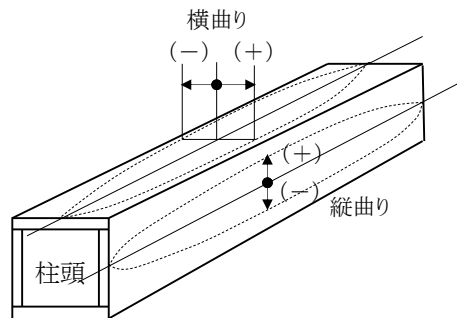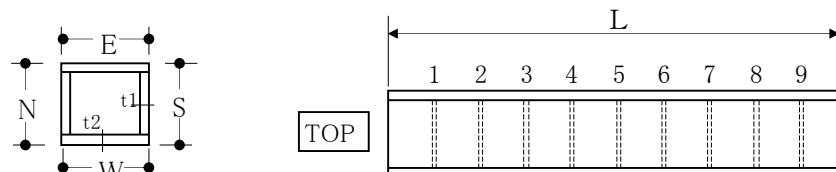

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)




⑭-1																	
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑭-1	K-1CX3Y11				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	802	801	799	799	800	801	+1.0	-1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+2	+1	-1	-1	0	+1	+1.0	-1.0	0.5						
⑭-2																	
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑭-2	K-1CX3Y13				設計値	6,993.0	設計値	1,253.0	2,257.0								
					実測値	6,996.0	実測値	1,253.0	2,257.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/19	
実測値	800	800	801	801	799	799	800	801	0	-0.5	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	-1	-1	0	+1	0	-0.5	1.0						

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

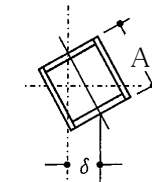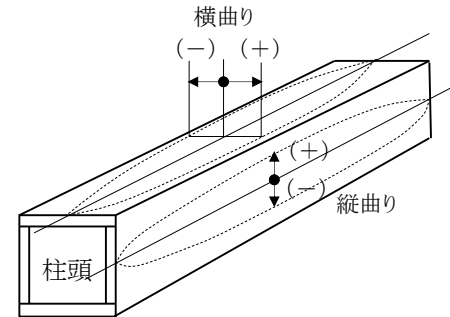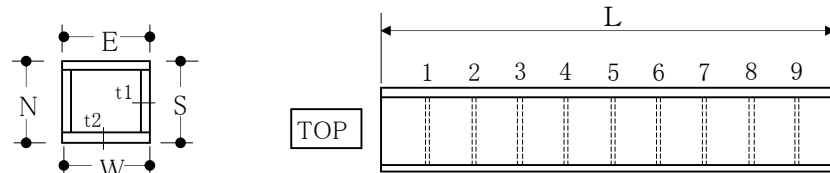

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑮	K-1CX0Y15				設計値	6,993.0	設計値	1,253.0	1,707.0	1,957.0	2,257.0						
					実測値	6,996.0	実測値	1,252.0	1,707.0	1,959.0	2,258.0						
					許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	-1.0	0	+2.0	+1.0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	801	801	800	800	799	799	801	800	-1.0	+0.5	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	+1	0	0	-1	-1	+1	0	-1.0	+0.5	1.5						




品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑮-1	K-1CX0Y11				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,708.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+1.0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/22	
実測値	799	799	801	801	800	799	801	801	0	0	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	+1	+1	0	-1	+1	+1	0	0	2.0						

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

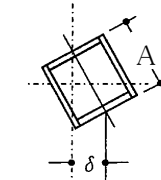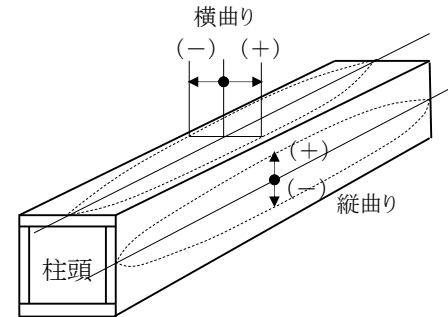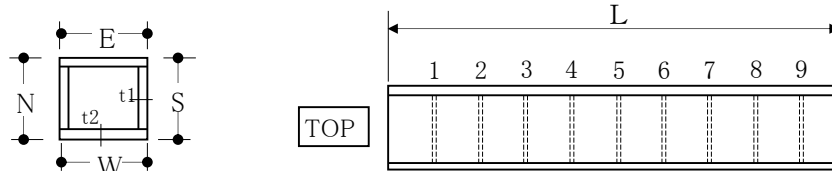

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(単位:mm)




品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-2	K-1CX0Y12				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,708.0	2,258.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+1.0	+1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/26	
実測値	800	802	801	800	800	801	800	801	-0.5	+0.5	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	+2	+1	0	0	+1	0	+1	-0.5	+0.5	1.5						

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-3	K-1CX0Y13				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,707.5	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	+0.5	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外觀 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	801	799	800	801	800	798	801	801	+0.5	-1.0	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	+1	-1	0	+1	0	-2	+1	+1	+0.5	-1.0	2.0						

No. 14 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

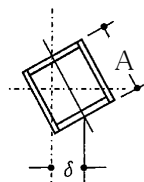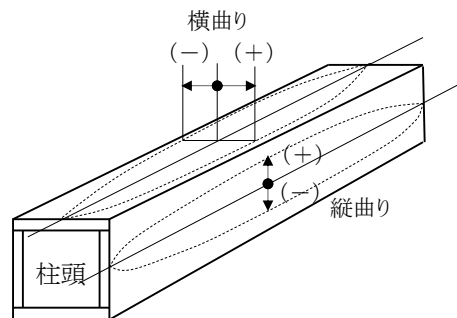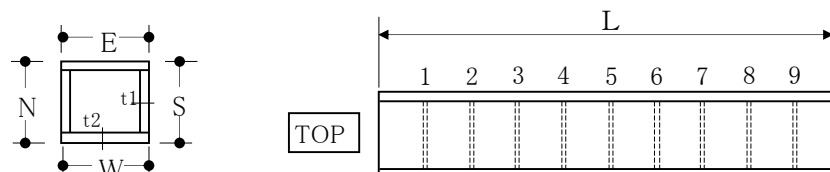

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(单位:mm)





品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑬-4	K-1CX0Y14				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0							
					実測値	6,995.0	実測値	1,252.5	1,707.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	-0.5	0	-1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/20	
実測値	800	799	801	800	800	800	801	800	+1.0	-0.5	3.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	-1	+1	0	0	0	+1	0	+1.0	-0.5	3.5						

品番		柱マーク			全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
⑰	K-1CX6Y15-2				設計値	892.0	設計値	548.0									
					実測値	893.0	実測値	548.0									
					許容値	±3.0	許容値	±3.0									
□ 800 × 800 × 40 / 40 × 892					差	+1.0	差	0									
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/11	
実測値	801	799	801	802	801	800	800	801	0	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±0.5	±0.5	4.5						
差	+1	-1	+1	+2	+1	0	0	+1	0	+0.5	0.5						

No. 15 / 19

持込先：株式会社 北川組鉄工所

神栄鉄鋼株式会社

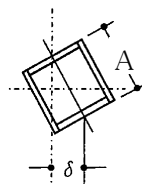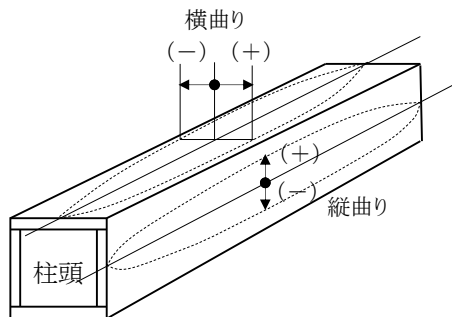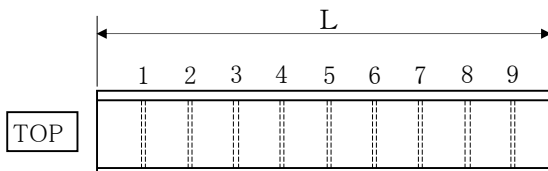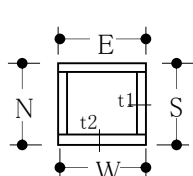

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(单位:mm)

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-1	K-1CX8Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	0	-1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/25	
実測値	799	799	800	800	798	798	800	800	0	+1.0	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	0	-2	-2	0	0	0	+1.0	0.5						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬-2	K-1CX9Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	0	-1.0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/28	
実測値	799	800	800	800	799	798	801	799	-1.0	+0.5	0.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	0	0	0	-1	-2	+1	-1	-1.0	+0.5	0.5						

B - B O X 製 品 検 査 表




No. 11 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

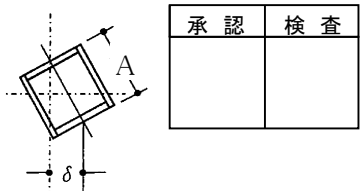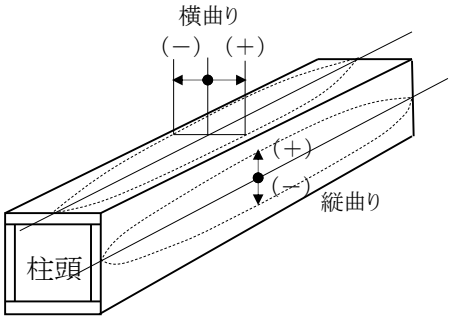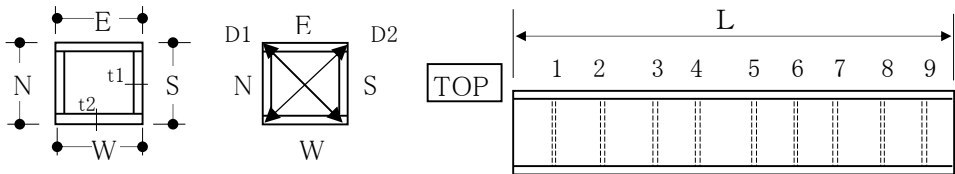

対角寸法				(断面寸法)				(開先有のときは内寸法)				(全長・ダイアフラム位置)				(曲 り)				(ねじれ)				(単位 mm)			
品番		柱マーク				全長				ダイアフラム位置 (累積)																	
寸法 : W × F × t1 / t2 × L						L					1	2	3	4	5	6	7	8	9								
⑭-1		K-1CX3Y11	設計値	6,993.0	設計値	1,253.0	2,257.0																				
			実測値	6,996.0	実測値	1,253.0	2,256.0																				
			許容値	±3.0	許容値	±3.0	±3.0																				
□ 800 × 800 × 40 / 40 × 6,993			差	+3.0	差	0	-1.0																				
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日							
	柱 頭				柱 脚				柱頭		柱脚																
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質											
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/19							
実測値	800	800	802	801	799	799	800	801					+1.0	-1.0	0.5	適											
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適											
差	0	0	+2	+1	-1	-1	0	+1					+1.0	-1.0	0.5												
品番		柱マーク				全長				ダイアフラム位置 (累積)																	
寸法 : W × F × t1 / t2 × L						L					1	2	3	4	5	6	7	8	9								
⑭-2		K-1CX3Y13	設計値	6,993.0	設計値	1,253.0	2,257.0																				
			実測値	6,996.0	実測値	1,253.0	2,257.0																				
			許容値	±3.0	許容値	±3.0	±3.0																				
□ 800 × 800 × 40 / 40 × 6,993			差	+3.0	差	0	0																				
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日							
	柱 頭				柱 脚				柱頭		柱脚																
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質											
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	合	8/19							
実測値	800	800	801	801	799	799	800	801					0	-0.5	1.0	適											
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適											
差	0	0	+1	+1	-1	-1	0	+1					0	-0.5	1.0												

B - B O X 製品検査表




No. 12 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

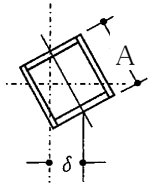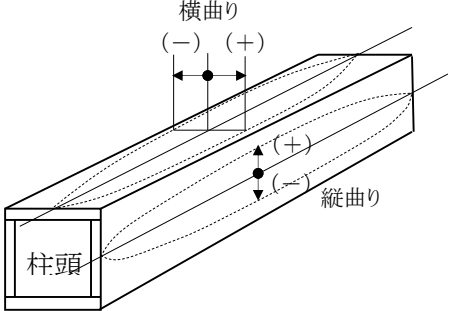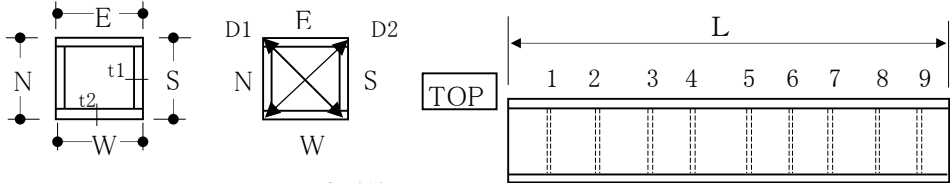

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイアフラム位置（累積）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
⑮	K-1CX0Y15	設計値	6,993.0	設計値	1,253.0	1,707.0	1,957.0	2,257.0					
		実測値	6,996.0	実測値	1,252.0	1,707.0	1,959.0	2,258.0					
		許容値	±3.0	許容値	±3.0	±3.0	±3.0	±3.0					
□	800 × 800 × 40 / 40 × 6,993	差	+3.0	差	-1.0	0	+2.0	+1.0					

	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部 開先 加工	端部 直角度	外観 検査 可否	検査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	8/22	
実測値	801	801	800	800	799	799	801	800					-1.0	+0.5	1.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適	適	合		
差	+1	+1	0	0	-1	-1	+1	0					-1.0	+0.5	1.5					

品番	柱マーク	全長		ダイアフラム位置（累積）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
⑯-1	K-1CX0Y11	設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0						
		実測値	6,996.0	実測値	1,253.0	1,708.0	2,257.0						
		許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993		差	+3.0	差	0	+1.0	0						

	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直 角 度	外観 検査	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/22
実測値	799	799	801	801	800	799	801	801					0	0	2.0					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適			合	
差	-1	-1	+1	+1	0	-1	+1	+1					0	0	2.0					

B - B O X 製 品 検 査 表




No. 13 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

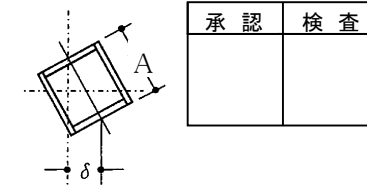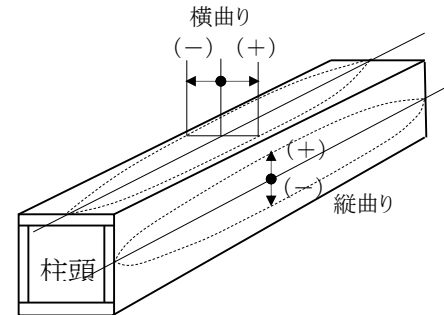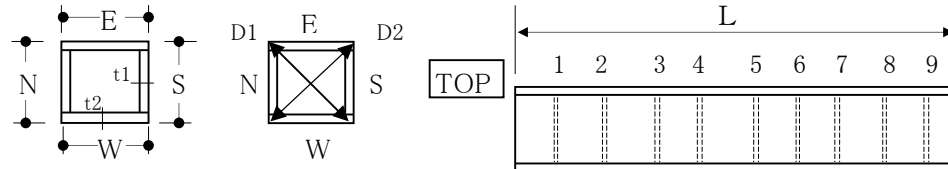

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイヤフラム位置（累積）										曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日			
寸法：W×F×t1/t2×L		L			1	2	3	4	5	6	7	8	9				材質							
⑩-2	K-1CX0Y12	設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0										適	適	適	適				
		実測値	6,996.0	実測値	1,253.0	1,708.0	2,258.0																	
		許容値	±3.0	許容値	±3.0	±3.0	±3.0																	
□ 800 × 800 × 40 / 40 × 6,993		差	+3.0	差	0	+1.0	+1.0																	
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日				
	柱 頭				柱 脚				柱頭		柱脚					材質			合否					
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ									
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/26				
実測値	800	802	801	800	800	801	800	801					-0.5	+0.5	1.5									
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5									
差	0	+2	+1	0	0	+1	0	+1					-0.5	+0.5	1.5									
品番	柱マーク	全長		ダイヤフラム位置（累積）										曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日			
寸法：W×F×t1/t2×L		L			1	2	3	4	5	6	7	8	9				材質							
⑩-3	K-1CX0Y13	設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0										適	適	適	適				
		実測値	6,996.0	実測値	1,253.0	1,707.5	2,257.0																	
		許容値	±3.0	許容値	±3.0	±3.0	±3.0																	
□ 800 × 800 × 40 / 40 × 6,993		差	+3.0	差	0	+0.5	0																	
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日				
	柱 頭				柱 脚				柱頭		柱脚					材質			合否					
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ									
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	8/20				
実測値	801	799	800	801	800	798	801	801					+0.5	-1.0	2.0									
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5									
差	+1	-1	0	+1	0	-2	+1	+1					+0.5	-1.0	2.0									

B - B O X 製品検査表



No. 14 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

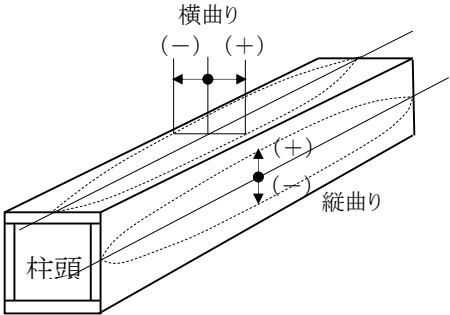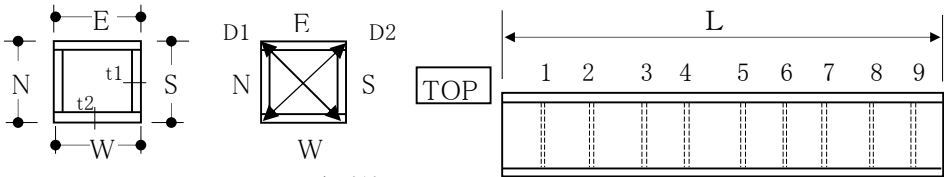




承認	検査

(断面寸法)				(開先有のときは内寸法)				(全長・ダイアフラム位置)				(曲り)				(ねじれ)				(単位 mm)			
品番	柱マーク				全長		ダイアフラム位置 (累積)																
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9							
⑩-4	K-1CX0Y14				設計値	6,993.0	設計値	1,253.0	1,707.0	2,257.0													
					実測値	6,995.0	実測値	1,252.5	1,707.0	2,256.0													
					許容値	±3.0	許容値	±3.0	±3.0	±3.0													
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	-0.5	0	-1.0													
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査	検 査 日			
	柱 頭				柱 脚				柱頭		柱脚												
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適	適	適	合	8/20		
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	合	8/20			
実測値	800	799	801	800	800	800	801	800					+1.0	-0.5	3.5	適	適	適	合	8/20			
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適	適	適	合	8/20			
差	0	-1	+1	0	0	0	+1	0					+1.0	-0.5	3.5								
品番	柱マーク				全長		ダイアフラム位置 (累積)																
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9							
⑰	K-1CX6Y15-2				設計値	892.0	設計値	548.0															
					実測値	893.0	実測値	548.0															
					許容値	±3.0	許容値	±3.0															
□ 800 × 800 × 40 / 40 × 892					差	+1.0	差	0															
	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査	検 査 日			
	柱 頭				柱 脚				柱頭		柱脚												
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適	適	適	合	8/11		
設計値	800	800	800	800	800	800	800	800	1018	1018	1018	1018	0	0	0	適	適	適	合	8/11			
実測値	801	799	801	802	801	800	800	801					0	+0.5	0.5	適	適	適	合	8/11			
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±0.5	±0.5	4.5	適	適	適	合	8/11			
差	+1	-1	+1	+2	+1	0	0	+1					0	+0.5	0.5					8/11			

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

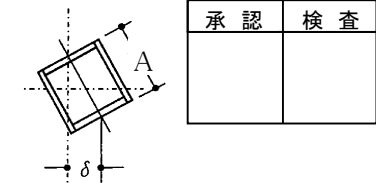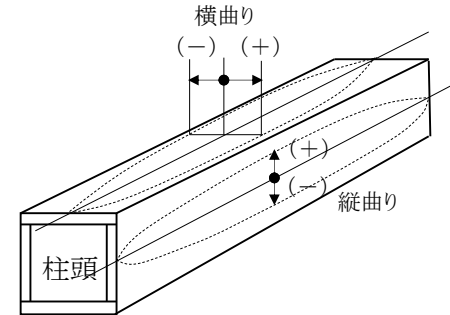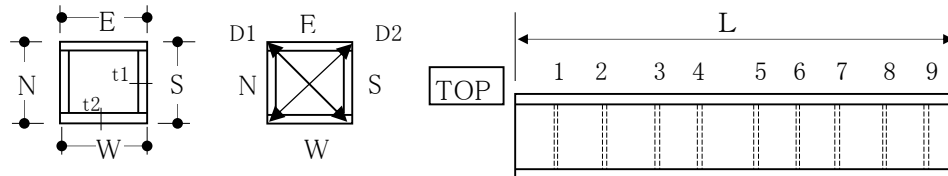

神栄鉄鋼株式会社




(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲 り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイアフラム位置（累積）																
寸法：W×F×t1/t2×L		L			1	2	3	4	5	6	7	8	9							
⑬-1	K-1CX8Y15	設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0													
		実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0													
		許容値	±3.0	許容値	±3.0	±3.0	±3.0													
□ 800 × 800 × 40 / 40 × 6,993		差	+2.0	差	0	0	-1.0													
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適合			
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	8/25	
実測値	799	799	800	800	798	798	800	800					0	+1.0	0.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	-1	-1	0	0	-2	-2	0	0					0	+1.0	0.5					

品番	柱マーク	全長		ダイアフラム位置（累積）																
寸法：W×F×t1/t2×L		L			1	2	3	4	5	6	7	8	9							
⑬-2	K-1CX9Y15	設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0													
		実測値	6,995.0	実測値	1,253.0	1,857.0	2,256.0													
		許容値	±3.0	許容値	±3.0	±3.0	±3.0													
□ 800 × 800 × 40 / 40 × 6,993		差	+2.0	差	0	0	-1.0													
	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部開先加工	端部直角度	外観検査	検査日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	適合			
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	8/28	
実測値	799	800	800	800	799	798	801	799					-1.0	+0.5	0.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	-1	0	0	0	-1	-2	+1	-1					-1.0	+0.5	0.5					

B - B O X 製 品 檢 查 表

No. 16 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑬	K-1CX10Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,995.0	実測値	1,253.0	1,856.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+2.0	差	0	-1.0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/25	
実測値	799	799	800	800	798	798	801	800	0	+1.0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	0	-2	-2	+1	0	0	+1.0	1.5						
品番	柱マーク				全長		ダイアフラム位置（累積）										
寸法：W×F×t1/t2×L					L			1	2	3	4	5	6	7	8	9	
⑳-1	K-1CX4Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	9/5	
実測値	799	799	800	799	798	798	801	800	+0.5	+0.5	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	-1	-2	-2	+1	0	+0.5	+0.5	2.0						

B - B O X 製 品 檢 查 表

No. 17 / 19

受注No. : 25-1050

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊤-2	K-1CX7Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合		9/3
実測値	799	798	801	800	799	798	801	800	-0.5	+2.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-2	+1	0	-1	-2	+1	0	-0.5	+2.0	1.0						
品番	柱マーク				全長		ダイヤフラム位置（累積）										
寸法：W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊤	K-1CX5Y13				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 7,003					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合		9/1
実測値	800	800	801	801	799	799	801	801	-1.0	+1.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	-1	-1	+1	+1	-1.0	+1.0	1.0						

B - B O X 製 品 檢 查 表

No. 18 / 19

受注No. : 25-1050

工事名：八重洲二丁目中地区再開発事業新築工事(1節)




持込先： 株式会社 北川組鉄工所

[illegible]

No. 16 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

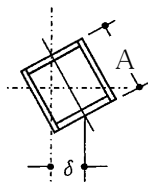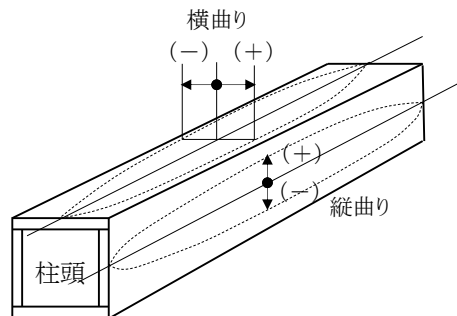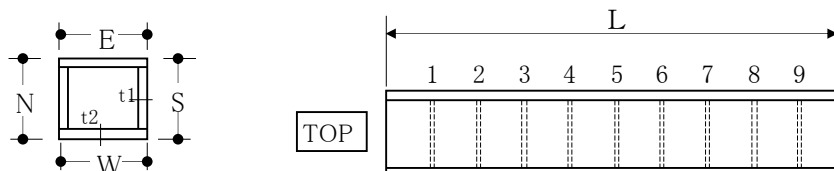

(断面寸法)

(全長・ダイアフラム位置)

(曲がり)

(ねじれ)

(单位:mm)




品番		柱マーク				全長		ダイヤフラム位置（累積）									
寸法：W×F×t1/t2×L						L			1	2	3	4	5	6	7	8	9
⑬	K-1CX10Y15					設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
						実測値	6,995.0	実測値	1,253.0	1,856.0	2,257.0						
						許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993						差	+2.0	差	0	-1.0	0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	8/25	
実測値	799	799	800	800	798	798	801	800	0	+1.0	1.5						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	0	-2	-2	+1	0	0	+1.0	1.5						

品番		柱マーク				全長		ダイヤフラム位置（累積）									
寸法：W×F×t1/t2×L						L			1	2	3	4	5	6	7	8	9
⑳-1	K-1CX4Y15					設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
						実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0						
						許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993						差	+3.0	差	0	0	0						
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	9/5	
実測値	799	799	800	799	798	798	801	800	+0.5	+0.5	2.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-1	0	-1	-2	-2	+1	0	+0.5	+0.5	2.0						

No. 17 / 19

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

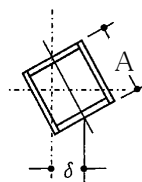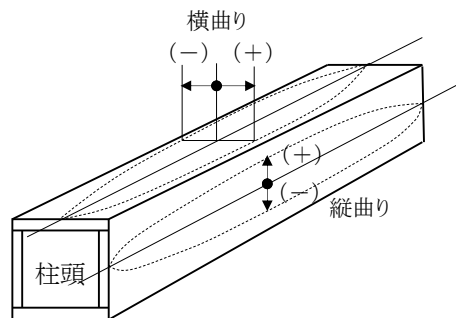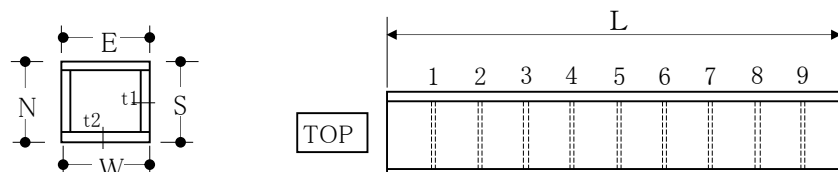

承認	検査
後藤	井上

(断面寸法)					(全長・ダイアフラム位置)				(曲がり)			(ねじれ)				(単位:mm)	
品番	柱マーク				全長		ダイアフラム位置 (累積)										
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊦-2	K-1CX7Y15				設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0							
					実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0							
					許容値	±3.0	許容値	±3.0	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 6,993					差	+3.0	差	0	0	0							
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	9/3	
実測値	799	798	801	800	799	798	801	800	-0.5	+2.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	-1	-2	+1	0	-1	-2	+1	0	-0.5	+2.0	1.0						
品番	柱マーク				全長		ダイアフラム位置 (累積)										
寸法 : W × F × t1 / t2 × L					L			1	2	3	4	5	6	7	8	9	
㊦1	K-1CX5Y13				設計値	7,003.0	設計値	1,253.0	2,257.0								
					実測値	7,006.0	実測値	1,253.0	2,256.0								
					許容値	±3.0	許容値	±3.0	±3.0								
□ 800 × 800 × 40 / 40 × 7,003					差	+3.0	差	0	-1.0								
	断 面 寸 法								曲り		ねじれ	板厚	材質	外観 検査	合否	検査日	備考
	柱 頭				柱 脚												
	N	S	E	W	N	S	E	W	E面	S面	δ						
設計値	800	800	800	800	800	800	800	800	0	0	0	適	適	適	合	9/1	
実測値	800	800	801	801	799	799	801	801	-1.0	+1.0	1.0						
許容値	±3	±3	±3	±3	±3	±3	±3	±3	±4.5	±4.5	4.5						
差	0	0	+1	+1	-1	-1	+1	+1	-1.0	+1.0	1.0						

B - B O X 製 品 檢 查 表




No. 18 / 19

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

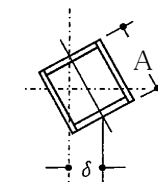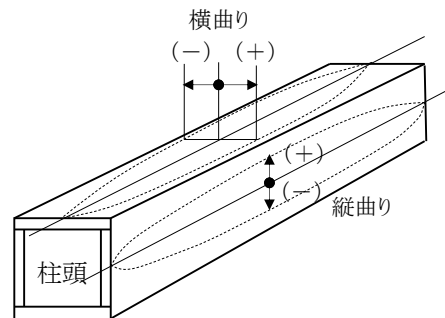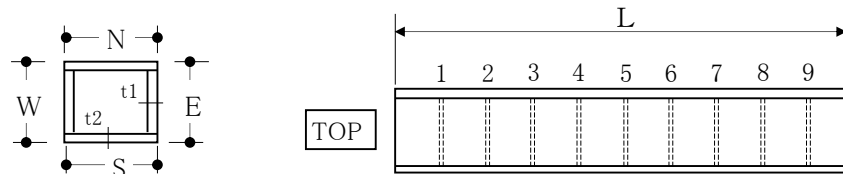

承認	検査
後藤	井上

[illegible]

B - B O X 製 品 検 査 表




No. 16 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

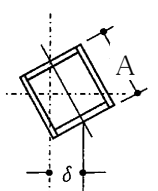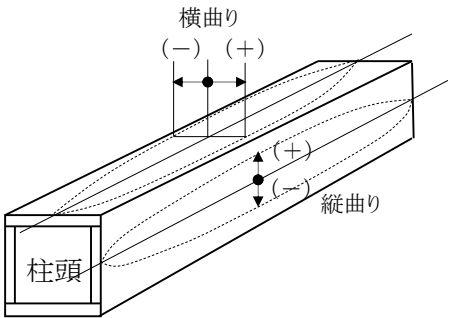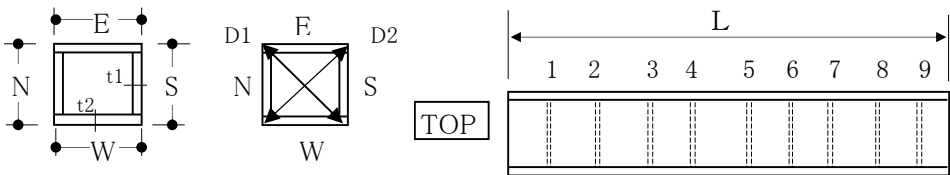

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイアフラム位置（累積）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
⑱	K-1CX10Y15	設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
		実測値	6,995.0	実測値	1,253.0	1,856.0	2,257.0						
		許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□	800 × 800 × 40 / 40 × 6,993	差	+2.0	差	0	-1.0	0						

	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部 開先 加工	端部 直角度	外観 検査	検査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	可否			
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	8/25	
実測値	799	799	800	800	798	798	801	800					0	+1.0	1.5					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5					
差	-1	-1	0	0	-2	-2	+1	0					0	+1.0	1.5	適		合		

品番	柱マーク	全長		ダイアフラム位置（累積）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
㊤-1	K-1CX4Y15	設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
		実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0						
		許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993		差	+3.0	差	0	0	0						

	断 面 寸 法								対 角 寸 法				曲り		ねじれ	板厚	端部 開先 加工	端部 直角度	外観 検査	検査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面					δ	
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	9/5
実測値	799	799	800	799	798	798	801	800					+0.5	+0.5	2.0					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適			合	
差	-1	-1	0	-1	-2	-2	+1	0					+0.5	+0.5	2.0					

B - B O X 製品検査表



No. 17 / 19

受注No. : 25-1050

工事名 : 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

神栄鉄鋼株式会社

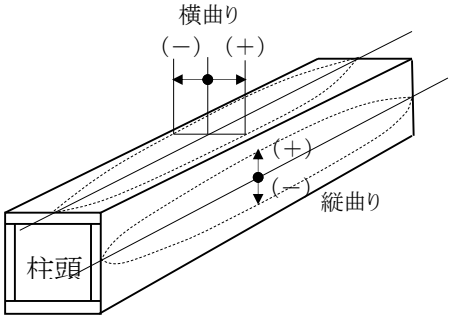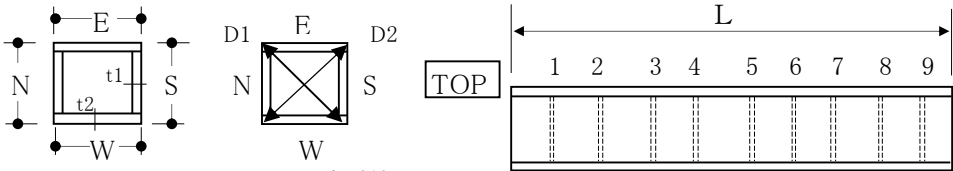

承認	検査

(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

品番	柱マーク	全長		ダイアフラム位置（累積）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
㊤-2	K-1CX7Y15	設計値	6,993.0	設計値	1,253.0	1,857.0	2,257.0						
		実測値	6,996.0	実測値	1,253.0	1,857.0	2,257.0						
		許容値	±3.0	許容値	±3.0	±3.0	±3.0						
□ 800 × 800 × 40 / 40 × 6,993		差	+3.0	差	0	0	0						

	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直角度	外観 検査 合否	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質				
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	適	
実測値	799	798	801	800	799	798	801	800					-0.5	+2.0	1.0					適
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適				
差	-1	-2	+1	0	-1	-2	+1	0					-0.5	+2.0	1.0					




品番	柱マーク	全長		ダイアフラム位置（ 累積 ）									
寸法：W × F × t1 / t2 × L		L			1	2	3	4	5	6	7	8	9
②1	K-1CX5Y13	設計値	7,003.0	設計値	1,253.0	2,257.0							
		実測値	7,006.0	実測値	1,253.0	2,256.0							
		許容値	±3.0	許容値	±3.0	±3.0							
□ 800 × 800 × 40 / 40 × 7,003		差	+3.0	差	0	-1.0							

	断 面 寸 法								対 角 寸 法				曲り		ね じ れ	板厚	端部 開先 加工	端部 直 角 度	外観 検査	検 査 日
	柱 頭				柱 脚				柱頭		柱脚									
	N	S	E	W	N	S	E	W	D1	D2	D1	D2	E面	S面	δ	材質	合 否			
設計値	800	800	800	800	800	800	800	800	1131	1131	1018	1018	0	0	0	適	適	適	9/1	
実測値	800	800	801	801	799	799	801	801					-1.0	+1.0	1.0					
許容値	±3	±3	±3	±3	±3	±3	±3	±3	-	-	-	-	±4.5	±4.5	4.5	適		合		
差	0	0	+1	+1	-1	-1	+1	+1					-1.0	+1.0	1.0					

受注No.:	25-1050
--------	---------

工事名： 八重洲二丁目中地区再開発事業新築工事(1節)

持込先 : 株式会社 北川組鉄工所

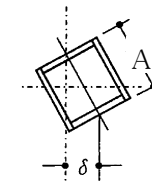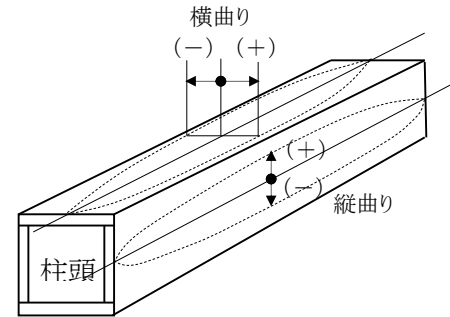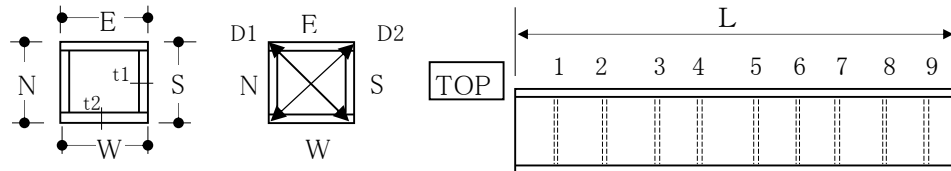

神栄鉄鋼株式会社

承認	検査

対角寸法
(断面寸法) (開先有のときは内寸法) (全長・ダイアフラム位置) (曲り) (ねじれ) (単位 mm)

[illegible]