ストレージファームウェアバンドル 2.76 リリースノート

HCI

Michael Wallis, Aksel Davis, Ann-Marie Grissino, Dave Bagwell
June 21, 2021

This PDF was generated from https://docs.netapp.com/ja-jp/hci/docs/rn_storage_firmware_2.76.html on July 01, 2021. Always check docs.netapp.com for the latest.

目次

ストレージファームウェアバンドル 2.76 リリースノート 1
新機能 1
ストレージファームウェアコンポーネントの変更点 2
解決済みの問題と既知の問題 2
セキュリティの脆弱性を解決 4

ストレージファームウェアバンドル 2.76 リリースノート

Element 12.0 以降および管理サービスバージョン 2.14 以降では、 NetApp Hybrid Cloud Control の UI と REST API を使用して、ストレージノードでファームウェアのみのアップグレードを実行できます。この手順では、 Element ソフトウェアはアップグレードされず、 Element のメジャーリリース以外のバージョンのストレージファームウェアもアップグレードできます。

新機能

ストレージファームウェアバンドルバージョン 2.76 には、セキュリティ上の脆弱性の修正など、さまざまなバグ修正と新機能が含まれています。の手順に従って、ストレージファームウェアをアップグレードできます "ストレージファームウェアをアップグレードします"。

ファームウェアコンポーネントが更新されました

このファームウェアパッケージには、次のファームウェアバージョンが含まれています。これらのファームウェアバージョンは、太字で更新されています。

コンポーネント	**SolidFire SF** シリーズ	**H410S**	**H610S**
BIOS	該当なし	NA2.1	* 3B06 *
BMC の場合	該当なし	6.8400	* 3.86.07 *
NIC / Mellanox	-	* 14.25.1020 *	* 14.25.1020 *
RMS200	aeb8cc	aeb8cc	-
RMS300	7d8422bc	7d8422bc	-
NVDIMM 、スマート	-	-	3.1
bpm 、 SMART	-	-	2.16
NVDIMM 、 Micron Gen1	-	-	26.2c
NVDIMM 、 Micron Gen2	-	-	25.3c
PGEM 、 Micron 社	-	-	1.40
PM863 、 SED	GXT5404Q	GXT5404Q	-
PM863 、 NSED	GXT5103Q	GXT5103Q	-
PM883 、 SED	* HXT7904Q *	* HXT7904Q *	-
Hawk-4 、 SED	8ENP7101	8ENP7101	-
Hawk-4 、 NSED	8ENP6101	8ENP6101	-
PM963 、 SED	-	-	CXV8202Q
PM963 、 NSED	-	-	CXV8501Q
PM983 、 SED	-	-	* EDA5402Q *

コンポーネント	**SolidFire SF** シリーズ	**H410S**	**H610S**
PM983 、 NSED	-	-	* EDA5700Q *
CD5 、 SED	-	-	* 0109 *
CD5 、 NSED	-	-	* 0109 *
CD5 、 FIPS	-	-	0108.

ストレージファームウェアコンポーネントの変更点

コンポーネント	改善 / 変更
H610S BIOS 3B06	• メモリ障害の処理が改善されました • マイクロコードバージョンを MCU x6906 に更新
H610S BMC 3.86.07	• BMC SEL に BIOS PPR イベントログ解析を追加 • BMC　がハングした場合にシステムの過熱を防止する • LDAP　のグループドメインの長さが　64　からに変更されました 128 文字です
H410S / H610S NIC 、 Mellanox 14.25.1020	該当なし
ドライブファームウェアの各種更新	該当なし

解決済みの問題と既知の問題

を参照してください "Bugs Online のツール" 解決済みの問題と新しい問題の詳細については、を参照してください。

BOL ツールへのアクセス

1. に移動します "BOL ツール" ドロップダウンリストから * Element Software * を選択します。

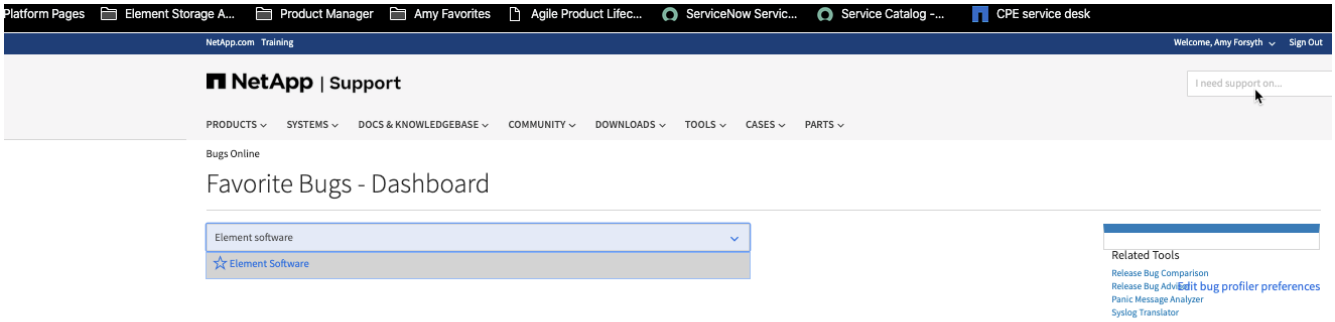

2. キーワード検索フィールドに「 Storage Firmware Bundle 」と入力して、「 * New Search* 」をクリックします。

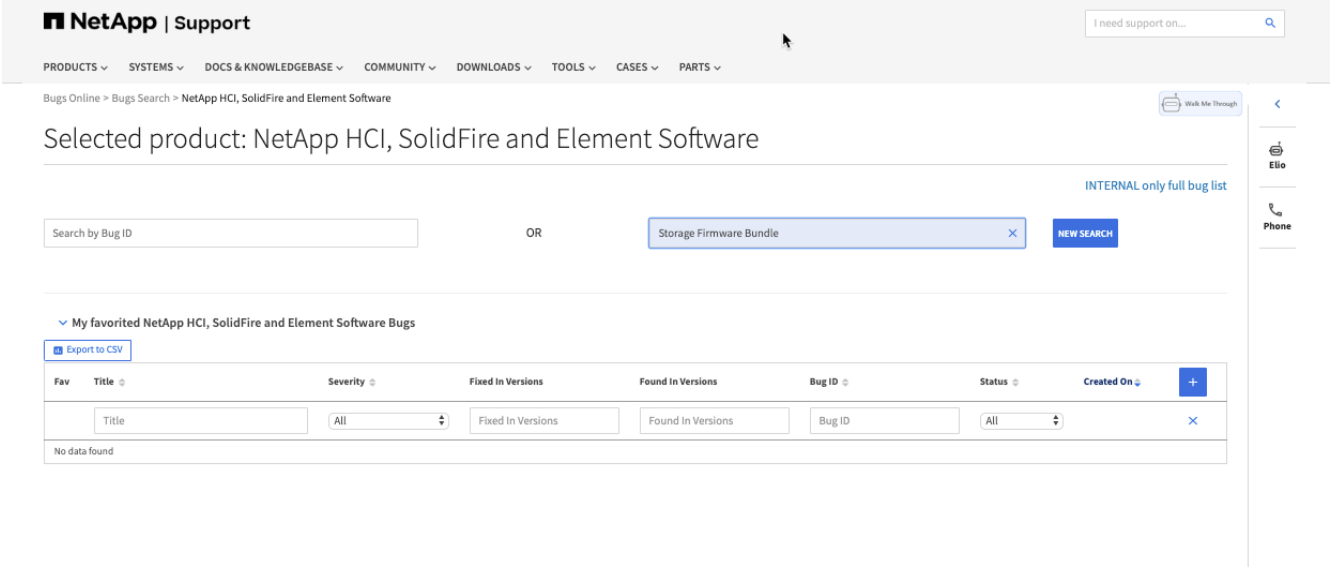

3. 解決済みまたはオープン状態のバグのリストが表示されます。次のように結果をさらに絞り込むことができます。

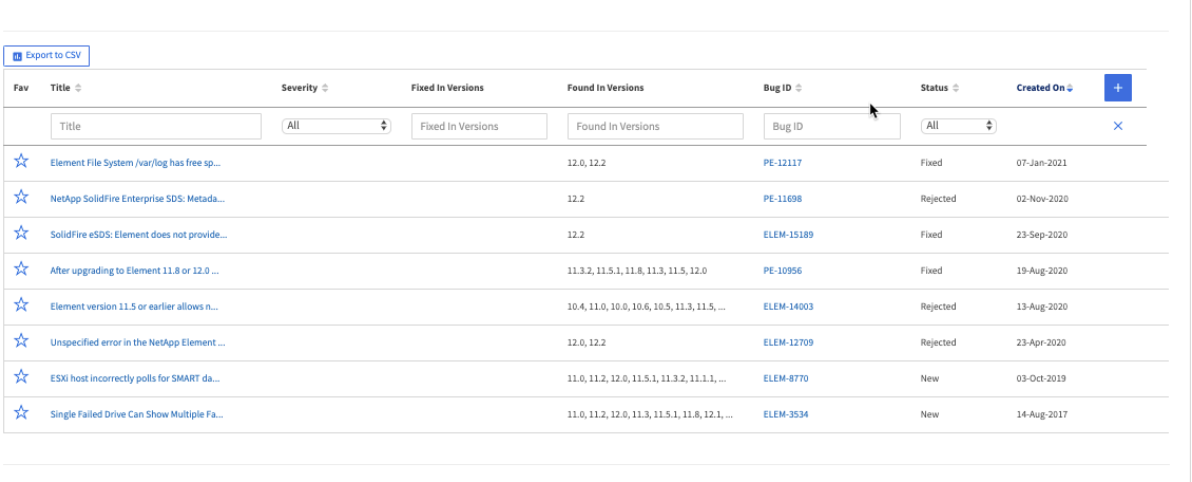

Export to CSV

Fav	Title	Severity	Fixed In Versions	Found In Versions	Bug ID	Status	Created On
	Title	All	Fixed In Versions	Found In Versions	Bug ID	All	
☆	Element File System /var/log has free sp...			12.0, 12.2	PE-12117	Fixed	07-Jan-2021
☆	NetApp SolidFire Enterprise SDS: Metada...			12.2	PE-11698	Rejected	02-Nov-2020
☆	SolidFire eSDS: Element does not provide...			12.2	ELEM-15189	Fixed	23-Sep-2020
☆	After upgrading to Element 11.8 or 12.0 ...			11.3.2, 11.5.1, 11.8, 11.3, 11.5, 12.0	PE-10956	Fixed	19-Aug-2020
☆	Element version 11.5 or earlier allows n...			10.4, 11.0, 10.0, 10.6, 10.5, 11.3, 11.5, ...	ELEM-14003	Rejected	13-Aug-2020
☆	Unspecified error in the NetApp Element ...			12.0, 12.2	ELEM-12709	Rejected	23-Apr-2020
☆	ESXi host incorrectly polls for SMART da...			11.0, 11.2, 12.0, 11.5.1, 11.3.2, 11.1.1, ...	ELEM-8770	New	03-Oct-2019
☆	Single Failed Drive Can Show Multiple Fa...			11.0, 11.2, 12.0, 11.3, 11.5.1, 11.8, 12.1, ...	ELEM-3534	New	14-Aug-2017

セキュリティの脆弱性を解決

このリリースで解決されたセキュリティの脆弱性は次のとおりです。

H410S BMC 6.84.00

- CVE-2020-0542 、 CVE-20-0532 、 CVE-20-0538 、 CVE-20-0534 、 CVE-20-0541 、 CVE-20-0533 、 CVE-20-0537 、 CVE-20-0537 、 CVE-20-0531
- CVE-2020-0535 、 CVE-2020-0536 、 CVE-2020-0535 、 CVE-2020-0524 、 CVE-2020-0566 、 CVE-20-0539 、 CVE-20-0586 、 CVE-20-0594
- CVE-2020-0595 、 CVE-20-0596 、 CVE-2020-05874 、 CVE-20-0543 CVE-20-0543 CVE-20-0548 、 CVE-20-0549

H610S BMC 3.86.07

- CVE-2016-20636
- CVE-2017-11599 、 CVE-2018-12826 、 CVE-2018-12464 、 CVE-20120-12114
- CVE-2016-4706 、 CVE-2011-5320 、 CVE-2015-8984 、 CVE-2015-8983 、 CVE-2015-8982 、 CVE-2006-7254 、 CVE-2005-3590

詳細については、こちらをご覧ください

- "NetApp HCI ドキュメントセンター"
- "NetApp HCI のリソースページ"

Copyright Information

Copyright © 2021 NetApp, Inc. All rights reserved. Printed in the U.S. No part of this document covered by copyright may be reproduced in any form or by any means-graphic, electronic, or mechanical, including photocopying, recording, taping, or storage in an electronic retrieval system-without prior written permission of the copyright owner.

Software derived from copyrighted NetApp material is subject to the following license and disclaimer:

THIS SOFTWARE IS PROVIDED BY NETAPP “AS IS” AND WITHOUT ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, WHICH ARE HEREBY DISCLAIMED. IN NO EVENT SHALL NETAPP BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES (INCLUDING, BUT NOT LIMITED TO, PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY OUT OF THE USE OF THIS SOFTWARE, EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.

NetApp reserves the right to change any products described herein at any time, and without notice. NetApp assumes no responsibility or liability arising from the use of products described herein, except as expressly agreed to in writing by NetApp. The use or purchase of this product does not convey a license under any patent rights, trademark rights, or any other intellectual property rights of NetApp.

The product described in this manual may be protected by one or more U.S. patents, foreign patents, or pending applications.

RESTRICTED RIGHTS LEGEND: Use, duplication, or disclosure by the government is subject to restrictions as set forth in subparagraph (c)(1)(ii) of the Rights in Technical Data and Computer Software clause at DFARS 252.277-7103 (October 1988) and FAR 52-227-19 (June 1987).

Trademark Information

NETAPP, the NETAPP logo, and the marks listed at http://www.netapp.com/TM are trademarks of NetApp, Inc. Other company and product names may be trademarks of their respective owners.