Compute Firmware Bundle 2.76.10 Release Notes

HCI

Aksel Davis
May 26, 2021

This PDF was generated from https://docs.netapp.com/us-en/hci/docs/rn_compute_firmware_2.76.10.html on July 16, 2021. Always check docs.netapp.com for the latest.

Table of Contents

Compute Firmware Bundle 2.76.10 Release Notes . . . 1
What's New . . . 1
Download Compute Firmware Bundle 2.76.10 . . . 2
Resolved security vulnerabilities . . . 2
Resolved and known issues . . . 2

Compute Firmware Bundle 2.76.10 Release Notes

The downloadable compute node firmware package contains the latest BIOS and BMC feature enhancements, bugfixes, and hardware support for all supported NetApp HCI compute nodes.

What's New

Version 2.76.10 contains general bugfixes.

Updated firmware components

This firmware package contains the following firmware versions for hardware components, with updated versions in bold:

Component	H300E, H500E, H700E	H410C	H610C	H615C
BIOS	NA2.1	NATP3.9	3B03	3B08.CO
BMC	6.84.00	**6.71.20**	4.00.07	4.68.07
NIC / Mellanox	14.25.1020	14.25.1020	14.25.1020	14.24.1000

Changes in firmware components

Here are the details of the improvements and changes included in each new firmware component:

Node and firmware component	Improvements and changes
NATP3.9	• CSESF-284 Tatooine + BMC 6.71.18 does not report when PPR function work success event. • CSESF-289 NA3.7 BIOS does not have the ability to report a success on hPPR (hard PPR). • Updated SKX ucode to 0x6906 and CLX ucode to 0x2F01.

Mellanox NIC firmware driver compatibility

The updated Mellanox firmware versions 14.25.1020 and 14.24.1000 are compatible only with the following versions of the VMware ESXi driver:

- **ESXi 7.0**: H300E/H500E/H700E/H410C: Version 4.19.16.1
- **ESXi 7.0**: H610C/H615C: Version 4.17.15.16
- **ESXi 6.7**: Version 4.17.15.16
- **ESXi 6.5**: Version 4.16.13.5

Before upgrading to version 2.76.10, make sure you check the current ESXi driver version. If the driver is out of date, upgrade the driver first. Then upgrade the compute firmware to version 2.99 for your compute nodes. Visit Update compute node drivers for instructions on updating your compute node drivers, which include the ESXi driver.

While NetApp Deployment Engine 1.8P1 does not deploy ESXi version 7.0, ESXi 7.0 is supported as a self-install or manual upgrade option. When you manually install or upgrade host OSes, NetApp cannot control the drivers and firmware for these OSes.

Download Compute Firmware Bundle 2.76.10

To download the Compute Firmware Bundle:

1. Go to the NetApp HCI downloads page.
2. Choose **Compute_Firmware_Bundle** from the drop down list.
3. Click **Go**.

Visit Update compute node firmware for instructions on updating your compute node firmware.

Resolved security vulnerabilities

The following are security vulnerabilities that have been resolved in this release:

H410C BMC 6.71.20

- CVE-2019-1010022, CVE-2019-9169, CVE-2017-15804, CVE-2018-11236, CVE-2017-15670, CVE-2019-1010023, CVE-2015-8982, CVE-2015-8983, CVE-2017-16997, CVE-2019-20838,
- CVE-2017-1000408, CVE-2017-1000409, CVE-2018-1000001, CVE-2018-19591, CVE-2009-5155, CVE-2018-20796, CVE-2016-3706, CVE-2020-1752, CVE-2019-1010024, CVE-2019-1010025,
- CVE-2017-15671, CVE-2015-8985, CVE-2016-4429, CVE-2016-10739, CVE-2018-6485, CVE-2020-10029, CVE-2020-14155

Resolved and known issues

See the Bugs Online tool for details of issues that have been resolved and for any new issues.

Accessing the BOL tool

1. Navigate to the BOL tool and select **Element Software** from the drop-down list:

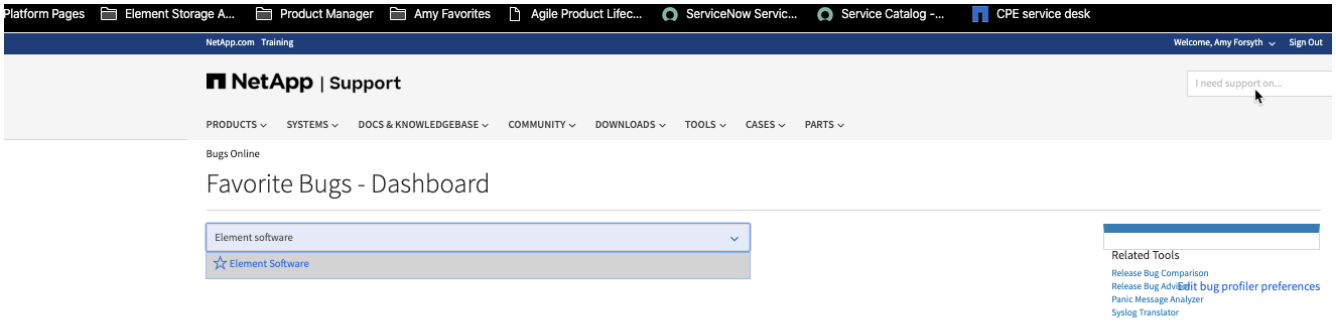

2. In the keyword search field, type “Compute Firmware Bundle” and click **New Search**:

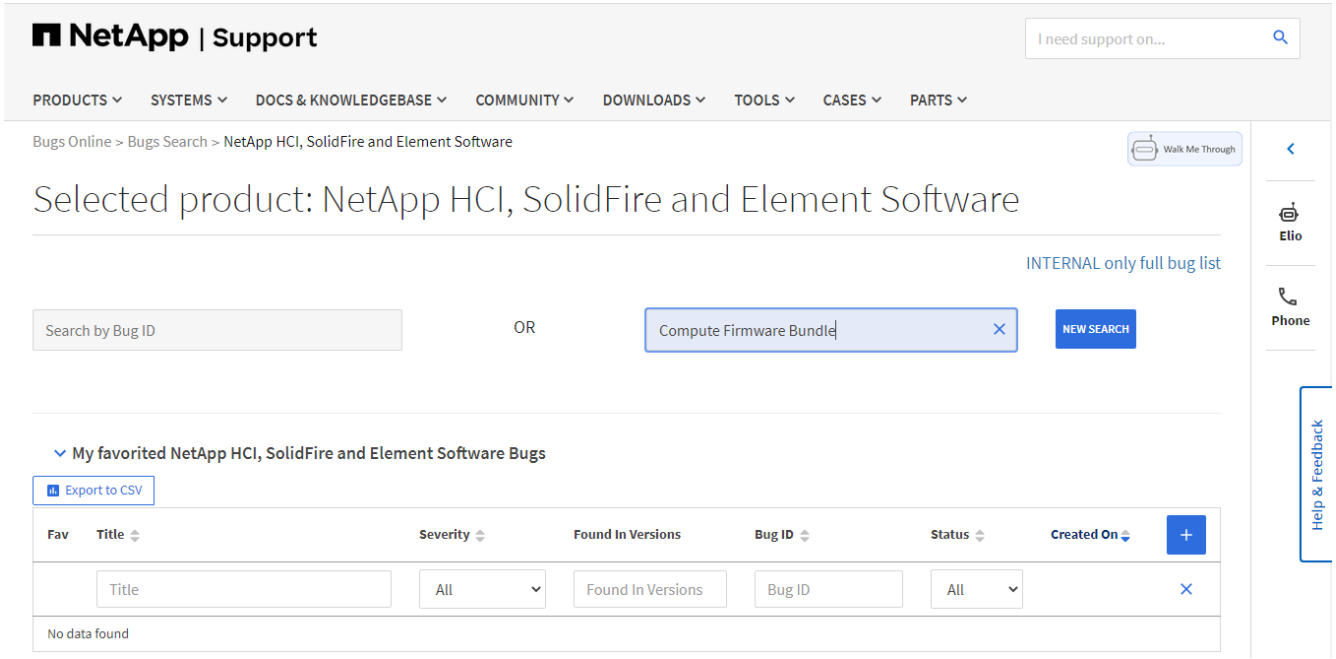

3. A list of resolved or open bugs is displayed. You can further refine the results as shown:

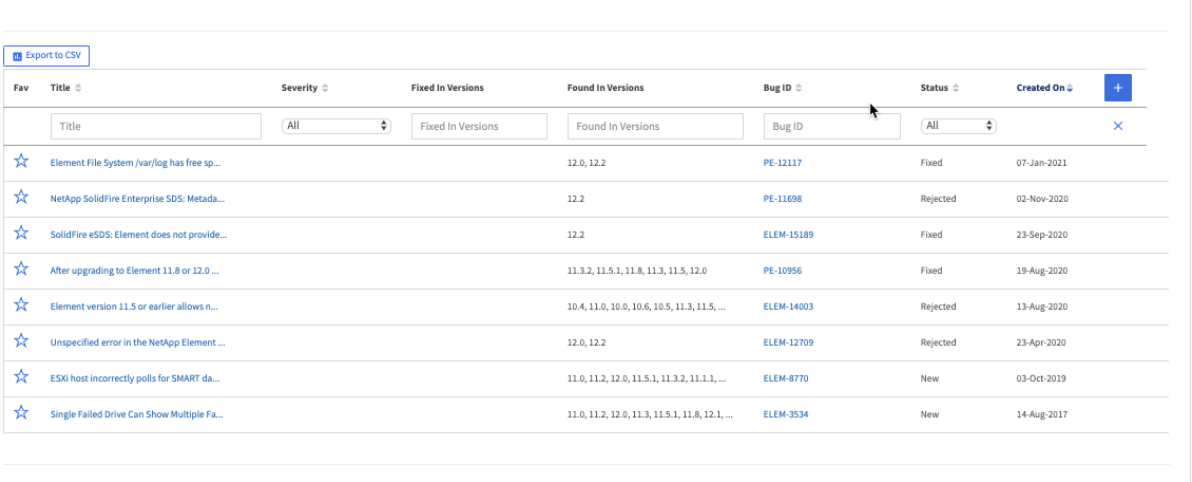

Export to CSV

Fav	Title	Severity	Fixed In Versions	Found In Versions	Bug ID	Status	Created On
	Title	All	Fixed In Versions	Found In Versions	Bug ID	All	
☆	Element File System /var/log has free sp...			12.0, 12.2	PE-12117	Fixed	07-Jan-2021
☆	NetApp SolidFire Enterprise SDS: Metada...			12.2	PE-11698	Rejected	02-Nov-2020
☆	SolidFire eSDS: Element does not provide...			12.2	ELEM-15189	Fixed	23-Sep-2020
☆	After upgrading to Element 11.8 or 12.0 ...			11.3.2, 11.5.1, 11.8, 11.3, 11.5, 12.0	PE-10956	Fixed	19-Aug-2020
☆	Element version 11.5 or earlier allows n...			10.4, 11.0, 10.0, 10.6, 10.5, 11.3, 11.5, ...	ELEM-14003	Rejected	13-Aug-2020
☆	Unspecified error in the NetApp Element ...			12.0, 12.2	ELEM-12709	Rejected	23-Apr-2020
☆	ESXi host incorrectly polls for SMART da...			11.0, 11.2, 12.0, 11.5.1, 11.3.2, 11.1.1, ...	ELEM-8770	New	03-Oct-2019
☆	Single Failed Drive Can Show Multiple Fa...			11.0, 11.2, 12.0, 11.3, 11.5.1, 11.8, 12.1, ...	ELEM-3534	New	14-Aug-2017

Find more information

- Firmware and driver versions in NetApp HCI and NetApp Element software

Copyright Information

Copyright © 2021 NetApp, Inc. All rights reserved. Printed in the U.S. No part of this document covered by copyright may be reproduced in any form or by any means-graphic, electronic, or mechanical, including photocopying, recording, taping, or storage in an electronic retrieval system-without prior written permission of the copyright owner.

Software derived from copyrighted NetApp material is subject to the following license and disclaimer:

THIS SOFTWARE IS PROVIDED BY NETAPP “AS IS” AND WITHOUT ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, WHICH ARE HEREBY DISCLAIMED. IN NO EVENT SHALL NETAPP BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES (INCLUDING, BUT NOT LIMITED TO, PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY OUT OF THE USE OF THIS SOFTWARE, EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.

NetApp reserves the right to change any products described herein at any time, and without notice. NetApp assumes no responsibility or liability arising from the use of products described herein, except as expressly agreed to in writing by NetApp. The use or purchase of this product does not convey a license under any patent rights, trademark rights, or any other intellectual property rights of NetApp.

The product described in this manual may be protected by one or more U.S. patents, foreign patents, or pending applications.

RESTRICTED RIGHTS LEGEND: Use, duplication, or disclosure by the government is subject to restrictions as set forth in subparagraph (c)(1)(ii) of the Rights in Technical Data and Computer Software clause at DFARS 252.277-7103 (October 1988) and FAR 52-227-19 (June 1987).

Trademark Information

NETAPP, the NETAPP logo, and the marks listed at http://www.netapp.com/TM are trademarks of NetApp, Inc. Other company and product names may be trademarks of their respective owners.