For all Intergamma orders, the following general inspection requirements need to be taken into account:

AQL and inspection level

Unless otherwise is stated, the following AQL level and inspection level is applicable:
AQL major 2.5/minor 4.0, general inspection level: II

Reference sample or briefing

-For new or modified items an approved golden sample will be provided to the inspection company or must be left behind sealed and packed in the factory by OBI/Intergamma representatives.
-The inspection party must check the availability of a golden sample and report missing samples to OBI before the inspection takes place.
-If a product has changed against the last inspection, then Intergamma, OBI and the inspection company should make such a sample available to the inspector on a case by case scenario.
-If the previously sealed sample at the factory was unpacked, tampered, or cannot be found, then the inspector should do the inspection, but Intergamma can decide on a RE-INSPECTION.
-If no sample is available, then OBI must report the reason to Intergamma preferably before the inspection, or latest at the time of the inspection report.
-If for practical reasons a sample cannot be provided to the inspector, then a proper briefing in the order sheet, or a photo file should be provided to the inspector. If the file has been composed by OBI then Intergamma must receive a copy as well.
-The inspection company must receive all technical and artwork documentation through OBI before the final inspection.
-If no sample was available for inspection, or the inspector has found grave differences between the production and golden sample, then a new golden sample must be dated and left behind after the inspection.
-The golden sample status must always be reported in the inspection report.

Quantity available for inspection.

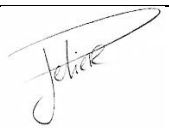
-Valid inspection is 100% finished, 100% packed.
-Valid inspection is 80% packed, 100% finished. The inspector is allowed to start the inspection, but the other 20% must be finished before the end of the inspection and must have been taken into account within the random sampling in an equal percentage. If the final packing has not been finished before the inspector left, Intergamma will decide about the need for RE-INSPECTION after reporting.
-All other inspections of a lesser quantity must be carried out, but are FAIL inspections and may need a RE-INSPECTION.
-Information about available quantity and used protocol must always be stated in the inspection report.
-For re-inspections, overtime and abortive situations the charge back rules are based on OBI procedures.

Inspection points

- Inspection needs to take place in the factory and will involve:
* Correct execution, according to specifications, materials and colours
* Correct functioning
* Correct workmanship and finishing
* Correct packing and artwork, case marks, barcode, label, stickers and manual
* For item sizes a 5% deviation is acceptable
- Any specific points for inspections are listed in the Intergamma order sheet.
- All points need to be inspected according to the product information in the order sheet, comparison to the golden sample, technical reports or briefing, general observations from the inspector and whatever is usual for the type of product group.
- Specific guide lines for PASS, FAIL and REMARK can be found in the annex

Final and binding inspection report

-Hand written reports are not accepted by Intergamma
-The Inspection certificate (IC) signed by the factory must be send to OBI before 10 am the day after the inspection. The final report with photo's must be send to OBI, within 24 hours after the inspection was finished. The report is then passed on to Intergamma the same working day or latest in the morning of the next day.
-Intergamma will reply within 24 hours. However, if 1) such a reply cannot be given within 24 hours and 2) Intergamma fails to mention the reason for the delay before the 24 hour period has expired and 3) the inspection eventually has been accepted, then a (further) delay shipment is the responsibility of Intergamma and will be accepted.
-In case lab-tests must be done according to the briefing of Intergamma's order sheet, or based on the OBI briefing or protocols, then the RELEASE will be pending for lab-tests. Only after the lab-test has been accepted, OBI can send a RELEASE Inspection Certificate to the supplier. Any shipment before the lab-test arrives is always conditional and the risk and consequences for finding wrong doing and eventually rejection are fully on supplier's account.

Intergamma	**Quality Department**	*Floris Jelier* *Head Quality Department*		21-04-2022

Annex:

Specific guide lines for PASS, FAIL, REMARK

PASS = complies to the standards, description or conditions of Intergamma.

FAIL = does not comply to the standards, description or conditions of Intergamma and are not mentioned as points for which REMARK need to be given.

REMARK = clarification about the points listed in this guide line, but which will not be judged as a point for overall FAIL of the total inspection.

***Number of mistakes based on AQL level:**

PASS = within the standards

FAIL = above standard. This includes also a high level of 1 specific mistake in the total production which is not integrated in the major or minor listings.

***Rating label:**

PASS = artwork is compliant artwork provided.

FAIL = artwork is NOT compliant to the artwork provided.

REMARK = all deviations between artwork, GS report, order description, colour box, manual.

REMARK = size of used logo's not in conformity to CE standard sizes.

REMARK = anything else noticed by the inspector, or if the artwork was not available for comparison.

***Artwork = colour box, manual, and additional stickers**

Artwork must be available to the inspector through a file or a print.

PASS = artwork is compliant with the documentation.

FAIL = artwork is not compliant with the documentation.

REMARK = anything else noticed by the inspector, or if the artwork was not available for comparison.

***Colour**

If a pantone or RAL colour is listed in the order sheet or product specification, then the inspect or must have either a correct confirmed colour sample (this can also be a golden sample) or a colour chart with him. If the inspector does not have a colour chart, then he should inquire at the factory for availability at the inspection location of a colour chart (or approved colour sample). If in advance it is known that the correct colour cannot be checked, then this must be reported back to OBI and Intergamma.

PASS = exact match

PASS = very small deviation

FAIL = large deviation

REMARK = doubtful deviations

Colour check must be listed in the inspection report, preferably with a photo of the comparison (although such photo's are only indicative).

***Barcode**

PASS = scanner can read the barcode and the barcode is conform the information in the order sheet.

FAIL = barcode cannot be read by the scanner or deviates from the information in the order sheet

***Product size, weight:**

Product sizes and weight will always be mentioned in the report in a table listing the size and weight of the actual production, the order specifications and the golden sample.

PASS = size or weight conforms to the order sheet **or** the golden sample.
FAIL = size or weight does not comply to a specific mentioned inspection point in the order sheet.
REMARK = if according to the judgment of the inspector there is a clear mistake from Intergamma's side which may lead to an unjust PASS or FAIL.
REMARK = When it is unclear on odd shapes how measuring should take place.
REMARK = Deviations larger than +/-5%.

***Colour box size or single item export cartons size with colour label:**

PASS = size according to the previous colour box sample (+1 to -2%).
PASS = size according to the provided artwork and information on the order sheet (+1 to -2%).
PASS = size according to the order sheet information (+1 to -2%) when no briefing about artwork is available.
FAIL = not according to the previous colour box sample or the (new) artwork size
REMARK = size of required colour box is not known to the inspector.
REMARK = size is outside of the tolerance.
REMARK = mistakes from Intergamma in the documentation or order sheets must be reported.
In all cases, deviations must be listed in the inspection report.

***export carton or pallet packing**

PASS = size according to the order information and correct case marks. Case marks for single packed items in full colour box are not required, unless stated in the order sheet.
PASS = deviations of less than 5% in size.
FAIL = quantity per export carton is different from the quantity listed in the order sheet.
FAIL = wrong article number or wrong quantity contents on the export carton.
FAIL = not complying with specific instructions on the order sheet or briefing and points that are not listed as REMARK.
REMARK = if no further instructions are given and an export carton is for the inspector clearly not capable to withstand normal transport and stacking.
REMARK = any deviation in listed weight, actual weight and weight listed on the order sheet.

***spare parts**

Spare parts must be treated as individual articles when they have an IG.Nr. (=Intergamma article number). The order description is leading. There is usually no artwork available.
PASS = same rules as for other articles, especially on points of individual marking and set packing.
FAIL = the spare parts are different from the parts used in the "main" product.
FAIL = total inspection is FAIL if the ordered spare parts are not ready and not correctly marked per item or per set as described in the order sheet.
REMARK = the individual packing method may be different from the order sheet. Any individual packing of the entire product or set may be in carton box instead of poly bag (or vise versa), and quantity of export carton may deviate.
REMARK = any ordered extra colour boxes are not available during the inspection.
Photo's of the contents of an individual spare part packing and of the labels must be added to the report.

***Critical parts**

PASS = critical part is identical to the order specification, latest CDF and golden sample

PASS = critical part is identical to the order specification, latest CDF, but not to golden sample.

FAIL = critical part is not identical to the order specification.

FAIL = critical part is not listed in the order sheet and not listed in the CDF.

REMARK = critical part is not listed in the order sheet, is different from the golden sample, but complies to latest CDF list.

Photo's of critical parts must be shown in the inspection report.

***Export carton drop test**

The carton drop test is not mandatory, unless otherwise stated in the P.O.

If requested, always need to be carried out on the shipment carton (= single packed items without export carton or export cartons).

PASS = complies

PASS = when the drop test was specifically excluded in the order sheet from the inspection points.

FAIL = does not comply

REMARK = supplier refuses to do the drop test.

Note: Intergamma does not have the same packaging requirements as OBI.

*Some general points that sometimes lead to mistakes:

GS marking on the type label or colour box.

GS listing is only required when Intergamma is co listed on the GS certificate and the MARKING is part of the Intergamma artwork design. Otherwise no listing is necessary.

Size of logo's and discrepancies of information on the artwork

CE required sizes on the artwork and deviations with reports or technical data are never a FAIL point, as the artwork is made by or approved by Intergamma. Deviations must only be added as a REMARK