ECEn 483 / ME 431

Practice Final - Winter 2023

Professor R. W. Beard


Na	ame:	
or	that you develor Closed email, in Work all proble Draw a box a	n notes, open J drive, open Python. You may only use files that were provided by the instructor ped yourself. Internet, and other forms of communication.
	Part 1	/ 25
	Part 2	/ 25
	Part 3	/ 25
	Part 4	/ 25
	Total	/ 100

Equations of Motion - Simulation Model

The figure below shows a point mass connected to a massless rod which is connected to the wall with a nonlinear spring and damper. The potential energy for the nonlinear spring is given by

$$V_{\text{spring}} = \frac{1}{2}k_1\theta^2 + \frac{1}{4}k_2\theta^4.$$

The joint has friction which we will model as viscous friction with damping coefficient of b=0.1. The physical parameters of the system are g=9.8 meters per second, $\ell=0.25$ meters, m=0.1 kg, $k_1=0.02$, and $k_2=0.01$. The input torque τ is limited to ± 3.0 Newton-meters.

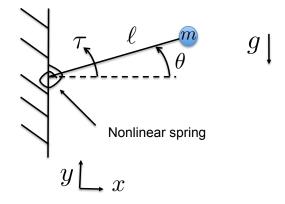

The nonlinear equations of motion for this system are

$$m\ell^2\ddot{\theta} + b\dot{\theta} + k_1\theta + k_2\theta^3 + mg\ell\cos\theta = \tau.$$

A Python implementation of this system is in rodMassDynamics.py, with parameters in rodMassParameters.py, and animation in rodMassAnimation.py.

Part 1. Design Models

For this section, use part1_rodMassSim.py to implement the simulation.

The objective of this part is to use the equations of motion to find the appropriate design models that will be used to design the feedback control strategies.

- 1.1 Suppose that the objective is to linearize the system around the equilibrium angle θ_e , which may or may not be zero. Find the associated equilibrium torque τ_e so that θ_e is an equilibrium of the system.
- 1.2 Create a controller that places a constant torque constant torque of τ_e on the physical system. Set the initial conditions to $\theta(0) = \dot{\theta}(0) = 0$ to verify that the equilibrium force is correct, assuming that $\theta_e = 0$ degrees. Insert a plot of the output of the system with initial condition $\theta(0) = \theta_e = 0$ and an input of τ_e in the associated Word document.
- 1.3 Using Jacobian linearization, linearize the nonlinear model around the equilibrium (θ_e, τ_e) .
- **1.4** Find the transfer function of the linearized model when $\theta_e = 0$.
- **1.5** Find a state-space model for the system linearized around θ_e , u_e when $\theta_e = 0$. For your states use $x = (\tilde{\theta}, \dot{\tilde{\theta}})^{\top}$.

Part 2. PID Control

For this section, use part2_rodMassSim.py to implement the simulation. An input disturbance of d = 0.5 should be included in the simulation.

The sampling rate for the controller is $T_s = 0.01$. Use a dirty derivative gain of $\sigma = 0.005$.

- **2.1** Using the transfer function derived in Problem 1.4, draw the block diagram for the system using PD control, where the derivative gain multiples the angular rate and not the derivative of the error.
- **2.2** Derive the transfer function from the reference input θ_r to the angle θ .
- **2.3** Find the gain k_p and k_d so that the rise time of the system is $t_r = 0.1$ and the damping ratio is $\zeta = 0.707$. Write down your final gains in this booklet.
- **2.4** Using a dirty derivative, implement PD control where the input θ_r is a square wave with an amplitude of ± 20 degrees and a frequency of $\omega = 0.1$ Hertz. Insert a plot in the Word file that shows both θ_r and θ for 20 seconds of simulation.
- 2.5 Add an integrator to remove the steady state error. What is the value of the integrator? Insert a plot in the Word file that shows both θ_r and θ for 20 seconds of simulation.
- 2.6 Insert a copy of the control code ctrlPID.py in the Word document.

Part 3. Observer-based Control

For this section, use part3_rodMassSim.py to implement the simulation. An input disturbance of d = 0.5 should be included in the simulation. The sampling rate for the controller is $T_s = 0.01$.

The objective of this part is to design a state feedback controller of the form

$$u = u_e - K\hat{x} - k_i \int (\theta_r - C_r\hat{x})d\sigma - \hat{d}$$

to regulate the angle to a commanded input, and where the estimated state \hat{x} and the estimated disturbance \hat{d} is produced by the observer

$$\dot{\hat{x}}_2 = A_2(\hat{x}_2 - x_{2e}) + B_2(u - u_e) + L_2(y - C_2\hat{x}_2).$$

- **3.1** Find the feedback gain K that places the poles so that the rise time is $t_r = 0.1$ s and the damping ratio is $\zeta = 0.707$, and the integrator gain k_i so that the pole of the integrator is at $p_{int} = -10$. Write the gains in this booklet.
- **3.2** Find the observer gains so that the poles of the observation error, i.e., the eigenvalues of A LC, are five times the eigenvalues of A BK. Write the observer gains in this booklet.
- **3.3** Add a disturbance observer, where the pole of the disturbance observer is $p_{dist} = -1$.
- 3.4 Implement the observer based control and tune the controller and estimator as needed.
- 3.5 Insert a plot of the step response of the system (θ and θ_r), for the complete observer based controller in the Word document.
- 3.6 Insert a plot of the estimation error and disturbance estimation error in the Word document.
- 3.7 Insert a copy of the control code ctrlObsv.py in the Word document.

Part 4. Loopshaping

For this section, use part4_rodMassSim.py to implement the simulation. An input disturbance of d = 0.5 should be included in the simulation. The sampling rate for the controller is $T_s = 0.01$.

- 4.1 Using the PID controller derived in the Part 3, graph the Bode Plot of the loop gain of the original open loop system using PID control. Using PID control, what is the attenuation on the noise for noise with frequency content above 100 rad/sec? Using PID control, what is the tracking accuracy for reference signals with frequency content below 0.001 rad/sec.
- **4.2** Starting with the PID controlled plant, add a lead filter so that the phase margin is $PM = 60^{\circ}$.
- **4.3** Add a lag filter to improve the tracking accuracy for signals with frequency content below $\omega_r = .02 \text{ rad/sec}$ by a factor of 10.
- **4.4** Add a low pass filter to increase noise attenuation by a factor of 10 for noise with frequency content above $\omega_n = 2000 \text{ rad/sec.}$ What is the final controller C(s)? Write the transfer function in this booklet. *Hint:* Use print('C(s)=', C) in the loopshaping file.
- **4.5** Add a prefilter to remove any overshoot in the response. Write the transfer function of the prefilter in this booklet. *Hint: Use* print('F(s)=', F) *in the loopshaping file.*
- 4.6 Insert a graph in the Word file that simultaneously show Bode plots for the original plant, the PID controlled plant, and the plant augmented with loopshaping.
- 4.7 Implement the controller in simulation. Insert a plot in the Word file that shows both θ_r and θ for 20 seconds of simulation.
- 4.8 Insert a copy of the loopshaping code loopshapeRodMass.py in the Word document.