





Member of the Phoenix Contact Group

P C B Layouts






| SCITES IV (All measurements in min) | Con |
|--|--|
| 6 positions RC-06 (6 x 2 mm Ø) | 7 positions RC-07 (7 x 2 mm Ø) |
| 8,25 | 8,25 |
| 9 positions RC-09 (8 x 1 mm, 1 x 2 mm Ø) | 9 positions RC-63 (6 x 1 mm, 3 x 2 mm Ø) |
| 8,7 3,6 | 10,15 4,2 3,45 5,70 4,5 4,5 4,5 4,5 4,5 4,5 4,5 4,5 4,5 4,5 |






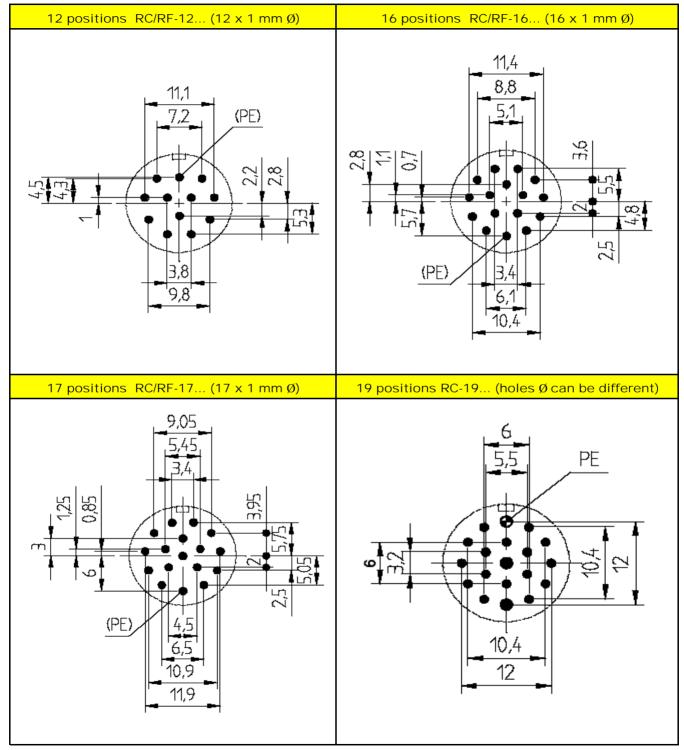



PCB Layouts for Coninvers Connector Inserts Series HC (All measurements in mm)

26/28 positions HC-26/28... (26/28 x 1 mm Ø)

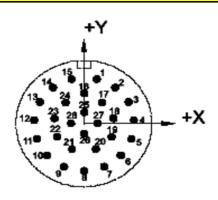

| Pos. 11 Pos. 12 Pos. 13 Pos. 14 Pos. 15 Pos. 16 Pos. 17 Pos. 18 Pos. 19 | (X / Y) = (-7,28/ -2,53) = (-7,7 / +0,6) = (-6,82/ +3,65) = (-4,8 / +6,05) = (-1,95/ +7,47) = (0 / +5,03) = (+2,82/ +3,6) = (+4,55/ +0,97) = (+4,2 / -2,13) | |
|---|--|---|
| Pos. 19 Pos. 20 | |) |
| | | |


| (X / Y) |
|---|
| Pos. 21 = $(-1,83/-4,17)$ |
| Pos. 22 = (-4,2 / -2,13) |
| Pos. 23 = (-4,55/ +0,97) Pos. 24 = (-2,82/ +3,6) |
| Pos. 25 = (0 /+1,88) |
| Pos. 26 = (0 / -1,6) |
| Pos. 27 = (+2,02/+0,14) |
| Pos 28 = $(-2.02/\pm0.14)$ |





PCB Layouts for Coninvers Connector Inserts Series SC/SF/SSP (All measurements in mm)

6 (5+PE) and 8 (4+3+PE) positions SC/SF/SSP-06 or SC/SF/SSP-08

(6 x 2 mm Ø and 4 x 1 mm + 4 x 2 mm Ø)

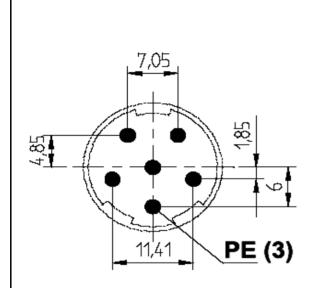



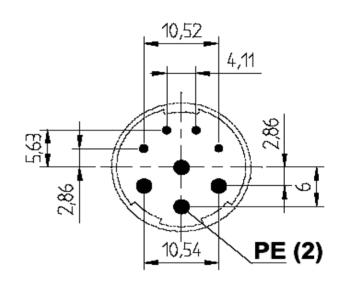

8pol. (4+3+PE)