# Exercise 1a: Forward Kinematics of the ABB IRB 120

Prof. Marco Hutter\*
Teaching Assistants: Vassilios Tsounis, Jan Carius, Ruben Grandia<sup>†</sup>

October 3, 2017



Figure 1: The ABB IRW 120 robot arm.

## Abstract

The aim of this exercise is to calculate the forward and inverse kinematics of an ABB robot arm. In doing so, you will practice the use of different representations of the end-effector's orientation as well as how to check whether your implementations are correct. Essentially, the task is to implement the functions for computing the forward and inverse kinematics using symbolic and numerical computations in MATLAB. A separate MATLAB script will be provided for the 3D visualization of the robot arm.

## 1 Introduction

The following exercise is based on an ABB IRB 120 depicted in Figure 2. It is a 6-link robotic manipulator with a fixed base. During the exercise you will implement several different MATLAB functions, which you should test carefully since the

<sup>\*</sup>original contributors include Michael Blösch, Dario Bellicoso, and Samuel Bachmann

 $<sup>^\</sup>dagger tsounisv@ethz.ch, jan.carius@mavt.ethz.ch, ruben.grandia@mavt.ethz.ch$ 

following tasks are often dependent on them. To help you with this, use the provided script prototypes (download from http://www.rsl.ethz.ch/education-students/lectures/robotdynamics.html).

# 2 Forward Kinematics

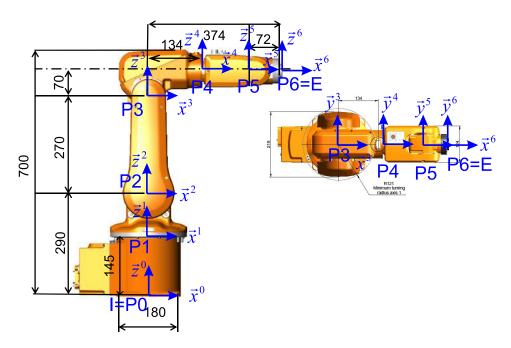


Figure 2: ABB IRB 120 with coordinate systems and joints. The units are mm.

Throughout this document, we will employ I for denoting the inertial world coordinate system (coordinate system P0 in Figure 2) and E for the coordinate system attached to the end-effector (coordinate system P6 in Figure 2).

You should always check your solutions with the provided script evaluate\_problems.m. This script compares your implementation with our solution on random data points.

## Exercise 2.1

Define a vector  $\mathbf{q}$  of generalized coordinates to describe the configuration of the ABB IRB120. Recall that generalized coordinates should be *complete* and *independent*. The former property means that they should fully described the configuration of the robot while at the same time comprising a minimal set of coordinates. The latter property refers to the fact that the each generalized coordinate must not be a function of any of the others.

## Exercise 2.2

Assume from here on that the generalized coordinates  $\mathbf{q}$  are the joint angles of the robot arm numbered according to Figure 2. Positive angles imply rotations around the positive coordinate axis.

Compute the homogeneous transformations matrices  $\mathbf{T}_{k-1,k}(q_k)$ ,  $\forall k=1,\ldots,6$ . Additionally, find the constant homogeneous transformations between the inertial frame and frame 0 ( $\mathbf{T}_{I0}$ ) and between frame 6 and the end-effector frame ( $\mathbf{T}_{6E}$ ). Please implement the following functions (i.e., replace the zero assignments with your solution):

```
function TI0 = getTransformI0()
     % Input: void
     \mbox{\%} Output: homogeneous transformation Matrix from frame 0 to the \dots
          inertial frame I. T_IO
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
     TI0 = zeros(4);
6
7 end
   function T01 = jointToTransform01(q)
9
10
     % Input: joint angles
     % Output: homogeneous transformation Matrix from frame 1 to frame ...
         0. T_01
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
13
     T01 = zeros(4);
14
15
   end
16
   function T12 = jointToTransform12(q)
17
18
     % Input: joint angles
     % Output: homogeneous transformation Matrix from frame 2 to frame ...
19
          1. T<sub>-</sub>12
20
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
21
     T12 = zeros(4);
23 end
24
   function T23 = jointToTransform23(q)
     % Input: joint angles
26
     \mbox{\%} Output: homogeneous transformation Matrix from frame 3 to frame ...
27
          2. T<sub>2</sub>3
28
29
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
     T23 = zeros(4);
30
31 end
33 function T34 = jointToTransform34(q)
     % Input: joint angles
     % Output: homogeneous transformation Matrix from frame 4 to frame ...
35
          3. T 34
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
37
     T34 = zeros(4);
38
40
41
   function T45 = jointToTransform45(q)
     % Input: joint angles
43
     \$ Output: homogeneous transformation Matrix from frame 5 to frame ...
          4. T<sub>-</sub>45
45
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
     T45 = zeros(4);
47
49
   function T56 = jointToTransform56(q)
50
     % Input: joint angles
     % Output: homogeneous transformation Matrix from frame 6 to frame ...
52
          5. T<sub>-</sub>56
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
54
55
    T56 = zeros(4);
57
   function T6E = getTransform6E()
     % Input: void
59
     \mbox{\%} Output: homogeneous transformation Matrix from the end-effector \dots
60
```

```
frame E to frame 6. T_6E

61

62 % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION

63 T6E = zeros(4);

64 end
```

## Exercise 2.3

Find the end-effector position vector  ${}_{I}\mathbf{r}_{IE} = {}_{I}\mathbf{r}_{IE}(\mathbf{q})$ . Please implement the following function:

```
1 function I.r.IE = jointToPosition(q)
2 % Input: joint angles
3 % Output: position of end—effector w.r.t. inertial frame. I_r_IE
4
5 % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
6 I.r.IE = zeros(3,1);
7 end
```

#### Exercise 2.4

What is the end-effector position for  $\mathbf{q} = \begin{pmatrix} \pi/6 \\ \pi/6 \\ \pi/6 \\ \pi/6 \\ \pi/6 \\ \pi/6 \end{pmatrix}$ ?

Use Matlab (abbRobot.setJointPositions(q)) to visualize it.

## Exercise 2.5

Find the end-effector rotation matrix  $\mathbf{C}_{IE} = \mathbf{C}_{IE}(\mathbf{q})$ . Please implement the following function:

```
1 function C_IE = jointToRotMat(q)
2 % Input: joint angles
3 % Output: rotation matrix which projects a vector defined in the
4 % end—effector frame E to the inertial frame I, C_IE.
5
6 % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
7 C_IE = zeros(3);
8 end
```

## Exercise 2.6

Find the quaternion representing the attitude of the end-effector  $\xi_{IE} = \xi_{IE}(\mathbf{q})$ . Please also implement the following function:

- Two functions for converting from quaternion to rotation matrices and viceversa. Test these by converting from quaternions to rotation matrices and back to quaternions.
- $\bullet$  The quaternion multiplication  ${\pmb q} \otimes {\pmb p}$
- The passive rotation of a vector with a given quaternion. This can be implemented in different ways which can be tested with respect to each other. The easiest way is to transform the quaternion to the corresponding rotation matrix (by using the function from above) and then multiply the matrix with the vector to be rotated.

Also check that your two representations for the end-effector orientation match with each other. In total you should write the following five functions:

```
function quat = jointToQuat(q)
     % Input: joint angles
     % Output: quaternion representing the orientation of the end-effector
     % q_IE.
4
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
    quat = zeros(4,1);
   end
8
10 function R = quatToRotMat(q)
11
     % Input: quaternion [w x y z]
     % Output: corresponding rotation matrix
12
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
14
   R = zeros(3);
15
17
   function q = rotMatToQuat(R)
18
    % Input: rotation matrix
19
     % Output: corresponding quaternion [w x y z]
20
^{21}
    % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
    q = zeros(4,1);
23
24 end
25
26
  function q_AC = quatMult(q_AB, q_BC)
    % Input: two quaternions to be multiplied
27
     % Output: output of the multiplication
28
30
    % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
    q_AC = zeros(4,1);
31
33
34 function B_r = rotVecWithQuat(q_BA,A_r)
    % Input: the orientation quaternion and the coordinate of the ...
35
         vector to be mapped
     % Output: the coordinates of the vector in the target frame
     % PLACEHOLDER FOR OUTPUT -> REPLACE WITH SOLUTION
    B_r = zeros(3,1);
40 end
```