



3-6 Wiring Method

Integrated Junction Box (Aluminum Case)

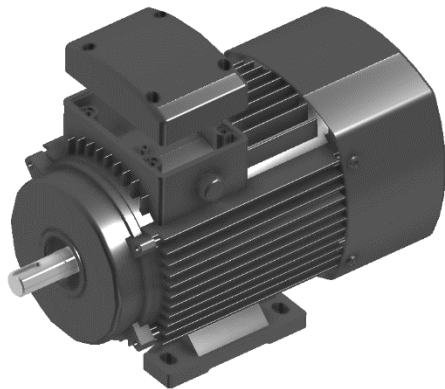

Split Junction Box (Cast Iron Case)

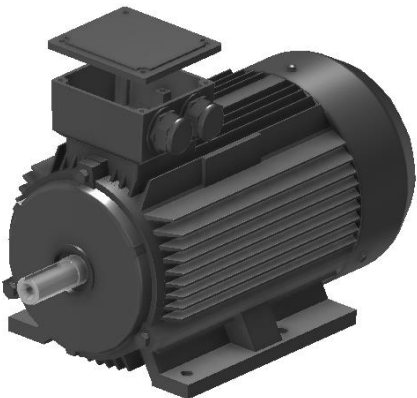

3-6-1 Wiring Method

- Tri-binding Post Junction Box (Aluminum Case)  
Motor in an aluminum shell ( the tenth digit in the motor model name is A) uses a tri-binding post junction box. The external power supply and the U, V, W outlet wire of the motor are locked on the three binding posts for power transmission. The temperature sensors KTY-84 (yellow and green wires) and PTC-130 (double blue wires) can be used for real-time temperature monitoring and over-temperature protection.
- Hex-binding Posts Junction Box (Cast Iron Case)  
Motor in a cast iron shell (the tenth digit in the motor model name is B) uses a hex-binding posts junction box. Its front and rear conduction adopt a two-row three-column wiring design. The motor U1, V1, W1 outlet wires are locked to one end of the three posts, and the other end is locked with the external power supply U2, V2, W2 for power transmission. The temperature sensor KTY-84 (yellow and green wire) and PTC-130 (double blue wire) can be used for real-time temperature monitoring and over-temperature protection.

