


2.5.2 Posture area

When a SCARA robot is connected, the Posture area shows the following:



- H indicates the arm configuration of the robot. A 4-axis SCARA robot can be right-handed or left-handed:

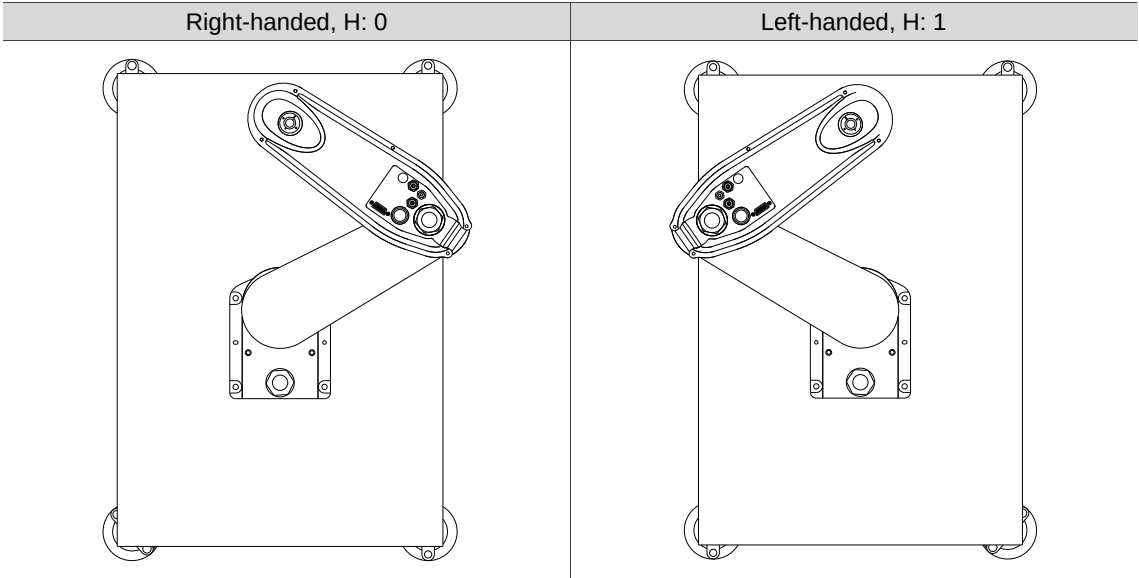

- JRC4 indicates the JRC (Joint Rotation Count) of the J4 axis.
When $-180^{\circ} \leq \text{rotation angle} < +180^{\circ}$, the JRC4 shows 0.
When $180^{\circ} \leq \text{rotation angle} < 360^{\circ}$ or $-360^{\circ} \leq \text{rotation angle} < -180^{\circ}$, the JRC4 shows 1.