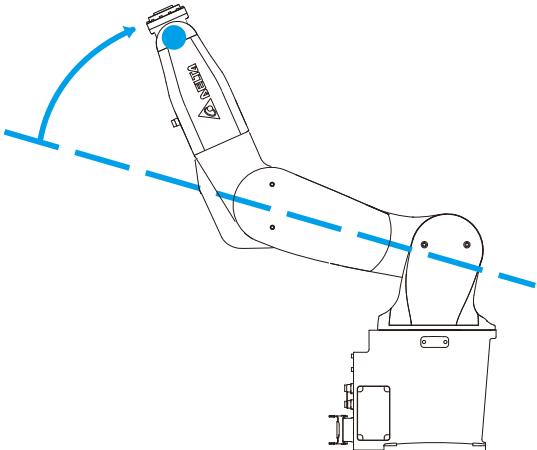
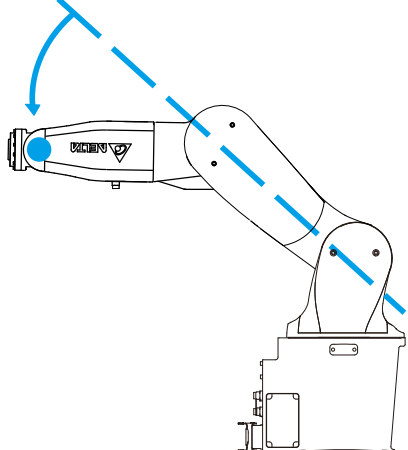


When a VA robot is connected, the Posture area shows the following:

Posture

E: 0 S: 0 F: 0 JRC4: 0 JRC6: 0

- E indicates the elbow condition of the robot, and there are two conditions. Determined based on the position of J3 (the dashed lines in the following figures). The robot is in the elbow down condition (E: 0) when J3 is below J5 (the blue dots in the following figures); the robot is in the elbow up condition (E: 1) when J3 is above J5.

Elbow down, E: 0 J1 axis is at 0°	Elbow up, E: 1 J1 axis is at 0°
	
Elbow down, E: 0 J1 axis rotates more than ±90°	Elbow up, E: 1 J1 axis rotates more than ±90°
