

Copper cutting guide - 20s4p Max G3 pack - 100 mm roll


Uses 902 mm of the roll for one pack (4 roll pages, 21 pieces, both faces).

1. Print every page at 100 % / 'Actual size' (NOT 'fit to page'). Check the 100 mm bar below with a ruler.
2. Roll pages 2-5: cut each page along its dashed JOIN lines, butt the pages together in order (page numbers and the mm scale along the roll edge must run on) and tape them on the back.
3. Lay the strip on the copper with the thick ROLL EDGE lines on the copper edges. Glue stick or tape it down.
4. Cut out every piece along its outline with sharp scissors / snips, paper and copper together.
5. Punch an 8 mm hole at every circle (+ marks the centre). Cut the 3 sides of each small TAB rectangle (U-flap for the balance wire, see README section 6).
6. B- / B+: the tongue folds down along the dashed FOLD line. Solder the main lead before welding.
7. Leave the paper on until the piece is placed: its label says which face + piece. Pages 6-7 are 1:1 maps of both faces to check where each piece goes.



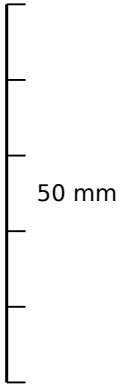


Overview (not to scale): 100 mm roll, numbers = roll page

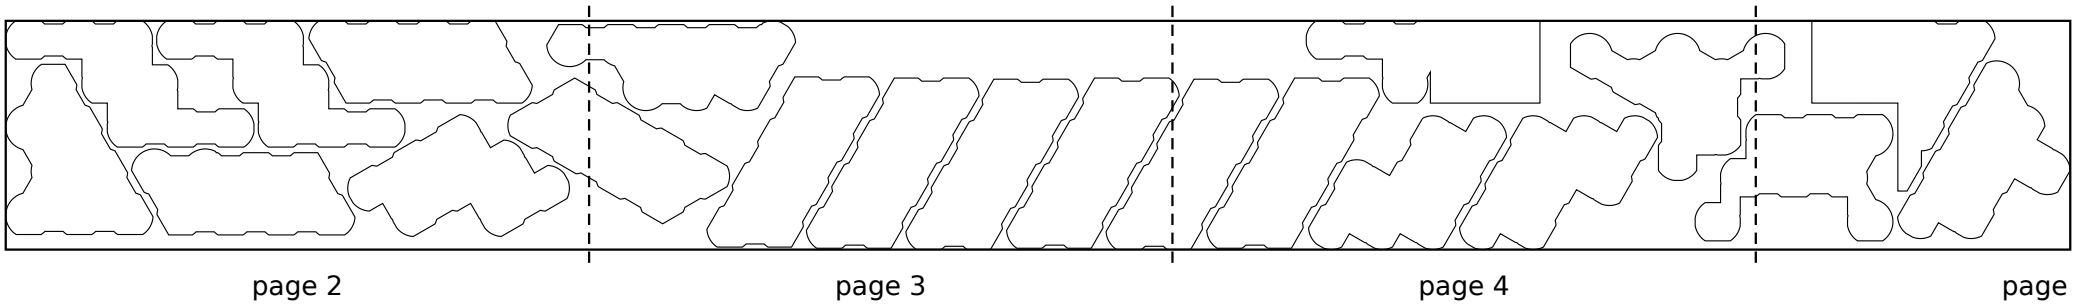

ROLL page 2 of 5 - roll 0 to 255 mm (1:1, print at 100 %)

Thick lines = copper roll edges. Cut along every piece outline. Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides).

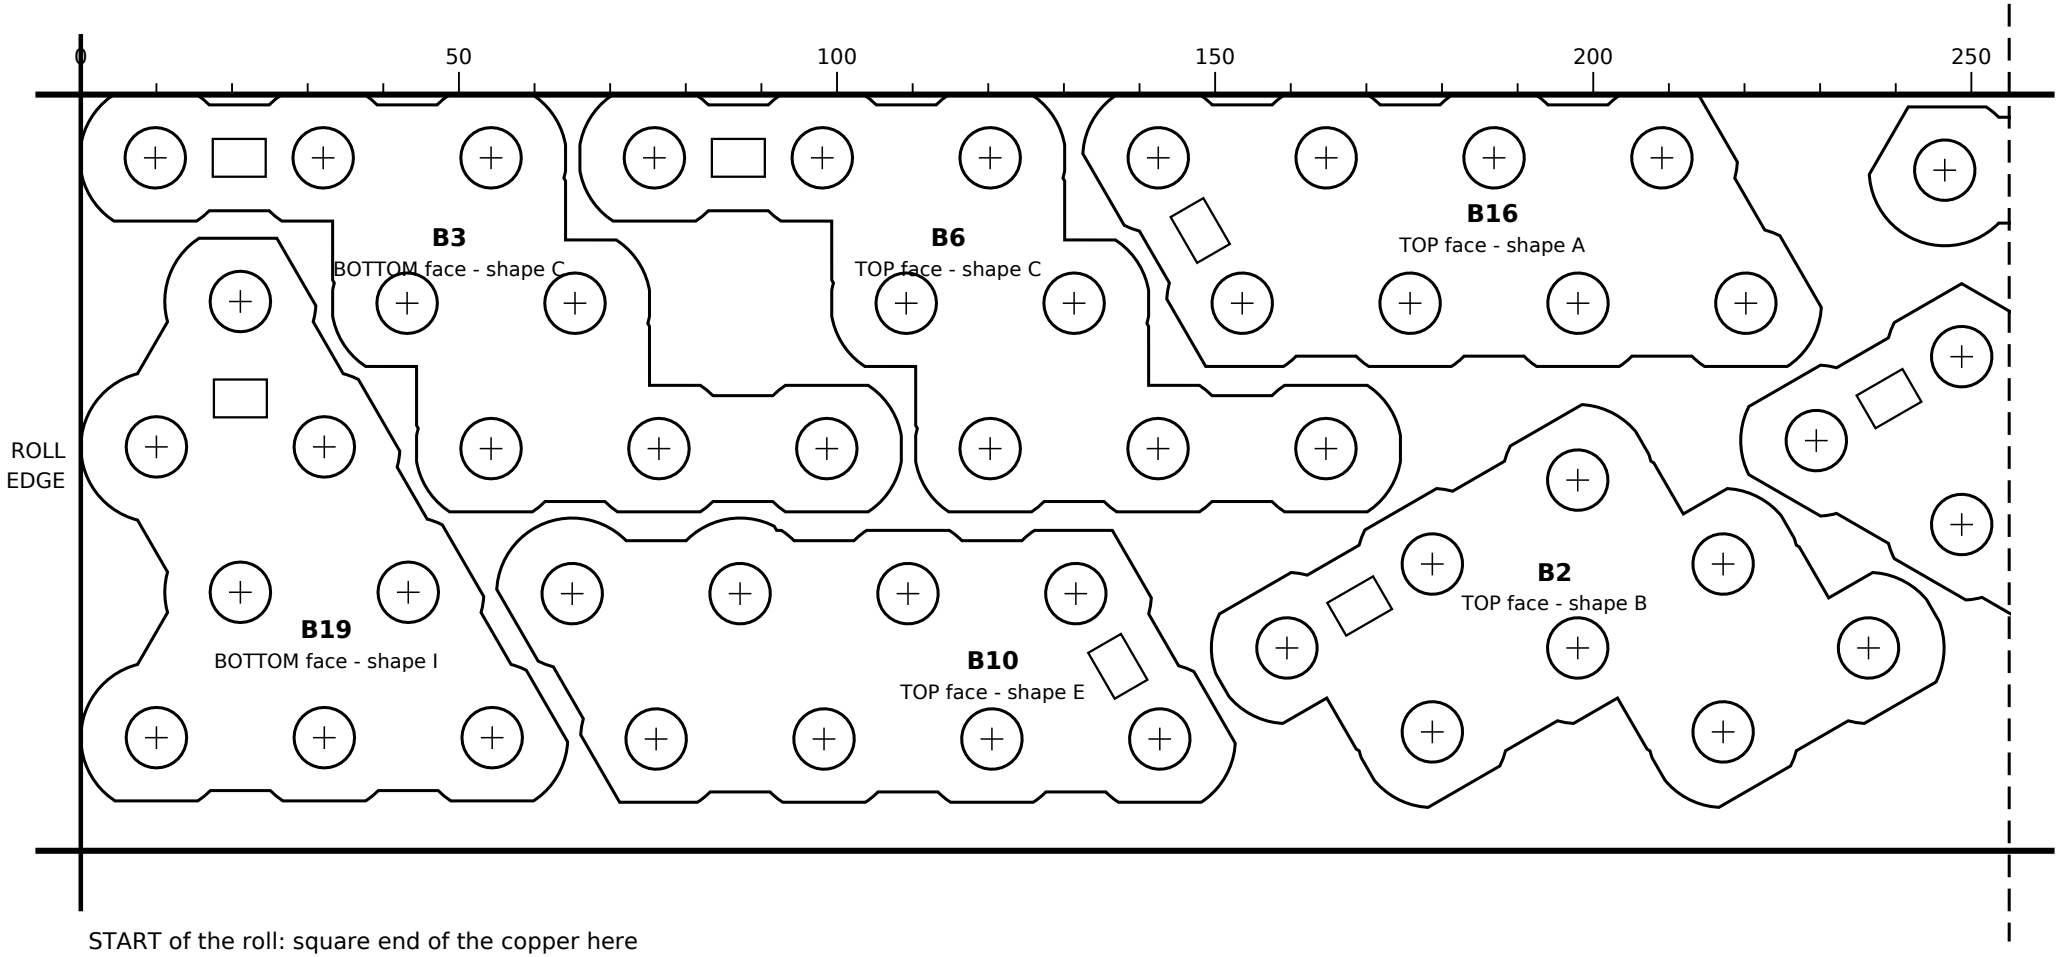


START of the roll: square end of the copper here

JOIN - cut here, page 3 goes this side

100 mm - measure this: it must be exactly 100 mm

ROLL page 3 of 5 - roll 255 to 510 mm (1:1, print at 100 %)

Thick lines = copper roll edges. Cut along every piece outline. Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides).

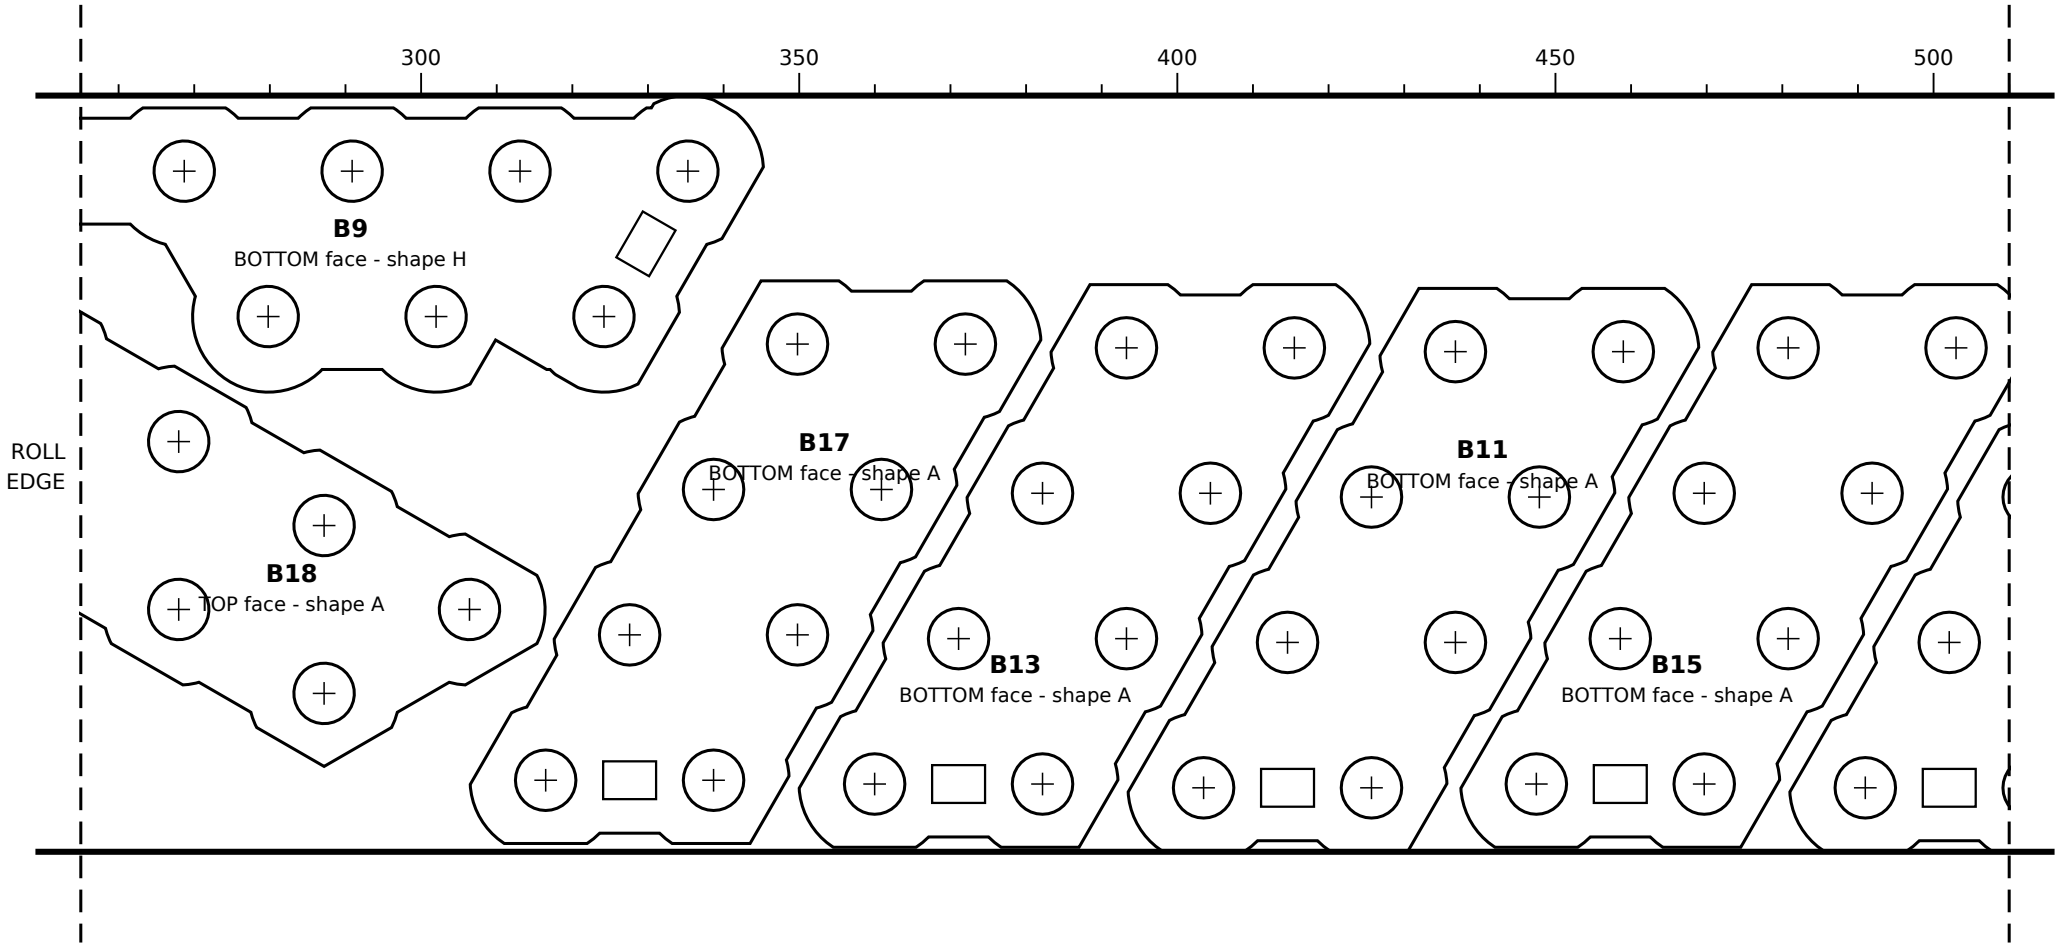


JOIN - cut here, page 2 goes this side

JOIN - cut here, page 4 goes this side

100 mm - measure this: it must be exactly 100 mm

ROLL page 4 of 5 - roll 510 to 765 mm (1:1, print at 100 %)


Thick lines = copper roll edges. Cut along every piece outline. Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides).

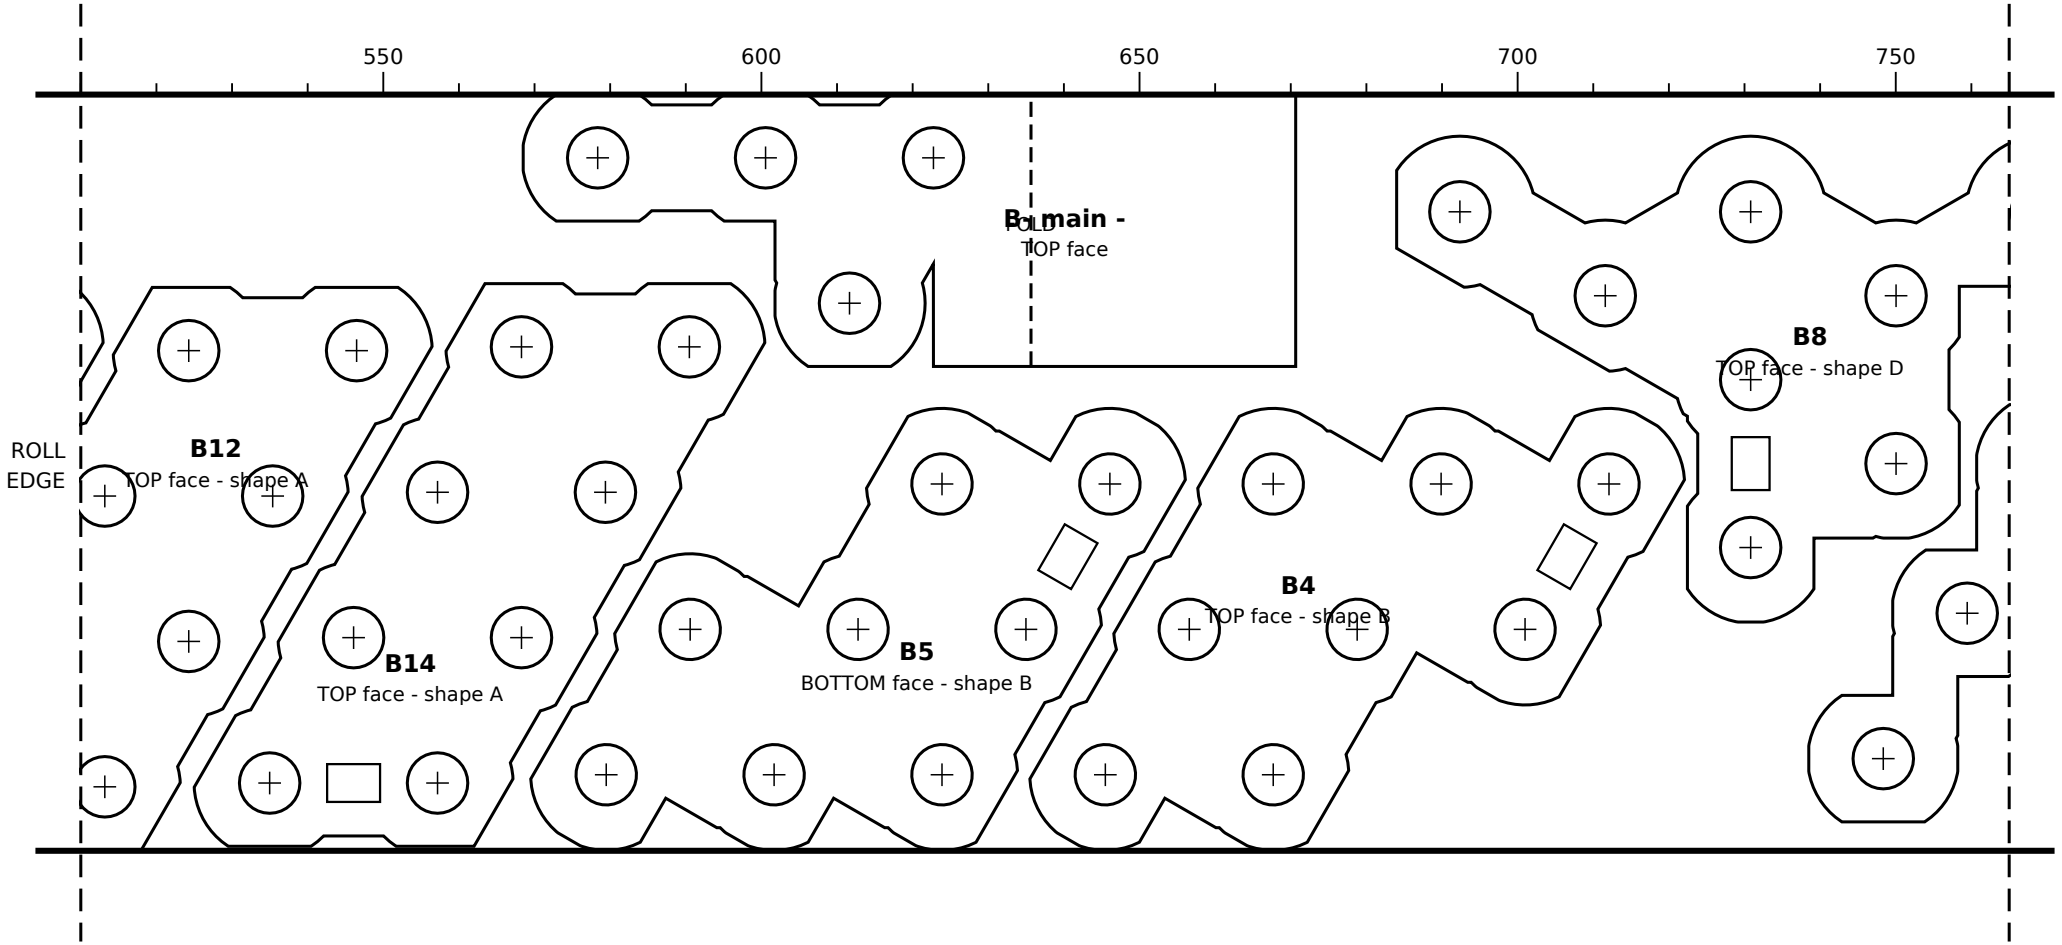

100 mm - measure this: it must be exactly 100 mm

ROLL page 5 of 5 - roll 765 to 902 mm (1:1, print at 100 %)

Thick lines = copper roll edges. Cut along every piece outline. Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides).

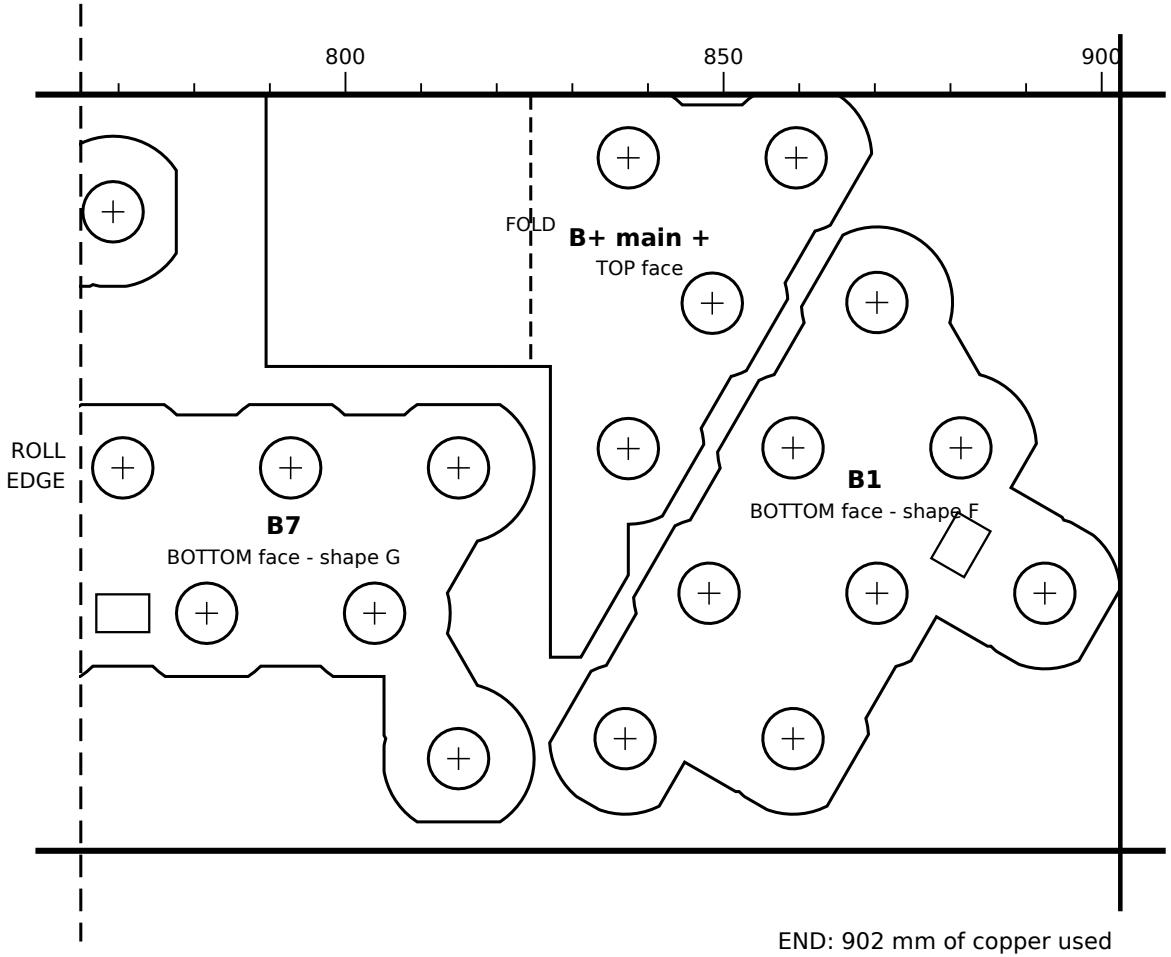


END: 902 mm of copper used

JOIN - cut here, page 4 goes this side

100 mm - measure this: it must be exactly 100 mm

TOP face placement map - seen from ABOVE - 1:1


Divider end on the LEFT. Each outline = one copper piece with its label. Cell: group number and the terminal facing you.

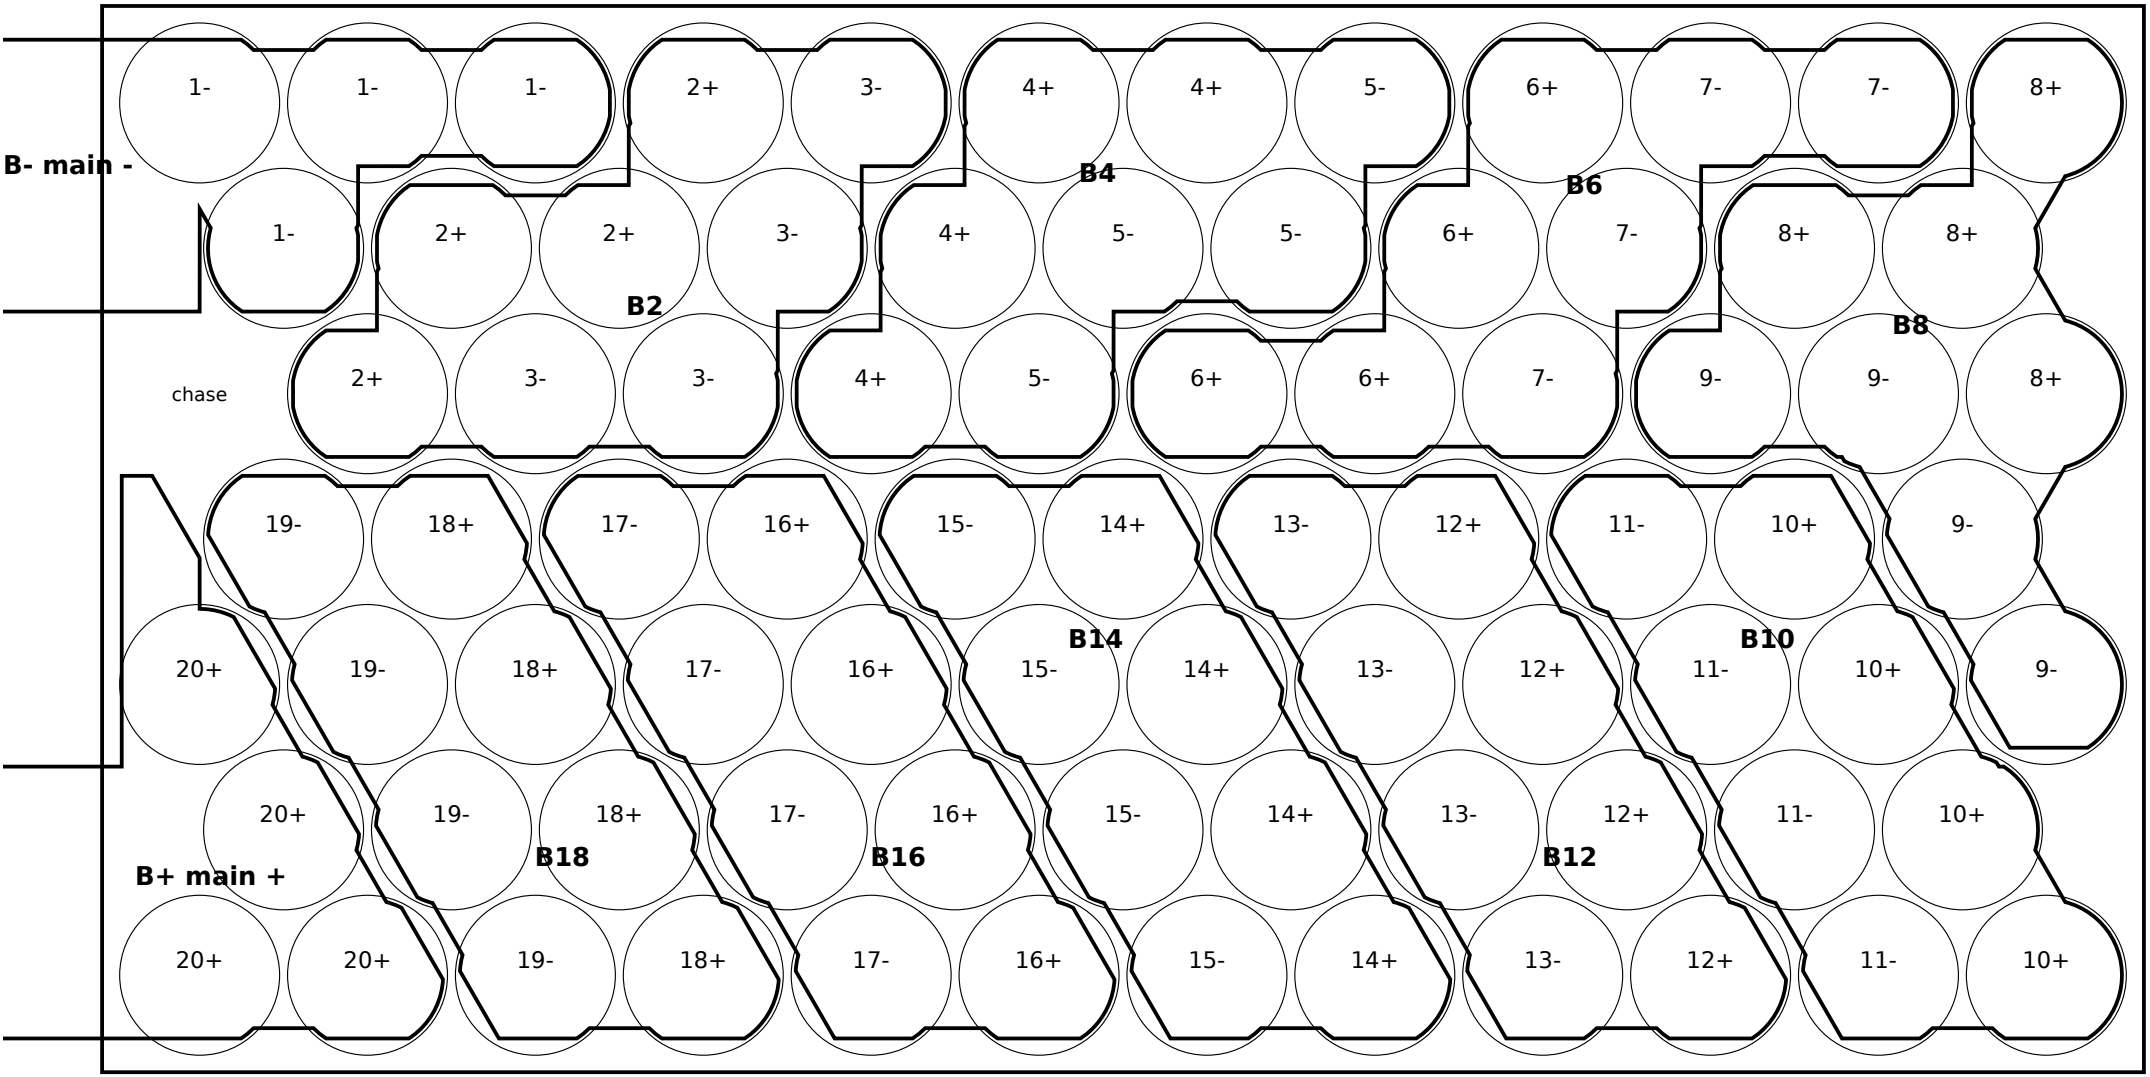

<- DIVIDER END (lead tongues fold down here)

BOTTOM face placement map - seen from BELOW (pack rolled over its long side) - 1:1

Divider end on the LEFT. Each outline = one copper piece with its label. Cell: group number and the terminal facing you.

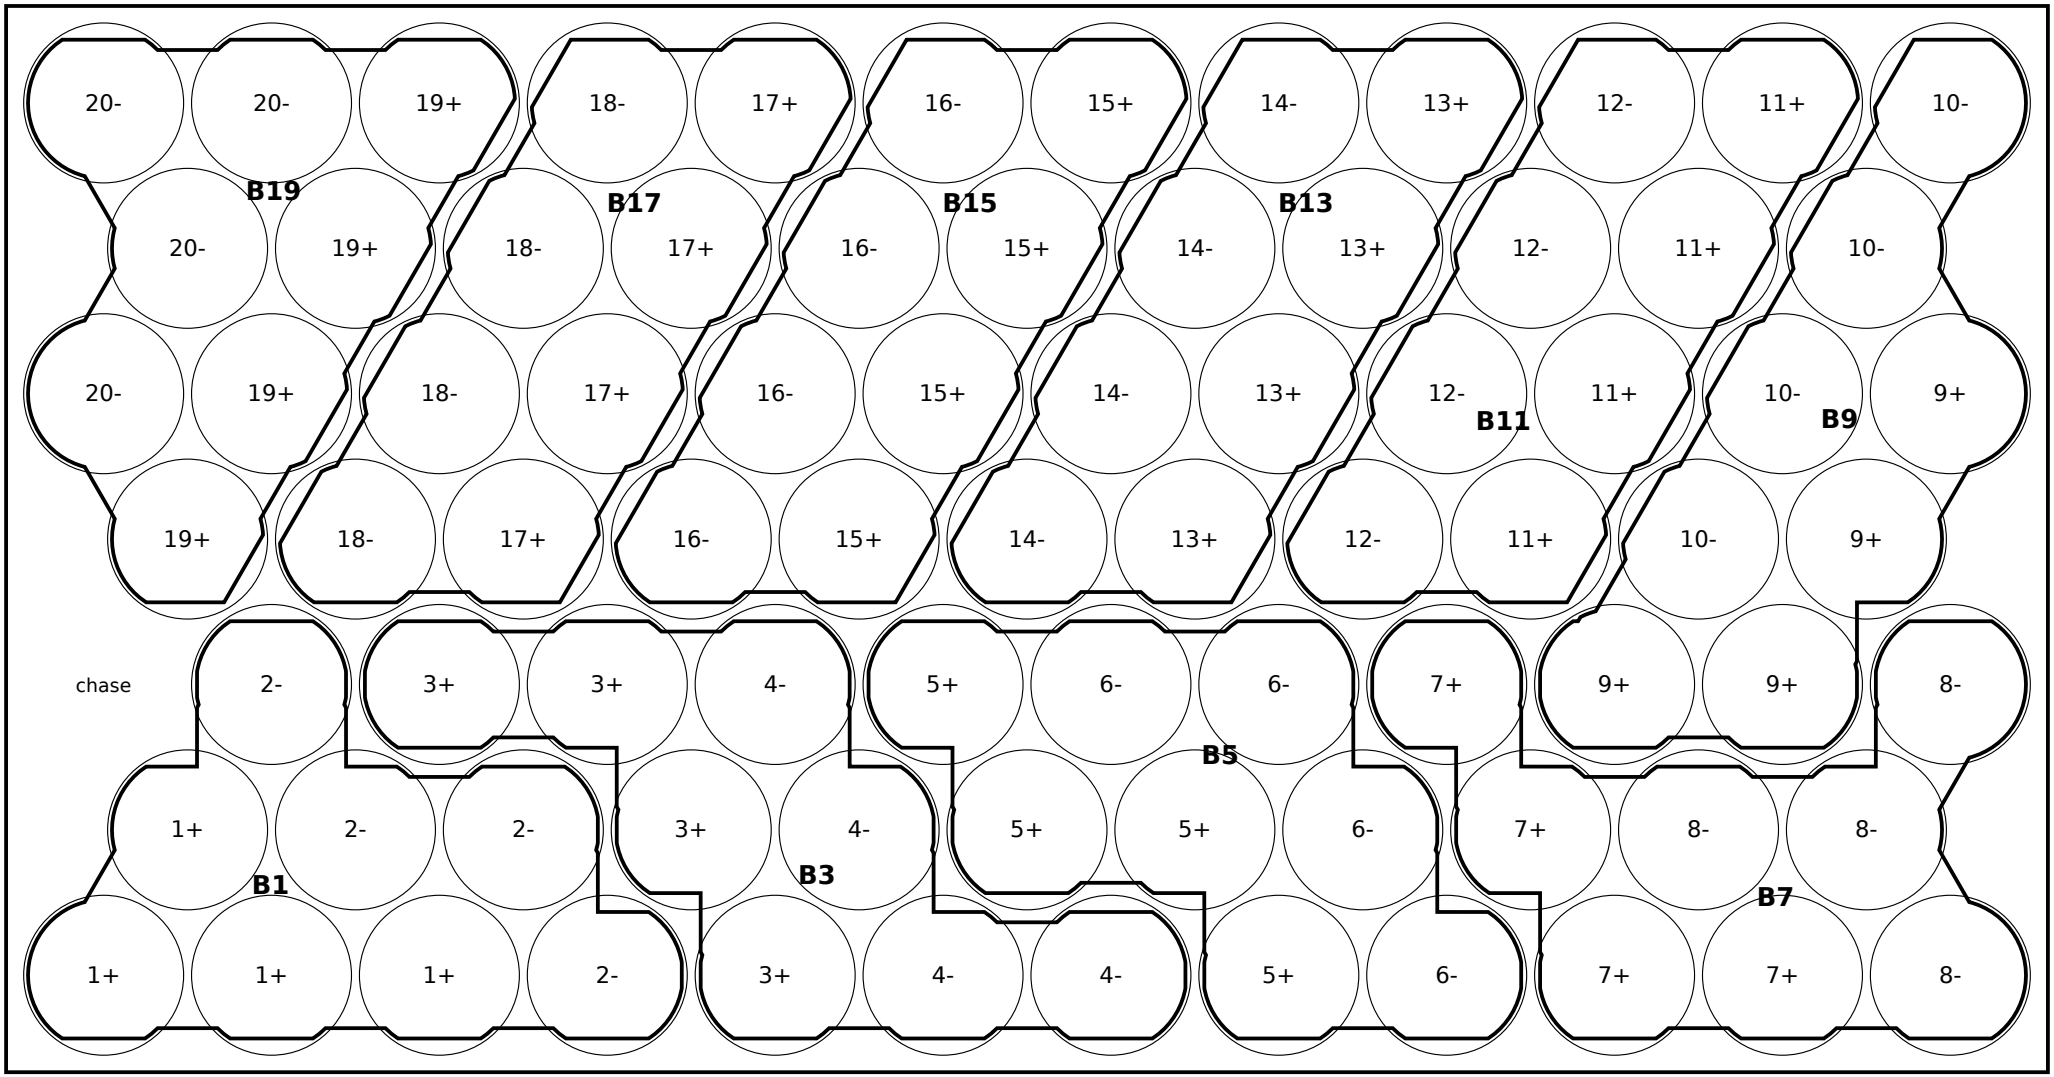

<- DIVIDER END (lead tongues fold down here)