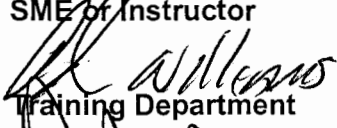



**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

STATION:	SALEM		
SYSTEM:	Containment Spray		
TASK:	Perform Containment Spray Valve Verification (Flush the Containment Spray Educator)		
TASK NUMBER:	N0260070201		
JPM NUMBER:	14-01 NRC IP-i		
ALTERNATE PATH:	☐	K/A NUMBER:	026 2.2.12
APPLICABILITY:	IMPORTANCE FACTOR:		
EO ☐	RO ☒	STA ☐	SRO ☒
		RO	4.1
		SRO	
EVALUATION SETTING/METHOD:	In Plant-Simulate		
REFERENCES:	S1.OP-ST.CS-0003, Rev. 5, Inservice Testing Containment Spray Valves SA-AA-2113, Rev. 5, Chemical Safety		
TOOLS AND EQUIPMENT:	None		
VALIDATED JPM COMPLETION TIME:	10 min		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:	N/A		
Developed By:	G Gauding Instructor	Date:	9-16-15
Validated By:	S Bickhart / M spencer SME or Instructor	Date:	9-29-15
Approved By:	 Training Department	Date:	10-7-15
Approved By:	 Operations Department	Date:	10-9-15
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:			
GRADE:	☐ SAT	☐ UNSAT	
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:		DATE:	

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Containment Spray

TASK: Perform Containment Spray Valve Verification (Flush the Containment Spray Educator)

**TASK
NUMBER:** N0260070201

**INITIAL
CONDITIONS:**

- Unit 1 is operating normally at 100% power.
- The crew is performing S1.OP-ST.CS-0003, Inservice Testing Containment Spray Valves for its normally scheduled 92 day surveillance.
- The control room is performing Section 5.2, IST of 1CS14/1CS16/1CS17 Tank Discharge Valves by Stroke Timing.
- The control room has reached Step 5.2.14 and directed you to perform Attachment 3, CS Educator Line Flushing.

INITIATING CUE:

PPE requirements are RED for the flushing evolution. You are directed to determine what PPE you are required to wear, then perform the CS Educator Line flush IAW Attachment 3, CS Educator Line Flushing.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made (and NRC concurrence is obtained).

Task Standard for Successful Completion:

1. Determine proper PPE as listed on page 52 of SA-AA-2113. (attached to this JPM)
2. Perform CS Educator Line Flushing as per Attachment 3 of S1.OP-ST.CS-0003.

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Containment Spray

TASK: Perform Containment Spray Valve Verification (Flush the Containment Spray Eductor)

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
			Note: All actions in this JPM are simulated.		
		Provide clean copy of S1.OP-ST.CS-0003. Provide clean copy of SA-AA-2113.	Note: The Controlling copy of this procedure would be in the control room.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Containment Spray

TASK: Perform Containment Spray Valve Verification (Flush the Containment Spray Educator)

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*	Att. 3 Caution	PPE as specified in SA-AA-2113, Chemical Safety, are required to be worn when performing Educator flush and sample.	Determines required PPE by reviewing SA-AA-2113 and finds PPE requirements for Sodium Hydroxide [NaOH] — 0-50% on pages 51-52: Hand: Neoprene Supported UltraFlex gloves Eye: Flushed or Diluted: Safety glasses with side shields* Not Flushed or Concentrated: Chemical Goggles* Face: Face shield* Body: ChemMAX 2 TYCHEM SL or 6LYXX (Dupont) with Hood & Booties suit Foot: Butyl boots or, safety shoes inside ChemMAX 2 TYCHEM SL or 6LYXX (Dupont) suit with booties, caution must be used for slip hazard and wear through of suit. Respiratory: None — unless heating (grinding, cutting, welding) or creating vapor and area is not well ventilated.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Containment Spray

TASK: Perform Containment Spray Valve Verification (Flush the Containment Spray Eductor)

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
	Att. 3 A.0	ENSURE the following valves are CLOSED: ___ A. 1CS16, TANK DISCH ___ B. 1CS17, TANK DISCH	Locates MOV's 1CS16, TANK DISCH, and 1CS17, TANK DISCH, and determines they are shut. Note: 1CS16 and 1CS17 are normally shut valves)		
*	Att. 3 B.0	UNLOCK AND OPEN 1CS31, RWST SUPPLY TO EDUCTORS STOP VALVE.	Locates and opens 1CS31, RWST SUPPLY TO EDUCTORS STOP VALVE.		
*	Att. 3 C.0	OPEN 1CS40, SPRAY ADD TK DISCH LINE DRN.	Locates and opens 1CS40, SPRAY ADD TK DISCH LINE DRN.		
*	Att. 3 D.0	After 3 minutes of flushing to drain header, CLOSE 1CS40.	Cue: 3 minutes have elapsed. Closes 1CS40.		
*	Att. 3 E.0	THROTTLE 1CS61, CS SPRAY ADD TK DISCH SAMP VALVE, directing sample flow to a floor drain.	Locates 1CS61, CS SPRAY ADD TK DISCH SAMP VALVE, and describes throttling open valve and how to direct sample flow to floor drain.		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Containment Spray

TASK: Perform Containment Spray Valve Verification (Flush the Containment Spray Eductor)

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
	Att. 3 F.0	DIRECT Chemistry to perform sodium sample analysis of the water at 1CS61 local sample point.	Contacts Chemistry to perform sodium sample analysis of the water at 1CS61 local sample point. Cue: Chemistry has collected 1CS61 local sample.		
*	Att. 3 G.0	After sample has been obtained, CLOSE 1CS61.	Closes 1CS61.		
*	Att. 3 H.0	IF additional sampling is required, THEN THROTTLE 1CS61 as required by Chemistry Department.	Cue: Chemistry reports sample is 9 ppb sodium.		
*	Att. 3 I.0	WHEN Chemistry analysis verifies <10 ppm sodium, THEN PERFORM the following: ____ 1. ENSURE 1CS61 is CLOSED. ____ 2. CLOSE AND LOCK 1CS31.	Ensures 1CS61 is CLOSED. Closes and locks 1CS31.		
	Att. 3 J.0	NOTIFY Control Room Containment Spray Eductor Line flushing is complete.	Notifies control room Containment Spray Eductor Line flushing is complete.		
			Terminate JPM.		

TERMINATING CUE: None.

Chemical System Safety Template – Hazardous Bulk Chemical
Enclosure 5.13
Page 2 of 2
Sodium Hydroxide [NaOH] — 0 _ 50%

PPE REQUIREMENTS FOR APPLICABLE RISK CATEGORY

GREEN

Minimum PPE.

YELLOW

Minimum PPE, including Neoprene Supported UltraFlex gloves (wet) or leather work gloves (dry), as appropriate.

Face shield and ChemMAX 2 TYCHEM SL or 6LYXX (Dupont) with Hood & Booties suit, if opening a vent or drain valve.

RED

Hand	Neoprene Supported UltraFlex gloves
Eye	Flushed or Diluted: Safety glasses with side shields* Not Flushed or Concentrated: Chemical Goggles*
Face	Face shield*
Body	ChemMAX 2 TYCHEM SL or 6LYXX (Dupont) with Hood & Booties suit
Foot	Butyl boots or, safety shoes inside ChemMAX 2 TYCHEM SL or 6LYXX (Dupont) suit with booties, caution must be used for slip hazard and wear through of suit.
Respiratory	None – unless heating (grinding, cutting, welding) or creating vapor and area is not well ventilated.

*Not applicable if Respiratory Protection is used.

JOB PERFORMANCE MEASURE

TQ-AA-106-0303

Revision 4

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

- 5/8 1. Task description and number, JPM description and number are identified.
- 5/8 2. Knowledge and Abilities (K/A) references are included.
- 5/8 3. Performance location specified. (in-plant, control room, or simulator)
- 5/8 4. Initial setup conditions are identified.
- 5/8 5. Initiating and terminating Cues are properly identified.
- 5/8 6. Task standards identified and verified by SME review.
- 5/8 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
- 5/8 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. Rev S Date 9/29/15
Rev S 5A-AA-2113
51.0P-ST. CS 0003
- 5/8 9. Pilot test the JPM:
a. verify Cues both verbal and visual are free of conflict, and
b. ensure performance time is accurate.
- N/A 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
- N/A 11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

Michael Spencer

SME/Instructor: Michael Spencer

Date: 9/29/15

SME/Instructor: BERNARD

Date: 9/29/15

SME/Instructor: _____

Date: _____

JOB PERFORMANCE MEASURE

INITIAL CONDITIONS:

- Unit 1 is operating normally at 100% power.
- The crew is performing S1.OP-ST.CS-0003, Inservice Testing Containment Spray Valves for its normally scheduled 92 day surveillance.
- The control room is performing Section 5.2, IST of 1CS14/1CS16/1CS17 Tank Discharge Valves by Stroke Timing.
- The control room has reached Step 5.2.14 and has directed you to perform Attachment 3, CS Eductor Line Flushing.

INITIATING CUE:

PPE requirements are RED for the flushing evolution.

You are directed to determine what PPE is required for this task, then perform the CS Eductor Line flush IAW Attachment 3, CS Eductor Line Flushing.