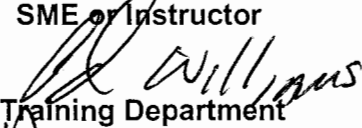
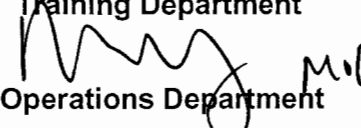


**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

STATION:	SALEM		
SYSTEM:	Reactor Coolant Pump		
TASK:	Perform Actions For Reactor Coolant Pump Seal Cooling Restoration		
TASK NUMBER:	N1150460501		
JPM NUMBER:	14-01 NRC IP-j		
ALTERNATE PATH:	☐	K/A NUMBER:	039 A1.09
APPLICABILITY:	IMPORTANCE FACTOR:		
EO ☐	RO ☒	STA ☐	SRO ☒
			2.8 2.8 RO SRO
EVALUATION SETTING/METHOD:	In Plant / Simulate		
REFERENCES:	1-EOP-LOPA-1 Sheet 2 Rev. 25		
TOOLS AND EQUIPMENT:	None		
VALIDATED JPM COMPLETION TIME:	6 min		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:	N/A		
Developed By:	G Gauding Instructor	Date:	8-28-15
Validated By:	S Bickhart / M Spencer SME or Instructor	Date:	9-29-15
Approved By:	 Training Department	Date:	10-7-15
Approved By:	 Operations Department	Date:	10-9-15
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:			
GRADE:	☐ SAT	☐ UNSAT	
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:		DATE:	

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

**TASK
NUMBER:** N1150460501

**INITIAL
CONDITIONS:**

A loss of all AC power has occurred in Unit 1. The crew has completed LOPA-1 through Step 26.

INITIATING CUE:

You are directed to locally isolate Unit 1 RCP Seal Cooling per Step 27 of EOP-LOPA-1.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made (and NRC concurrence is obtained).

Task Standard for Successful Completion:

1. Isolate RCP seal cooling IAW LOPA-1.

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
	1	Provide a copy of LOPA-1, Sheet 2.	Refers to LOPA-1, Sheet 2, Step 27.		
*	2a	Locally close CV83, SEAL WATER FILTER INLET	Locates CV83 in 84 ft elevation Aux Bldg in Seal Water Injection Filter Valve Room. Closes valve by turning handwheel in clockwise direction. CUE: Handwheel has been rotated clockwise. Valve stem has fully lowered. Handwheel will not turn further.		
*	2b	Locally close CV89, SEAL WATER FILTER INLET	Locates CV89 in 84 ft elevation Aux Bldg in Seal Water Injection Filter Valve Room. Closes valve by turning handwheel in clockwise direction. CUE: : Handwheel has been rotated clockwise. Valve stem has fully lowered. Handwheel will not turn further.		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*	2c	Locally close CV95, SEAL WATER FILTER BYPASS	Locates CV95 in 84 ft elevation Aux Bldg in Seal Water Injection Filter Valve Room. Closes valve by turning handwheel in clockwise direction. CUE: : Handwheel has been rotated clockwise. Valve stem has fully lowered. Handwheel will not turn further.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
			Note: The following 2 steps contain valves which are located in contaminated areas. If the candidate does not identify or discuss radiological measures required for entry into these areas, use a follow up query to elicit information. The requirements for PC use and obtaining dosimetry during accident conditions (LOPA) will vary based on situational conditions, such as is there a Rad Pro Technician immediately available at Control Point to escort operator, or to waive PC requirements, is the OSC manned, etc. For this reason there is no specific standard stated here for radiological conditions. However, candidate should mention any method of contamination control they may take, or how they would perform actions in a contaminated area.		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*	3	Locally close CV116, SEAL WATER TO VCT VALVE.	Points to CV116 in 78 ft elevation Mech Pen Area SG B/D HX Area. Valve is located in roped off area. CUE: Demonstrate how to close a similar valve in the area outside of the roped off area as if were CV116. Closes valve by depressing and holding motor operator declutch lever and turning handwheel in clockwise direction. CUE: Handwheel has been rotated clockwise. Valve stem has fully lowered. Handwheel will not turn further		
*	4	Locally close CC131, RCP THERMAL BARRIER VALVE	Points to CC131 in 78 ft elevation Mech Pen Area SG B/D HX Area. Valve is located in roped off area. CUE: Handwheel has been rotated clockwise. Valve stem has fully lowered. Handwheel will not turn further.		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Reactor Coolant Pump

TASK: Perform Actions For Reactor Coolant Pump Seal Cooling Restoration

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
	5	NOTIFY Control Room that RCP Seal Cooling has been isolated.	Notifies control room that RCP Seal Cooling has been isolated. TERMINATING CUE: Control room has been informed that RCP Seal Cooling has been isolated.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

- 58 1. Task description and number, JPM description and number are identified.
- 58 2. Knowledge and Abilities (K/A) references are included.
- 58 3. Performance location specified. (in-plant, control room, or simulator)
- 58 4. Initial setup conditions are identified.
- 58 5. Initiating and terminating Cues are properly identified.
- 58 6. Task standards identified and verified by SME review.
- 58 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
- 58 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. 25 Date 9/29/15
EOP LOPA - 1 Rev 25
- 58 9. Pilot test the JPM:
a. verify Cues both verbal and visual are free of conflict, and
b. ensure performance time is accurate.
- N/A 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
- N/A 11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

Michael Spencer

SME/Instructor: Michael Spencer

SME/Instructor: Michael Spencer

SME/Instructor: _____

Date: 9/29/15

Date: 9/29/15

Date: _____

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE

INITIAL CONDITIONS:

A loss of all AC power has occurred in Unit 1. The crew has completed LOPA-1 through Step 26.

INITIATING CUE:

You are directed to locally isolate RCP Seal Cooling per Step 27 of EOP-LOPA-1.