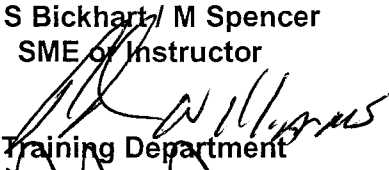


**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

STATION:	SALEM		
SYSTEM:	Waste Gas		
TASK:	Conduct an Authorized Waste Gas Release (Swap in-service GDT's and Place a Gas Decay Tank in Holdup)		
TASK NUMBER:	N0715070104		
JPM NUMBER:	14-01 NRC IP-k		
ALTERNATE PATH:	☐	K/A NUMBER:	071 Gen 2.3.11
APPLICABILITY:		IMPORTANCE FACTOR:	
EO ☐	RO ☒	STA ☐	SRO ☒
EVALUATION SETTING/METHOD:	In Plant / Simulate		
REFERENCES:	S2.OP-SO.WG-0008, Rev. 26 S2.OP-SO.WG-0003, Rev.11		
TOOLS AND EQUIPMENT:	None		
VALIDATED JPM COMPLETION TIME:	15 min		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:	N/A		
Developed By:	G Gauding Instructor	Date:	8-27-15
Validated By:	S Bickhart / M Spencer SME of Instructor	Date:	9-29-15
Approved By:	 Training Department	Date:	10-7-15
Approved By:	 Operations Department	Date:	10-9-15
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:			
GRADE: ☐ SAT ☐ UNSAT			
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:		DATE:	

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Waste Gas

TASK: Conduct an Authorized Waste Gas Release (Place a Gas Decay Tank in Holdup)

**TASK
NUMBER:** N0715070104

**INITIAL
CONDITIONS:**

Both Salem Units are operating at 100% power.
21 Waste Gas Decay Tank is in service at 90 psig.
22 Waste Gas Decay Tank is in Standby at 15 psig.
23 Waste Gas Decay Tank is O/S at 15 psig.
24 Waste Gas Decay Tank is O/S at 15 psig.

INITIATING CUE:

You are directed to place 24 Waste Gas Decay Tank (WGDT) in service and remove 21 Waste Gas Decay tank from service IAW Section 5.2 of S2.OP-SO.WG-0003, GASEOUS WASTE DISPOSAL SYSTEM OPERATION.

Once 21 WGDT is removed from service, you are directed to align 21 WGDT for Holdup IAW S2.OP-SO.WG-0008, DISCHARGE OF 21 GAS DECAY TANK TO PLANT VENT in preparation for sampling and release of 21 WGDT. Prerequisites and P&L's for BOTH procedures have been performed.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made (and NRC concurrence is obtained).

Task Standard for Successful Completion:

1. Swap in-service WGDT from 21 to 24.
2. Align 21 WGDT for HOLDUP IAW Att 1 of S2.OP-SO.WG-0008.

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Waste Gas

TASK: Place a Waste Gas Tank in Holdup

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
		Provide operator with marked up procedures.			
	SO.WG-3 5.2.7	IF 24 GDT being placed in service OR standby, THEN:			
	SO.WG-3 5.2.7.A	ENSURE the following: 1. 24 GDT release NOT in progress. 2. 24 GDT pressure >10 psig AND <92 psig. 3. 24WG31, GDT INLET VALVE, is OPEN.	Determines 24 GDT release not in progress. Determines 24 GDT pressure is >10 psig AND <92 psig. (2PIS1039) Cue if required: 2PIS1039 reads 15 psig.) Determines 24WG31 is open.		
	SO.WG-3 5.2.7.B	IF 24 GDT being placed in service, THEN:			

NAME: _____

DATE: _____

TASK: Place a Waste Gas Tank in Holdup

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*	SO.WG-3 5.2.7.B (cont)	1. PRESS GAS DECAY TANK 24 MANUAL SELECT pushbutton. 2. ENSURE 24WG29, GDT INLET CONT VALVE, is OPEN. 3. CLOSE WG35, GDT STOP VALVE TO HUT for GDT being removed from service. 4. OPEN 24WG35, GDT STOP VALVE TO HUT.	Depresses Gas Decay Tank 24 Manual Select PB on 104 panel. Cue: 24 in service light is illuminated and 21in service light is extinguished. Determines 24WG29 GDT INLET CONT VALVE, is OPEN. Shuts 21WG35. Opens 24WG35.		
	SO.WG-3 5.2.2	IF removing 21 GDT from service, THEN: A. ENSURE GAS DECAY TANK STANDBY SELECTOR switch is NOT in "21" position. B. CLOSE 21WG35, GDT STOP VALVE TO HUT.	On 105 panel checks Gas Decay Tank Standby Selector switch is NOT in "21" position. Cue if GDT Standby Selector switch is in 21 or 24 position: Gas Decay Tank Standby Selector switch is in "22" Verifies 21WG35 is shut.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Waste Gas

TASK: Place a Waste Gas Tank in Holdup


*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*	SO.WG-8 5.1.1	ALIGN 21 GDT as follows: A. OBTAIN a CRS Tagging Request for 21WG31 GDT INLET VALVE, in the CLOSED position and with specific instructions that this tag should only be released IAW this procedure. B. PERFORM 21 GDT Holdup Alignment IAW Attachment 1, Section 1.0	Cue: Assume you have the CRS tagging Request for 21WG31. Locates and describes required positions for valves listed on Attachment 1 Section 1.0. Describes hanging Red Blocking Tag on 21WG31.		
			When Attachment 1 alignment has been performed terminate JPM.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

1. Task description and number, JPM description and number are identified.
2. Knowledge and Abilities (K/A) references are included.
3. Performance location specified. (in-plant, control room, or simulator)
4. Initial setup conditions are identified.
5. Initiating and terminating Cues are properly identified.
6. Task standards identified and verified by SME review.
7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. 11 Date 9/29/15 SO.WG-0003
26 9/29/15 SO.WG-0000
9. Pilot test the JPM:
 - a. verify Cues both verbal and visual are free of conflict, and
 - b. ensure performance time is accurate.
10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

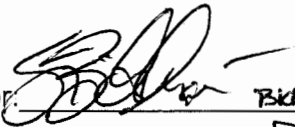SME/Instructor:  B. K. HART

Date: 9/29/15

SME/Instructor:  Michael J. Spencer

Date: 9/29/15

SME/Instructor: _____

Date: _____

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE

INITIAL CONDITIONS:

Both Salem Units are operating at 100% power.
21 Waste Gas Decay Tank is in service at 90 psig.
22 Waste Gas Decay Tank is in Standby at 15 psig.
23 Waste gas Decay Tank is O/S at 15 psig.
24 Waste Gas Decay Tank is O/S at 15 psig.

INITIATING CUE: You are directed to place 24 Waste Gas Decay Tank (WGDT) in service and remove 21 Waste Gas Decay tank from service IAW Section 5.2 of S2.OP-SO.WG-0003, GASEOUS WASTE DISPOSAL SYSTEM OPERATION.

Once 21 WGDT is removed from service, you are directed to align 21 WGDT for Holdup IAW S2.OP-SO.WG-0008, DISCHARGE OF 21 GAS DECAY TANK TO PLANT VENT in preparation for sampling and release of 21 WGDT. Prerequisites and P&L's for BOTH procedures have been performed.