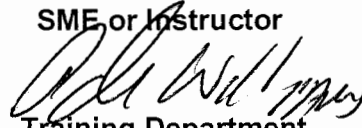
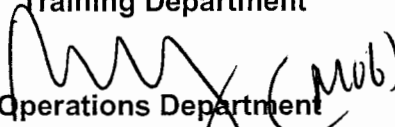


**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

STATION:	SALEM		
SYSTEM:	Waste Liquid		
TASK:	Select Release Path for Radioactive Liquid Waste Release		
TASK NUMBER:	N0680070302		
JPM NUMBER:	14-01 NRC SRO A3		
ALTERNATE PATH:	☐	K/A NUMBER:	2.3.6
APPLICABILITY:		IMPORTANCE FACTOR:	3.8
EO ☐	RO ☐	STA ☐	SRO ☒
EVALUATION SETTING/METHOD:	Classroom		
REFERENCES:	S1.OP-SO.WL-0002, Rev.27, 205209 (CW), 205242 (SW)		
TOOLS AND EQUIPMENT:	Highlighters		
VALIDATED JPM COMPLETION TIME:	30 minutes		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:			
Developed By:	G Gauding Instructor	Date:	9-15-15
Validated By:	K Hantho / B Boos SME or Instructor	Date:	9-29-15 / 9-30-15
Approved By:	 Training Department	Date:	10-7-15
Approved By:	 Operations Department	Date:	10-9-15
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:			
GRADE:	☐ SAT	☐ UNSAT	
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:			DATE:

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Waste Liquid

TASK: Select Release Path for Radioactive Liquid Waste Release

TASK NUMBER: N0680070302

INITIAL CONDITIONS:

Salem Unit 2 is on day 25 of a scheduled 45 day refueling outage.

11 and 12 CCHX's are in service.

21 CCHX is in service, 22 CCHX is removed from service and drained.

All Unit 2 Circulators are O/S.

Salem Unit 1 is operating at 75% power.

12A Circulator is O/S for waterbox cleaning.

The Non-Rad Waste Treatment System is in service performing a release, and must remain in service.

Unit 1 is NOT in any active Tech Specs.

12 CVCS Monitor Tank is in Recirc using 11 CVCS Monitor Tank Pump, and Chemistry has granted permission to release the tank with a minimum dilution flow rate of 100,000 gpm.

INITIATING CUE: You are the Unit 1 CRS. Select the release path for 12 CVCS Monitor Tank IAW S1.OP-SO.WL-0002, Attachment 2, Section 2.2 Release Verification AND provide marked up drawings of the flow path from 12 CVCS Monitor tank to its ultimate release point.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made (and NRC concurrence is obtained).

Task Standard for Successful Completion:

1. Determines the release path as 21 CCHX to 12A AND/OR 12B CW Pump I/S (Att. 2 Step 2.2.3)
2. Provides release flow path drawings of 12 CVCS MT to 21 CCHX, (via Unit x-conn) to discharge of 12A/12B Circulators.

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Waste Liquid

TASK: Select Release Path for Radioactive Liquid Waste Release

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
		Provide marked up copy of S1.OP-SO.WL-0002., and blank copies of drawings: 205230 205239-1 205229-2 205242-4 205339-1 205342-3,4,5,6 205209-2 and a colored marker. Have a blank copy of S1.OP-SO.CW-0001 Circulating Water System Operation available if asked for.	Note: Drawings 205229-2 205242-4 205342-5 are not needed for flowpath but are included to ensure an incorrect alternate flowpath could be selected.		
*			Uses S1.OP-SO.WL-0002, Attachment 2, Section 2.2, to select the release flow path based on CCHX's available and Circulators in service, as 12 CVCS Monitor Tank to 21 CCHX, to 12A and/or 12B CW pumps I/S.		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

NAME: _____

DATE: _____

SYSTEM: Waste Liquid

TASK: Select Release Path for Radioactive Liquid Waste Release

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT Evaluation)
*			Marks the appropriate drawings, from the 12 CVCS MT on drawing 205230 to 205239 Sheet 1, to 205339 Sheet 1 via x-connect line, to 205342 Sheet 4, to 205342 Sheet 3, through 21SW222, to 205342 Sheet 6, to 205342 Sheet 3, to 205209 Sheet 2.		
			Terminate JPM when operator has returned procedures and marked up drawings.		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

- AD ✓ 1. Task description and number, JPM description and number are identified.
- AD ✓ 2. Knowledge and Abilities (K/A) references are included.
- AD ✓ 3. Performance location specified. (in-plant, control room, or simulator)
- AD ✓ 4. Initial setup conditions are identified.
- AD ✓ 5. Initiating and terminating Cues are properly identified.
- AD ✓ 6. Task standards identified and verified by SME review.
- AD ✓ 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
- AD ✓ 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. 27 Date 9/29/15
- AD ✓ 9. Pilot test the JPM:
a. verify Cues both verbal and visual are free of conflict, and
b. ensure performance time is accurate.
- _____ 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
- _____ 11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

SME/Instructor: Karl Hantho Date: 9/29/15

SME/Instructor: Brian Boos Date: 09/30/2015

SME/Instructor: _____ Date: _____

INITIAL CONDITIONS:

Salem Unit 2 is on day 25 of a scheduled 45 day refueling outage.

11 and 12 CCHX's are in service.

21 CCHX is in service, 22 CCHX is removed from service and drained.

All Unit 2 Circulators are O/S.

Salem Unit 1 is operating at 75% power.

12A Circulator is O/S for waterbox cleaning.

The Non-Rad Waste Treatment System is in service performing a release, and must remain in service.

Unit 1 is NOT in any active Tech Specs.

12 CVCS Monitor Tank is in Recirc using 11 CVCS Monitor Tank Pump, and Chemistry has granted permission to release the tank with a minimum dilution flow rate of 100,000 gpm.

INITIATING CUE:

You are the Unit 1 CRS. Select the release path for 12 CVCS Monitor Tank IAW S1.OP-SO.WL-0002, Attachment 2, Section 2.2 Release Verification **AND** provide marked up drawings of the flow path from 12 CVCS Monitor tank to its ultimate release point.