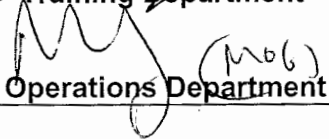


**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

STATION:	SALEM		
SYSTEM:	Radioactive Liquid Waste		
TASK:	Respond to High Radiation Alarm during an Authorized Release of Rad. Liquid Waste to the CIRC Water System From 21 CVCS Monitor Tank		
TASK NUMBER:	N0685140104		
JPM NUMBER:	13-01 NRC IP-k		
ALTERNATE PATH:	☒	K/A NUMBER:	2.3.11
APPLICABILITY:		IMPORTANCE FACTOR:	
EO ☐	RO ☒	STA ☐	SRO ☒
EVALUATION SETTING/METHOD:	In Plant/SIMULATE		
REFERENCES:	S2.OP-SO.WL-0001, Rev. 25, Release of Radioactive Liquid Waste from 21 CVCS Monitor Tank (checked 10-15-14)		
TOOLS AND EQUIPMENT:	None		
VALIDATED JPM COMPLETION TIME:	15 min.		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:	N/A		
Developed By:	G Gauding Instructor	Date:	9-24-14
Validated By:	S Bickhart SME or Instructor	Date:	10-15-14
Approved By:	 Training Department	Date:	10-23-14
Approved By:	 Operations Department	Date:	10-23-14
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:			
GRADE: ☐ SAT ☐ UNSAT			
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:		DATE:	

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Radioactive Liquid Waste

TASK: Respond to High Radiation Alarm during an Authorized Release of Rad. Liquid Waste to the CIRC Water System From 21 CVCS Monitor Tank

**TASK
NUMBER:** N0685140104

**INITIAL
CONDITIONS:**

Both Units are at 100% power.
A discharge of 21 CVCS Monitor Tank to Unit 1 Circ Water via Unit 2 SW has been directed IAW S2.OP SO.WL-0001, Release of Radioactive Liquid Waste from 21 CVCS Monitor Tank.
Recirculation and preparation for release of the Monitoring Tank have been completed.
Chemistry has authorized a maximum allowable release rate of 150 gpm.
ALL Circulators are in service.
2R18 and the Overboard Flow monitor are OPERABLE.
SW Room Cooler Headers are NOT cross-tied.
S2.OP-SO.WL-0001, Sections 5.1, 5.2, and 5.3 are complete.
21 CVCS tank initial level is 19,600 gallons.

INITIATING CUE:

Perform Section 5.5, Release of 21 CVCS Monitor Tank via SW system to CW system, of S2.OP-SO.WL-0001.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made (and NRC concurrence is obtained).

Task Standard for Successful Completion:

1. Perform normal Liquid Radwaste Release.
2. Terminate release upon receipt of high radiation alarm on release.

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

*	STEP No.	STEP	STANDARD	EVAL S/U	COMMENTS
		Provide operator with marked up copy of release procedure.	Reviews marked up procedure		
	5.5.1	<u>IF</u> 2FR1064 is INOPERABLE....	NA's step since 2FR1064 is OPERABLE.		
*	5.5.2	Direct Unit 2 NCO to OPEN 2WL51, LIQUID RELEASE STOP VALVE.	Locates plant page or phone to call control room. Cue: Unit 2 NCO reports 2WL51 has been opened.		
	5.5.3	Direct a second operator to PERFORM an Independent Verification for 2WL51 position IAW Attachment 2, Step 4.1.2 OR 4.2.2 as applicable (ODCM)	Cue: IV has been performed.		
*	5.5.4	THROTTLE OPEN 2WR59, MT PMPS OB STOP VALVE, <u>NOT</u> to exceed the Maximum Release Rate recorded in Attachment 2, Step 2.2.2	Locates 2WR59 and simulates opening valve. When operator checks flow indication on 104 panel gauge 2FR-1064 then Cue: With the valve fully open, flow is 10 gpm. Note: Max Release Rate from Att. 2, Step 2.2.2 is 150 gpm. Note: When facing the 104 panel, turn left and walk to first valve room off hallway. 2WR59 is located in 1 st valve room on right.		
	5.5.5	Direct a second operator to PERFORM an Independent Verification for 2WR59 position IAW Attachment 2, Step 4.1.3 OR 4.2.3 as applicable (ODCM)	Cue: IV has been performed.		
*	5.5.6	<u>IF</u> the Maximum Release Rate recorded in Attachment 2, Step 2.2.2 can <u>NOT</u> be obtained, THEN THROTTLE CLOSED 21WR53 MT RECIRC V, <u>NOT</u> to exceed the Maximum Release Rate.	Locates 21WR53 and simulates throttling valve closed. Note: To locate 21WR53, when facing 104 panel, turn right and walk down hallway. Turn right into big CVCS Monitor Tank room. When operator checks flow on 2FR-1064 on 104 panel, Cue: Flow is 55 gpm.		

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE


* STEP No.	STEP	STANDARD	EVAL S/U	COMMENTS
	5.5.7	IF 2FR1064 flow monitor is OPERABLE, THEN RECORD time, date, and tank identification on recorder.		
	5.5.8	COMPLETE Attachment 2, Section 5.1		
	5.5.9	IF any of the following occur during the release THEN direct the NCO to CLOSE 2WL51, LIQUID RELEASE STOP VALVE. Loss of dilution water flow 2FR1064 becomes inoperable 2R18 Monitor ALARMS MT pump pressure falls below the MDP allowed IAW Attachment 4, as applicable	Records data. Cue: Chemistry paperwork indicates dilution water flowrate is 200,000 gpm. Cue: When operator reads 21 CVCS Monitor Tank Level, state, "2-LIS-180 indicates 90%". Records 19,600 from either Att. 1 Section 2.0 or Att. 2 Section 1.0. If operator requests S2.OP-TM.ZZ-0002, Tank Capacity Data, tell them the procedure is not needed to determine the tank volume. Records Dilution Water Flowrate of 200,000 gpm.) Initial conditions stated all circulators were in service. Records 55 gpm for Discharge Flow Rate. (Previous cue from Step 5.5.6 can be re-stated here if asked.) Cue: When operator reads 2R18 indication on 104 panel, state, "2R18 reads 10⁵ counts, the RED HI RAD light is lit." Calls control room to inform them of HI RADIATION condition and directs NCO to shut 2WL51.	
*				
		Cue: Once operator has called control room to have the 2WL51 shut, state: "JPM is complete."		

**OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE**

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

1. Task description and number, JPM description and number are identified.
2. Knowledge and Abilities (K/A) references are included.
3. Performance location specified. (in-plant, control room, or simulator)
4. Initial setup conditions are identified.
5. Initiating and terminating Cues are properly identified.
6. Task standards identified and verified by SME review.
7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. 25 Date 10/15/14
9. Pilot test the JPM:
 - a. verify Cues both verbal and visual are free of conflict, and
 - b. ensure performance time is accurate.
10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

SME/Instructor:  Bill H. Allen

Date: 10/15/14

SME/Instructor: _____

Date: _____

SME/Instructor: _____

Date: _____

OPERATOR TRAINING PROGRAM JOB PERFORMANCE MEASURE

INITIAL CONDITIONS:

Both Units are at 100% power.

A discharge of 21 CVCS Monitor Tank to Unit 1 Circ Water via Unit 2 SW has been directed IAW S2.OP SO.WL-0001, Release of Radioactive Liquid Waste from 21 CVCS Monitor Tank.

Recirculation and preparation for release of the Monitoring Tank have been completed.

Chemistry has authorized a maximum allowable release rate of 150 gpm.

ALL Circulators are in service.

2R18 and the Overboard Flow monitor are OPERABLE.

SW Room Cooler Headers are NOT cross-tied.

S2.OP-SO.WL-0001, Sections 5.1, 5.2, and 5.3 are complete.

21 CVCS tank initial level is 19,600 gallons.

INITIATING CUE:

Perform Section 5.5, Release of 21 CVCS Monitor Tank via SW system to CW system, of S2.OP-SO.WL-0001.