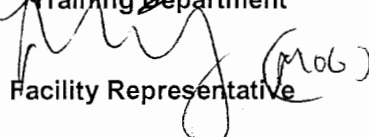


OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

STATION:	SALEM		
SYSTEM:	Administrative - Review Calculations that Determine Plant Status		
TASK:	Review a QPTR		
TASK NUMBER:	N1200170105		
JPM NUMBER:	13-01 NRC SRO Admin A1-2		
ALTERNATE PATH:	☐	K/A NUMBER:	2.1.18
APPLICABILITY:		IMPORTANCE FACTOR:	3.8
EO ☐	RO ☐	STA ☐	SRO ☒
EVALUATION SETTING/METHOD:	Classroom		
REFERENCES:	S1.OP-ST.NIS-0002 Rev. 15 S1.RE-RA.ZZ-0011 Rev. 383 Tech Spec 3.2.4		
TOOLS AND EQUIPMENT:	Calculator		
VALIDATED JPM COMPLETION TIME:	30 min		
TIME PERIOD IDENTIFIED FOR TIME CRITICAL STEPS:	N/A		
Developed By:	G Gauding Instructor	Date:	9-24-14
Validated By:	N Salam SME or Instructor	Date:	10-16-14
Approved By:	 Training Department	Date:	10-23-14
Approved By:	 Facility Representative	Date:	10-23-14
ACTUAL JPM COMPLETION TIME:			
ACTUAL TIME CRITICAL COMPLETION TIME:			
PERFORMED BY:	GRADE: ☐ SAT ☐ UNSAT		
REASON, IF UNSATISFACTORY:			
EVALUATOR'S SIGNATURE:		DATE:	

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____

DATE: _____

SYSTEM: Administrative - Review Calculations that Determine Plant Status

TASK: Review a QPTR

TASK NUMBER: N1200170105

INITIAL CONDITIONS:

Unit 1 was operating at 100% power when rod 2D4 dropped fully into the core. OHA E-46, LOWER SECT DEV ABV 50% PWR annunciated and remains locked in. Operators have not yet started reducing power to 74% to comply with TSAS 3.1.3.1.c.3.d IAW S1.OP-AB.ROD-002, Dropped Rod.

INITIATING CUE:

Review the completed S1.OP-ST.NIS-0002, Power Distribution - Quadrant Power Tilt Ratio for completeness and accuracy.

Note any discrepancies, if any, and required actions, if any, on Attachment 4.

Successful Completion Criteria:

1. All critical steps completed.
2. All sequential steps completed in order.
3. All time-critical steps completed within allotted time.
4. JPM completed within validated time. Completion time may exceed the validated time if satisfactory progress is being made.

Task Standard for Successful Completion:

1. Review the QPTR and determine it has been performed correctly, with SAT results.

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____
DATE: _____

SYSTEM: Admin
TASK: Review a QPTR

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT evaluation)
		Provide Candidate with completed copy of S1.OP-ST.NIS-0002, Rev. 15, Power Distribution - Quadrant Power Tilt Ratio, a copy of S1.RE-RA.ZZ-0011, Rev. 383, Tables, and a copy of Tech Spec 3.2.4.			
	2.1	IDENTIFY sections of this procedure that are <u>NOT</u> to be performed with "N/A".	Verifies proper section of procedure used and Section 5.2, Attachment 1 Section 3.0, and Attachment 3 are N/A.		
	3.0	<u>PRECAUTIONS AND LIMITATIONS</u>	Verifies PRECAUTIONS AND LIMITATIONS 3.1-3.5 initialed.		
	5.1.1	IF one PR channel is inoperable, <u>AND</u> RTP is >75%, THEN...	Verifies all PR channel are operable and step is marked NA.		
	5.1.2	RECORD the following data on Attachment 2 • Date • Time • Reactor Power • Reason for performing QPTR Calculation	Verifies current date, current time, 100% reactor power and that OHA E-46 as reason for performance in Attachment 2 is checked		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____
DATE: _____

SYSTEM: Admin
TASK: Review a QPTR

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT evaluation)
	5.1.3	RECORD the following data on Attachment 1: • NI Channels N-41, N-42, N43 and N-44 Upper Detector current readings • NI Channels N-41, N-42, N43 and N-44 Lower Detector current readings • Respective 100% NI Current Values for Channels N-41, N-42, N43 and N-44 Detectors from S1.RE-RA.ZZ-0011, Table 2	Verifies data completed on Attachment 1: • NI channels N41-44 Upper Detector Current Readings • NI channels N41-44 Lower Detector Current Readings • 100% NI Current Values from S1.RE-RA.ZZ-0011, TABLES Note: Attachment 1, Section 3 was NOT required to be performed to determine detector currents. It was added at Rev. 12 to use "when any NIS meter is suspect." If asked, Cue that all Power Range Detectors are/were Operable.		
*	5.1.4	COMPLETE Attachment 1 calculations.	Verifies calculations for Top and Bottom Detectors Verifies IV is complete.		
*	5.1.7	<u>IF</u> the Maximum Power Tilt for <u>any</u> detector exceeds 1.02, <u>THEN REFER</u> to T/S 3.2.4 for corrective actions.	Determines no power tilt exceeds 1.02.		
*	5.3.1	This surveillance is satisfactory when Attachment 2 or 3 is completed with the Test Data meeting the Acceptance Criteria stated.	Determines surveillance is SAT.		

OPERATOR TRAINING PROGRAM
JOB PERFORMANCE MEASURE

NAME: _____
DATE: _____

SYSTEM: Admin
TASK: Review a QPTR

*	STEP NO.	STEP (*Denotes a Critical Step)	STANDARD	EVAL S/U	COMMENTS (Required for UNSAT evaluation)
*	5.4.1	COMPLETE Attachment 4, Sections 1.0 and 2.0, AND FORWARD completed procedure to SM/CRS for review.	Completes Attachment 4, Section 3.		
			JPM is terminated when candidate returns all JPM paperwork to evaluator.		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 and 11 below.

- Ym 1. Task description and number, JPM description and number are identified.
- Ym 2. Knowledge and Abilities (K/A) references are included.
- Ym 3. Performance location specified. (in-plant, control room, or simulator)
- Ym 4. Initial setup conditions are identified.
- Ym 5. Initiating and terminating Cues are properly identified.
- Ym 6. Task standards identified and verified by SME review.
- Ym 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
- Ym 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. 15 Date Jun 17, 2009
- Ym 9. Pilot test the JPM:
 - a. verify Cues both verbal and visual are free of conflict, and
 - b. ensure performance time is accurate.
- N/A 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
- N/A 11. When JPM is revalidated, SME or Instructor sign and date JPM cover page.

SME/Instructor: [Signature] Date: 10/16/14
SME/Instructor: _____ Date: _____
SME/Instructor: _____ Date: _____

INITIAL CONDITIONS:

Unit 1 was operating at 100% power when rod 1D3 dropped fully into the core. OHA E-46, LOWER SECT DEV ABV 50% PWR annunciated and remains locked in. Operators have not yet started reducing power to 74% to comply with TSAS 3.1.3.1.c.3.d IAW S1.OP-AB.ROD-002, Dropped Rod.

INITIATING CUE:

Review the completed S1.OP-ST.NIS-0002, Power Distribution - Quadrant Power Tilt Ratio for completeness and accuracy.

Note any discrepancies, if any, and required actions, if any, on Attachment 4.