1. Description

1.1. Project

Project Name	Domotica_STM
Board Name	NUCLEO-F030R8
Generated with:	STM32CubeMX 4.26.1
Date	12/12/2018

1.2. MCU

MCU Series	STM32F0
MCU Line	STM32F0x0 Value Line
MCU name	STM32F030R8Tx
MCU Package	LQFP64
MCU Pin number	64

2. Pinout Configuration

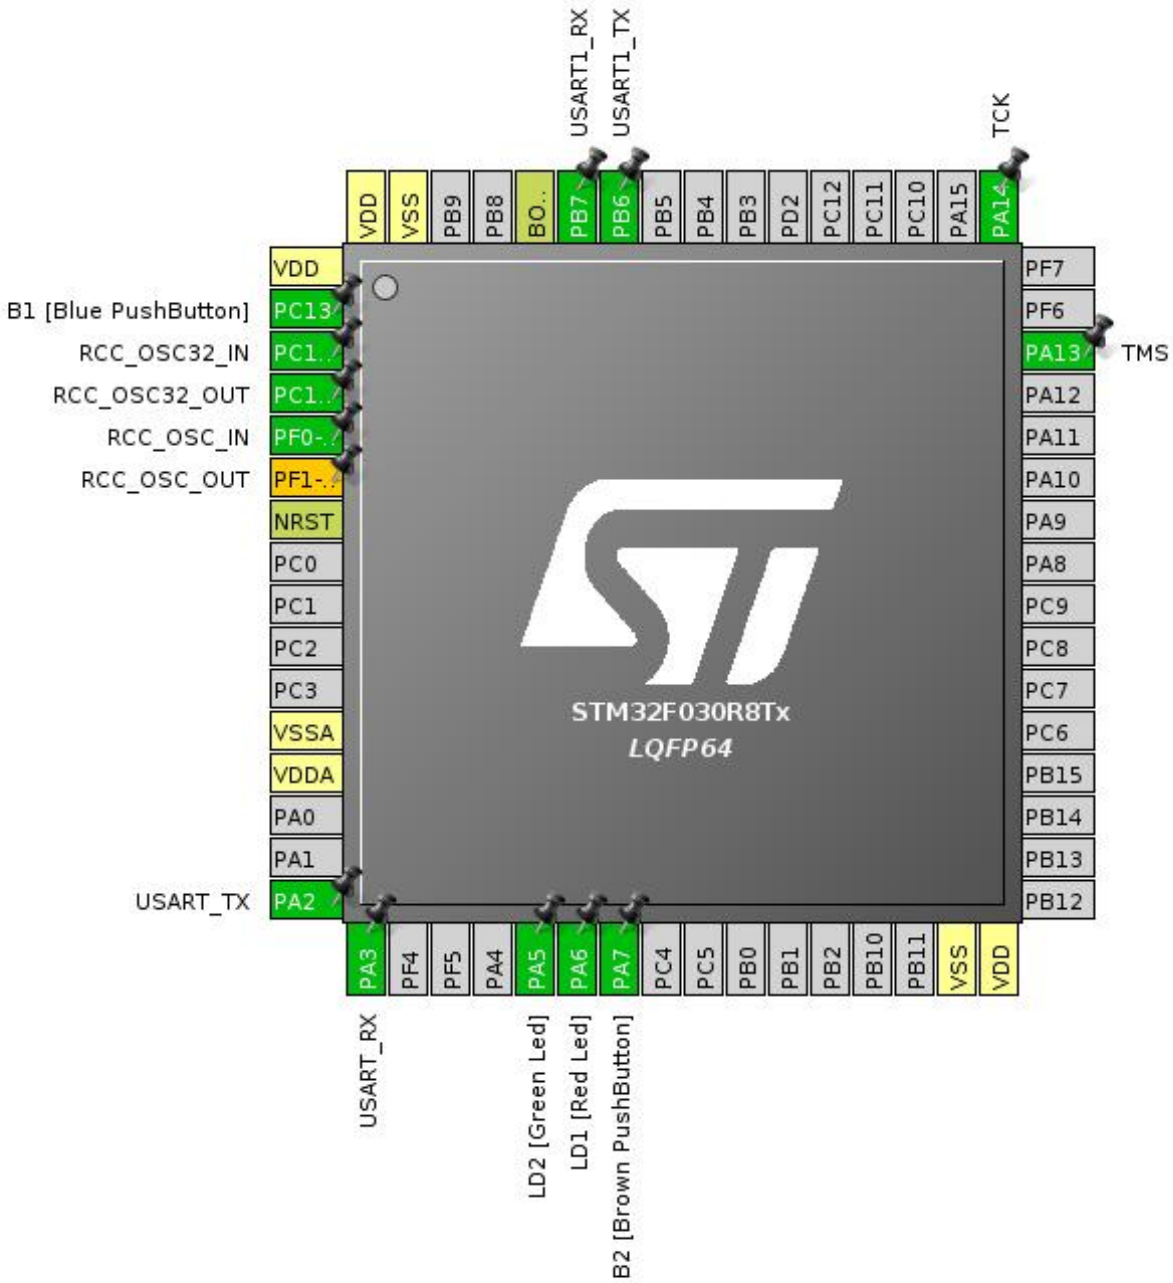

3. Pins Configuration

Pin Number LQFP64	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VDD	Power		
2	PC13	I/O	GPIO_EXTI13	B1 [Blue PushButton]
3	PC14-OSC32_IN	I/O	RCC_OSC32_IN	
4	PC15-OSC32_OUT	I/O	RCC_OSC32_OUT	
5	PF0-OSC_IN	I/O	RCC_OSC_IN	
6	PF1-OSC_OUT *	I/O	RCC_OSC_OUT	
7	NRST	Reset		
12	VSSA	Power		
13	VDDA	Power		
16	PA2	I/O	USART2_TX	USART_TX
17	PA3	I/O	USART2_RX	USART_RX
21	PA5 **	I/O	GPIO_Output	LD2 [Green Led]
22	PA6 **	I/O	GPIO_Output	LD1 [Red Led]
23	PA7	I/O	GPIO_EXTI7	B2 [Brown PushButton]
31	VSS	Power		
32	VDD	Power		
46	PA13	I/O	SYS_SWDIO	TMS
49	PA14	I/O	SYS_SWCLK	TCK
58	PB6	I/O	USART1_TX	
59	PB7	I/O	USART1_RX	
60	BOOT0	Boot		
63	VSS	Power		
64	VDD	Power		

** The pin is affected with an I/O function

* The pin is affected with a peripheral function but no peripheral mode is activated

4. Clock Tree Configuration

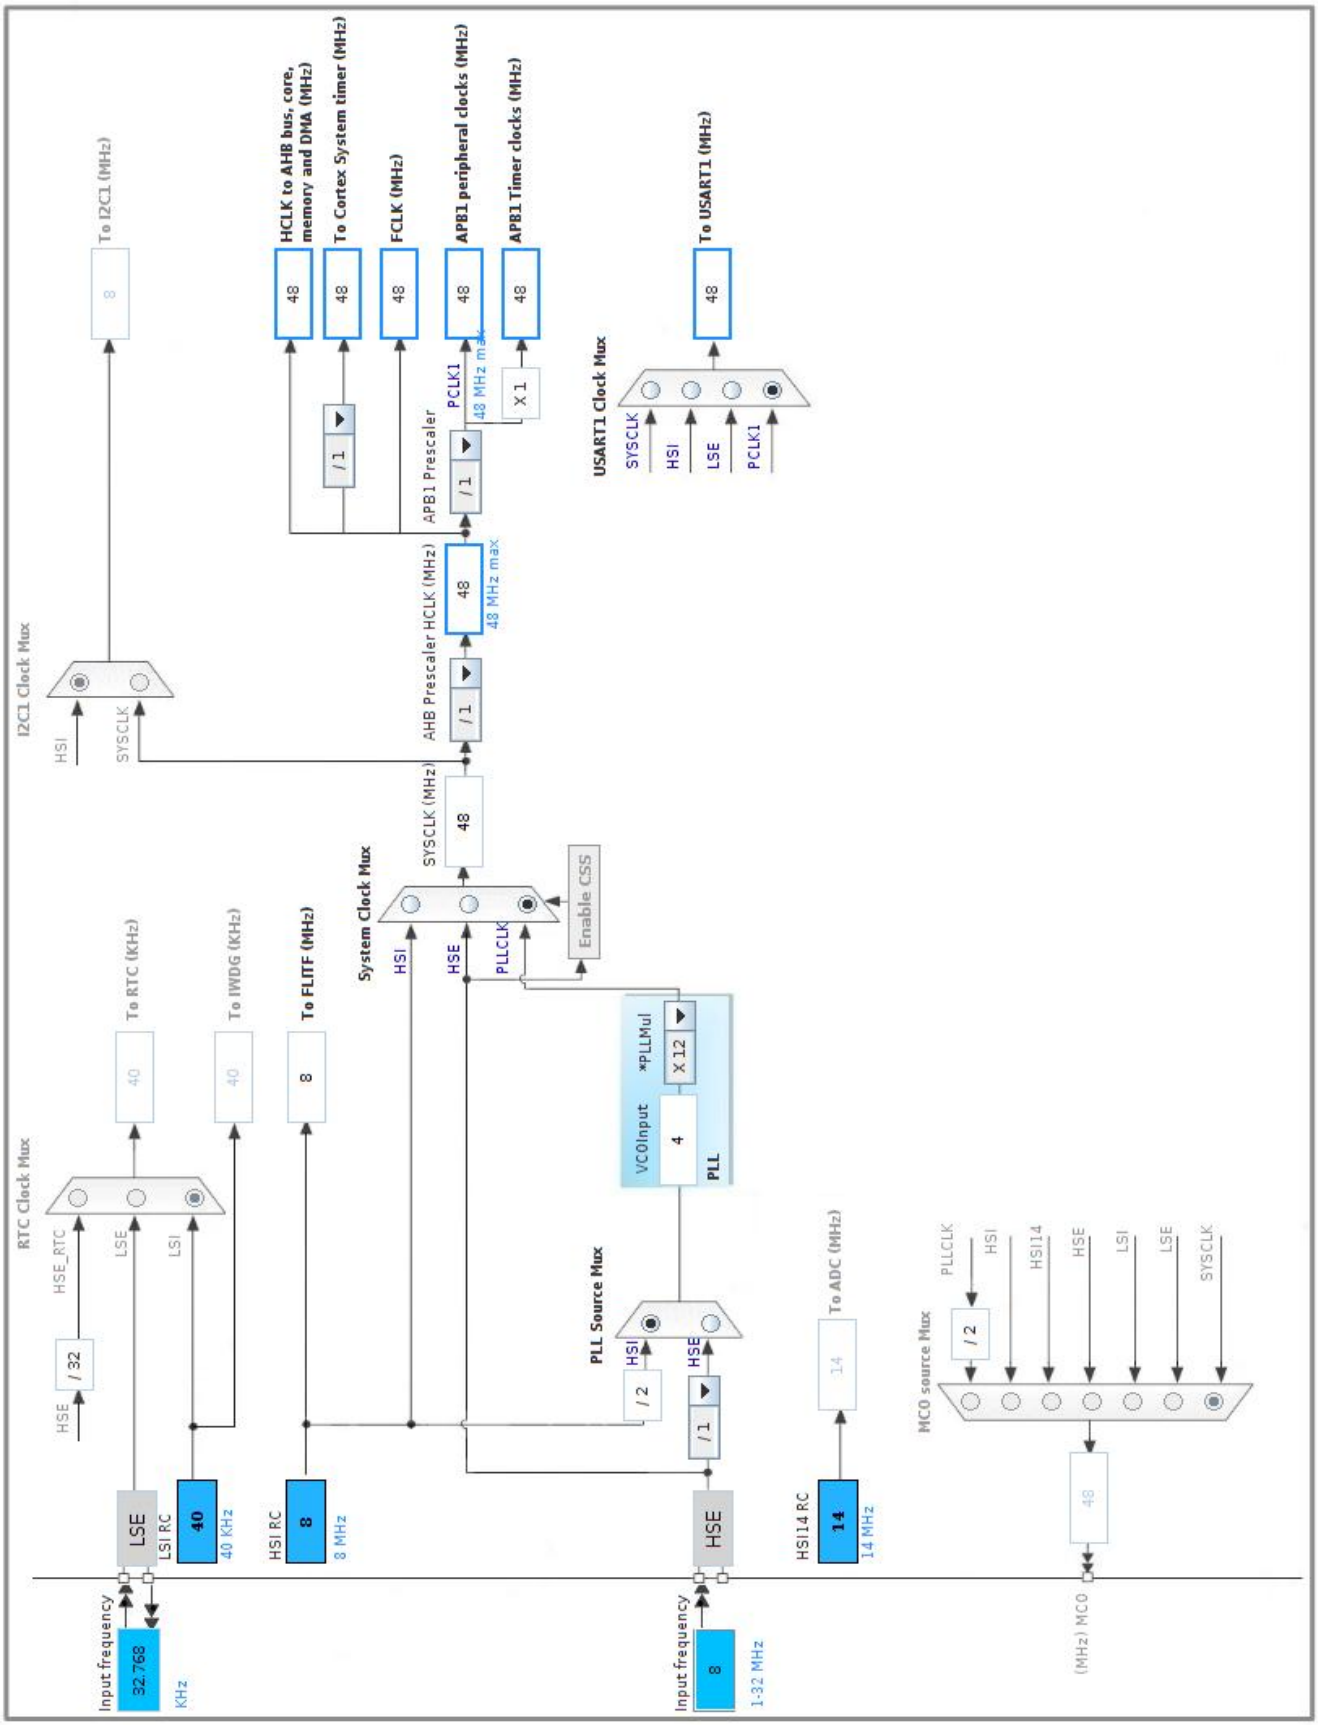

5. IPs and Middleware Configuration

5.1. RCC

High Speed Clock (HSE): BYPASS Clock Source

Low Speed Clock (LSE) : Crystal/Ceramic Resonator

5.1.1. Parameter Settings:

System Parameters:

VDD voltage (V)	3.3
Prefetch Buffer	Enabled
Flash Latency(WS)	1 WS (2 CPU cycle)

RCC Parameters:

HSI Calibration Value	16
HSE Startup Timout Value (ms)	100
LSE Startup Timout Value (ms)	5000

5.2. SYS

mode: Debug Serial Wire

Timebase Source: TIM6

5.3. USART1

Mode: Asynchronous

5.3.1. Parameter Settings:

Basic Parameters:

Baud Rate	38400
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples
Single Sample	Disable

Advanced Features:

Auto Baudrate	Disable
TX Pin Active Level Inversion	Disable
RX Pin Active Level Inversion	Disable
Data Inversion	Disable

TX and RX Pins Swapping	Disable
Overrun	Enable
DMA on RX Error	Enable
MSB First	Disable

5.4. USART2

Mode: Asynchronous

5.4.1. Parameter Settings:

Basic Parameters:

Baud Rate	38400
Word Length	8 Bits (including Parity)
Parity	None
Stop Bits	1

Advanced Parameters:

Data Direction	Receive and Transmit
Over Sampling	16 Samples
Single Sample	Disable

Advanced Features:

TX Pin Active Level Inversion	Disable
RX Pin Active Level Inversion	Disable
Data Inversion	Disable
TX and RX Pins Swapping	Disable
Overrun	Enable
DMA on RX Error	Enable
MSB First	Disable

5.5. FREERTOS

mode: Enabled

5.5.1. Config parameters:

Versions:

FreeRTOS version	9.0.0
CMSIS-RTOS version	1.02

Kernel settings:

USE_PREEMPTION	Enabled
CPU_CLOCK_HZ	SystemCoreClock

TICK_RATE_HZ	1000
MAX_PRIORITIES	7
MINIMAL_STACK_SIZE	128
MAX_TASK_NAME_LEN	16
USE_16_BIT_TICKS	Disabled
IDLE_SHOULD_YIELD	Enabled
USE_MUTEXES	Enabled
USE_RECURSIVE_MUTEXES	Disabled
USE_COUNTING_SEMAPHORES	Disabled
QUEUE_REGISTRY_SIZE	8
USE_APPLICATION_TASK_TAG	Disabled
ENABLE_BACKWARD_COMPATIBILITY	Enabled
USE_PORT_OPTIMISED_TASK_SELECTION	Disabled
USE_TICKLESS_IDLE	Disabled
USE_TASK_NOTIFICATIONS	Enabled

Memory management settings:

Memory Allocation	Dynamic
TOTAL_HEAP_SIZE	3072
Memory Management scheme	heap_4

Hook function related definitions:

USE_IDLE_HOOK	Disabled
USE_TICK_HOOK	Disabled
USE_MALLOC_FAILED_HOOK	Disabled
USE_DAEMON_TASK_STARTUP_HOOK	Disabled
CHECK_FOR_STACK_OVERFLOW	Disabled

Run time and task stats gathering related definitions:

GENERATE_RUN_TIME_STATS	Disabled
USE_TRACE_FACILITY	Disabled
USE_STATS_FORMATTING_FUNCTIONS	Disabled

Co-routine related definitions:

USE_CO_ROUTINES	Disabled
MAX_CO_ROUTINE_PRIORITIES	2

Software timer definitions:

USE_TIMERS	Disabled

Interrupt nesting behaviour configuration:

LIBRARY_LOWEST_INTERRUPT_PRIORITY	3
LIBRARY_MAX_SYSCALL_INTERRUPT_PRIORITY	3

5.5.2. Include parameters:

Include definitions:

vTaskPrioritySet	Enabled
uxTaskPriorityGet	Enabled
vTaskDelete	Enabled
vTaskCleanUpResources	Disabled
vTaskSuspend	Enabled
vTaskDelayUntil	Disabled
vTaskDelay	Enabled
xTaskGetSchedulerState	Enabled
xTaskResumeFromISR	Enabled
xQueueGetMutexHolder	Disabled
xSemaphoreGetMutexHolder	Disabled
pcTaskGetTaskName	Disabled
uxTaskGetStackHighWaterMark	Disabled
xTaskGetCurrentTaskHandle	Disabled
eTaskGetState	Disabled
xEventGroupSetBitFromISR	Disabled
xTimerPendFunctionCall	Disabled
xTaskAbortDelay	Disabled
xTaskGetHandle	Disabled

*** User modified value**

6. System Configuration

6.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
RCC	PC14-OSC32_IN	RCC_OSC32_IN	n/a	n/a	n/a	
	PC15-OSC32_OUT	RCC_OSC32_OUT	n/a	n/a	n/a	
	PF0-OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
SYS	PA13	SYS_SWDIO	n/a	n/a	n/a	TMS
	PA14	SYS_SWCLK	n/a	n/a	n/a	TCK
USART1	PB6	USART1_TX	Alternate Function Push Pull	No pull-up and no pull-down	**High ***	
	PB7	USART1_RX	Alternate Function Push Pull	No pull-up and no pull-down	**High ***	
USART2	PA2	USART2_TX	Alternate Function Push Pull	No pull-up and no pull-down	Low	USART_TX
	PA3	USART2_RX	Alternate Function Push Pull	No pull-up and no pull-down	Low	USART_RX
Single Mapped Signals	PF1-OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
GPIO	PC13	GPIO_EXTI13	**External Interrupt Mode with Falling edge trigger detection**	No pull-up and no pull-down	n/a	B1 [Blue PushButton]
	PA5	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD2 [Green Led]
	PA6	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD1 [Red Led]
	PA7	GPIO_EXTI7	External Interrupt Mode with Rising edge trigger detection	No pull-up and no pull-down	n/a	B2 [Brown PushButton]

6.2. DMA configuration

nothing configured in DMA service

6.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority
Non maskable interrupt	true	0	0
Hard fault interrupt	true	0	0
System service call via SWI instruction	true	0	0
Pendable request for system service	true	3	0
System tick timer	true	3	0
TIM6 global interrupt	true	0	0
Flash global interrupt	unused		
RCC global interrupt	unused		
EXTI line 4 to 15 interrupts	unused		
USART1 global interrupt	unused		
USART2 global interrupt	unused		

*** User modified value**

7. Power Consumption Calculator report

7.1. Microcontroller Selection

Series	STM32F0
Line	STM32F0x0 Value Line
MCU	STM32F030R8Tx
Datasheet	024849_Rev2

7.2. Parameter Selection

Temperature	25
Vdd	3.6

8. Software Pack Report

9. Software Project

9.1. Project Settings

Name	Value
Project Name	Domotica_STM
Project Folder	/home/marlon/Documents/Domotica/Domotica_STM
Toolchain / IDE	SW4STM32
Firmware Package Name and Version	STM32Cube FW_F0 V1.9.0

9.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy only the necessary library files
Generate peripheral initialization as a pair of '.c/.h' files	No
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power consumption)	Yes