




A: baseline (Kp 1.56, Ki 41.2) → PWM jitter 0.126 %

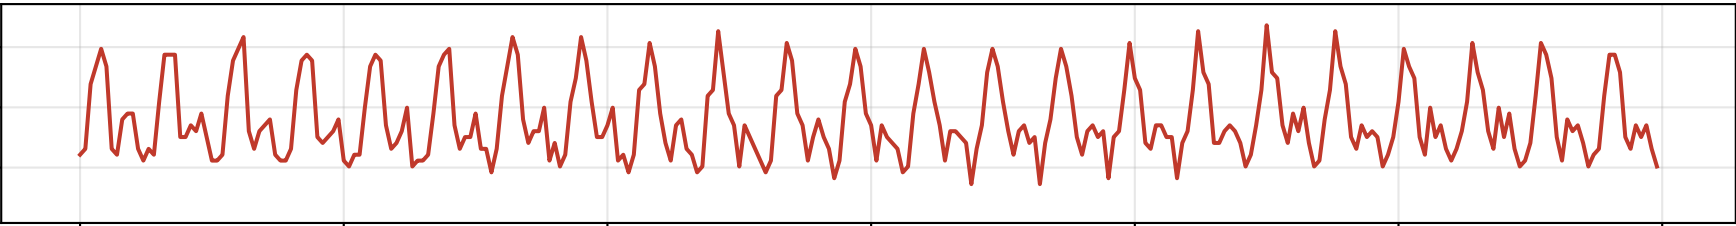


C1: Kp 1.2 → PWM jitter 0.096 % (-24 %)

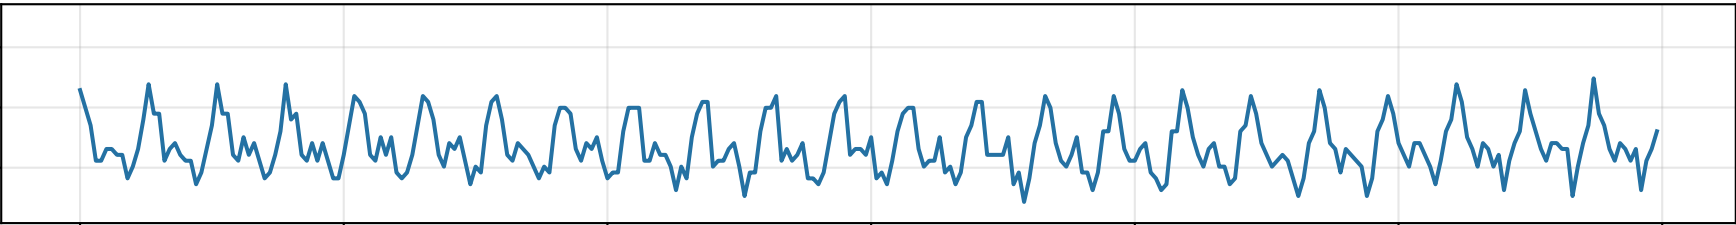


C2: Kp 1.0 → PWM jitter 0.084 % (-33 %)

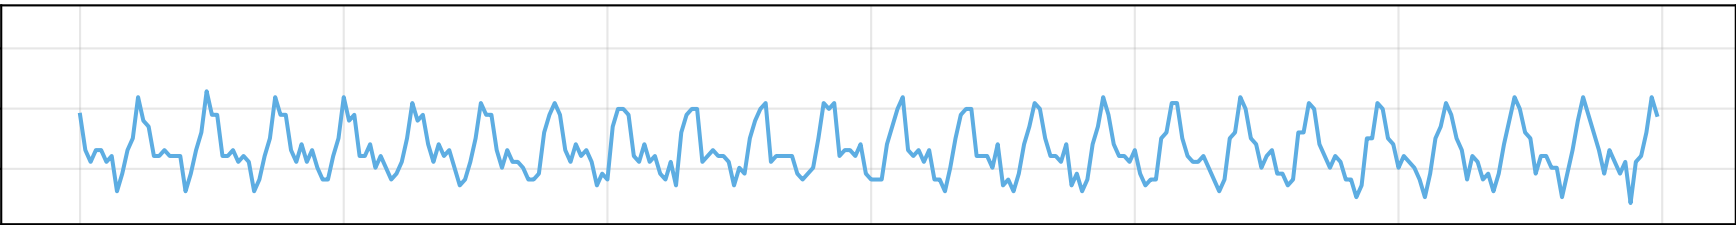


C3: Kp 0.8 → PWM jitter 0.073 % (-42 %)

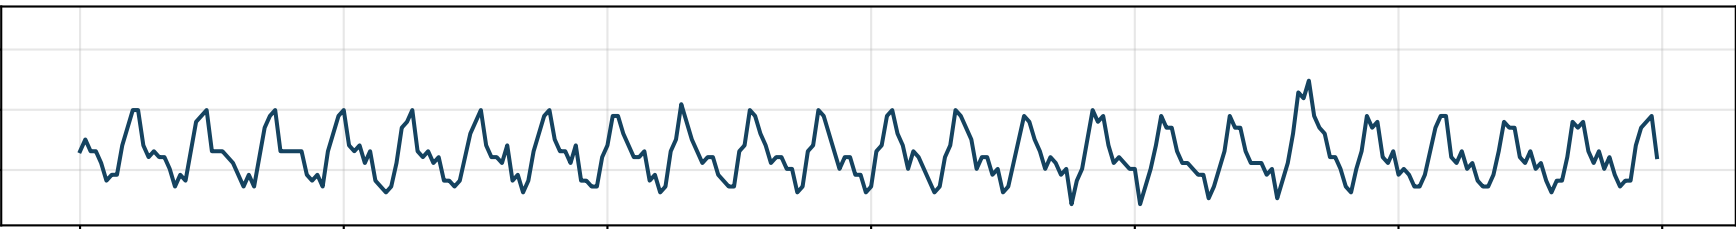


B1: α 0.5 → PWM jitter 0.075 % (-41 %)

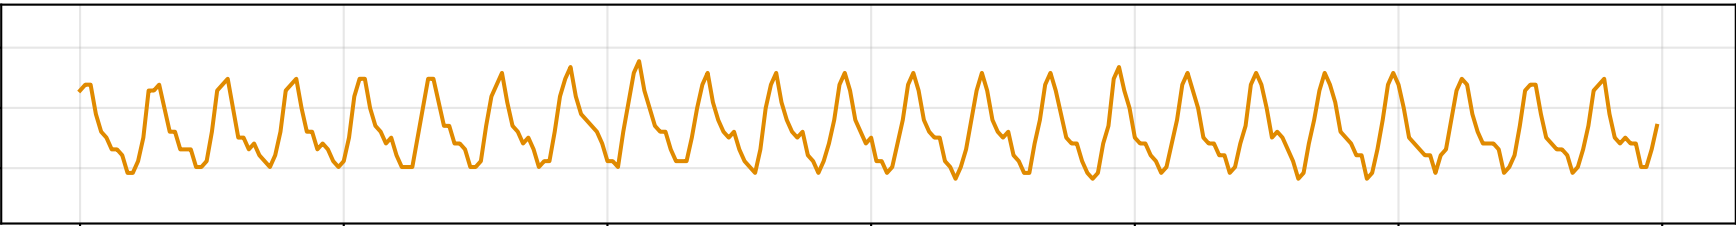


B2: α 0.3 → PWM jitter 0.047 % (-63 %)

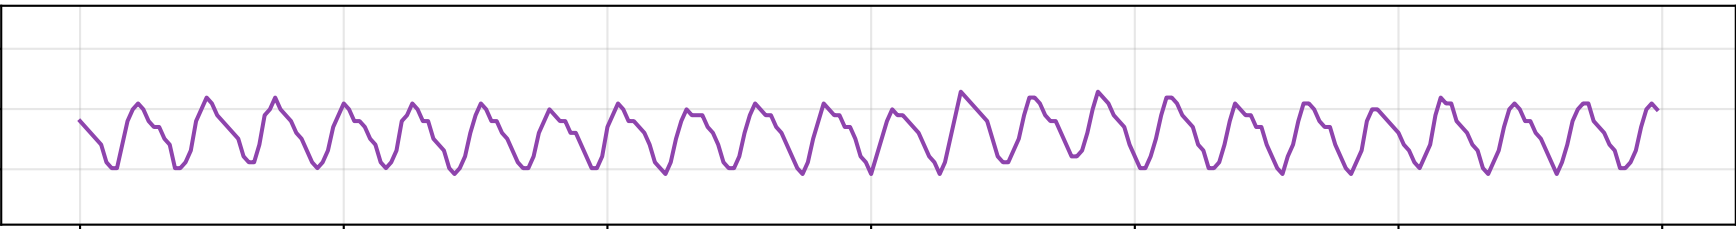


B3: α 0.15 → PWM jitter 0.023 % (-82 %)

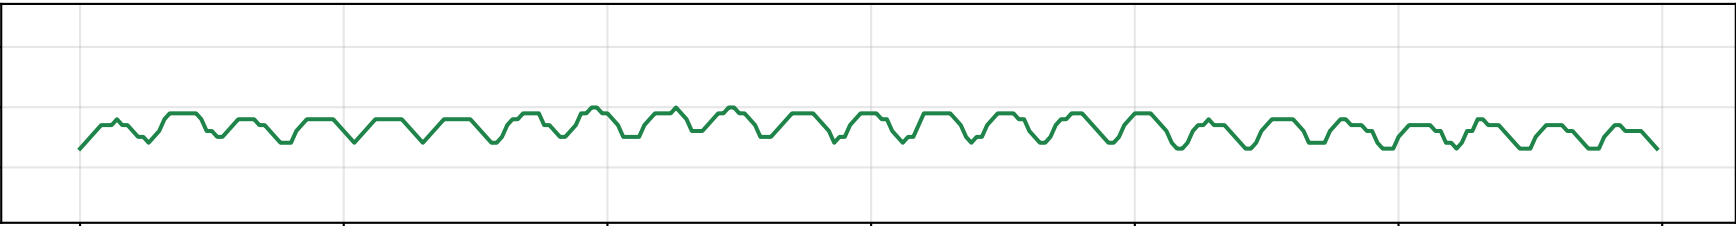


D1: Kp 1.2, α 0.5 → PWM jitter 0.059 % (-53 %)

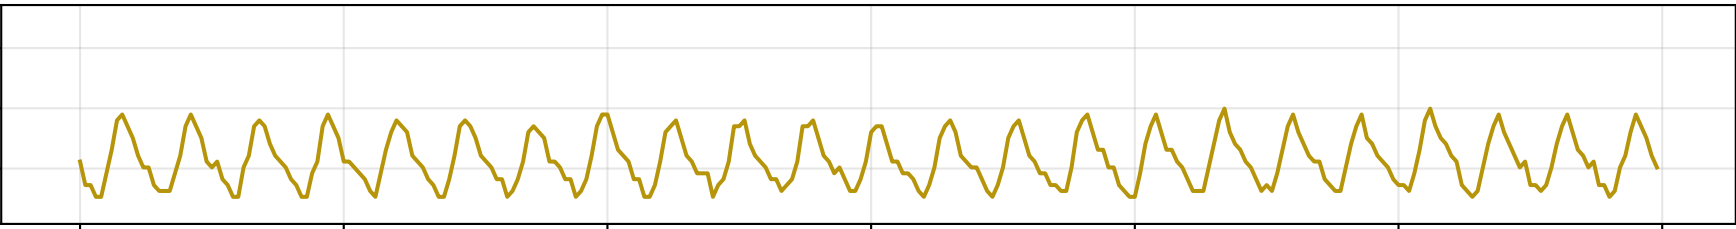


D2: Kp 1.2, α 0.3 → PWM jitter 0.038 % (-70 %)

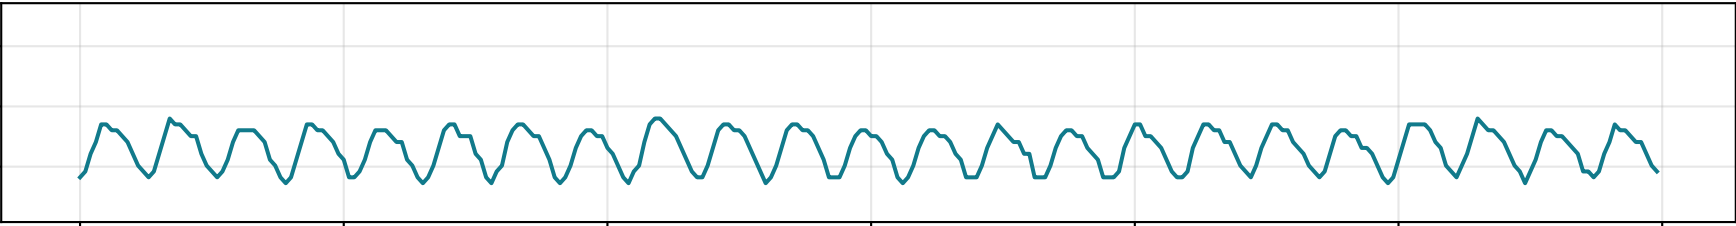

D3: Kp 1.0, α 0.5 → PWM jitter 0.050 % (-61 %)

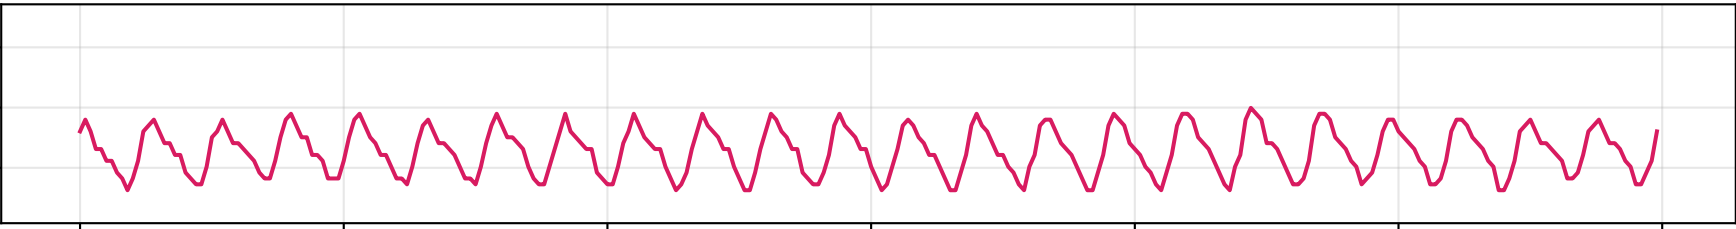

D4: Kp 1.0, α 0.3 → PWM jitter 0.031 % (-75 %)

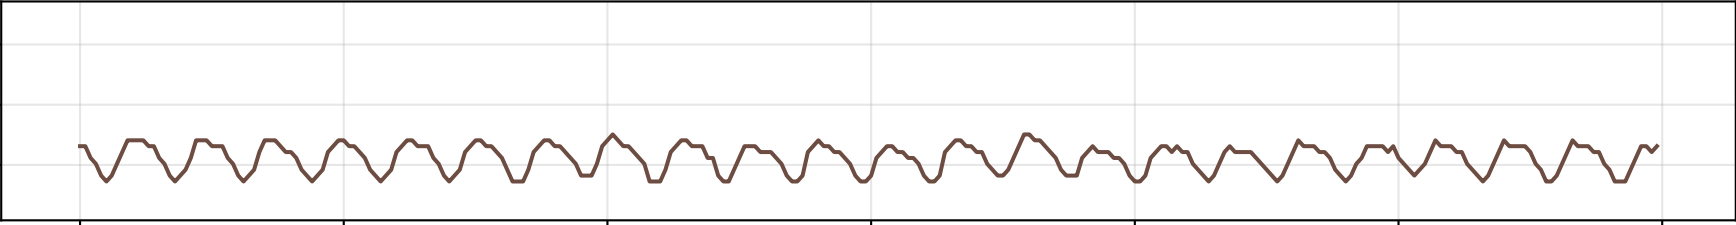

10.0 10.5 11.0 11.5 12.0 12.5 13.0

Time (s)