CORVUS' VERDICT

CROW'S EYE · CORVUS' VERDICT

Olive Baptist Church

Pensacola, FL · Church / Religious Facility · Indoor

Diagnostic — Security & Performance Issues

Report ID: OCWS-SN-OB032226
Survey Date: March 22, 2026
ACTION LEVEL: CRITICAL

SIGNAL METRICS

-55 dBm	-90 dBm	-60 dBm	20+	7+
Best RSSI	Worst RSSI	5 GHz Status	Networks Visible	Channel Conflicts
2.4 GHz · CH 6	2.4 GHz · CH 1	CH 64 · Serviceable	Across both bands	CH 6 · Severe

SCAN DATA — SCREENSHOTS

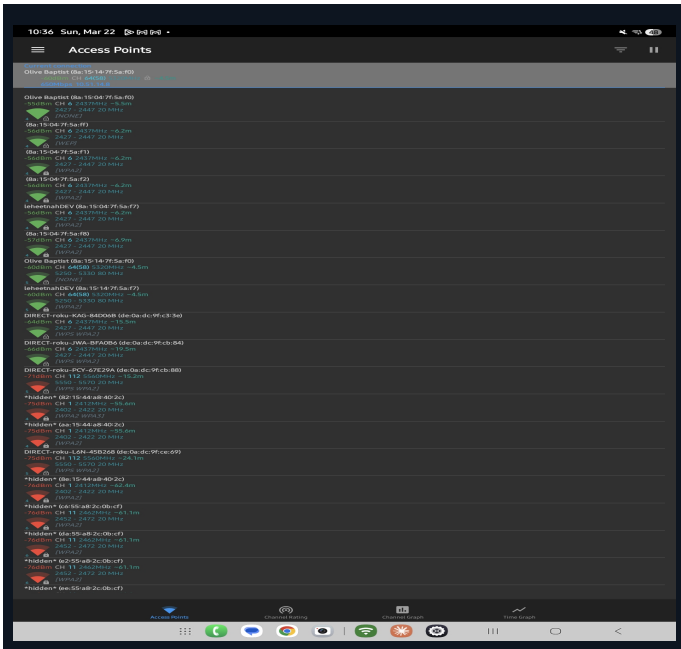

2.4 GHz Access Points — Olive Baptist Church

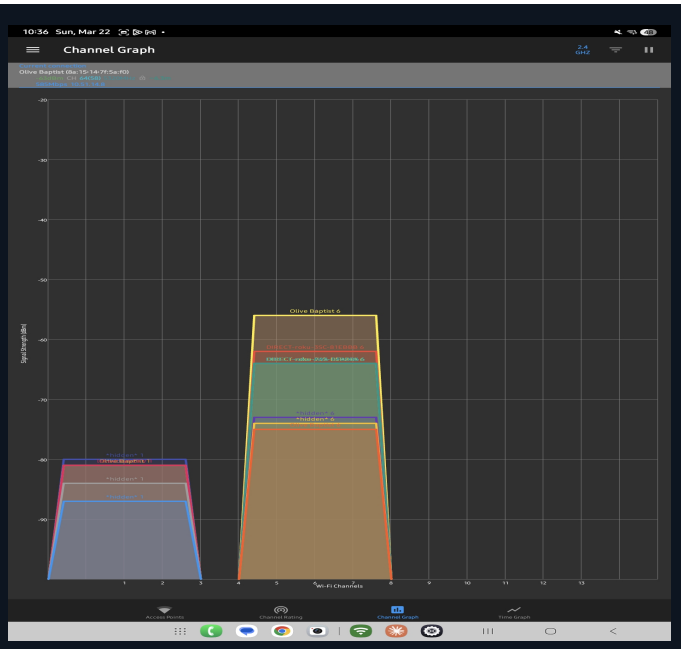

2.4 GHz Channel Graph — CH 6 Congestion Visible

NETWORK INVENTORY

SSID	BAND	CH	RSSI	VENDOR	STATUS
Olive Baptist	2.4 GHz	6	-55 dBm	8A:15:04	■ OPEN
Olive Baptist	5 GHz	64	-60 dBm	8A:15:14	■ OPEN
hidden x4	2.4 GHz	6	-56 dBm	8A:15:04	CLIENT?

leheetnahDEV	2.4 GHz	6	-56 dBm	8A:15:04	NEIGHBOR
leheetnahDEV	5 GHz	64	-60 dBm	8A:15:14	NEIGHBOR
DIRECT-roku-KAG	2.4 GHz	6	-64 dBm	DE:0A:DC	ROKU
DIRECT-roku-JWA	2.4 GHz	6	-66 dBm	DE:0A:DC	ROKU
DIRECT-roku-PCY	5 GHz	112	-71 dBm	DE:0A:DC	ROKU
hidden x3	2.4 GHz	1	-75 dBm	82:15:44	NEIGHBOR
hidden x3	2.4 GHz	11	-76 dBm	C6:55:A8	NEIGHBOR

■ OPEN networks highlighted in red — no password, no security on either band. Anyone within range has access.

CORVUS ANALYSIS

CROW'S EYE - CORVUS' VERDICT ANALYSIS

I have seen networks that were embarrassing and networks that were dangerous. Olive Baptist Church has managed to be both simultaneously. The primary SSID broadcasts on 2.4 GHz channel 6 at -55 dBm with security set to NONE. The 5 GHz network on channel 64 is also completely open. Both bands. No password. No encryption. Anyone within range is on this network right now. The channel 6 situation adds insult to injury — Olive Baptist is sharing that channel with four of its own hidden SSIDs all from the same MAC prefix, a neighbor at -56 dBm, and two Roku direct-connect devices at -64 and -66 dBm. The channel graph confirms what the access points list implies — channel 6 is a wall of competing signals while channels 3, 4, 9, and 10 sit completely empty. Channel 1 shows only weak distant activity at -75 to -80 dBm — effectively clean and available immediately. Every critical problem here is a configuration issue, not a hardware issue. WPA2 security, a 2.4 GHz channel move to channel 1, a 5 GHz relocation off channel 64, and disabling the Roku Wi-Fi Direct broadcasts would transform this network before Sunday. None of these fixes cost a dollar. They just require someone to log into the router.

FINDINGS

■ CRITICAL — Primary 2.4 GHz SSID Broadcasting With Zero Security

Olive Baptist is broadcasting its main 2.4 GHz network completely open — security shows as NONE in the scan data. No password. No encryption. Any device within range connects freely without credentials. In a church environment serving families, children, and congregants this is an unacceptable security posture. Every person in the parking lot, neighboring residences, and passing vehicles has unrestricted access to the church network right now.

→ **Enable WPA2-Personal security on the primary SSID immediately — router admin panel, takes under 10 minutes**

■ CRITICAL — 5 GHz Network Also Completely Open

The Olive Baptist 5 GHz network on CH 64(58) is also broadcasting with NO security. Both bands — 2.4 GHz and 5 GHz — are completely unsecured simultaneously. The 5 GHz network is additionally co-channeling with neighbor leheetnahDEV at identical -60 dBm signal strength, creating both a security failure and a performance conflict on the church's fastest band.

→ **Enable WPA2 on the 5 GHz network in the same router session — then move to CH 36 or CH 149**

■ CRITICAL — Channel 6 Carrying 7+ Competing Networks — Severe Congestion

Channel 6 is hosting Olive Baptist plus four hidden SSIDs sharing the same MAC prefix (8A:15:04) indicating they are all from the same router broadcasting multiple SSIDs, plus leheetnahDEV at -56 dBm, plus two Roku direct-connect devices at -64 and -66 dBm. The channel graph confirms a wall of overlapping signals. Every device on the church network constantly defers to neighbors. Sunday morning with 200+ congregants attempting to connect simultaneously will make this painfully visible.

→ **Move 2.4 GHz to channel 1 — the scan shows only weak signals at -75 to -80 dBm there, effectively clean**

■ WARNING — Four Hidden SSIDs Broadcasting From Church Router

Four hidden networks all share the MAC prefix 8A:15:04 — the same as the Olive Baptist primary SSID. The church router is broadcasting multiple SSIDs simultaneously, all on channel 6, all competing with the primary network for airtime. These hidden networks provide no security benefit while actively degrading performance.

→ **Log into router admin and disable all unnecessary secondary SSIDs — keep only primary and a separate guest network**

■ WARNING — Three Roku Devices Broadcasting Direct-Connect Signals

DIRECT-roku-KAG, DIRECT-roku-JWA on 2.4 GHz CH 6 and DIRECT-roku-PCY on 5 GHz CH 112 are all visible in the scan. These are Roku devices broadcasting Wi-Fi Direct signals from AV equipment — likely in the sanctuary or fellowship hall. Each one adds to the channel 6 congestion and creates unnecessary RF noise across both bands.

→ **Disable Wi-Fi Direct on each Roku device: Settings > System > Network > Disable Wi-Fi Direct**

■ INFO — No Separation Between Ministry Staff and Guest Traffic

There is no visible guest SSID separate from the primary Olive Baptist network. Ministry staff devices, administrative systems, and congregant personal devices are all on the same open network. This compounds the security concern — anyone connected has potential visibility into other devices on the same network segment.

→ **Create a dedicated guest SSID for congregant use — most routers support this natively at no cost**

■ GOOD — Channel 1 Available for Clean Relocation

While CH 1 shows a few weak hidden networks at -75 to -80 dBm, it is significantly cleaner than the current CH 6 situation. Moving the primary church network to CH 1 would immediately and substantially reduce co-channel interference. The channel graph confirms CH 1 is lightly loaded compared to the wall of signals on CH 6.

PRIORITIZED RECOMMENDATIONS

1 **Enable WPA2 Security on Both Networks — Today, Before Sunday**

Log into your router admin panel at 192.168.0.1 or 192.168.1.1. Find wireless security settings for both 2.4 GHz and 5 GHz. Change from None/Open to WPA2-Personal. Set a strong passphrase and share it with ministry staff. This is the single most critical fix and takes under 10 minutes. Every other problem is secondary to closing this open door.

2 **Move 2.4 GHz from Channel 6 to Channel 1**

In the same router admin session, change the 2.4 GHz channel from 6 to 1. The scan shows channel 1 carrying only weak distant signals at -75 to -80 dBm — effectively uncontested. This single change immediately removes the church network from the seven-network channel war currently destroying Sunday morning performance.

3 **Move 5 GHz from Channel 64 to Channel 36 or 149**

Relocate the 5 GHz network away from CH 64 where neighbor leheetnahDEV is competing at identical -60 dBm signal strength. CH 36 is in the lower UNII-1 band, typically less congested. CH 149 places you in UNII-3 with clear separation. Either eliminates the co-channel conflict on the church's fastest band.

4 **Disable Roku Wi-Fi Direct on All AV Equipment**

Identify the Roku devices broadcasting DIRECT-roku SSIDs — likely in the sanctuary or fellowship hall AV setup. On each device: Settings > System > Network > uncheck Enable Wi-Fi Direct. This removes three unnecessary networks from the already-congested environment and reduces RF noise across both bands during services.

5 **Disable Unnecessary Hidden SSIDs**

Four hidden networks are broadcasting from the same church router simultaneously. Log into the router admin panel and disable all secondary SSIDs that are not actively needed. Reducing the number of SSIDs the router manages improves performance and reduces channel utilization.

6 **Create a Dedicated Guest Network for Congregants**

Once security is enabled on the primary network, create a separate guest SSID for congregant and visitor use. Most routers support this natively. Display the guest password on a screen or bulletin. Keep the primary network for staff and ministry systems only. This improves both security and performance simultaneously.

7 **Schedule Full Reckoning for Complete Facility Assessment**

This Verdict was rendered from a single scan location. A Full Reckoning walk survey maps coverage throughout the entire facility — sanctuary, fellowship hall, offices, classrooms, and parking areas — and measures actual performance during a live Sunday service with full congregant load. An OCWS Pro Certified Full Reckoning delivers a signed report suitable for board presentation, insurance documentation, or vendor quotes for infrastructure upgrades. $750 flat.

OCWS CERTIFIED ✓

Joshua Turner
Managing Member · Old Crows Wireless Solutions LLC
U.S. Navy CTT (EW) · Active Duty · 17 Years Service · Retiring Oct 2028

Corvus' Verdict rendered by Crow's Eye · Certified by Joshua Turner · March 22, 2026

Want the full picture? Corvus rendered this Verdict from a single scan location. An OCWS Pro certified walk survey maps every square foot of signal, validates performance at every workstation, and delivers a signed report valid for compliance, insurance, or vendor documentation. Request a Pro Survey at oldcrowswireless.com - $750

This Corvus' Verdict was rendered by Crow's Eye and reviewed by Joshua Turner, Managing Member of Old Crows Wireless Solutions LLC. Findings are based on passive Wi-Fi scan data collected at a single point in time and location. Signal conditions may vary by time of day, occupancy, and environmental factors. This document is confidential and intended solely for the named client. © 2026 Old Crows Wireless Solutions LLC · oldcrowswireless.com · Pensacola, FL