CORRIE F rev 3 Step 2: swells, port patches, guy-port facings, Hypalon tabs - PAGE MAP

Paper: LETTER 215.9 x 279.4 mm, 2 rows x 3 cols = 6 tiles (+ this map = 7 pages).

Print at 100% / ACTUAL SIZE (no 'fit to page'). Verify the 100 mm and 4 in squares.

Assemble: rows A.. top to bottom, columns 1.. left to right; overlap 12 mm.

Lines: solid = CUT, grey dashed = SEW, red = notches, blue arrow = grain, circle+cross = drill hole.

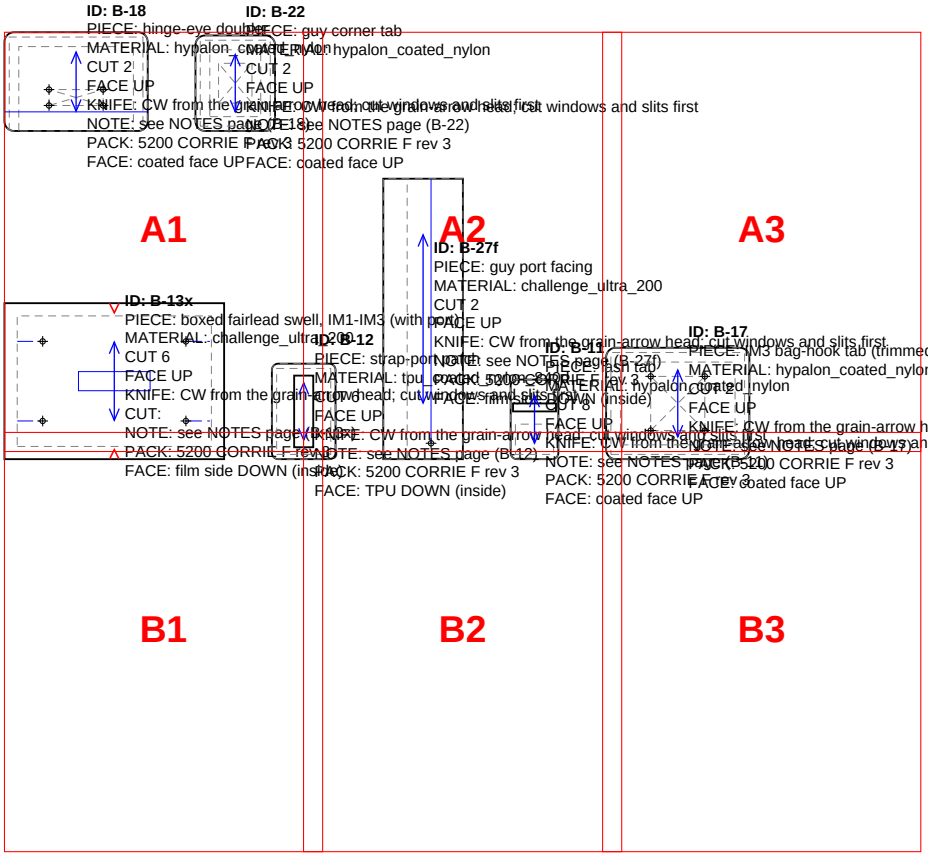

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

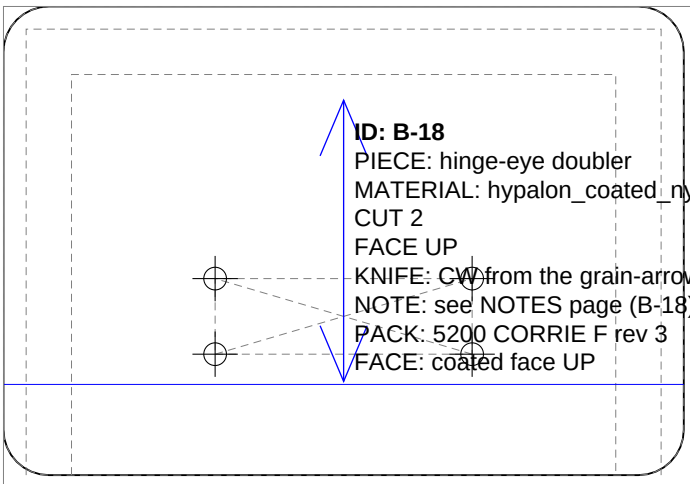

ID: B-18
PIECE: hinge-eye doubler
MATERIAL: hypalon_coated_nylon
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: see NOTES page (B-18)
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

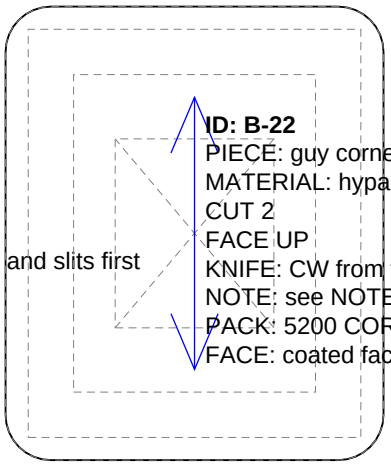

ID: B-22
PIECE: guy corner tab
MATERIAL: hypalon_coated_nylon
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head
NOTE: see NOTES page (B-22)
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

A2 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

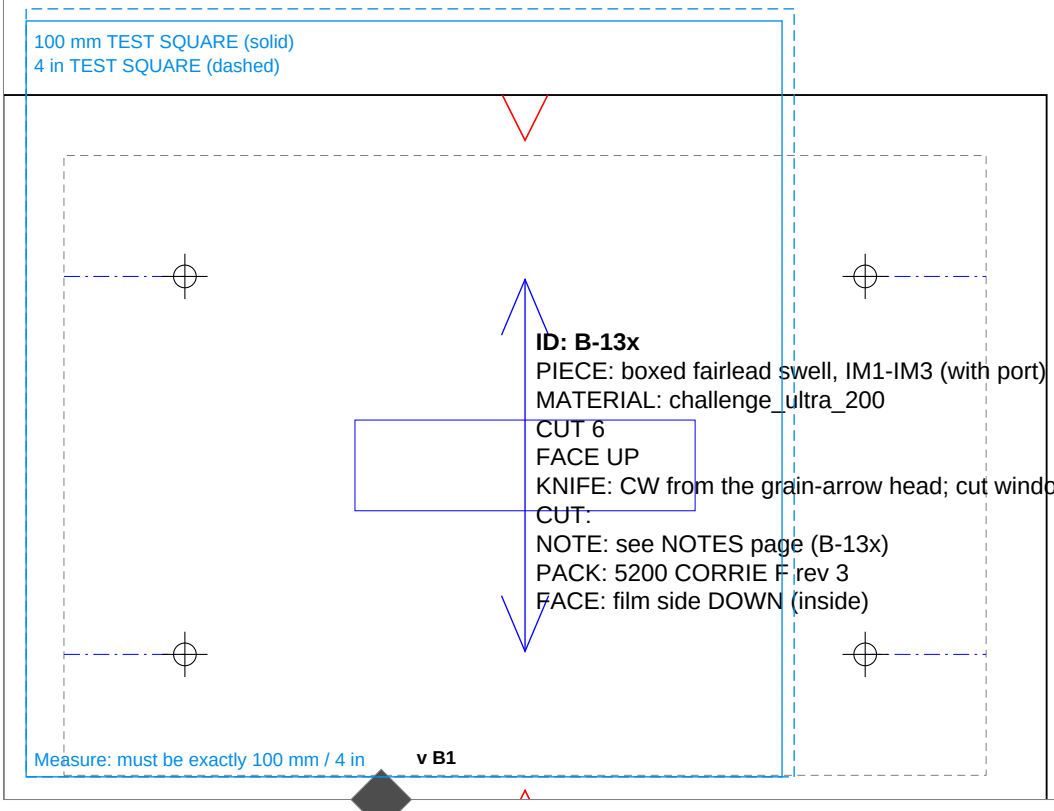

ID: B-13x
PIECE: boxed fairlead swell, IM1-IM3 (with port)
MATERIAL: challenge_ultra_200
CUT 6
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
CUT:
NOTE: see NOTES page (B-13x)
PACK: 5200 CORRIE F rev 3
FACE: film side DOWN (inside)

Measure: must be exactly 100 mm / 4 in

v B1

A2 >

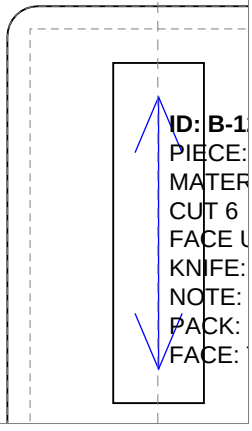

ID: B-1
PIECE:
MATER
CUT 6
FACE U
KNIFE:
NOTE:
PACK:
FACE:

v B1

< A1

A3 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

ID: B-27f
PIECE: guy port facing
MATERIAL: challenge_ultra_200
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: see NOTES page (B-27f)
PACK: 5200 CORRIE F rev 3
FACE: film side DOWN (inside)

< A1

A3 >

ID: B-12
PIECE: strap-port patch
MATERIAL: tpu_coated_nylon_840d
CUT 6
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: see NOTES page (B-12)
PACK: 5200 CORRIE F rev 3
FACE: TPU DOWN (inside)

Measure: must be exactly 100 mm / 4 in

v B2

ID: B-11
PIECE: lash tab
MATERIAL: hypalon_coated_nylon
CUT 8
FACE UP
KNIFE: CW from the grain-arrow head
NOTE: see NOTES page (B-11)
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

v B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< A2

< A2

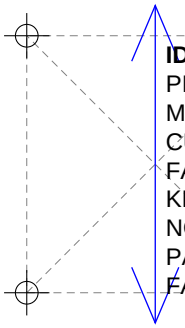

ID: B-17
PIECE: IM3 bag-hook tab (trimmed)
MATERIAL: hypalon_coated_nylon
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: see NOTES page (B-17)
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

v B3

v B3

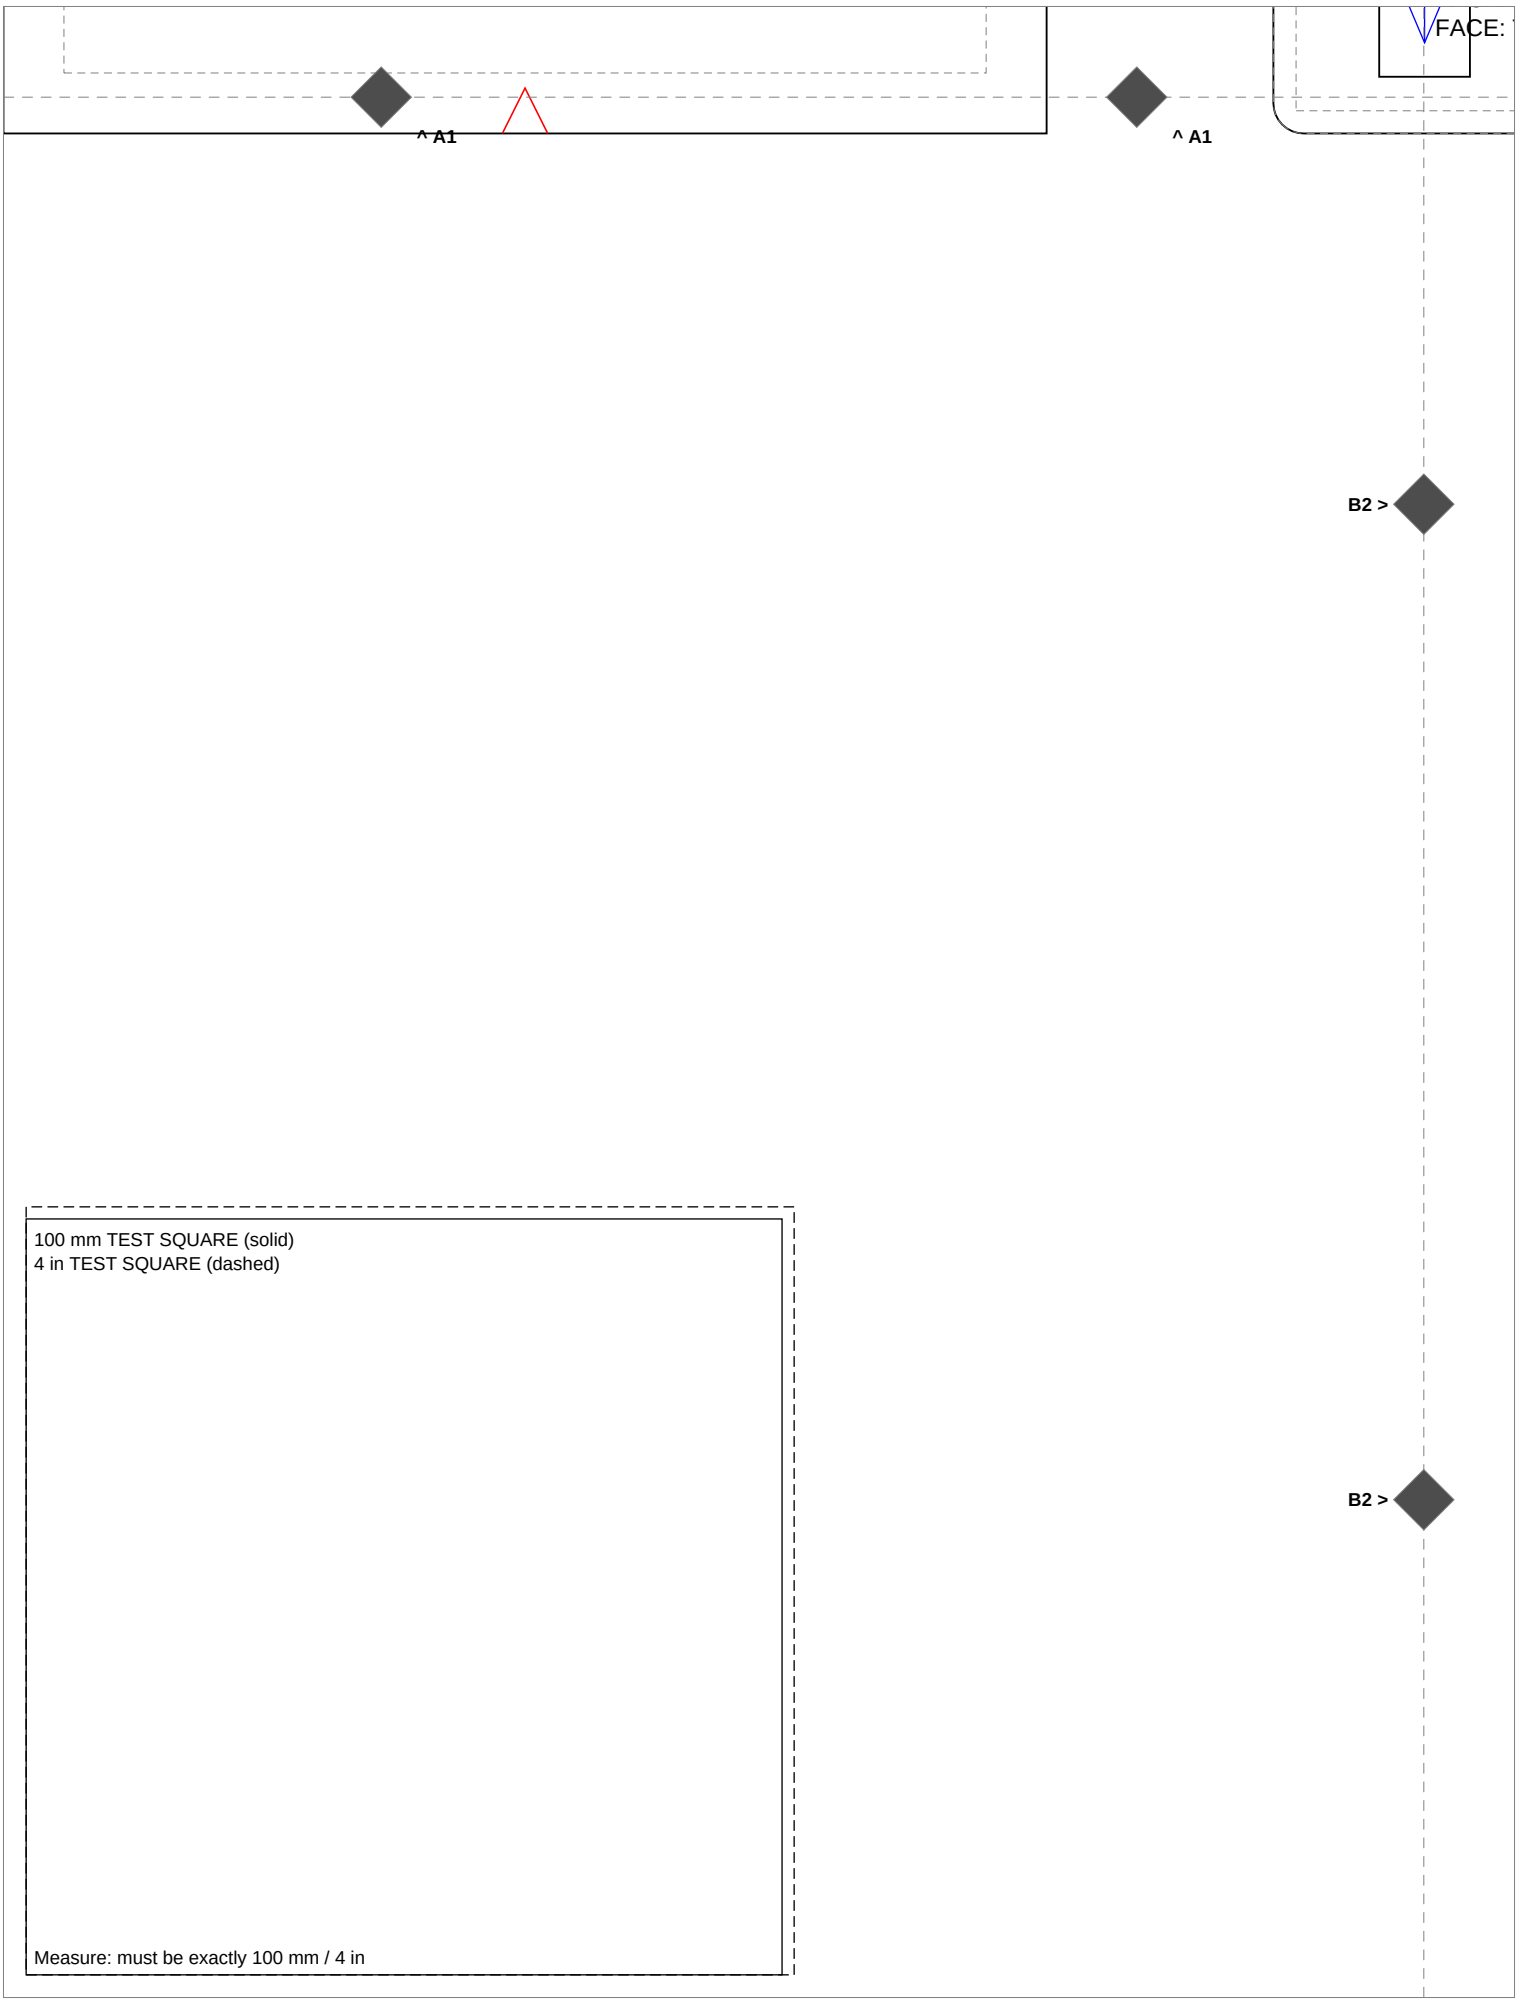
FACE:
^ A1
^ A1
B2 >
B2 >
100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)
Measure: must be exactly 100 mm / 4 in

FACE: TPU DOWN (inside)

^ A2

NOTE: see NOTES page (B-11)
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

^ A2

< B1

B3 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< B1

B3 >

Trim neighbour page on its border; align to dashed line; match diamonds.

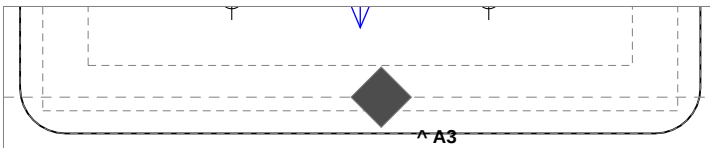

^ A3

^ A3

< B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

< B2

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: piece NOTES (full text; the DXFs carry the same)

B-13x boxed fairlead swell, IM1-IM3 (with port)

sew INSIDE B-01 over the IM1/IM2/IM3 windows; B-12 patch on the crest first

B-12 strap-port patch

laser-cut; on the swell crest (outside), slot through patch + swell; edge-stitch slot and perimeter; no load

B-27f guy port facing

B-01 fabric, hot-cut edges (laminate does not fray); INSIDE B-01 under the slit

B-11 lash tab

laser-cut; slot 27 x 5; R gusset: bow riser; L gusset: light lash only, NO load rating; muzzle keepers both (panels.yaml B-11, released)

B-17 IM3 bag-hook tab (trimmed)

laser-cut; OUTSIDE B-01 at x +/-115, z 385-455; T3 tongue box-X at centre

B-18 hinge-eye doubler

laser-cut; INSIDE B-01 at x +/-115, coated face to B-01; lower edge ON the B-01 cut edge (12 mm below the floor seam line, caught in the floor seam); HE box-X 34x10; rows top + sides only

B-22 guy corner tab

laser-cut, no seam allowance; INSIDE B-02h (the hinge band) at x +/-130.3, z 695; coated face to the band

CORRIE F rev 3: webbing marks 1:1 (page 1 of 2)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed).

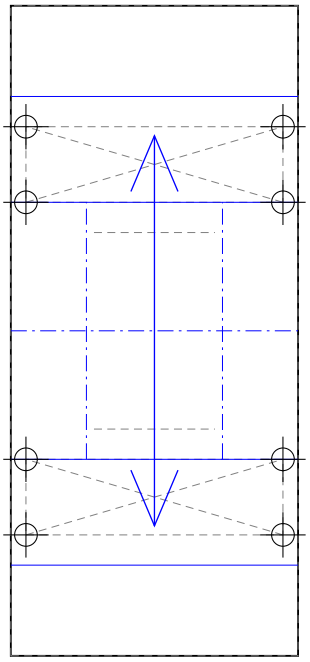

HE 38 x 86 mm

cut 2

EYE FOLD: fold in half here
box-X through HE (2 plies) + B-01 + B-18 (leg A)
box-X (leg B, same box once folded)
floor seam line (raw end below it goes in the seam)
neck line
neck: fold the edge in to this line
neck tack BT-M (one per leg)

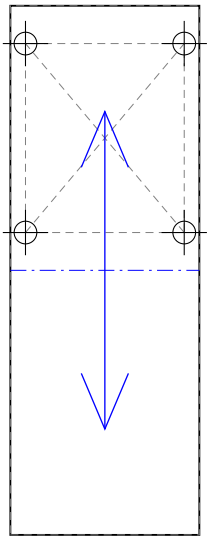

RTM 25 x 70 mm

cut 2

fold round the buckle's female-half bar
box-X through RTM + B-03

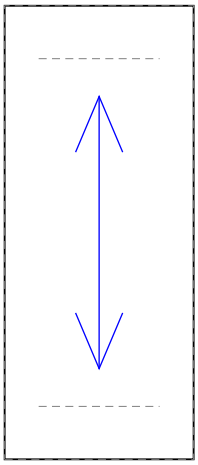

W3G 25 x 60 mm

cut 2

W3G tack BT-S (16 x 2, 304)

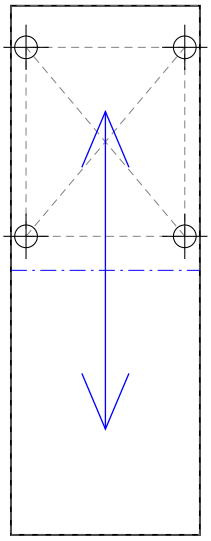

LLT 25 x 70 mm

cut 2

fold round the lock bar
box-X through B-22 + B-02h

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 2 of 2)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed).

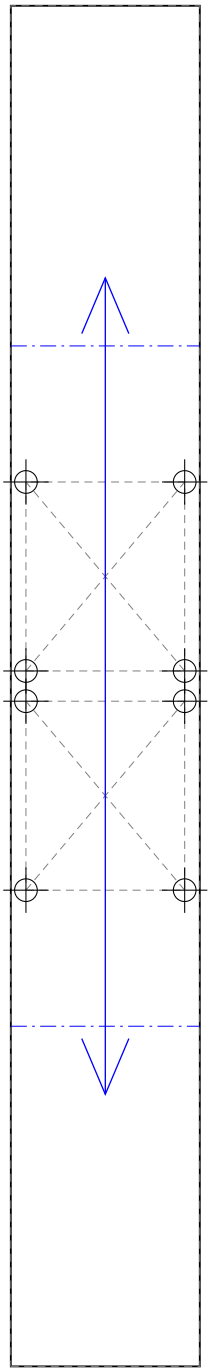

IMC 25 x 180 mm

cut 3

fold round the CAM anchor bar
fold round the G-hook bar / carabiner
cam end
hook end

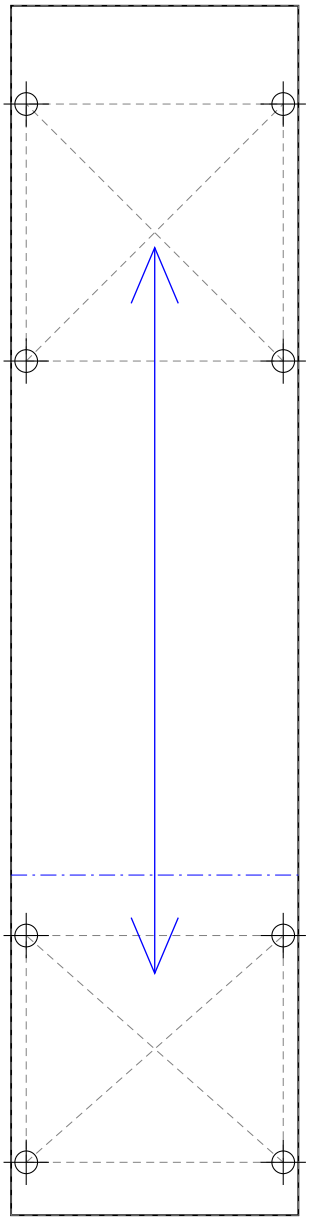

T3 38 x 160 mm

cut 2

fold round the hook bed
loop
box-X to B-17

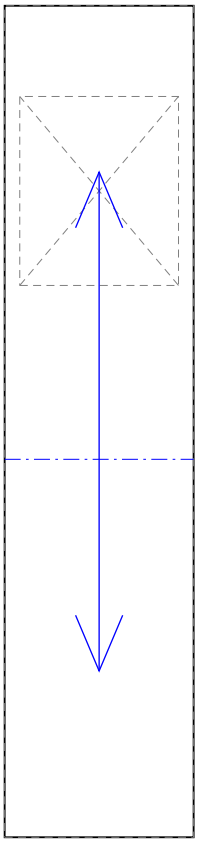

US 25 x 550 mm

cut 2; first 110 mm shown

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in