CORRIE F rev 3 Step 2: swells, port patches, guy-port facings, Hypalon tabs - PAGE MAP

Paper: LETTER 215.9 x 279.4 mm, 2 rows x 3 cols = 6 tiles (+ this map = 7 pages).

Print at 100% / ACTUAL SIZE (no 'fit to page'). Verify the 100 mm and 4 in squares.

Assemble: rows A.. top to bottom, columns 1.. left to right; overlap 12 mm.

Lines: solid = CUT, grey dashed = SEW, red = notches, blue arrow = grain, circle+cross = drill hole.

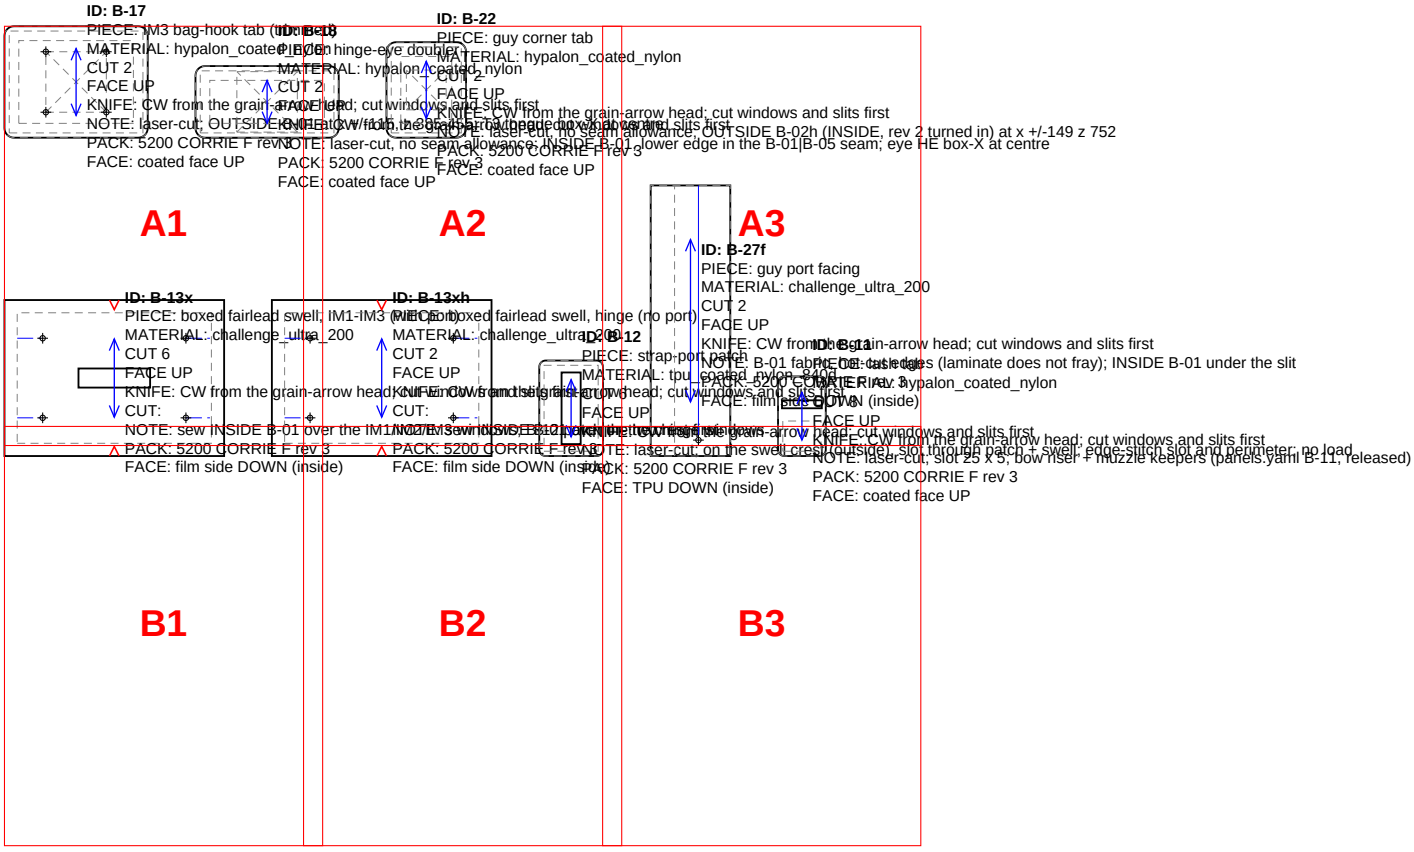

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

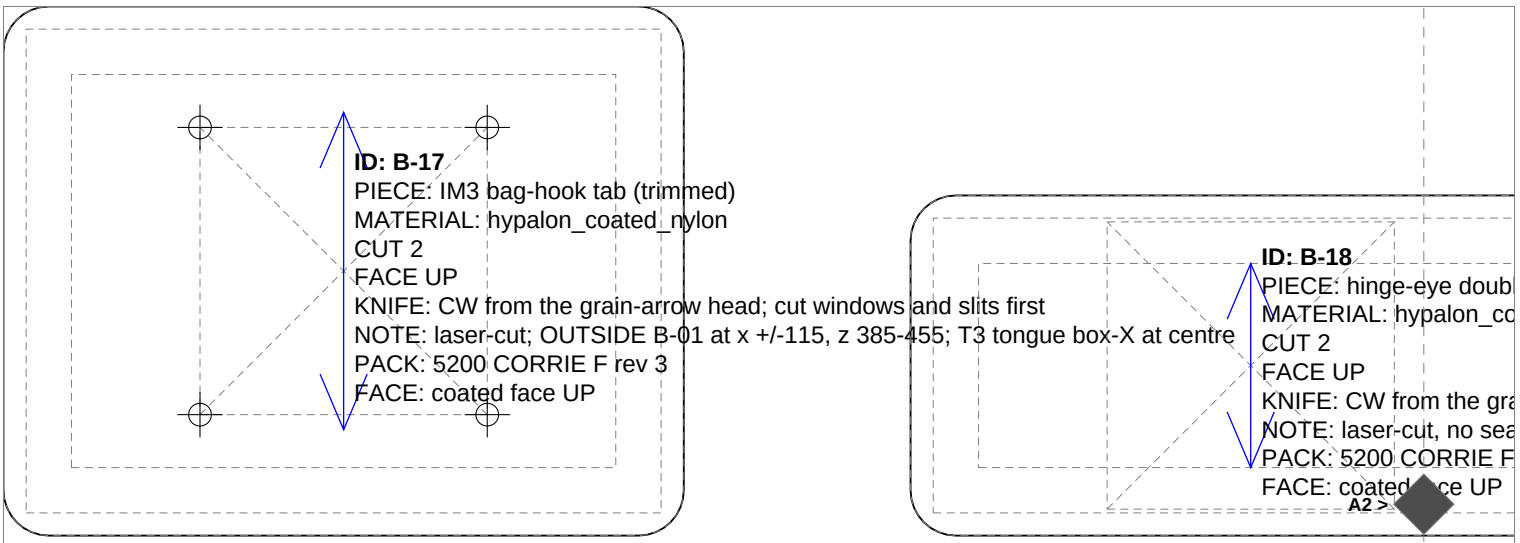

ID: B-17
PIECE: IM3 bag-hook tab (trimmed)
MATERIAL: hypalon_coated_nylon
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: laser-cut; OUTSIDE B-01 at x +/-115, z 385-455; T3 tongue box-X at centre
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

ID: B-18
PIECE: hinge-eye doubl
MATERIAL: hypalon_co
CUT 2
FACE UP
KNIFE: CW from the gra
NOTE: laser-cut, no sea
PACK: 5200 CORRIE F
FACE: coated ce UP

A2 >

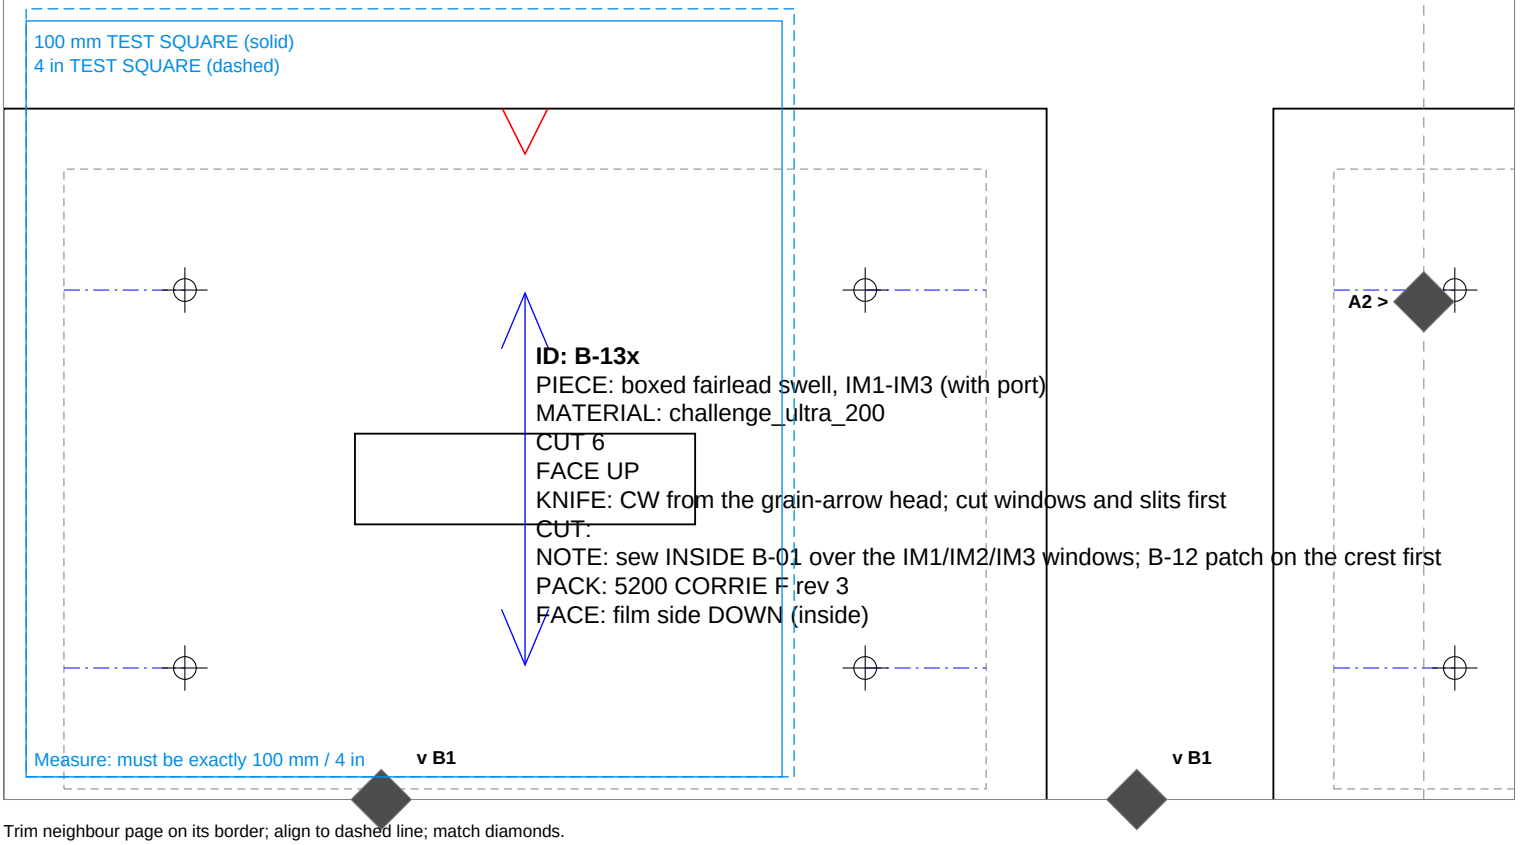

ID: B-13x
PIECE: boxed fairlead swell, IM1-IM3 (with port)
MATERIAL: challenge_ultra_200
CUT 6
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
CUT:
NOTE: sew INSIDE B-01 over the IM1/IM2/IM3 windows; B-12 patch on the crest first
PACK: 5200 CORRIE F rev 3
FACE: film side DOWN (inside)

Trim neighbour page on its border; align to dashed line; match diamonds.

ye doubler
palon_coated_nylon

m the grain-arrow head; cut windows and slits first
t, no seam allowance; INSIDE B-01, lower edge in the FACE: coated face UP
ORRIE F rev 3
ce UP

< A1

ID: B-22
PIECE: guy corner tab
MATERIAL: hypalon_coated_nylon
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: laser-cut, no seam allowance; OUTSIDE B-02h (INSIDE, rev 2 turned in) at x + B-05 at the box-X at centre
PACK: 5200 CORRIE F rev 3
FACE: coated face UP

A3 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

< A1

ID: B-13xh
PIECE: boxed fairlead swell, hinge (no port)
MATERIAL: challenge_ultra_200
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
CUT:
NOTE: sew INSIDE B-01 over the two hinge windows
PACK: 5200 CORRIE F rev 3
FACE: film side DOWN (inside)

A3 >

Measure: must be exactly 100 mm / 4 in

v B2

ID: B-12
PIECE: strap-port pat
MATERIAL: tpu_coate
CUT 6
FACE UP
KNIFE: CW from the g
NOTE: laser-cut; on tl
PACK: 5200 CORRIE
FACE: TPU DOWN (i

v B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< A2

ID: B-27f
PIECE: guy port facing
MATERIAL: challenge_ultra_200
CUT 2
FACE UP
KNIFE: CW from the grain-arrow head; cut windows and slits first
NOTE: B-01 fabric, hot-cut edges (laminate does not fray); INSIDE B-01 under the slit
PACK: 5200 CORRIE F rev 3
FACE: film side DOWN (inside)

< A2

-port patch
pu_coated_nylon_840d

rom the grain-arrow head; cut windows and slits first
cut; on the swell crest (outside), slot through patch + swell; edge-stitch slot and perimeter; no lead
CORRIE F rev 3
OWN (inside)

v B3

ID: B-11
PIECE: lash tab
MATERIAL: hypalon_coated_nylon
CUT 8
FACE UP
KNIFE: CW from the grain-arrow head; cut windows
NOTE: laser-cut; slot 25 x 5; bow riser + muzzle kee
PACK: 5200 CORRIE F rev 3
FACE: coated f e UP

v B3

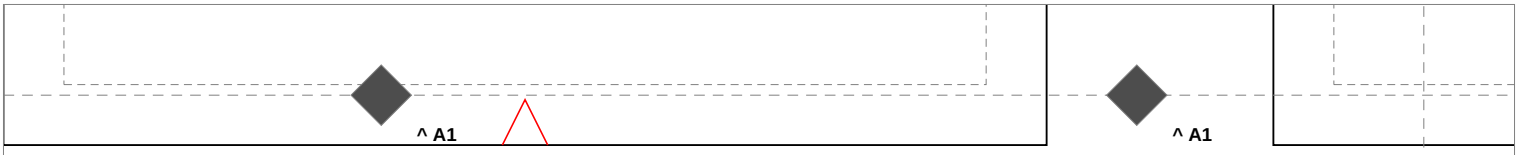

B2 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

B2 >

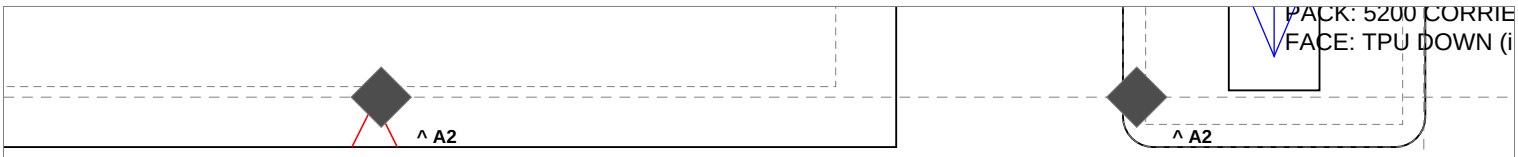

< B1

B3 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< B1

B3 >

CORRIE F rev 3
DOWN (inside)

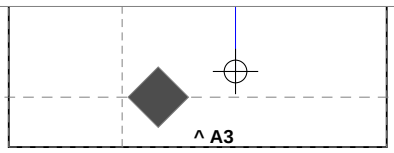

^ A3

NOTE: laser-cut; slot 25 x 5; bow riser + muzzle kee
PACK: 5200 CORRIE F rev 3
FACE: coated f e UP

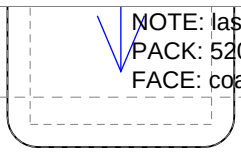

^ A3

< B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< B2

Trim neighbour page on its border; align to dashed line; match diamonds.