CORRIE F rev 3 Step 2: swells, port patches, guy-port facings, Hypalon tabs - PAGE MAP

Paper: LETTER 215.9 x 279.4 mm, 2 rows x 3 cols = 6 tiles (+ this map = 7 pages).

Print at 100% / ACTUAL SIZE (no 'fit to page'). Verify the 100 mm and 4 in squares.

Assemble: rows A.. top to bottom, columns 1.. left to right; overlap 12 mm.

Lines: solid = CUT, grey dashed = SEW, red = notches, blue arrow = grain, circle+cross = drill hole.

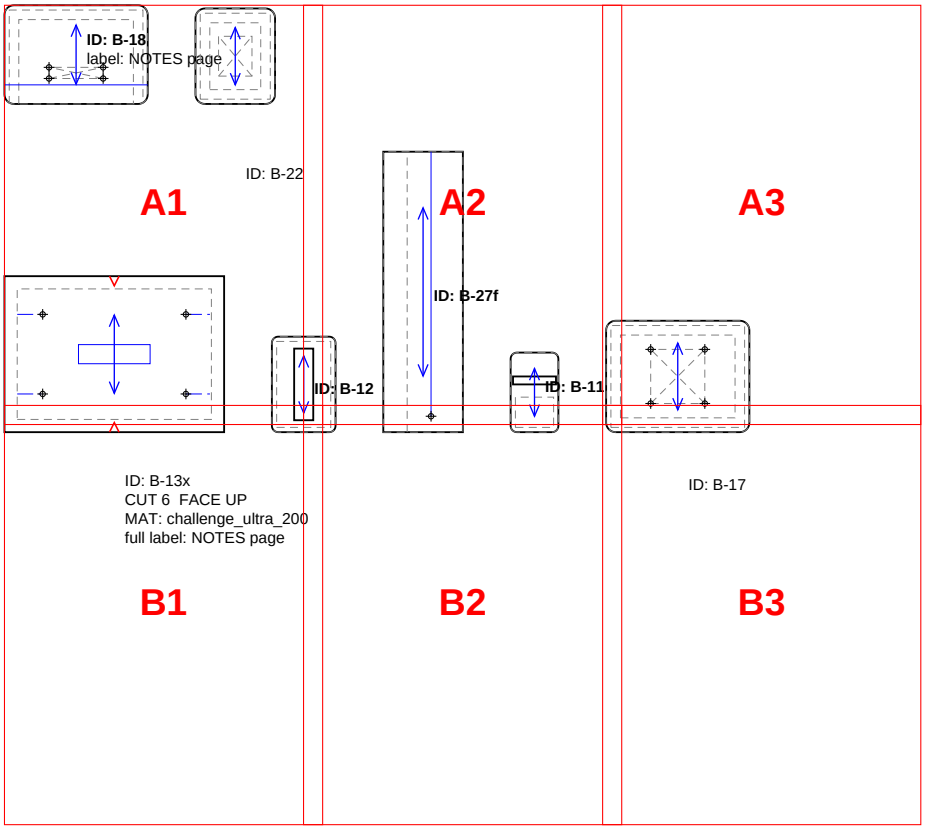

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

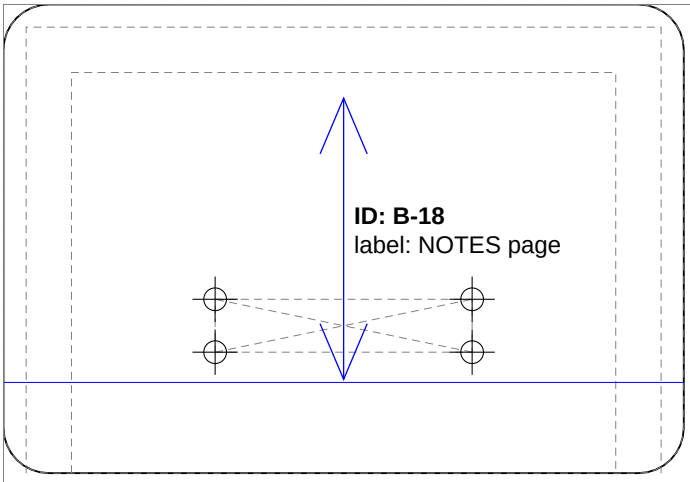

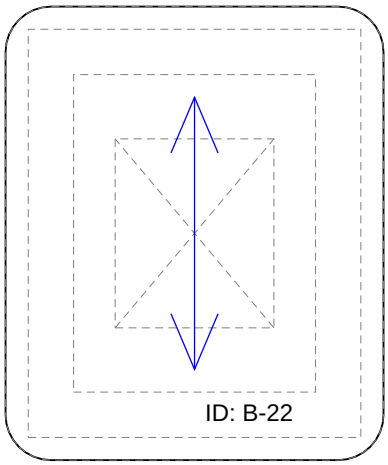

A2 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

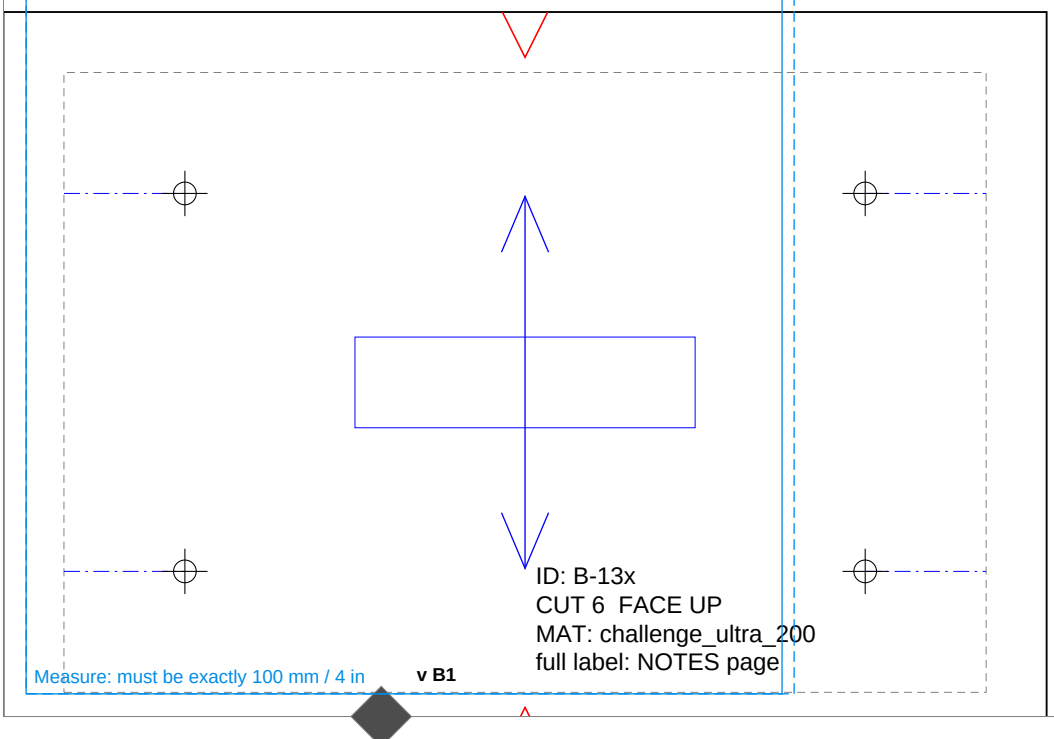

Measure: must be exactly 100 mm / 4 in

v B1

A2 >

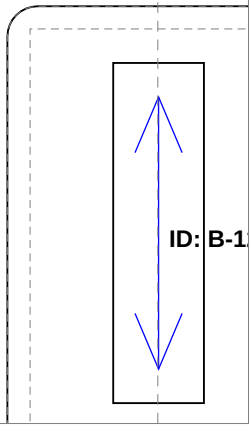

v B1

Trim neighbour page on its border; align to dashed line; match diamonds.

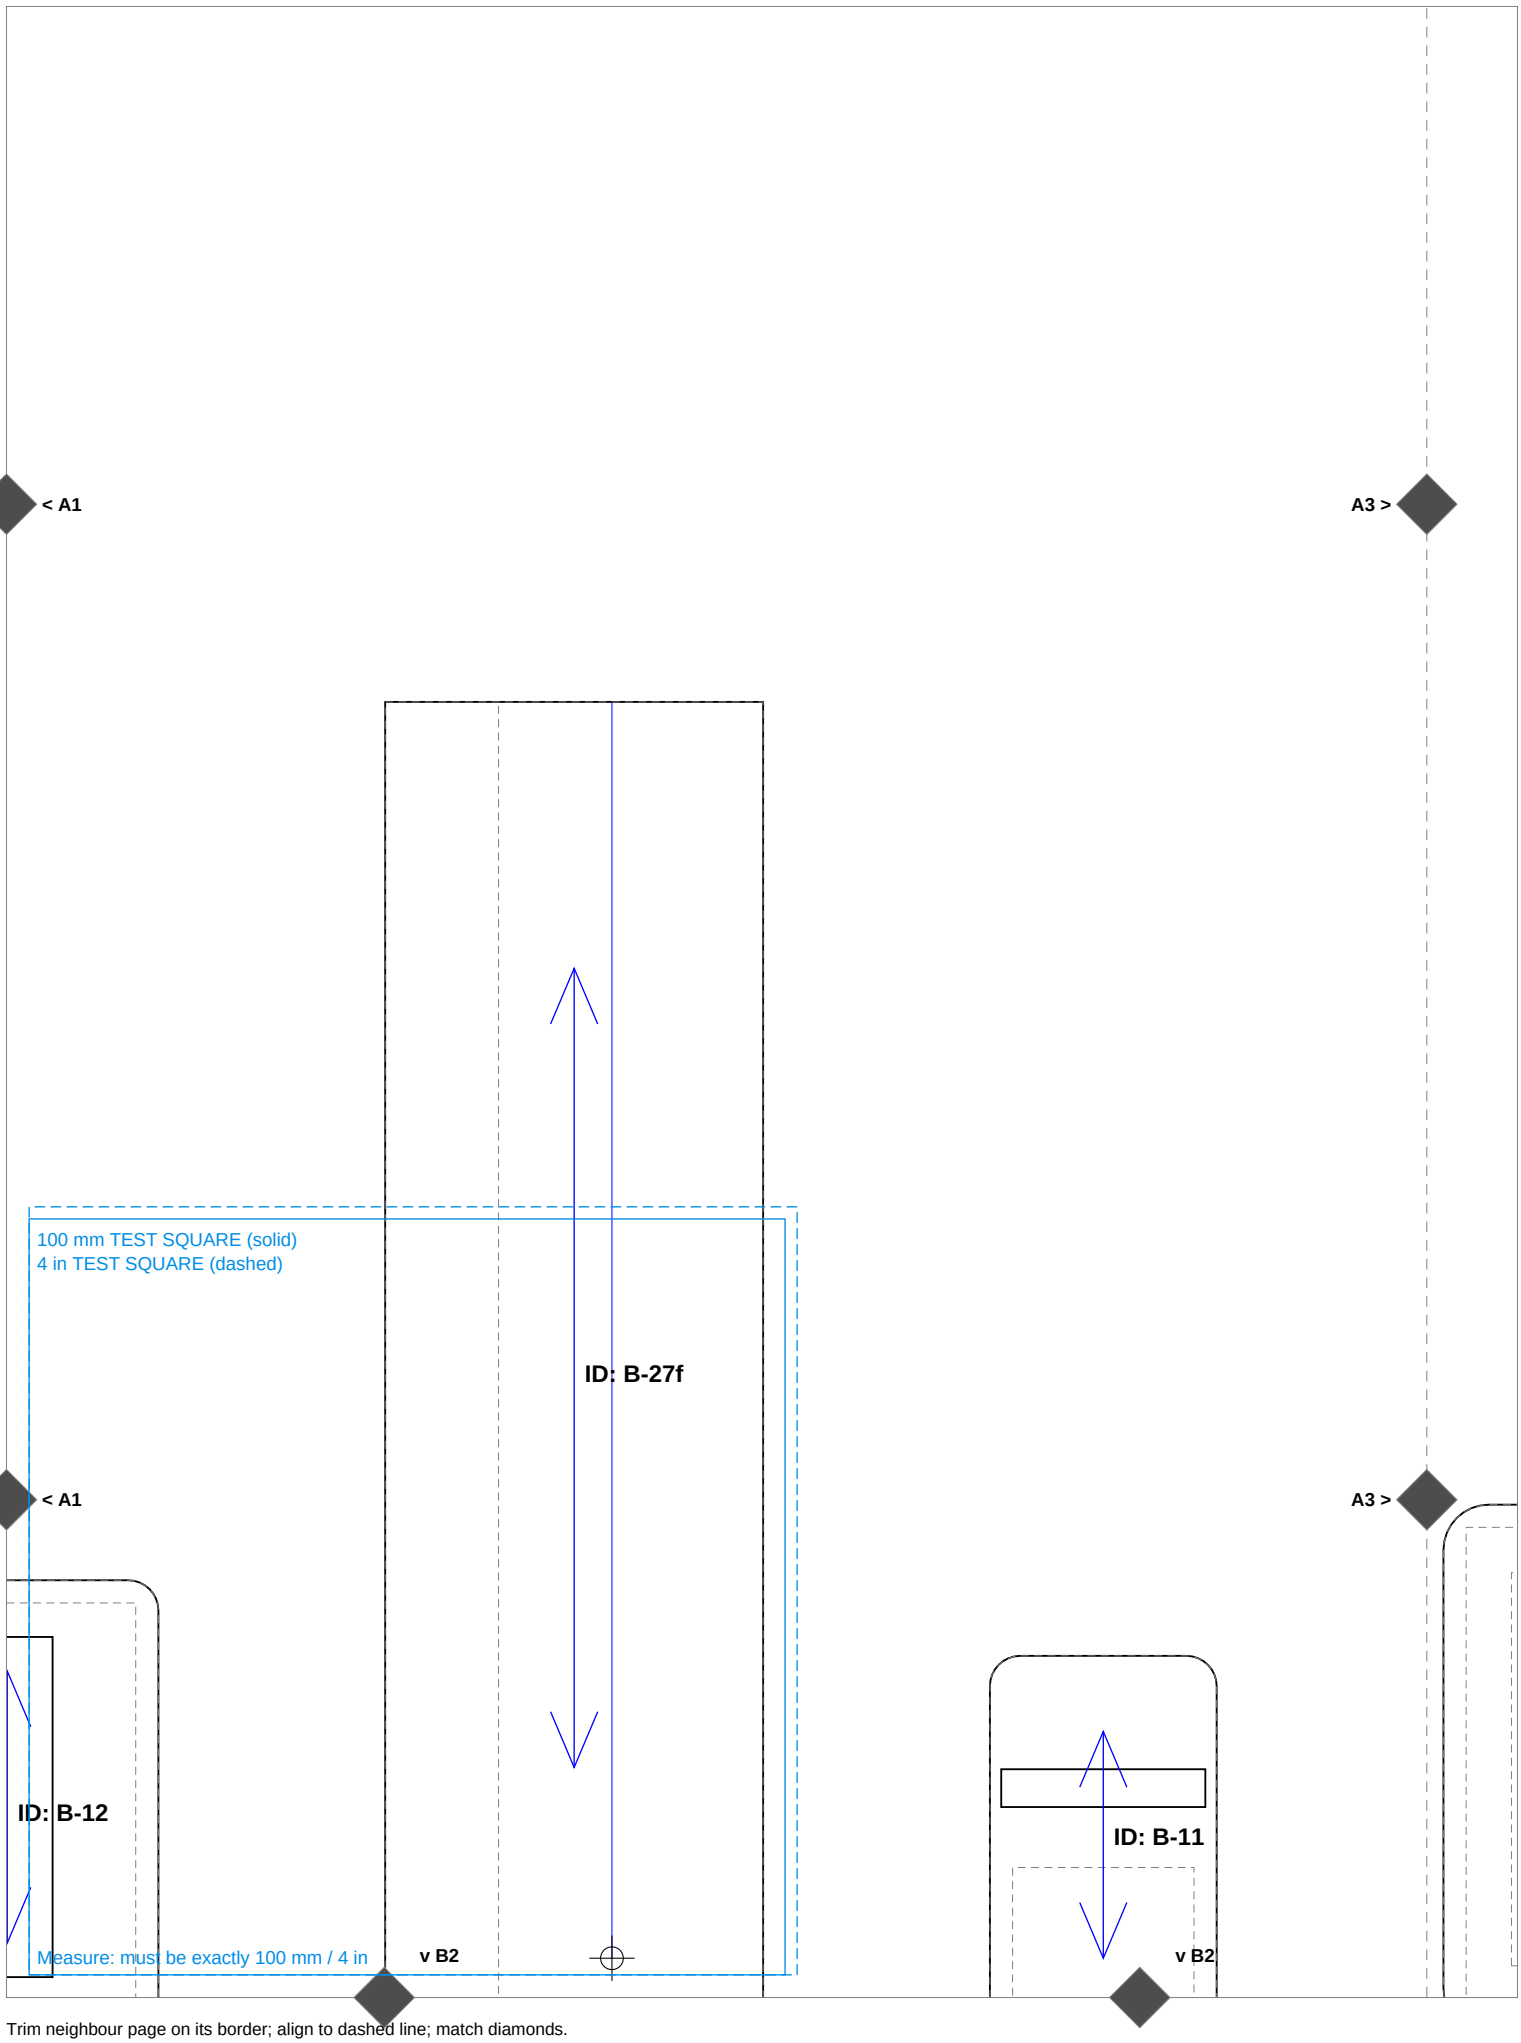
< A1
A3 >
100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)
ID: B-27f
< A1
A3 >
ID: B-12
ID: B-11
Measure: must be exactly 100 mm / 4 in
v B2
v B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

< A2

Measure: must be exactly 100 mm / 4 in

< A2

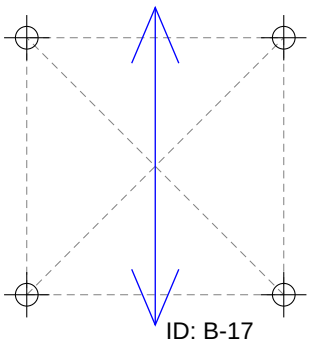

ID: B-17

v B3

v B3

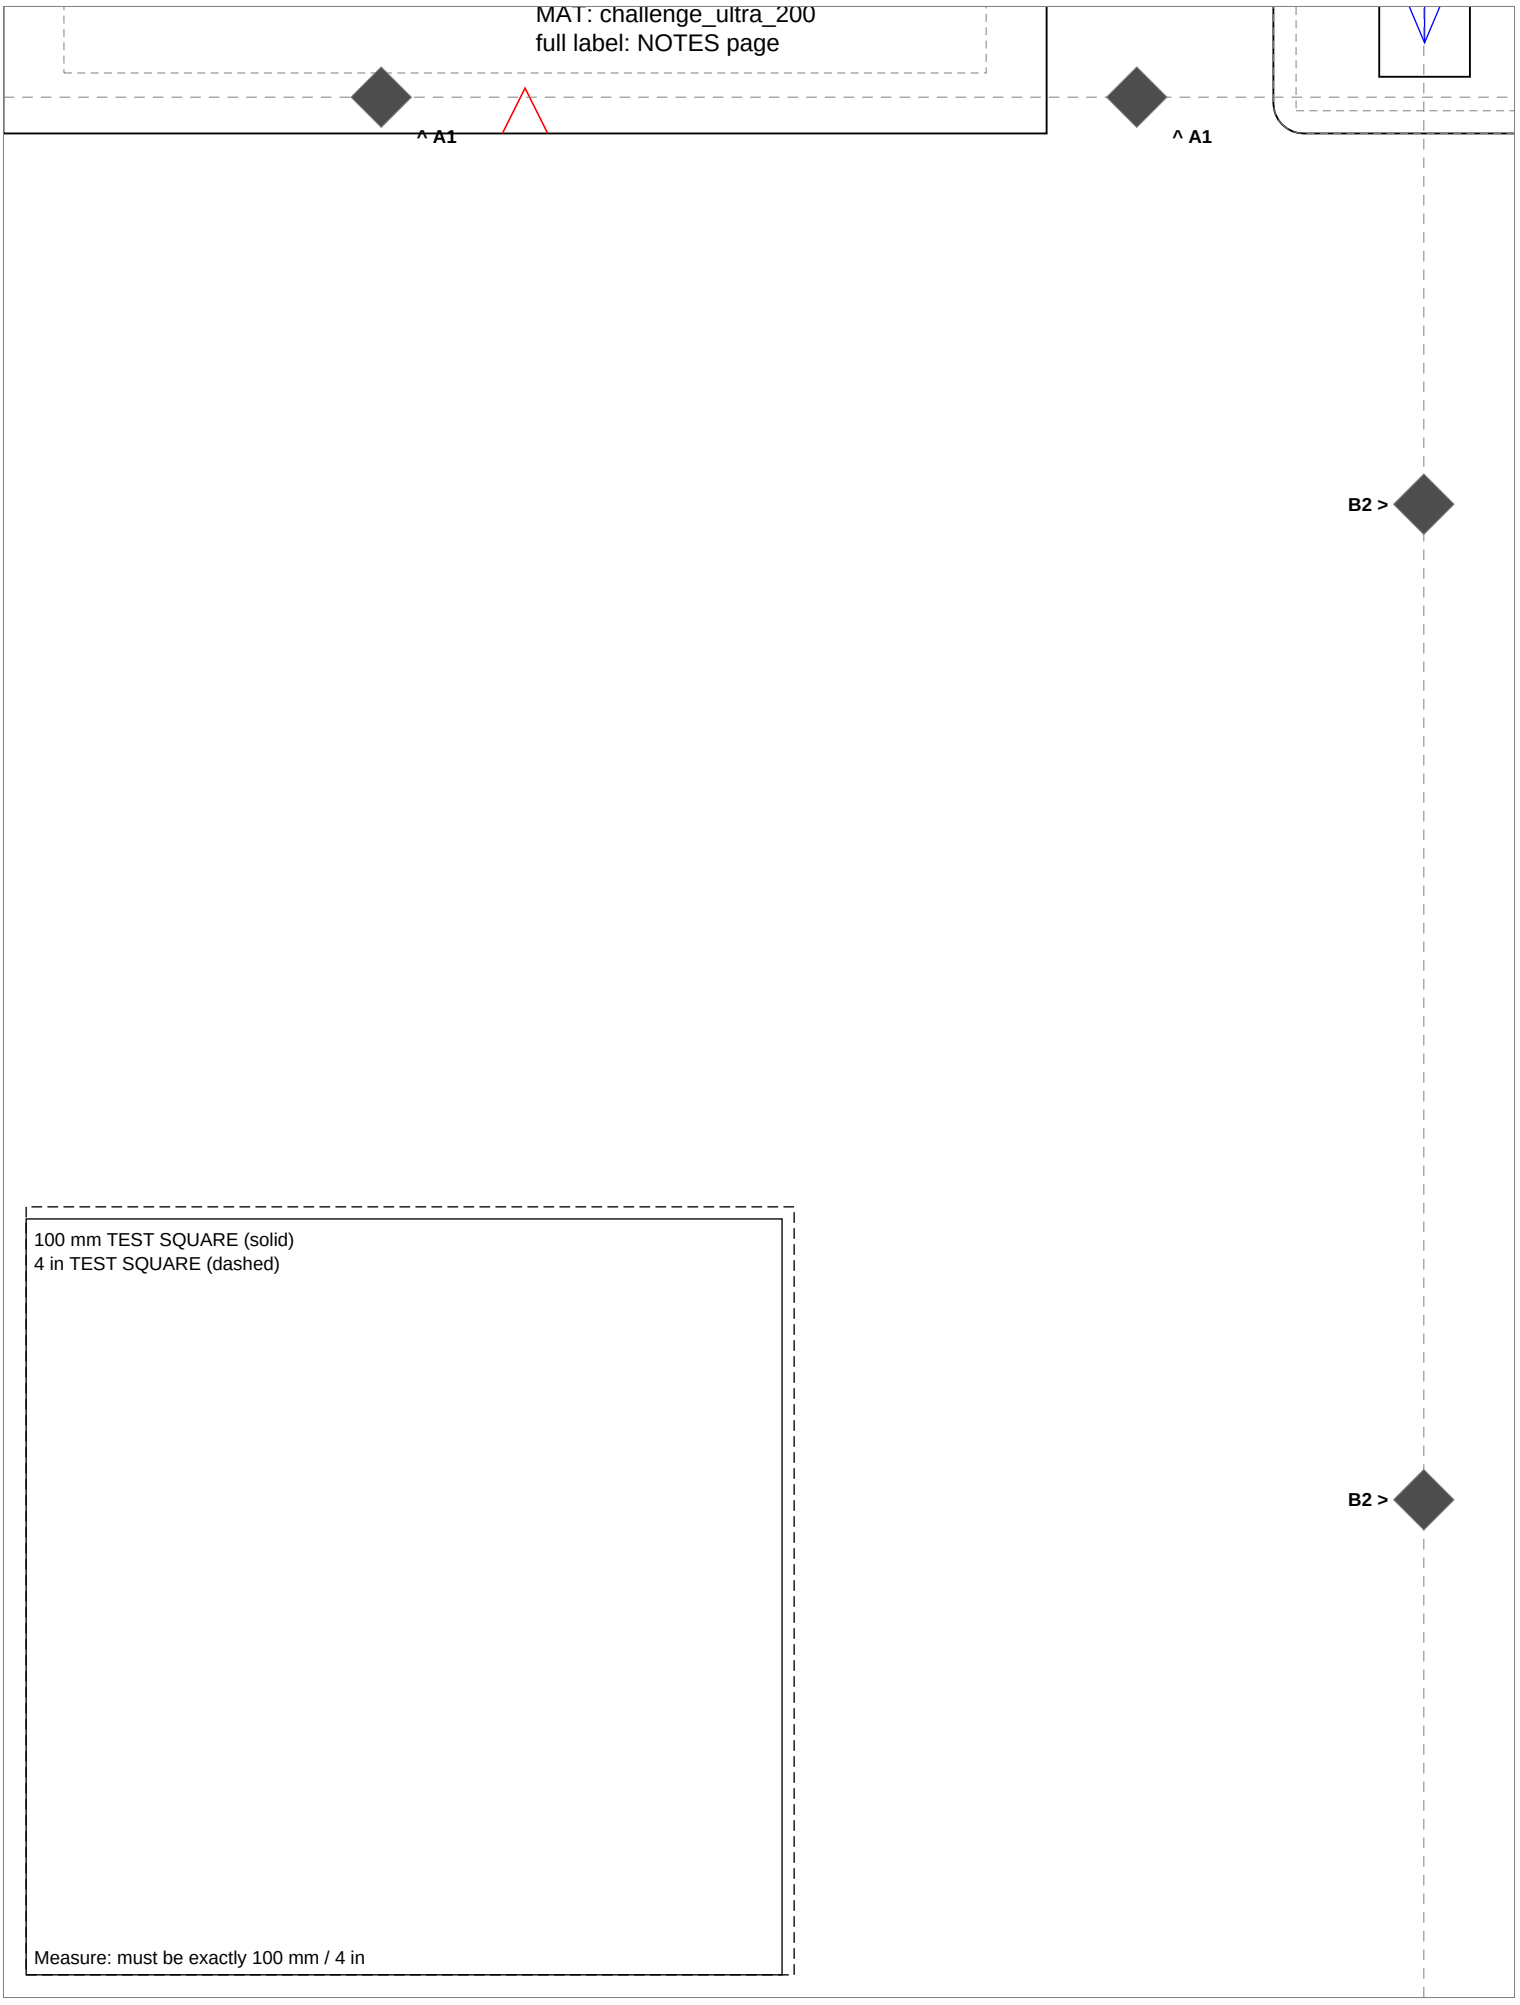

Trim neighbour page on its border; align to dashed line; match diamonds.

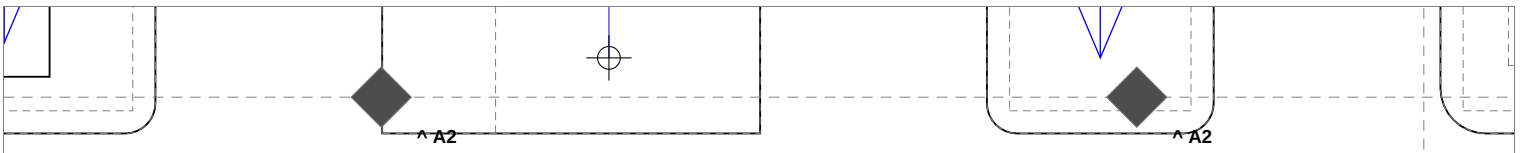

< B1

B3 >

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

< B1

B3 >

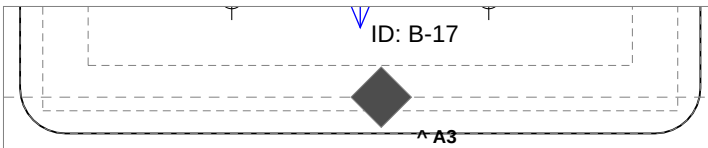

^ A3

^ A3

< B2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

< B2

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: piece NOTES (full text; the DXFs carry the same)

B-13x boxed fairlead swell, IM1-IM3 (with port)

LABEL (shortened on the piece so it clears the marks): ID: B-13x; PIECE: boxed fairlead swell, IM1-IM3 (with port); MATERIAL: challenge_ultra_200; CUT 6; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; CUT: ; PACK: 5200 CORRIE F rev 3; FACE: film side DOWN (inside)
sew INSIDE B-01 over the IM1/IM2/IM3 windows; B-12 patch on the crest first

B-12 strap-port patch

LABEL (shortened on the piece so it clears the marks): ID: B-12; PIECE: strap-port patch; MATERIAL: tpu_coated_nylon_840d; CUT 6; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: TPU DOWN (inside)
laser-cut; on the swell crest (outside), slot through patch + swell; edge-stitch slot and perimeter; no load

B-27f guy port facing

LABEL (shortened on the piece so it clears the marks): ID: B-27f; PIECE: guy port facing; MATERIAL: challenge_ultra_200; CUT 2; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: film side DOWN (inside)
B-01 fabric, hot-cut edges (laminate does not fray); INSIDE B-01 under the slit

B-11 lash tab

LABEL (shortened on the piece so it clears the marks): ID: B-11; PIECE: lash tab; MATERIAL: hypalon_coated_nylon; CUT 8; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: coated face UP
laser-cut; slot 27 x 5; R gusset: bow riser; L gusset: light lash only, NO load rating; muzzle keepers both (panels.yaml B-11, released)

B-17 IM3 bag-hook tab (trimmed)

LABEL (shortened on the piece so it clears the marks): ID: B-17; PIECE: IM3 bag-hook tab (trimmed); MATERIAL: hypalon_coated_nylon; CUT 2; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: coated face UP
laser-cut; OUTSIDE B-01 at x +/-115, z 385-455; T3 tongue box-X at centre

B-18 hinge-eye doubler

LABEL (shortened on the piece so it clears the marks): ID: B-18; PIECE: hinge-eye doubler; MATERIAL: hypalon_coated_nylon; CUT 2; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: coated face UP
laser-cut; INSIDE B-01 at x +/-115, coated face to B-01; lower edge ON the B-01 cut edge (12 mm below the floor seam line, caught in the floor seam); HE box-X 34x7; rows top + sides only

B-22 guy corner tab

LABEL (shortened on the piece so it clears the marks): ID: B-22; PIECE: guy corner tab; MATERIAL: hypalon_coated_nylon; CUT 2; FACE UP; KNIFE: CW from the grain-arrow head; cut windows and slits first; PACK: 5200 CORRIE F rev 3; FACE: coated face UP
laser-cut, no seam allowance; INSIDE B-02h (the hinge band) at x +/-130.3, z 695; coated face to the band

CORRIE F rev 3: webbing marks 1:1 (page 1 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

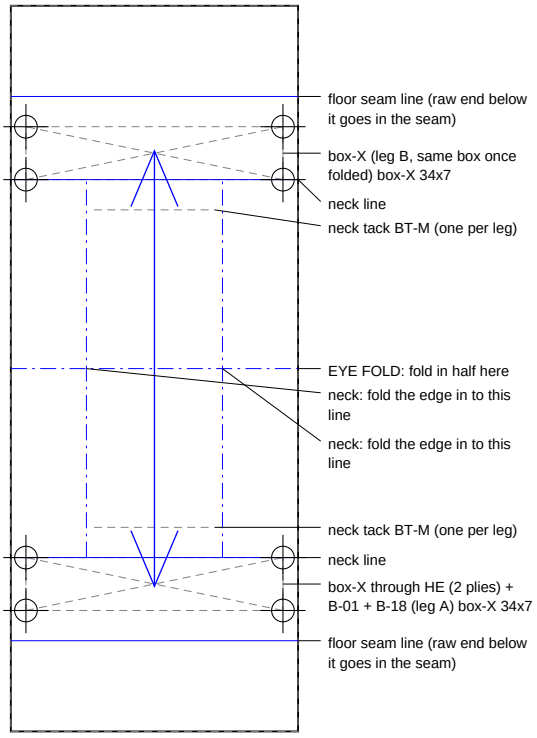

HE 38 x 96 mm

cut 2

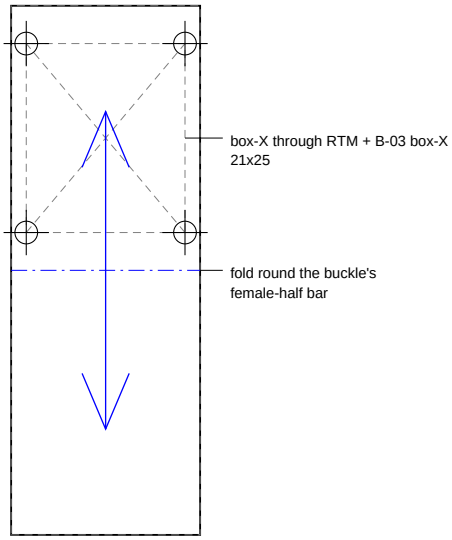

RTM 25 x 70 mm

cut 2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 2 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

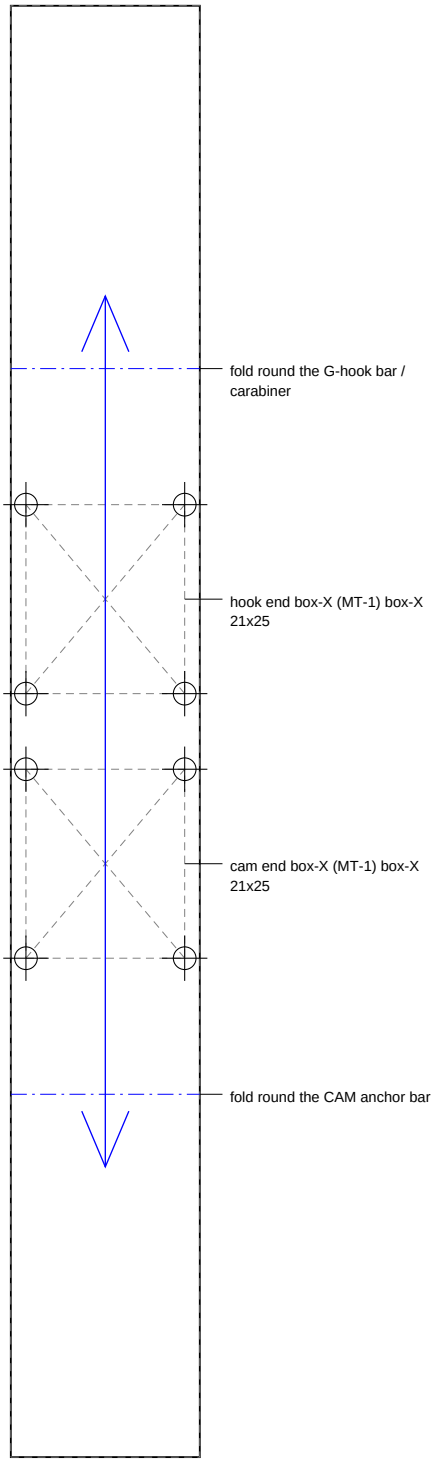

IMC 25 x 192 mm

cut 3

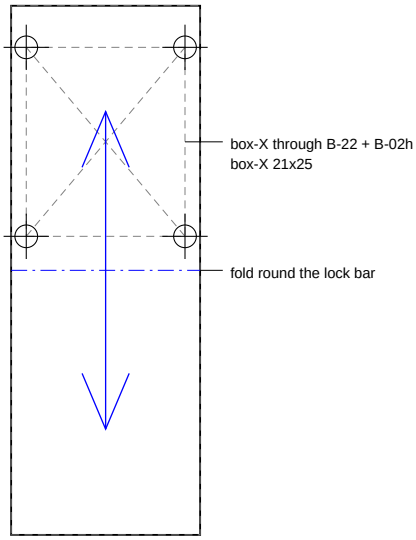

LLT 25 x 70 mm

cut 2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 3 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

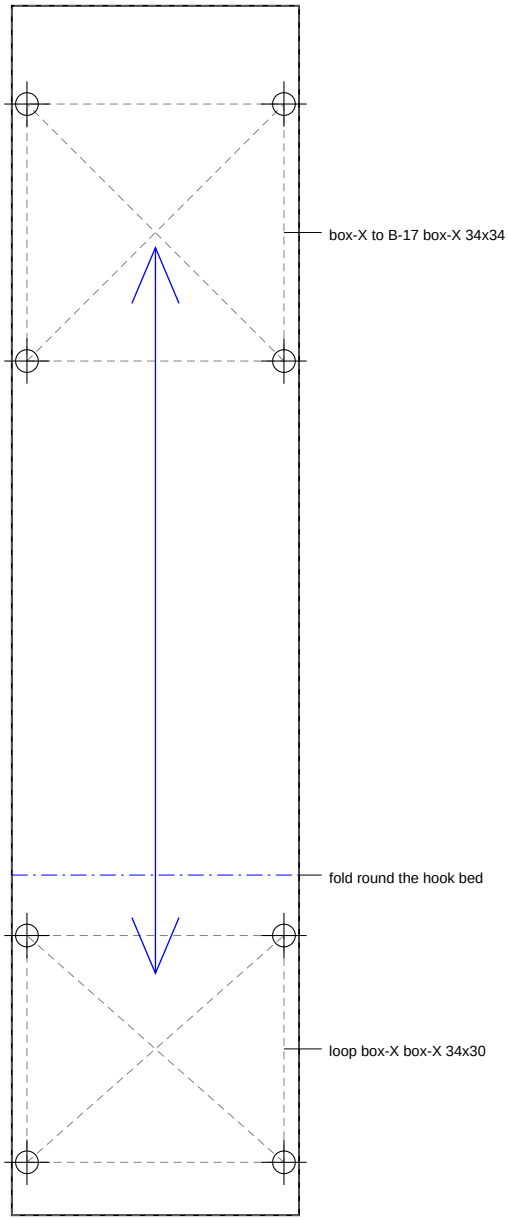

T3 38 x 160 mm

cut 2

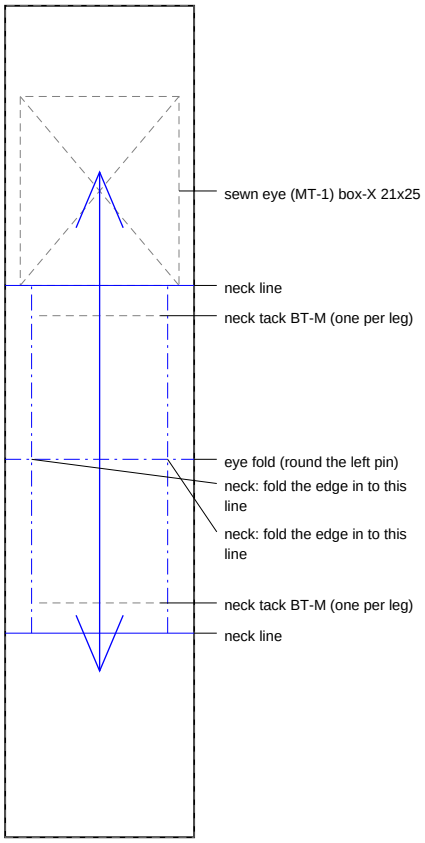

US 25 x 550 mm

cut 1; first 110 mm shown

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 4 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

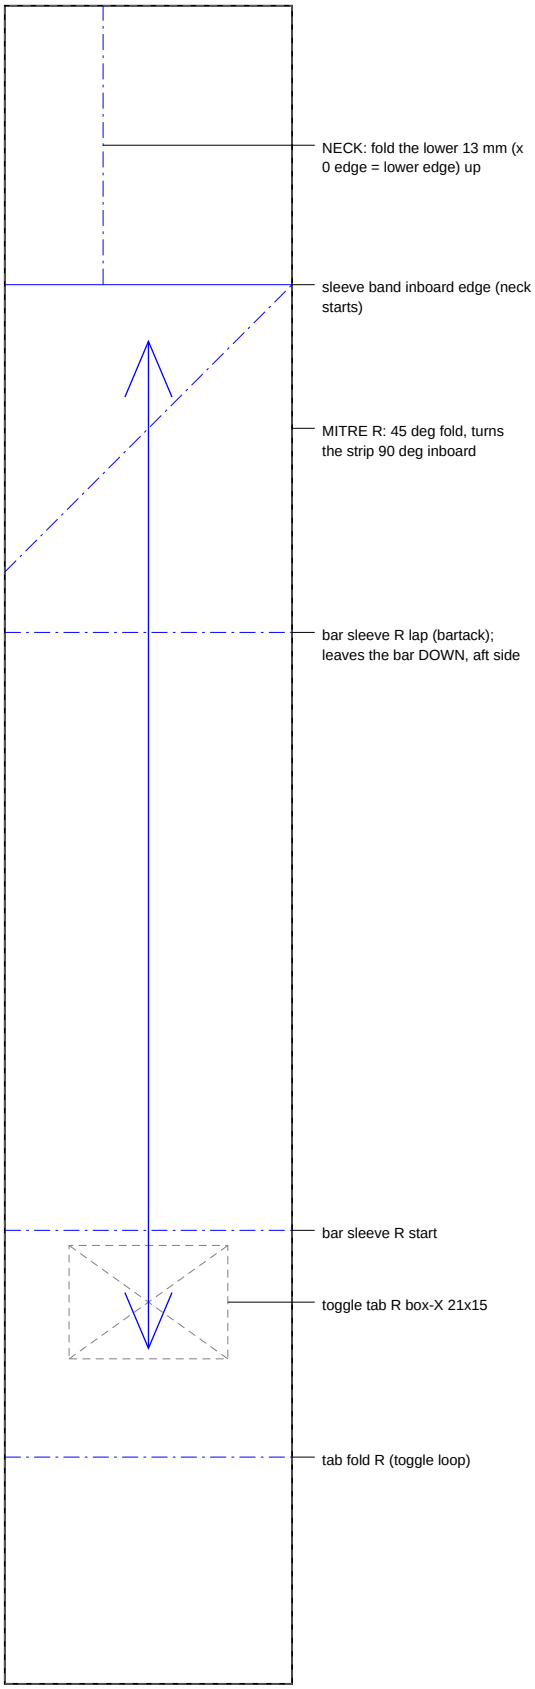

B-25 38 x 513 mm

cut 1; first 222 mm shown; the L half mirrors it

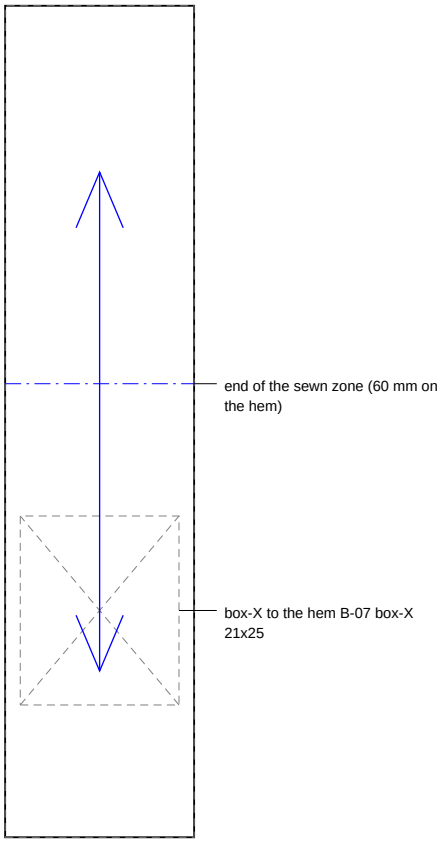

RT 25 x 565 mm

cut 2; first 110 mm shown

CORRIE F rev 3: webbing marks 1:1 (page 5 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

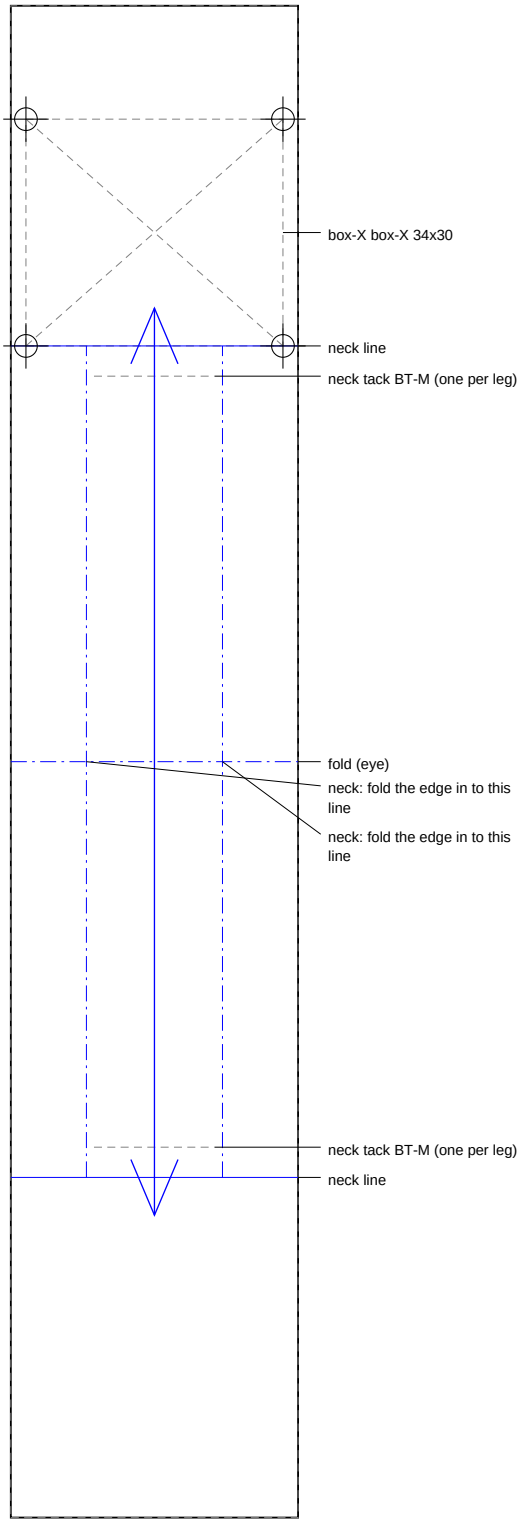

IME 38 x 200 mm

cut 6

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 6 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

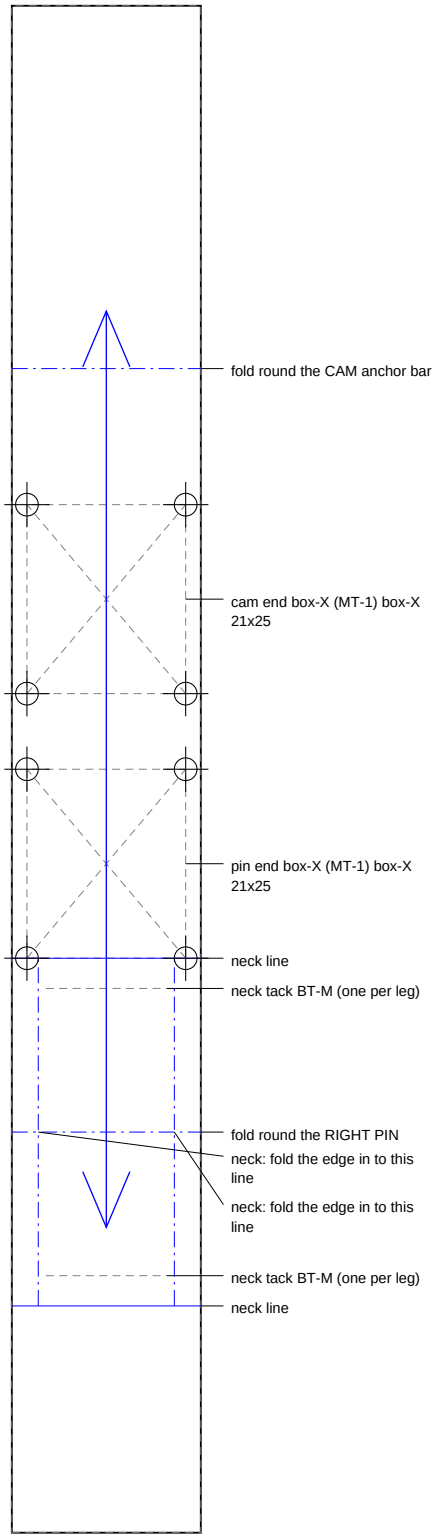

USA 25 x 202 mm

cut 2

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in

CORRIE F rev 3: webbing marks 1:1 (page 7 of 7)

Check the test square, lay the hot-knifed strip on its outline, chalk the folds (blue dash-dot), boxes and lines (grey dashed). Each line is named by its leader.

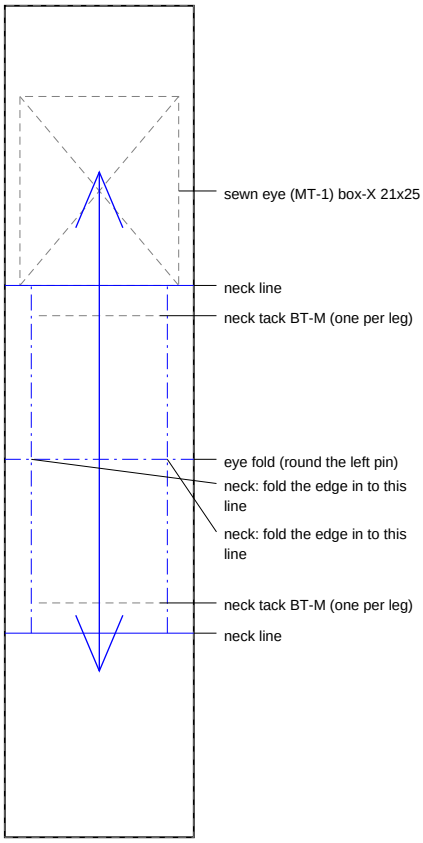

US2 25 x 925 mm

cut 1; first 110 mm shown

100 mm TEST SQUARE (solid)
4 in TEST SQUARE (dashed)

Measure: must be exactly 100 mm / 4 in