


Bathroom mmWave Sensors (×3)

→ FCC Room Live Monitoring

Three presence sensors in the bathroom connect to the **patient-room Wi-Fi (2.4 GHz)** and send data through the hospital's internal network to the **monitoring PC in the FCC room**. This communication requires **TCP 6053**.

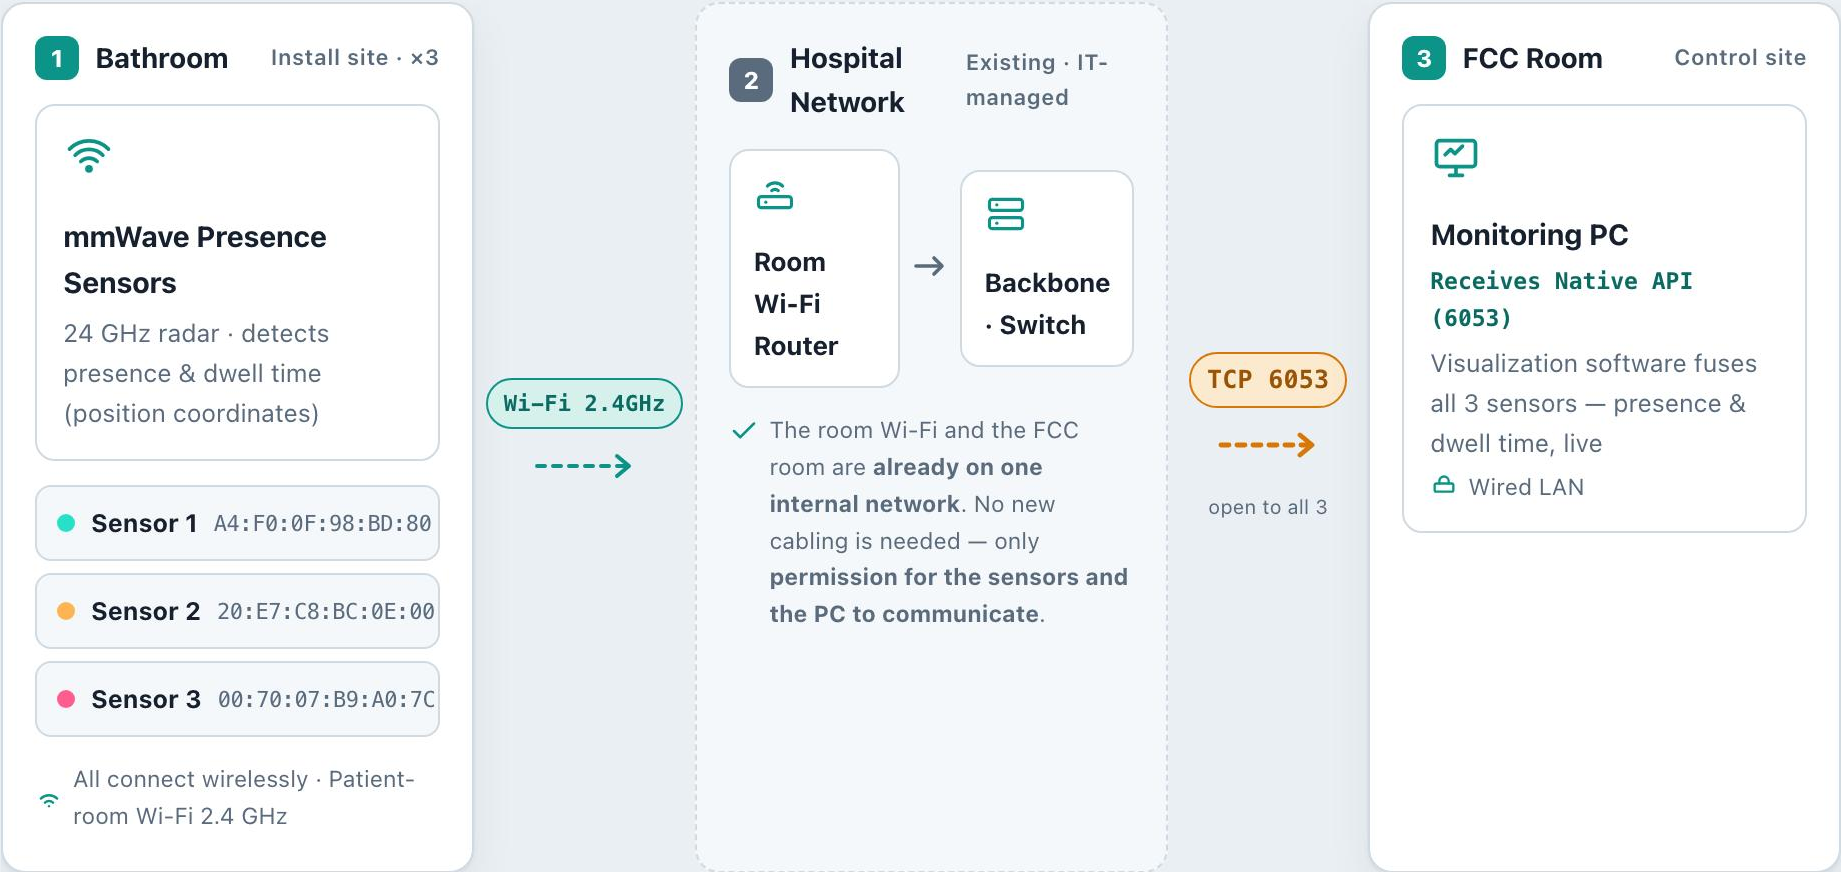

Request to IT Team

Protocol / Port

TCP 6053 — ESPHome Native API · open to all 3 sensors

Direction

FCC PC → each sensor (the PC initiates every connection)

Source

FCC monitoring PC · IP

Sensor MACs (×3)

Sensor 1

A4:F0:0F:98:BD:80

Sensor 2

20:E7:C8:BC:0E:00

Sensor 3

00:70:07:B9:A0:7C

Destination (×3)

Sensor 1

Sensor 2

Sensor 3

reserve one fixed IP per MAC above (DHCP reservation)

Requirement

Each sensor and the PC must be able to reach each other — **open TCP 6053 to all 3** (same internal network, or a firewall exception)

Please confirm — is the current block (1) a specific-port block, or (2) a block on device-to-device traffic itself (client isolation)? If (1), allowing the 6053 exception above resolves it. If (2), then separately from opening 6053, **client isolation must be disabled** (or the devices whitelisted to communicate).

Sensors not yet on-site — fix the IPs in advance:

please **reserve one fixed IP for each of the 3 Sensor MACs above** (DHCP reservation) and open TCP 6053 to all three. Each sensor will pick up its reserved IP the moment it powers on at the site, so the firewall rules and our software can be finalized before installation — no on-site IP lookup needed.