CASE STUDY

Terrace-slab crack — measured vs guessed

Ref SC-25D35C5E · 2026-11-03 · scale: 2 INR coin, nominal 25 mm issue spec (same coin ruler-read 24 mm — sizes vary by issue; typed diameter wins). Sensitivity at 24 mm: 228.0 mm / 3.1 mm / 7.08–7.09 cm².

1 · Observed damage



Figure 1 — photo with tape: the measuring tape held along the crack is the ground truth.

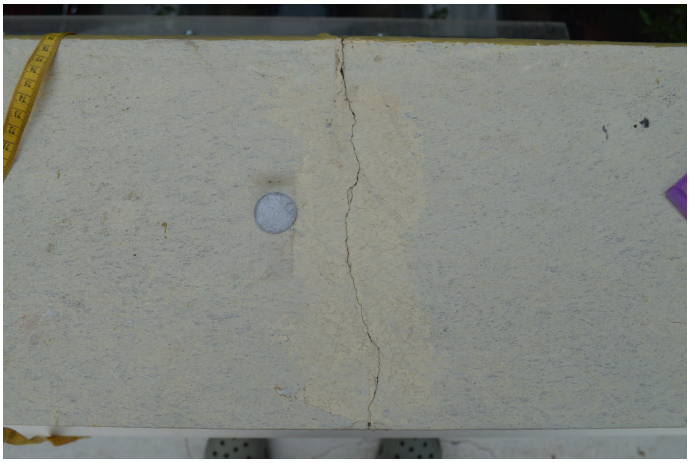


Figure 2 — photo used for the guess: the same crack as the app measured it, photo + coin.

In the tenant's words

> *“crack above the slab”*

2 · Measurements

Item	Value	Evidence	Status
Crack length	237.5 mm	R005	Confirmed
Crack width	3.2 mm	R006	Unverified — no width ground truth
Surface affected	0.73 %	R002	Confirmed
Area	7.69 cm2	R004	Confirmed
Severity	significant	R007	Confirmed

3 · Method

Outlines measured from photo pixels, scaled by the coin diameter (tilt-corrected from its ellipse). Every number cites its evidence receipt.

4 · Verification

Evidence gate: **passed** · Independent skeptic: live 2026-11-03, gate pass, nothing DISPUTED ($0.025) · Mask cross-check: not run (no masks archived)

Measured vs guessed

	Value	Reading
Thread truth	238.8 mm	ground truth (thread path ±4 mm)
SnapClaim measured	237.5 mm	inside ±10%
Photo-alone guess	315 mm	outside ±10%
Straight span	227 mm	printed, unscored (err 10.5 mm)

Bench case terrace-slab-tape-01.

Receipts

R001	scale_calibration 0.773994 mm_per_px
R002	area_ratio 0.73 percent
R003	region_count 1 count
R004	calibrated_area 7.69 cm2
R005	calibrated_length 237.5 mm
R006	calibrated_width 3.2 mm
R007	severity_classification significant