


VCarEA 测试报告

2026-08-14

报告概览


项目路径	D:\SCHOOL\6. 2026-Summer\Week_1\Project\EA_program\test01		
测试名称	D:\SCHOOL\6. 2026-Summer\Week_1\Project\EA_program\test01Cases\FI-02. case		
测试配置路径	D:\SCHOOL\6. 2026-Summer\Week_1\Project\EA_program\test01\Configurations\TestConfiguration_VCU_HIL. tcf		
测试台配置路径	D:\SCHOOL\6. 2026-Summer\Week_1\Project\EA_program\test01\Configurations\TestbenchConfiguration_VCU_HIL. tbf		
开始时间	结束时间	执行时间	
2026-08-14 14:56:40	2026-08-14 14:57:12	00:00:31.997	
测试步骤	通过步骤	失败步骤	
26	26	0	
测试用例	通过用例	失败用例	
1	1	0	

测试用例评估统计

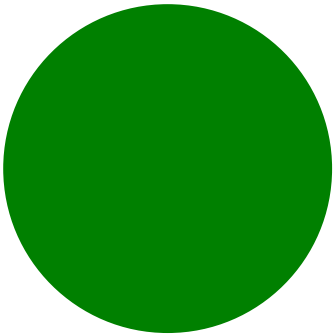

通过：100.0000%
失败：0.0000%

测试步骤评估统计

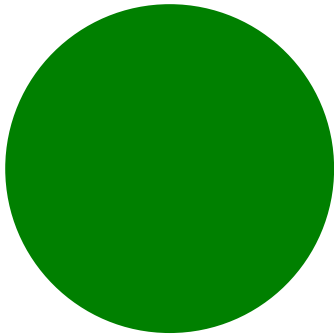

通过：100.0000%
失败：0.0000%

FI-02

开始时间：2026-08-14 14:56:41.234

结束时间：2026-08-14 14:57:11.802

执行时间：30568 ms

测试步骤：26

通过步骤：26

失败步骤：0

步骤名称	开始时间	结束时间	执行时间	名称	值	评估	期望	消息	信号源	注释
StartRecorder	2026-08-14 14:56:41.250	2026-08-14 14:56:41.543	293 ms			成功		执行成功		
加速踏板故障	2026-08-14 14:56:41.543	2026-08-14 14:57:11.801	30258 ms			成功		执行成功		
Write	2026-08-14 14:56:41.545	2026-08-14 14:56:41.799	254 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	100	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	制动踏板 0-100
Wait	2026-08-14 14:56:41.799	2026-08-14 14:56:41.902	103 ms		100 ms	成功		执行成功,等待100.0ms		
Write	2026-08-14 14:56:41.902	2026-08-14 14:56:42.010	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/Key	1	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/Key	拧钥匙 1-开 0-关
Wait	2026-08-14 14:56:42.010	2026-08-14 14:56:42.114	104 ms		100 ms	成功		执行成功,等待100.0ms		
Wait	2026-08-14 14:56:42.114	2026-08-14 14:56:45.117	3003 ms		3000 ms	成功		执行成功,等待3000.0ms		
Read	2026-08-14 14:56:45.117	2026-08-14 14:56:45.247	130 ms	[0]: env_1/网络模型/CAN/VCU/RxMsg/GW_VCU_1 (0x403)/VCU_bReadyLightSts	1.0	成功	==1	评估成功	VCU_HIL/[0]: env_1/网络模型/CAN/VCU/RxMsg/GW_VCU_1 (0x403)/VCU_bReadyLightSts	ready灯
Wait	2026-08-14 14:56:45.247	2026-08-14 14:56:45.350	103 ms		100 ms	成功		执行成功,等待100.0ms		
Write	2026-08-14 14:56:45.350	2026-08-14 14:56:45.458	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/Gear_Button	1	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/Gear_Button	挂D挡
Wait	2026-08-14 14:56:45.458	2026-08-14 14:56:45.561	103 ms		100 ms	成功		执行成功,等待100.0ms		
Write	2026-08-14 14:56:45.561	2026-08-14 14:56:45.670	109 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	0	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	松刹车
Wait	2026-08-14 14:56:45.671	2026-08-14 14:56:45.773	102 ms		100 ms	成功		执行成功,等待100.0ms		
阶跃	2026-08-14 14:56:45.773	2026-08-14 14:56:45.992	219 ms			成功		执行成功		
Write	2026-08-14 14:56:45.775	2026-08-14 14:56:45.883	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	50	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	0到中间值阶跃

步骤名称	开始时间	结束时间	执行时间	名称	值	评估	期望	消息	信号源	注释
Write	2026-08-14 14:56:45.883	2026-08-14 14:56:45.991	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	0	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	恢复到0
高值冻结	2026-08-14 14:56:45.992	2026-08-14 14:56:51.107	5115 ms			成功		执行成功		
Write	2026-08-14 14:56:45.994	2026-08-14 14:56:46.103	109 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	80	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	冻结
Wait	2026-08-14 14:56:46.103	2026-08-14 14:56:51.106	5003 ms		5000 ms	成功		执行成功,等待5000.0ms		
低值冻结	2026-08-14 14:56:51.108	2026-08-14 14:56:56.220	5112 ms			成功		执行成功		
Write	2026-08-14 14:56:51.109	2026-08-14 14:56:51.217	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	20	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	冻结
Wait	2026-08-14 14:56:51.217	2026-08-14 14:56:56.220	5003 ms		5000 ms	成功		执行成功,等待5000.0ms		
越界和非法浮点值	2026-08-14 14:56:56.221	2026-08-14 14:57:06.532	10311 ms			成功		执行成功		
Write	2026-08-14 14:56:56.222	2026-08-14 14:56:56.331	109 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	150	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	越界
Wait	2026-08-14 14:56:56.331	2026-08-14 14:57:01.420	5089 ms		5000 ms	成功		执行成功,等待5000.0ms		
Write	2026-08-14 14:57:01.421	2026-08-14 14:57:01.529	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	-50	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	越界
Wait	2026-08-14 14:57:01.529	2026-08-14 14:57:06.531	5002 ms		5000 ms	成功		执行成功,等待5000.0ms		
冲突输入	2026-08-14 14:57:06.533	2026-08-14 14:57:11.800	5267 ms			成功		执行成功		
Write	2026-08-14 14:57:06.534	2026-08-14 14:57:06.643	109 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	50	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/AccPedal_perc	油门
Write	2026-08-14 14:57:06.643	2026-08-14 14:57:06.751	108 ms	[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	50	成功		执行成功	VCU_HIL/[0]: env_1/第三方模型/Veh_1/InputPort/Veh_1/Driver/BrakePedal_perc	刹车
Wait	2026-08-14 14:57:06.751	2026-08-14 14:57:11.754	5003 ms		5000 ms	成功		执行成功,等待5000.0ms		
StopRecorder	2026-08-14 14:57:11.754	2026-08-14 14:57:11.799	45 ms			成功		执行成功		