

2016.0 RANGE ROVER (LG), 211-03

STEERING LINKAGE

TIE ROD END (G1551583)

REMOVAL AND INSTALLATION

	BALL JOINT - TIE-ROD - EACH - RENEW	ALL DERIVATIVES	1.3	USED WITHINS	+
57.55.07					

SPECIAL TOOL(S)



E145954

JLR-204-793

Ball Joint Splitter

PART(S)

STEP	REPLACE PART / RENEW PART	PART NAME

REMOVAL

NOTES:

- Removal steps in this procedure may contain installation details.
- LH illustration shown, RH is similar.

1.

WARNING:

Make sure to support the vehicle with axle stands.


Raise and support the vehicle.

2. Refer to: [Wheel and Tire - GTDi 2.0L Petrol/TDV6 3.0L Diesel /TDV8 4.4L Diesel/V6 S/C 3.0L Petrol /V8 N/A 5.0L Petrol/V8 S/C 5.0L Petrol](#) (204-04 Wheels and Tires, Removal and Installation).

3.


NOTE:

Loosen but do not fully remove .

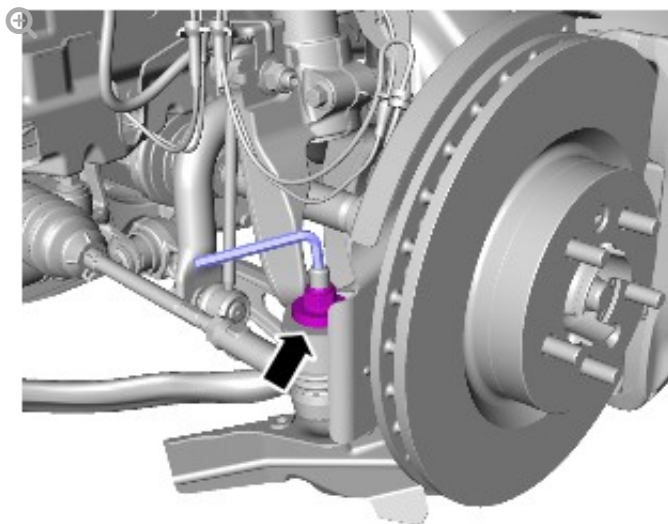

E147630

4.

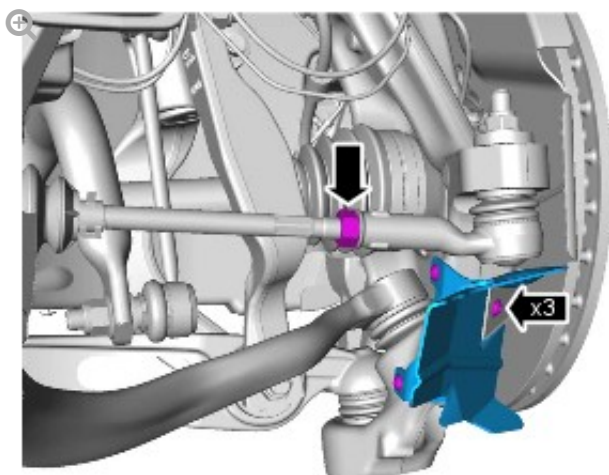

E147632

Torque:


M14 77 Nm

M6 9 Nm

5.

CAUTION:

Make sure that the ball joint seal is not damaged.

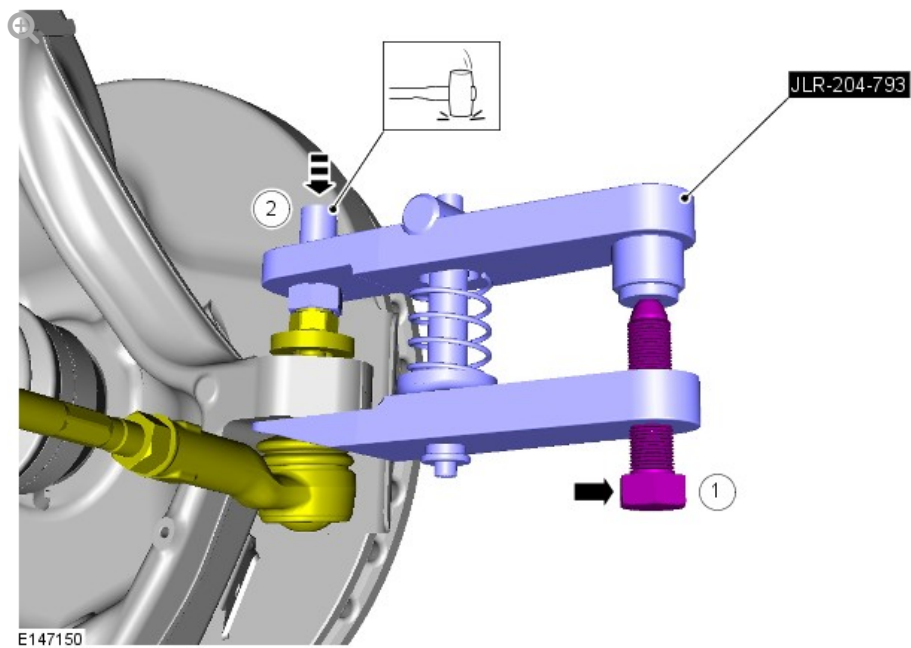


Special Tool(s): [JLR-204-793](#)

6.

CAUTION:

Discard the nut.

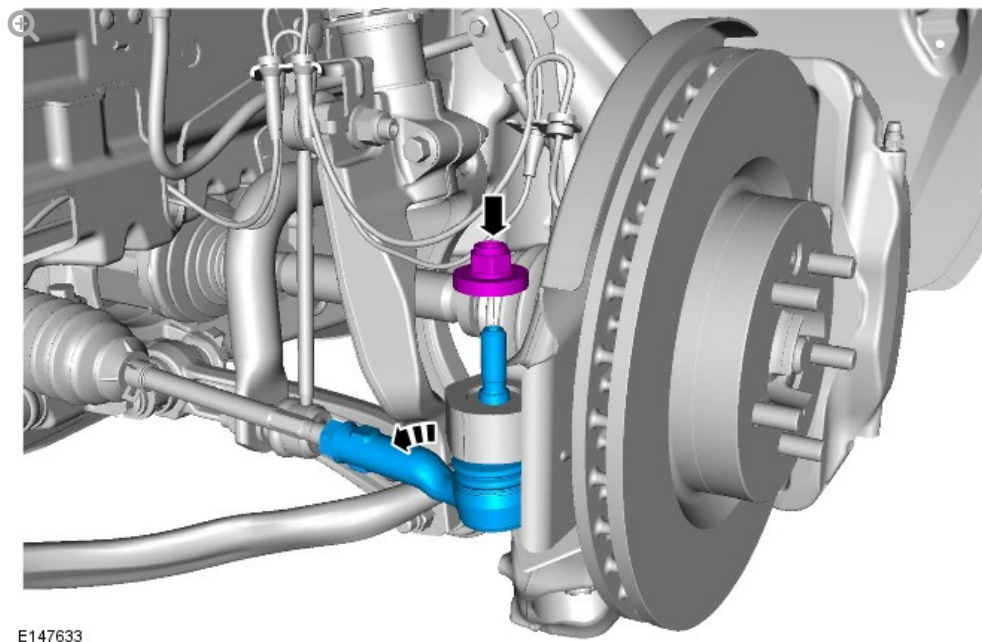

Renew Part: [Tie-rod end nut](#).

Torque: 140 Nm

INSTALLATION

1.


WARNING:

Make sure that a new nut is installed.

To install reverse the removal procedure.

2. Refer to: [Four Wheel Alignment](#) (204-00 Suspension System - General Information, General Procedures).

3.

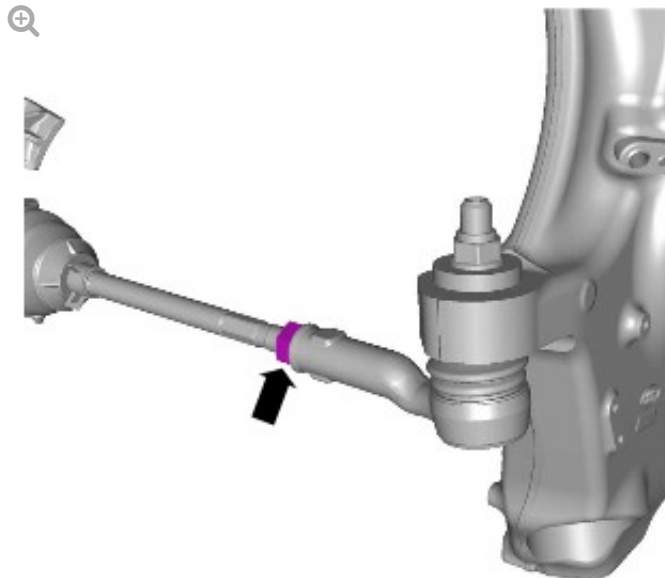

E147769

Torque: 77 Nm