

PUBLISHED: 24-AUG-2012
2014.0 RANGE ROVER (LG), 303-14

ELECTRONIC ENGINE CONTROLS - V8 S/C 5.0L PETROL

RIGHT MID CATALYST HEATED OXYGEN SENSOR (G1548978)

REMOVAL AND INSTALLATION

17.50.43	SENSOR - HEATED OXYGEN (HO2S) - MID CATALYST - RIGHT - RENEW	5000 CC, AJ V8	0.4	USED WITHINS	
----------	---	-------------------	-----	-----------------	--

SPECIAL TOOL(S)



REMOVAL



WARNING:

Observe due care when working near a hot exhaust system.



NOTE:

Removal steps in this procedure may contain installation details.

1.




WARNING:

Make sure to support the vehicle with axle stands.

Raise and support the vehicle.

2.

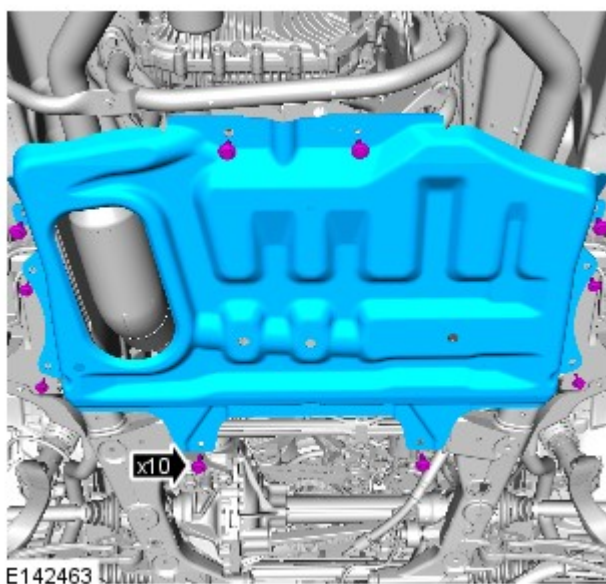


Torque:

M10 60 Nm


M6 10 Nm

3.

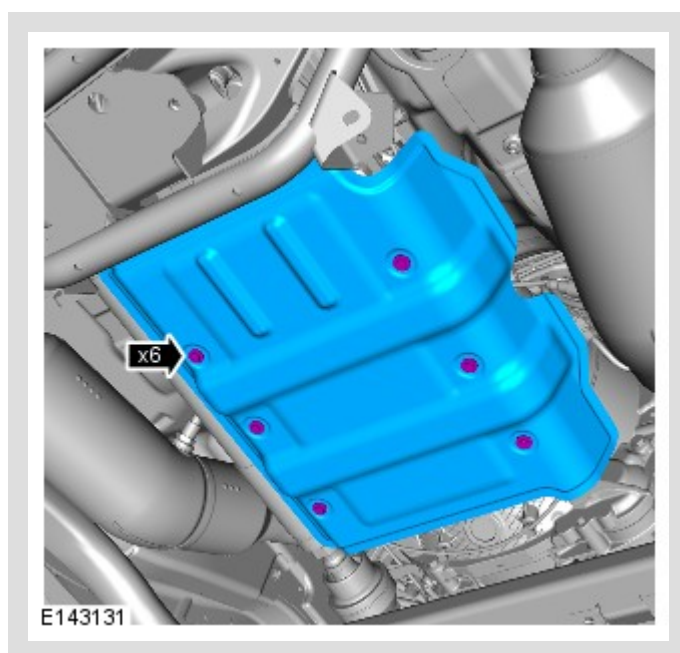

Torque: 10 Nm

4.

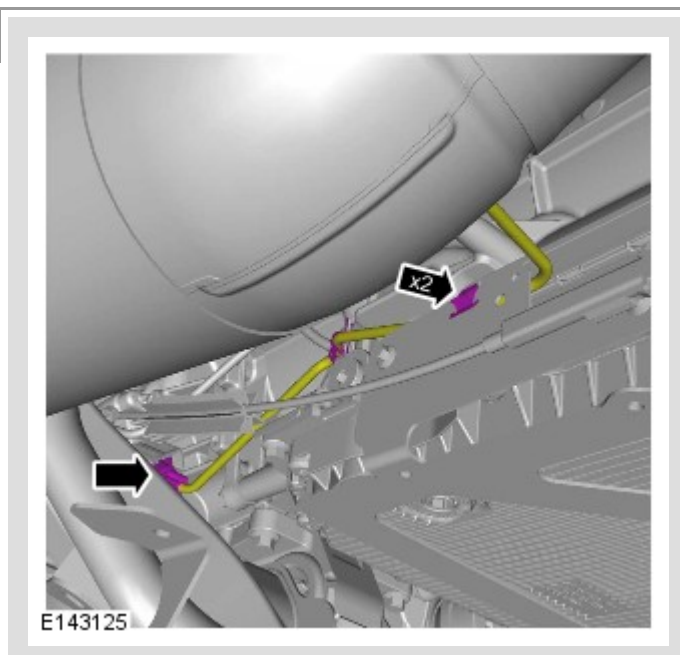


5.



CAUTION:

Make sure that the mating faces are clean and free of foreign material.

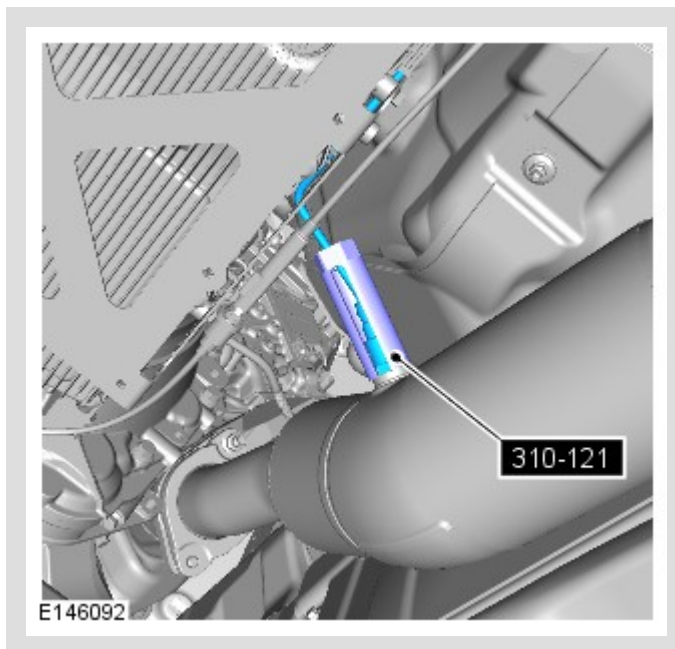

Special Tool(s): [310-121](#)

Torque: 48 Nm

INSTALLATION

1.



CAUTIONS:

- Make sure the anti-seize compound does not contact the HO2S tip.
- If accidentally dropped or knocked install a new sensor.

- Make sure the HO2S wiring harness is not twisted more than 180 degrees and is not in contact with either the exhaust or driveshaft.

 NOTE:

If the original sensor is to be installed, apply lubricant meeting specification ESE-M12A4-A to the thread of the sensor.

To install, reverse the removal procedure.