

2016.0 RANGE ROVER (LG), 303-01

ENGINE - TDV6 3.0L DIESEL - GEN 2/TDV6 3.0L DIESEL

CAMSHAFT FRONT SEAL

[G1509137]

REMOVAL AND INSTALLATION

12.13.12	OIL SEALS -	3000 CC, TDV6	3.8	USED WITHINS	+
	FRONT -				
	CAMSHAFTS				
	- PAIR - RENEW				

SPECIAL TOOL(S)



303-1118

Remover, Camshaft
Seal



303-1119



E54542

303-1119

Installer, Camshaft
Seal



303-1124



E54549

303-1124

Holding Tool,
Camshaft Front
Pulley



303-1126



E54551

303-1126

Timing Peg,
Camshaft Pulley

REMOVAL

NOTE:


Some variation in the illustrations may occur, but the essential information is always correct.

1. Refer to: [Specifications](#) (414-00 Battery and Charging System - General Information, Specifications).
2. Refer to: [Timing Belt](#) (303-01F Engine - SDV6 3.0L Diesel - Hybrid Electric Vehicle, Removal and Installation).

3.


CAUTION:

Do not use the special tools to lock the camshafts. Failure to follow this instruction may result in damage to the engine or the special tools.

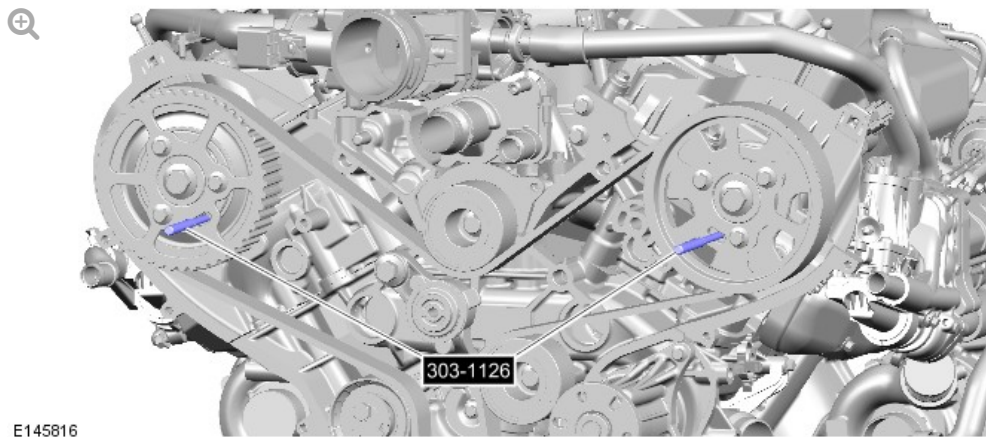


Special Tool(s): [303-1126](#)

4.

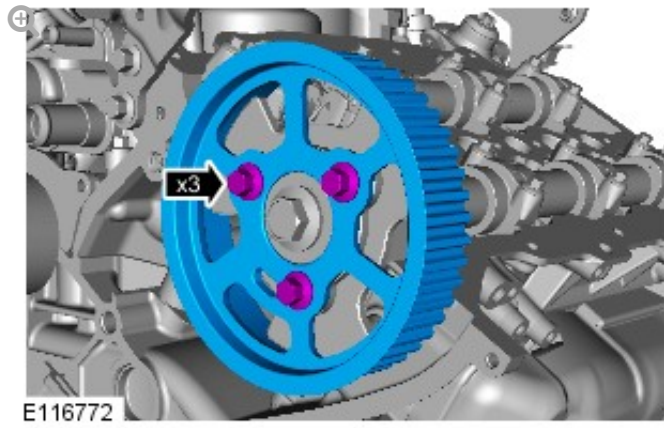


5.

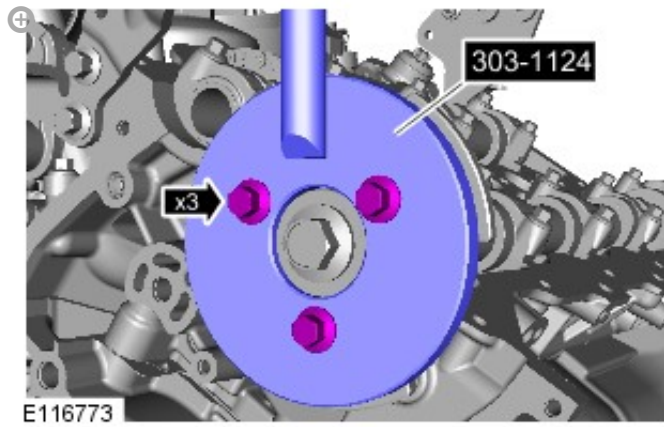


Special Tool(s): 303-1124

6.

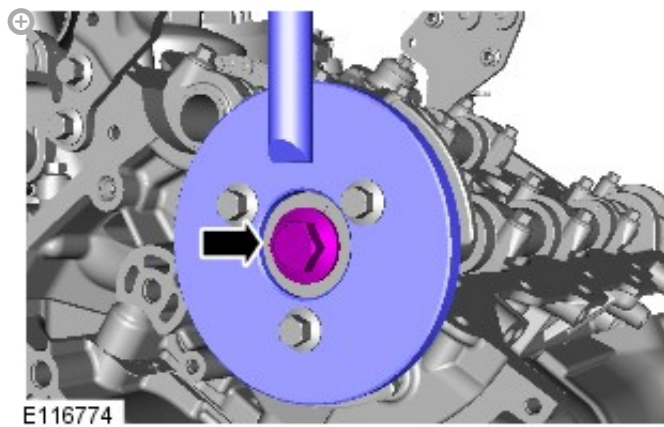


7.

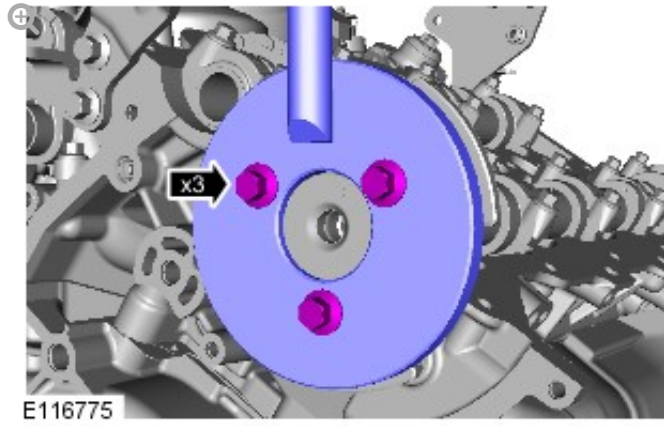

Special Tool(s): [303-1124](#)


8.

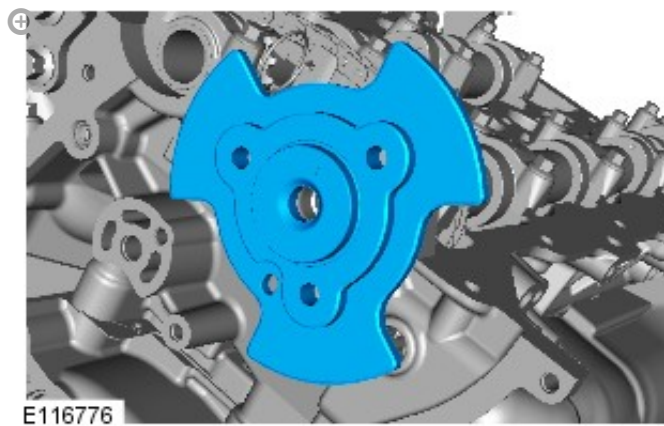

9.


CAUTION:

Make sure the special tool is correctly seated behind the camshaft seal. Failure to follow this instruction may result in damage to the special tool.

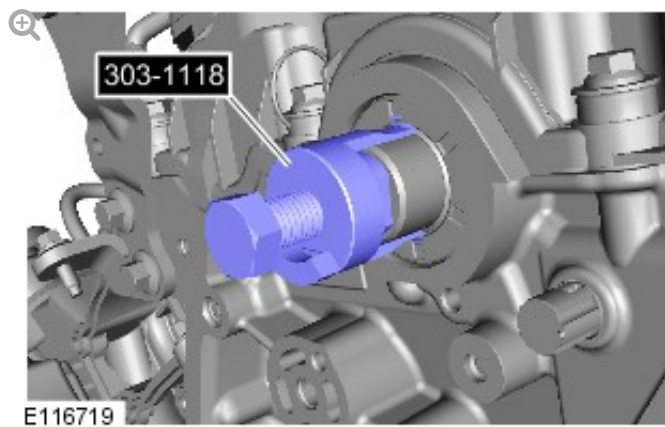


Special Tool(s): 303-1118

10.

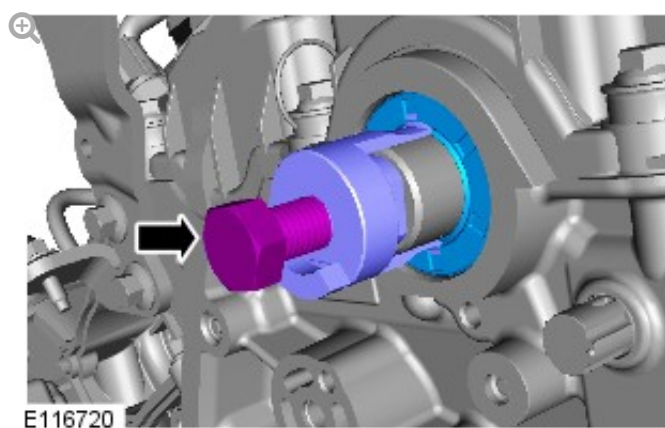

INSTALLATION

1.

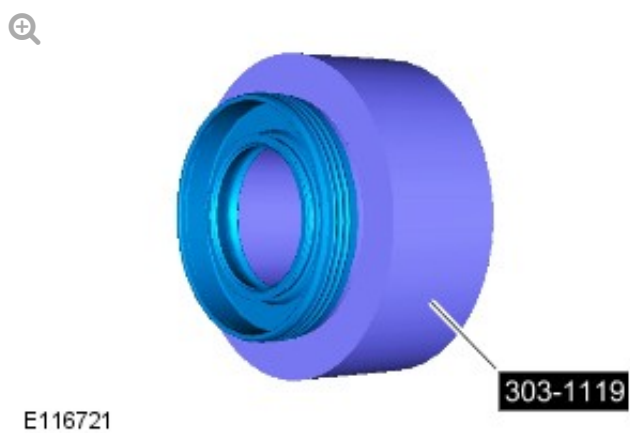


Special Tool(s): 303-1119

CAUTIONS:


- Make sure the seal is installed correctly.
- Make sure that the mating faces are clean and free of corrosion and foreign material.
- Do not use any lubricant on the camshaft front seal or the camshaft. Failure to follow this instruction may result in damage to the vehicle.

NOTE:

Make sure that the seal is 1mm below the face of the cylinder head.

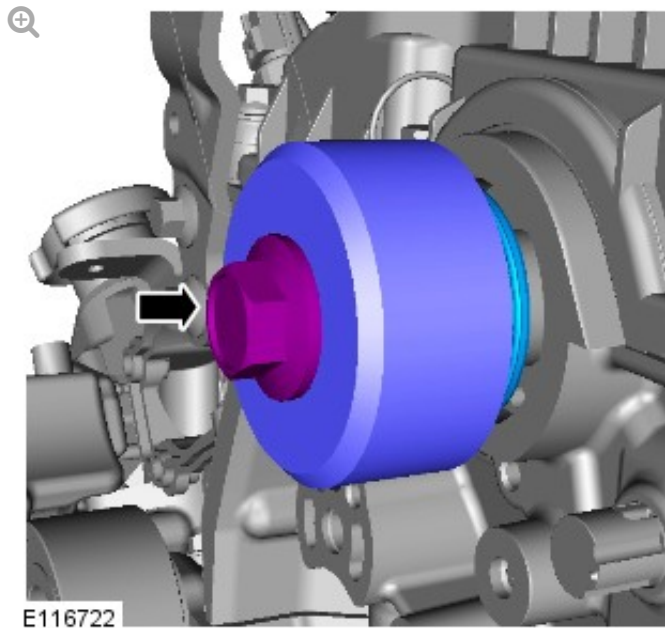


3.

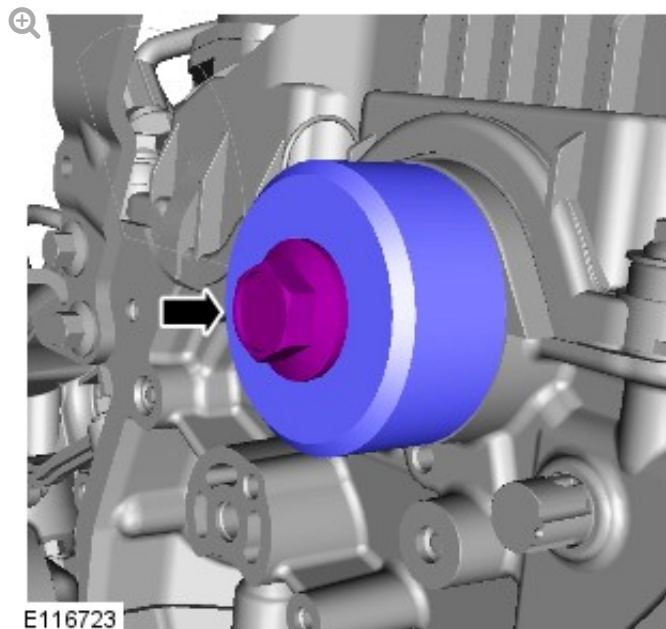


Special Tool(s): 303-1119

4.

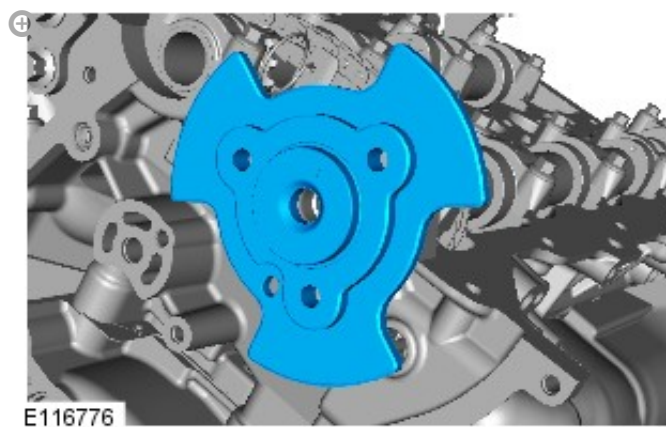


5.

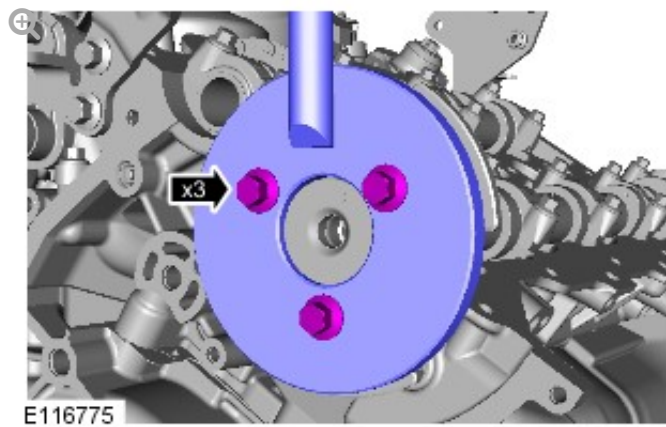

Special Tool(s): 303-1124

6.

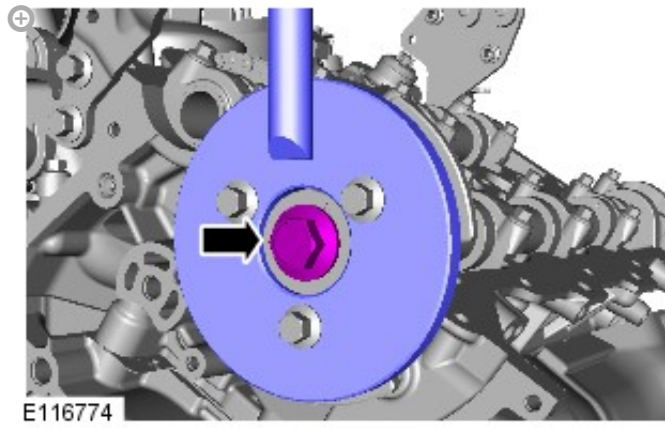


Torque:

Stage 1: 80 Nm

Stage 2: 80°

7.

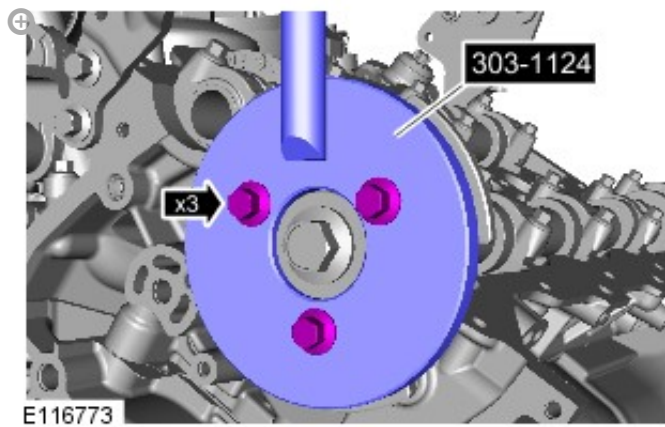


Special Tool(s): 303-1124

8.

CAUTION:


Only tighten the bolt finger-tight at this stage.

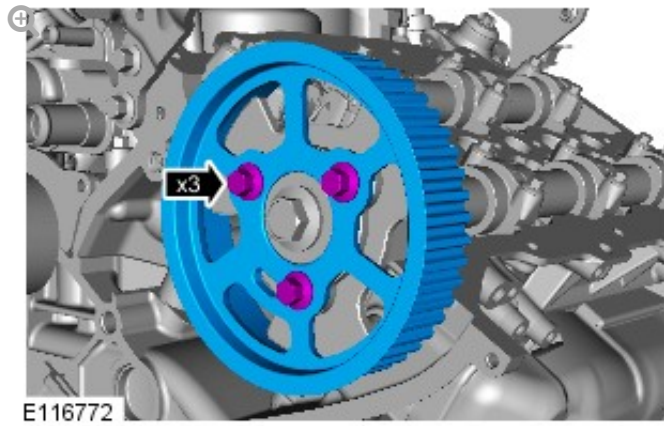

9.

CAUTION:

Do not use the special tools to lock the camshafts. Failure to follow this instruction may result in damage to the engine or the special tools.

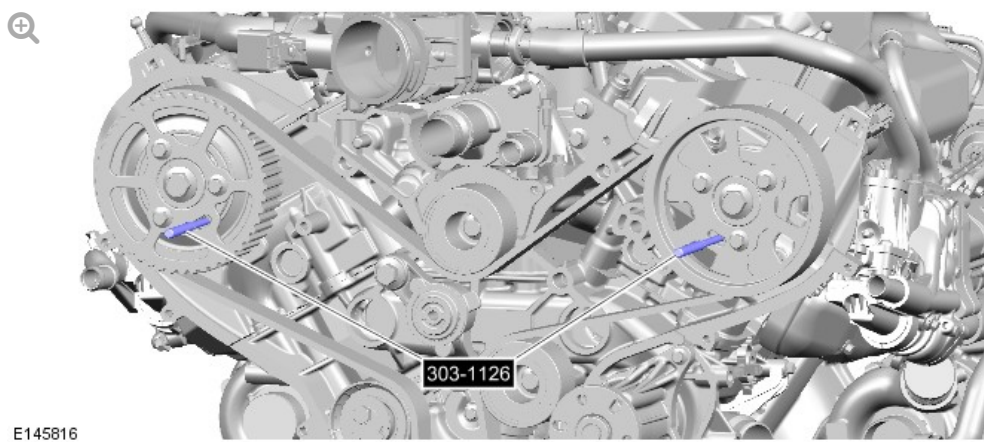

Special Tool(s): [303-1126](#)

10. Refer to: [Timing Belt](#) (303-01F Engine - SDV6 3.0L Diesel - Hybrid Electric Vehicle, Removal and Installation).
11. Refer to: [Specifications](#) (414-00 Battery and Charging System - General Information, Specifications).

