

2016.0 RANGE ROVER (LG), 303-01

ENGINE - TDV6 3.0L DIESEL - GEN 2/TDV6 3.0L DIESEL

LEFT EXHAUST MANIFOLD

[G 1 8 7 5 9 3 8]

REMOVAL AND INSTALLATION

		3000 CC, TDV6, DIESEL, WITH PARTICULATE FILTER, WITH DIESEL EXHAUST FLUID			
30.15.10	MANIFOLD - EXHAUST - LH/FRONT/EACH - RENEW	5.8	USED WITHINS	+	

PART(S)

STEP	REPLACE PART / RENEW PART	PART NAME
Installation Step 3	Renew Part	Exhaust manifold nuts
Installation Step 3	Renew Part	Exhaust manifold gasket
Installation Step 3	Renew Part	Crossover pipe gasket
Installation Step 5	Renew Part	Exhaust manifold cross-over pipe studs
Installation Step 6	Renew Part	Exhaust manifold cross-over pipe nuts and bolts

REMOVAL

WARNING:

Observe due care when working near a hot exhaust system.

1.


WARNING:

Make sure to support the vehicle with axle stands.

Raise and support the vehicle.

2. Refer to: [Left Turbocharger - TDV6 3.0L Diesel - Gen 2, Vehicles Without: Hybrid system](#) (303-04B Fuel Charging and Controls - Turbocharger - TDV6 3.0L Diesel, Removal and Installation).


3.

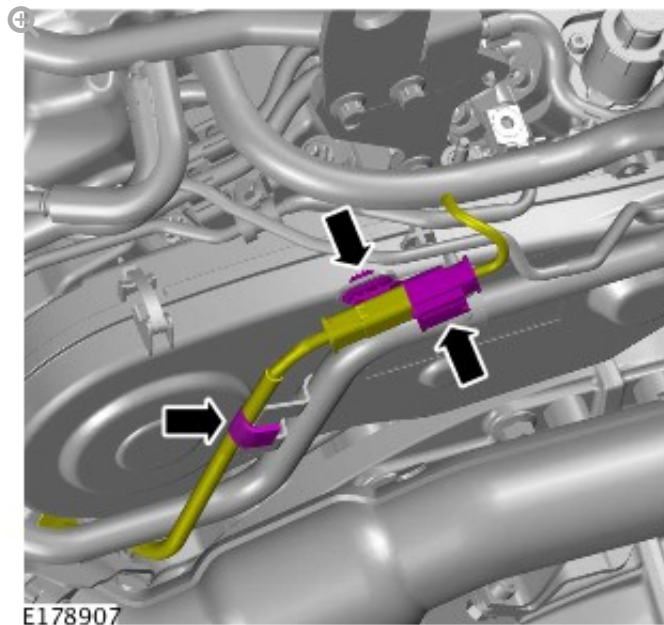

4.

CAUTION:


Discard the nuts and bolt.

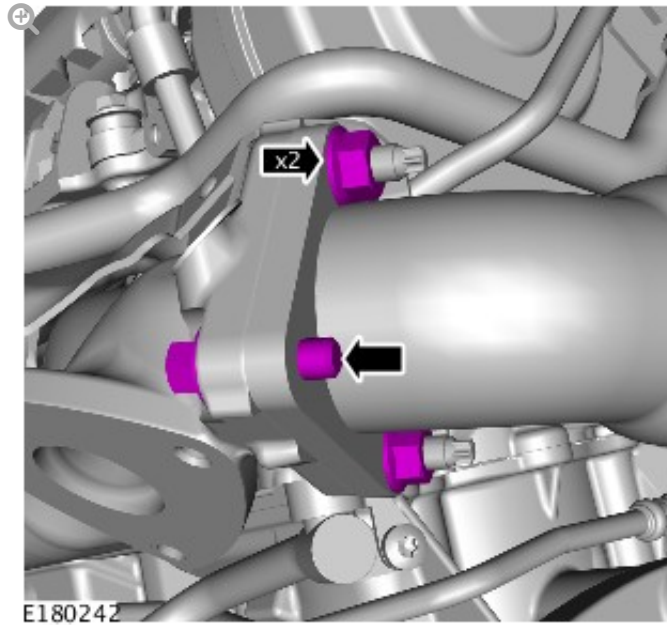

5.

CAUTION:


Discard the studs.

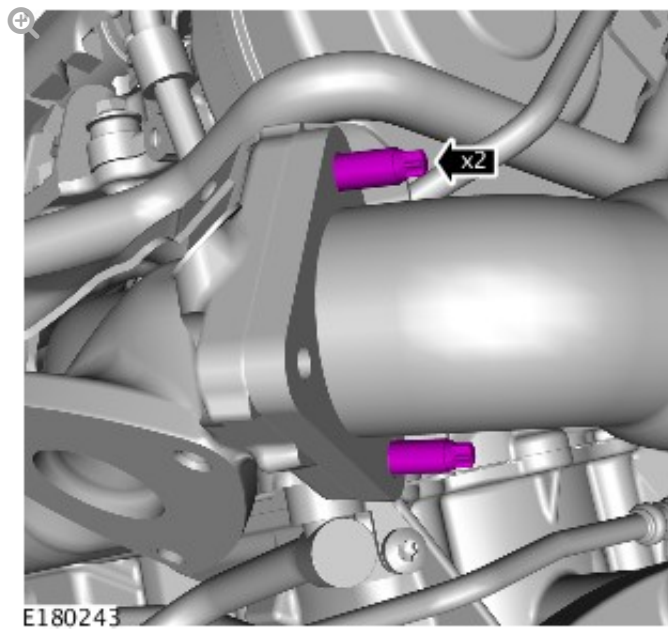

6.

CAUTIONS:


- Discard the nuts.
- Remove and discard the gaskets.

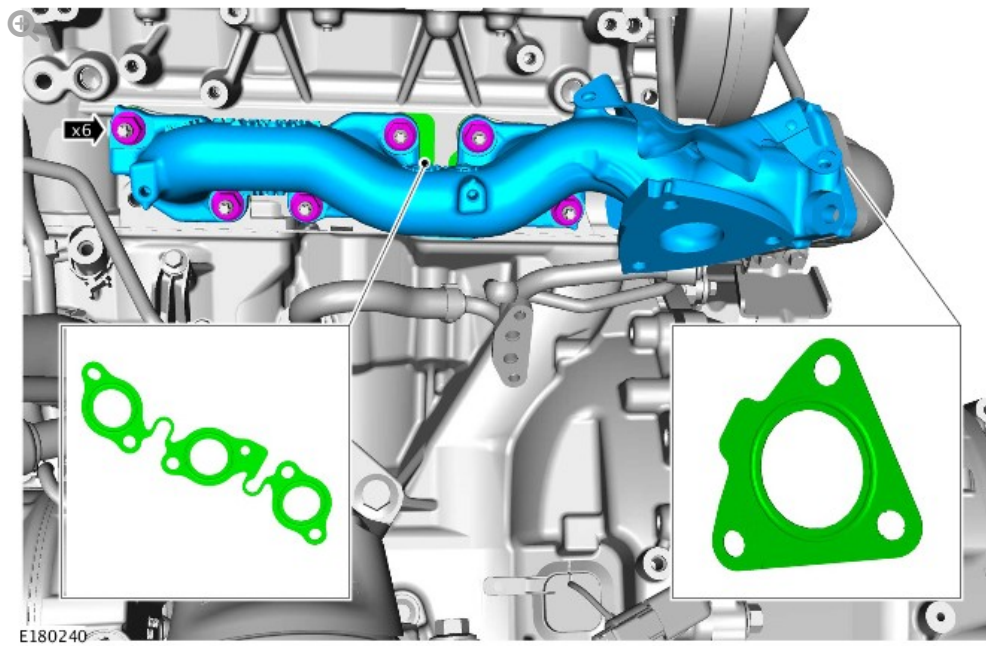

7.


NOTE:

Do not disassemble further if the component is removed for access only.

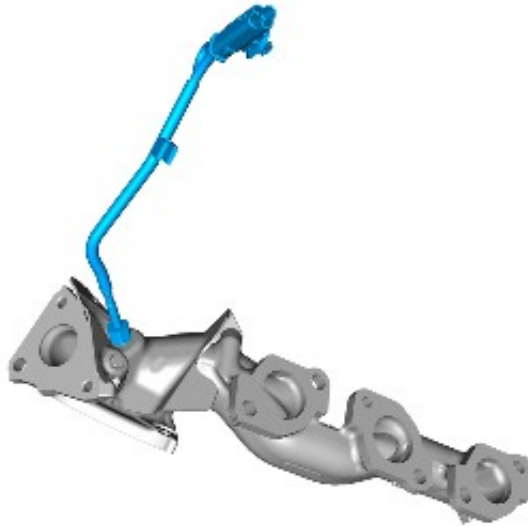


E180241

8.

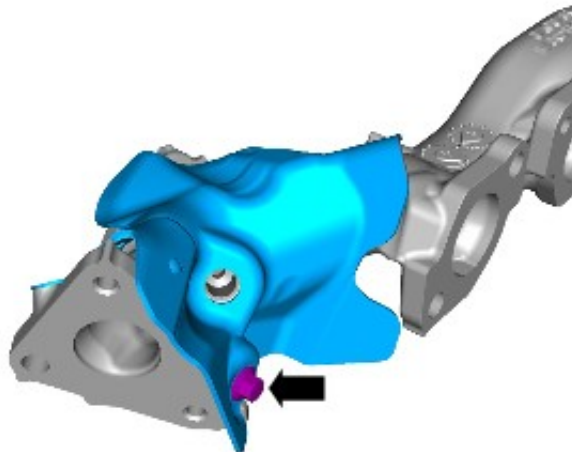

E180682

1.

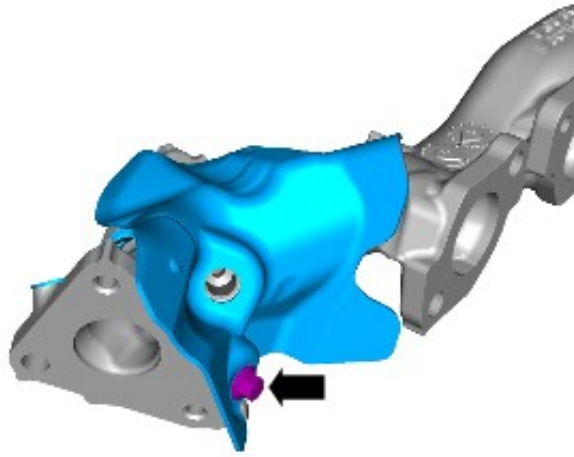

E180682

Torque: 7.5 Nm

2.



E180241

Torque: 28 Nm


3.

CAUTIONS:

- Make sure that new nuts are installed.
- Install the nuts finger tight before final tightening.

NOTE:

Install new gaskets.

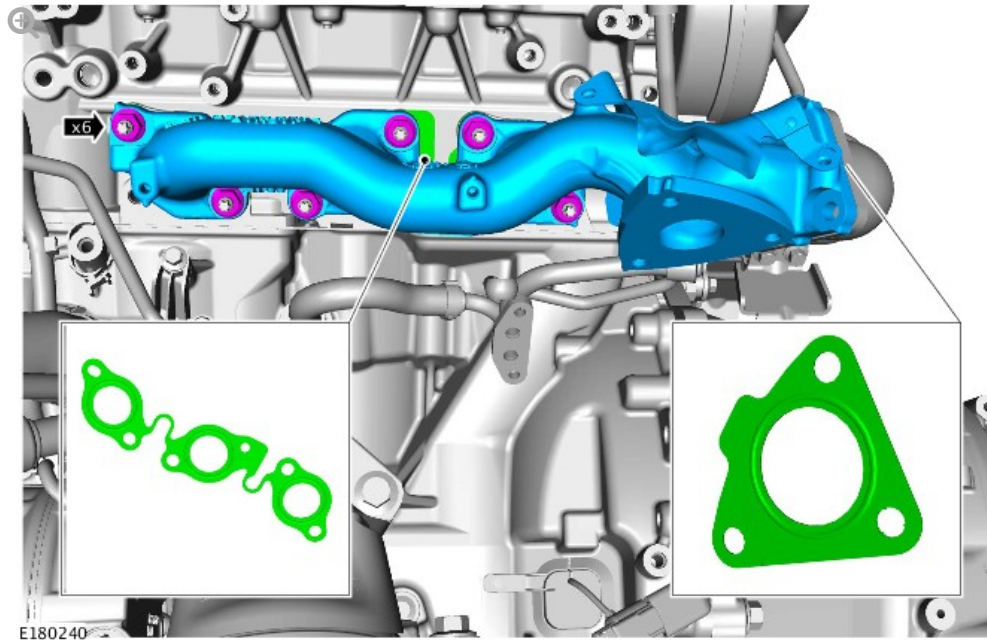

Renew Part: [Exhaust manifold nuts](#).


Renew Part: [Exhaust manifold gasket](#).

Renew Part: [Crossover pipe gasket](#).

4.

NOTE:

Tighten the bolts in the indicated sequence.

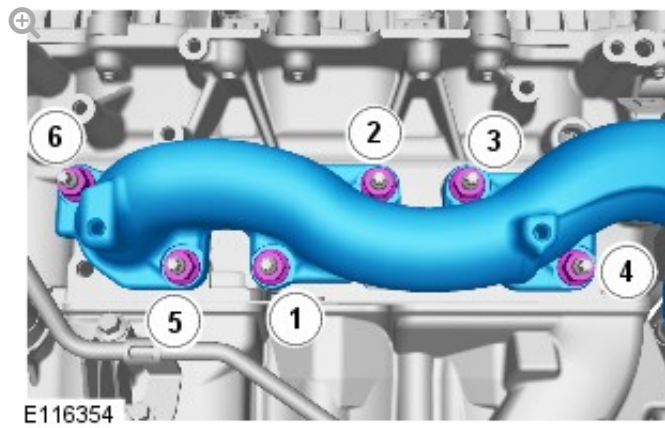


Torque: 24 Nm

5.

CAUTION:

Install new studs.

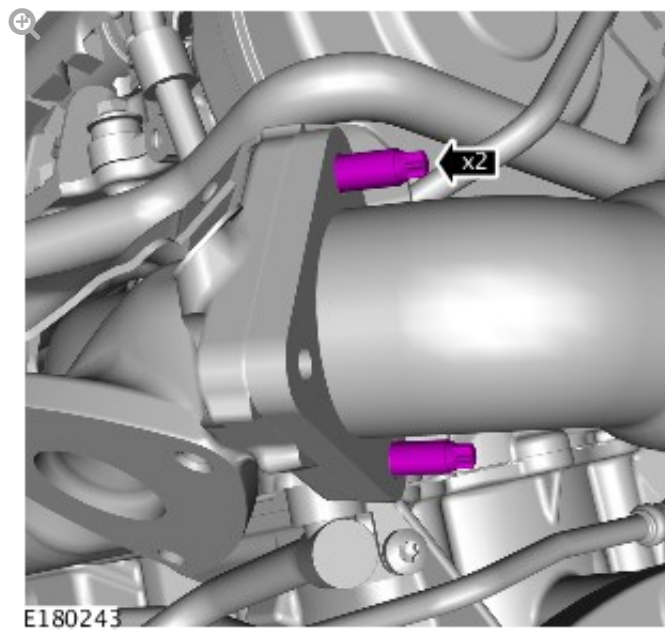


Renew Part: [Exhaust manifold cross-over pipe studs](#).

Torque: 24 Nm

6.

CAUTION:


Make sure that new nuts and bolt are installed.

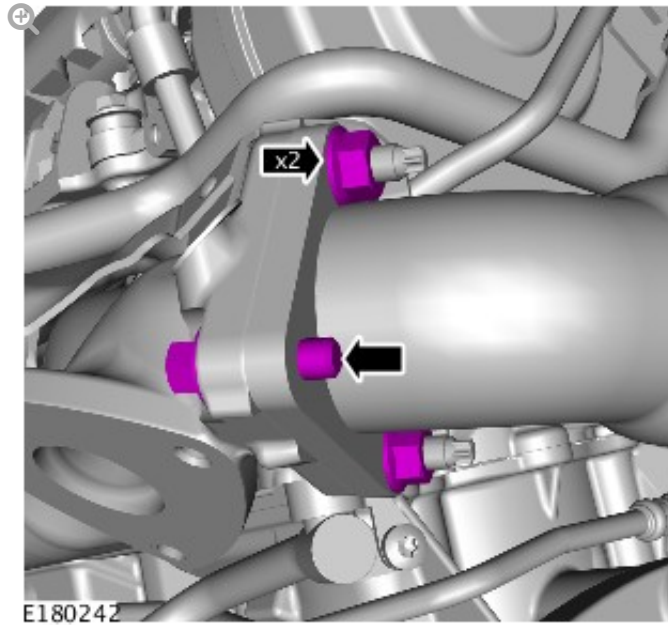

Renew Part: *Exhaust manifold cross-over pipe nuts and bolts.*

Torque: **24 Nm**

7.

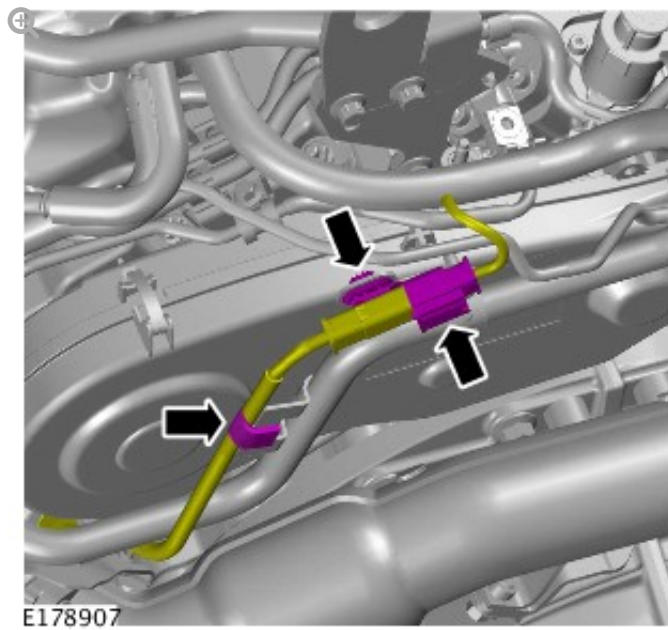

8. Refer to: *Left Turbocharger - TDV6 3.0L Diesel - Gen 2, Vehicles*

Without: Hybrid system (303-04B Fuel Charging and Controls -
Turbocharger - TDV6 3.0L Diesel, Removal and Installation).