

PUBLISHED: 10-JUL-2013
2014.0 RANGE ROVER (LG), 303-01

ENGINE - V8 S/C 5.0L PETROL

VALVE CLEARANCE CHECK (G1669392)

12.29.47	VALVE CLEARANCES - CHECK ONLY	5000 CC, AJ V8, SUPERCHARGED	8.6	USED WITHINS
----------	--	------------------------------------	-----	-----------------

CHECK

1. Refer to: Specifications (414-00 Battery and Charging System - General Information, Specifications).

2. **WARNING:**

Do not work on or under a vehicle supported only by a jack. Always support the vehicle on safety stands.

Raise and support the vehicle.

3. Refer to: Valve Cover LH (303-01C, Removal and Installation).


4. Refer to: Valve Cover RH (303-01C, Removal and Installation).

5. **CAUTIONS:**

- Rotate the engine clockwise until the camshafts are positioned as shown.
- Do not rotate the crankshaft counterclockwise. The timing chains may bind causing engine damage.
- Camshaft lobes must be 180 degrees away from each valve tappet or valve clearance will be incorrect.

 NOTE:

Using feeler gauge check the gap between the tappet and the camshaft lobe and check against specifications table.

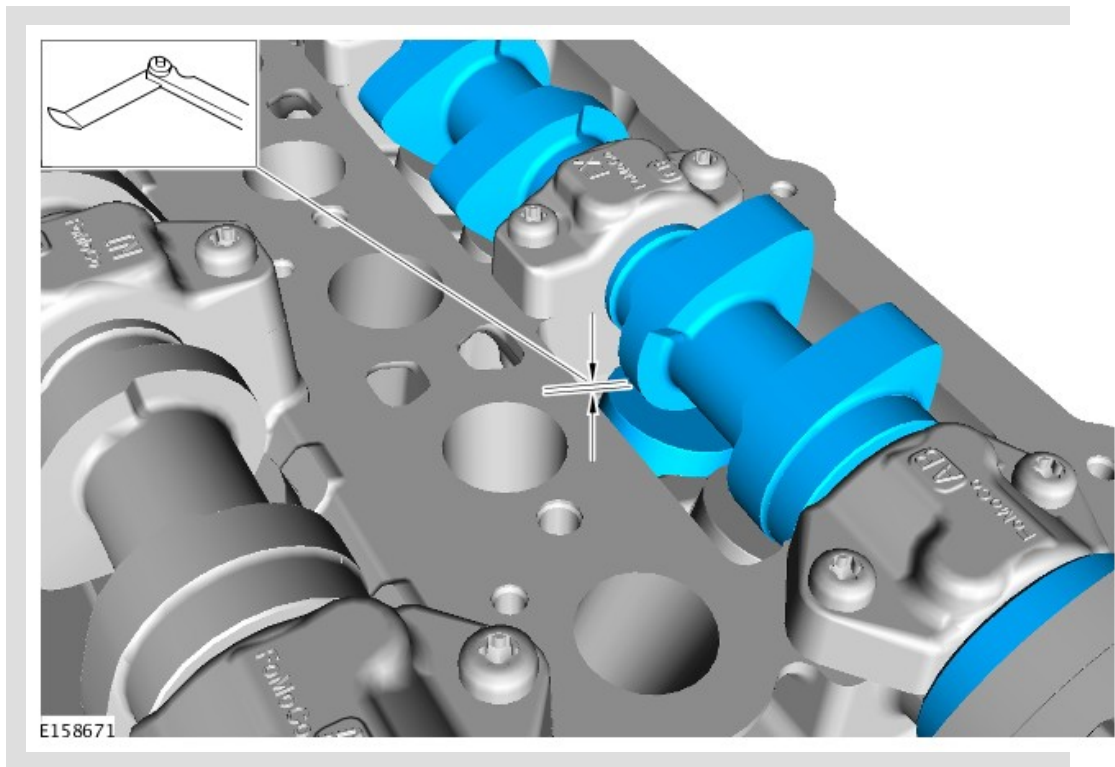

- Using feeler gauge check the gap between the tappet and the camshaft lobe and check against specifications table.
- Repeat this step for the remaining valve tappets.