



St. Joseph's Hospital Savannah GA (US)

St. Joseph's Hospital Cooling Tower Performance report -May 2026

31 May 2026

Location

St. Joseph's Hospital Savannah GA (US)

Prepared by

Vethigasri Velmurugan

Executive Summary

1. System Health Check:

Corrosion Control:

The Mild steel and copper corrosion rate readings are maintained on average of 0.1 mpy and 0.06 mpy which is well within the industrial limits of 3mpy and 0.5 mpy respectively indicating that the system is in good control.

Microbial control:

The delta ORP of 150 mV indicates the system has good microbial control. This indicates that the oxidizing biocide is being dosed appropriately based on the chlorine demand of the water. Total biocide consumption for May was 264 lb, which is slightly higher than the expected baseline usage of 225 lb per month. This indicates improved dosing efficiency following the implementation of delta ORP control.

Scaling Control:

The polymer consumption is less than 25% indicating the system is less prone to scaling. The product level is maintained 100% of the time to ensure better control.

2. Water Efficiency:

The system is operating at the target cycles of concentration (COC) of 2.5. Operating cycles are limited by silica concentration. Conductivity is well controlled, with 100% control compliance, indicating stable operation and effective blowdown and dosing management.

3. Product Efficiency:

The product level has been consistently maintained at setpoint of 45 ppm, indicating effective product dosing within the system. The product level is maintained 100% of the time to ensure better control.

The Overall KPM for the month of May is 100% indicating that the system is in good control achieved by teamwork from backend IL team and Ackumen technology preserving your valuable assets.

4. Proactive System Support:

The system is proactively monitored, and no alarms were generated during the reporting period, indicating that the system is operating under good control.

Performance Summary


Custom Table 1

Parameter	Context Point	Average	Lower Limit	Upper Limit	% In Range	Gauge Chart
Corrosion Probe - Cu(MPY)	St Joseph Hospital_ACM	0.0525	-	0.500	100	
Corrosion Probe - MS(MPY)	St Joseph Hospital_ACM	0.100	-	3.00	100	
Electrode Conductivity(µS/cm)	St Joseph Hospital_ACM	725	200	800	80,8	
Fluorometer - Cell fouling(%)	St Joseph Hospital_ACM	4.85	-	25.0	100	
Fluorometer - Trace(ppm)	St Joseph Hospital_ACM	44.5	20.0	60.0	100	
ORP(mV)	St Joseph Hospital_ACM	154	100	600	69,8	
pH Probe(pH)	St Joseph Hospital_ACM	8.89	7.00	10.0	100	

Controller	App	Plant	Overall	pH	EC	MSC	CuC	Trace	Turbidity	Cell fouling
84253FAB8CC5	ACM	St. Joseph's Hospital Savannah GA (US)	100%	100%	100%	100%	100%	100%	100%	100%

Overall, the system is operating in a stable and well-controlled manner. Key water quality parameters such as ORP, pH, and fluorometer readings are consistently within the desired range, reflecting effective process control. Conductivity is also being maintained at acceptable levels, indicating steady water quality and reliable system performance.


ORP VS Cu Corrosion Rate

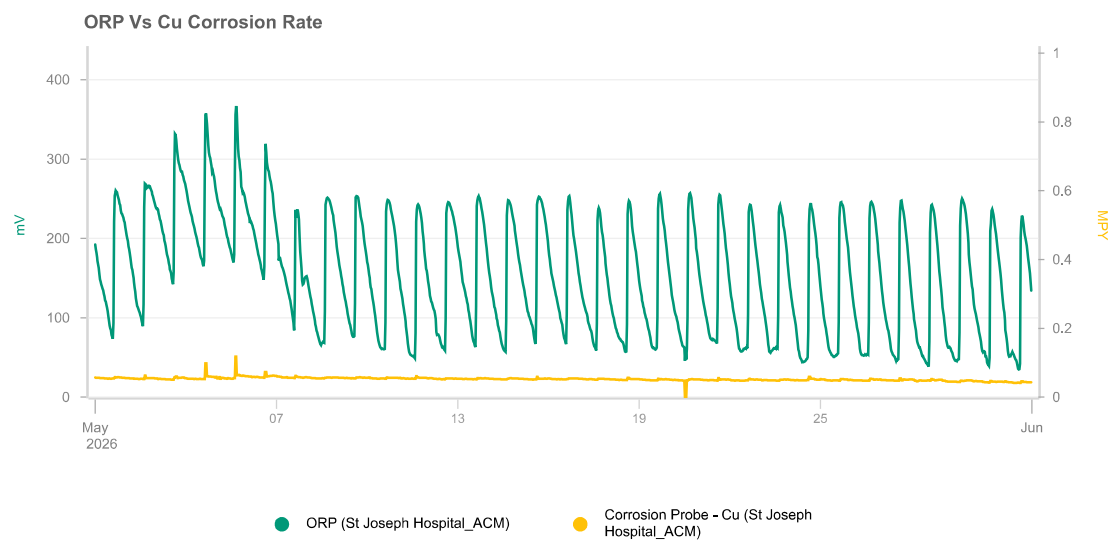

Comments

1. The Copper corrosion rate reading is maintained on an average of 0.05 mpy which is within the recommended range of 0.3 mpy.
2. The delta ORP of 150 mV indicates the system has good microbial control. This indicates that the oxidizing biocide is being dosed appropriately based on the chlorine demand of the water. As a result, adequate free residual chlorine is consistently maintained.

Actual COC Vs Target COC

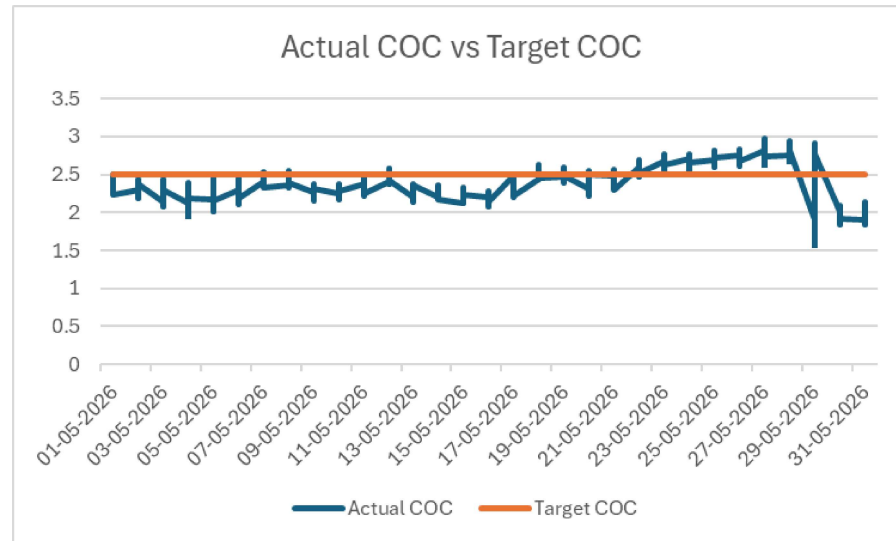

1. During May, conductivity was consistently maintained at an average of 700 S/cm, which is maintaining in the operating range of 600 μ S/cm. The actual COC is maintained well with the target COC of 2.5.
2. The flow through the skid is maintained around 3.5 gpm throughout the reporting period indicating stable and reliable system operation.

Inventory

Container Name	Product	Current Level (%)	Capacity	Total Usage	Average Usage	Target Usage
Inhibitor Impactt 547M	IMPACKT 547M	60.57	264 gal (U.S.)	0.00 lb	0.00 lb/d	0.00 L/d
Non Ox Biocide- Bulab 6057	BULAB 6057	100	55.0 gal (U.S.)	0.00 lb	0.00 lb/d	0.00 L/d
Ox Biocide Busan 1735	BUSAN 1735	48.89	264 gal (U.S.)	265 lb	8.53 lb/d	0.00 L/d

Comments

Chemical usage and inventory levels are well managed across the system. Inhibitor, oxidizing biocide, and non-oxidizing biocide inventories are maintained at healthy levels, ensuring uninterrupted system protection and treatment. A change in the non-oxidizing biocide usage reading was not observed; the corresponding sensor will be inspected during the upcoming site service visit to confirm proper operation.