WELL DATA - PROPOSED DIAGRAM

OPERATOR:	**California Resources Production Corp.**		
API:	**111-03416-01**		
WELL|FIELD|COUNTY:	**Santa Paula 1 | South Mountain | Ventura**		
SEC, TOWNSHIP, RANGE:	**Sec 18, T-03N, R-20W, BM -SB**		
ELEVATION AB SEA LVL:	**713'**	**DATUM:**	**741'**
KB:	**28'**	**SPUD**	**6/7/1916**
PREPARED BY:	**tm. Rev SS**	**DATE:**	**9/15/2020**
NOTES:	**DF elevation of 741'no longer exists. Tubing head flange, with an elevation of 713' used as reference point. (10/53). No cement history found for STK in historical records.**		

CALIFORNIA RESOURCES CORPORATION

Res Pressure - 400 psi
Kill fluid gradient - 0.45 psi/ft

CURRENT

HISTORY The **OH** was spud Jun-7, 1916 suspended Jul-26, 1916 after the 15-1/2" casing was landed at 350' (not cemented) the well was flowing and allowed to produce. Drilling commenced Jan-22, 1917, completed Jul-10, 1917. The 10" casing was never perforated (flowing). 8-1/4" csg landed at 2156' (TD). Fish in hole. Sidetracked when attempting to deepen.

STK 01 (May-Oct 2018) Used damaged area as sidetrack window, drilled to 2184' (TD). The 10" csg was landed @ 2065', hung on packing clamps. The 8-1/4" csg landed @ 2103'. Casing perforated (10/53).

OH Casing Record:

- 15-1/2" 70# landed at 350' (07/16)
- 12-1/2" 45# & 40# landed at 1709'. (parted @ 1335') (07/17)
  (STK Window from 1335'-1720') deepened to 2184' (TD)
- 10" 40# landed at 1996'. Undereemed & **landed @ 2096'** (09/17) with 30 sx cmt., TTOC @ 1970'. Perf'd 1875'-2060'. Csg parted @ 1380', collapsed @ 2065 - 2080'. (09/17) Twelve jnts pulled (5/18)
- 8-1/4" landed at 2156' (TD). Partial pull 2-jts in hole (09/17).

FISH: 2-jt 8-1/4" csg at btm (12/17), 1-jt 10" csg @ ~ 1721', also 12-1/2" bit, 4-1/2" x 30' stem, 6-1/4" jars, 3x4x7 rope socket and wire rope. (05/18)

STK Casing Record: (May to Oct -2018) window @ 1335' intersect both 12-1/2" and 10" OH casing.

- 10" 40# landed @ 2065' on packing clamps.
- 8-1/4" 36# landed at 2103' on packing clamps.

Casing/Perfs/Slots Details

15-1/2" cond csg driven to 350' (07/16)
No Cement.

OH 12-1/2" 45#, 40# landed 1709' (07/17)
Unkn hole size. No Cement. Never Perf'd.
12-1/2" parted @ 1,335' suspect csg shifted to one side. **Sidetracked with 10" csg string, window ~1335' to 1720'.**


STK 10" 40#, landed @ 2065' (10/18)
hung on packing clamps. No record of cement. (12-1/4" hole size assumed).
Perforated (**Open**) four 1/2" HPF (10/53)
491'-589', 606'-631', 756'-766', 1071'-1086', 1291'-1306', 1361'-1371', 1389'-1412', 1444'-1488', 1517'-1541', 1563'-1587', 1629'-1667', 1722'-1741', 1769'-1792', 1826'-1836'

8-1/4", 36# landed @ 2103' (10/18)
Perf (**Open**) 2R,6"C,5/8"x1-1/4"H
1875' - 1942', 1965' - 2060'.

No BFW/USDW

Geologic Markers:
Upper Sespe @ 62'
Lower Sespe @ 1500'

Schematic

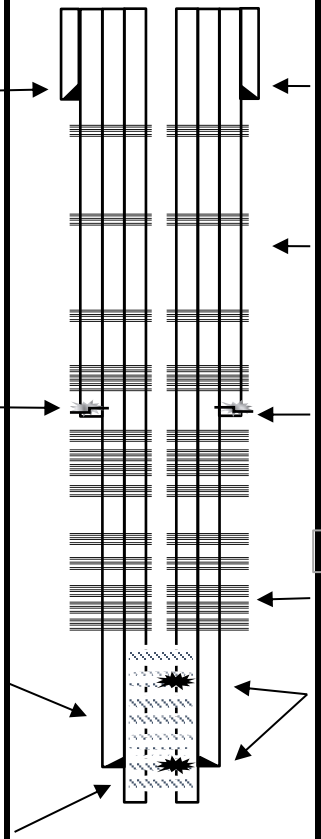

PB: 2184'
TD: 2184'

Hole Details

0 ft

Upper Sespe @ 248'
Cable tools used, hole size unkown. Assume 16" hole.

500 ft

Hole size unknown.
Assume 14-1/2" hole.

1000 ft

STK Window 1335'
inside 12-1/2" & 10" OH csg strings.

Lower Sespe @ 1500' 1500 ft
Unkn Hole Size Drl'd
Assume 12-1/2".

Unkn damage @ 1910', 2070'

2000 ft

2500 ft

3000 ft