

AMENDMENT NO. 1 OCTOBER 1987**TO**

**IS : 3347 (Part 5/Sec 2)- 1979 DIMENSIONS FOR
PORCELAIN TRANSFORMER BUSHINGS FOR USE
IN NORMAL AND LIGHTLY POLLUTED
ATMOSPHERES**

PART 5 36 kV BUSHINGS**Section 2 Metal Parts****(First Revision)**

(Page 10, Table 1, sixth and tenth entries) — Substitute the following for the existing details for parts:

Sealing washer for stem	Aluminium Copper	Fig. 12 Fig. 12	Fig. 14 Fig. 13	Fig. 14 Fig. 14	Fig. 14 Fig. 14	— Fig. 14
Connecting lug	Aluminium Copper	— —	— —	Fig. 23(B) Fig. 23(A)	Fig. 23(B) Fig. 23(B)	— Fig. 23(B)

[Page 22, Fig. 23(A), Form A]:


- Substitute 'M10 × 1.25' for 'M10' in left top diagram.
- Delete 'd₁' in right side diagram.

[Page 23, Fig. 23(A), Form B] — Add the following Note above the caption:

'NOTE — For other details, refer to Fig. 23(A), Form A,'

Gr 1

[Page 24, Fig. 23(B), Form A] — Substitute the following figure for the existing figure:

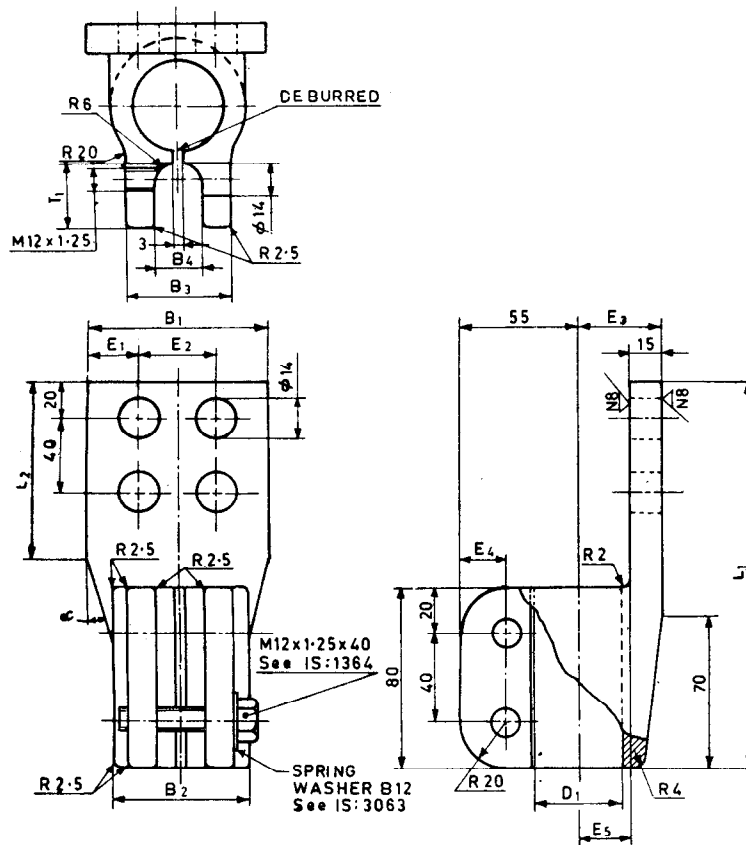

FORM A

STEM SIZE	D_1	B_1	B_2	B_3	B_4	E_1	E_2	E_3	E_4	E_5	L_1	L_2	L_3	L_4	T_1	α	FOR NOMINAL CURRENT RATING
M 42 × 3	M 42 × 3	100	58	45	20	25	50	40	20	25	190	100	105	155	26	26°	2 000 A
M 48 × 3	M 48 × 3	120	68	58	28	30	60	45	18	30	210	120	125	175	28	30°	3 150 A

Tolerance on dimensions:


For machine parts — medium
Other parts — coarse } (See IS : 2102-1969*)

*Specification for allowable deviation for dimensions without specified tolerances (first revision).

All dimensions in millimetres.

FIG. 23(B) CONNECTING LUG (FOR 36 kV/2 000 AND 3 150 A RATING)

[Page 25, Fig. 23(B), Form B] — Substitute the following figure for the existing figure:

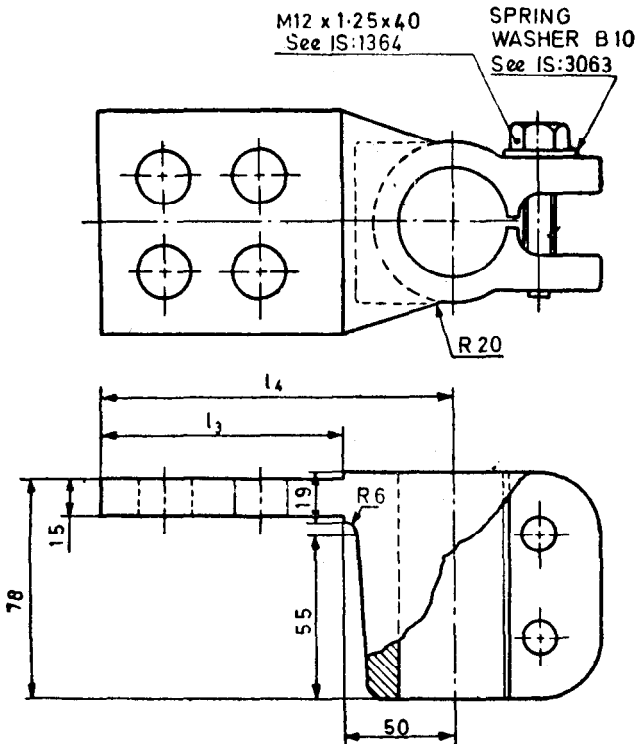

FORM B

All dimensions in millimetres.


NOTE — Let other details refer to Fig. 23(B), Form A.

FIG. 23(B) CONNECTING LUG (FOR 36 kV/2 000 AND 3 150 A RATING)

(Page 28, Fig. 28) — Add the following Note above the caption of the figure:

‘NOTE — The surface marked with dotted lines should be tinned or electroplated but not painted.’

(Page 29, Fig. 29) — Substitute the following figure for the existing figure:

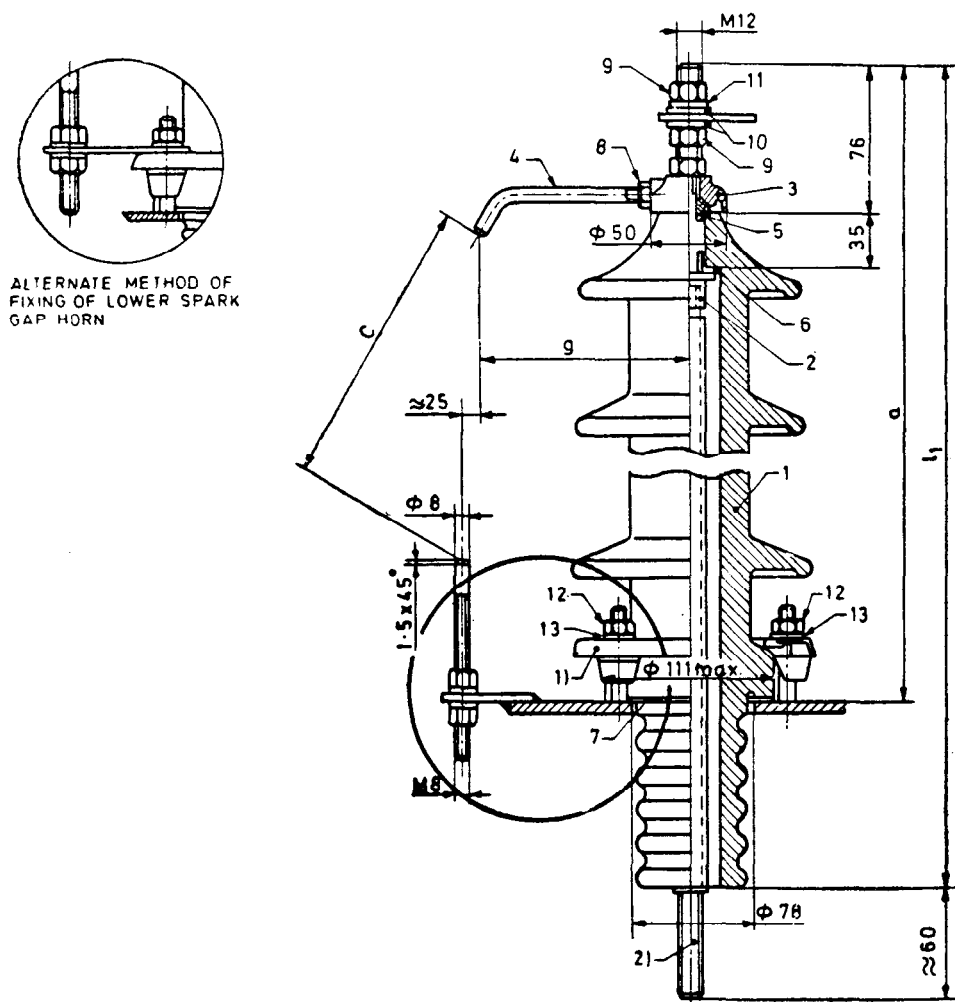

Alternate arrangement for fixing of lower spark gap horn may be used.

1. Clamping arrangement of bushings shall be according to IS : 4257 (Part 1)-1981*.
2. The connecting bolt and the stem may be made in one piece.

BUSHING RATING kV/A	<i>a</i>	<i>C</i>	<i>g</i>	<i>l₁</i>
36/250	485	220	170	561

P a r t s N o m e n c l a t u r e


- | | |
|---------------------------------------|-------------------|
| 1. Insulator | 8. Hexagonal nut |
| 2. Stem | 9. Hexagonal nut |
| 3. Cap | 10. Plain washer |
| 4. Upper spark gap horn | 11. Spring washer |
| 5. Sealing washer for stem | 12. Hexagonal nut |
| 6. Separator | 13. Plain washer |
| 7. Sealing washer for general purpose | |

*Dimensions for clamping arrangement for porcelain transformer bushings: Part 1 For 12 kV to 36 kV bushings (*first revision*).

All dimensions in millimetres.

FIG. 29 BUSHING ASSEMBLY (FOR 36 kV/250 A RATING)

(Page 30, Fig. 30) — Substitute the following^{*} new figure for the existing figure:

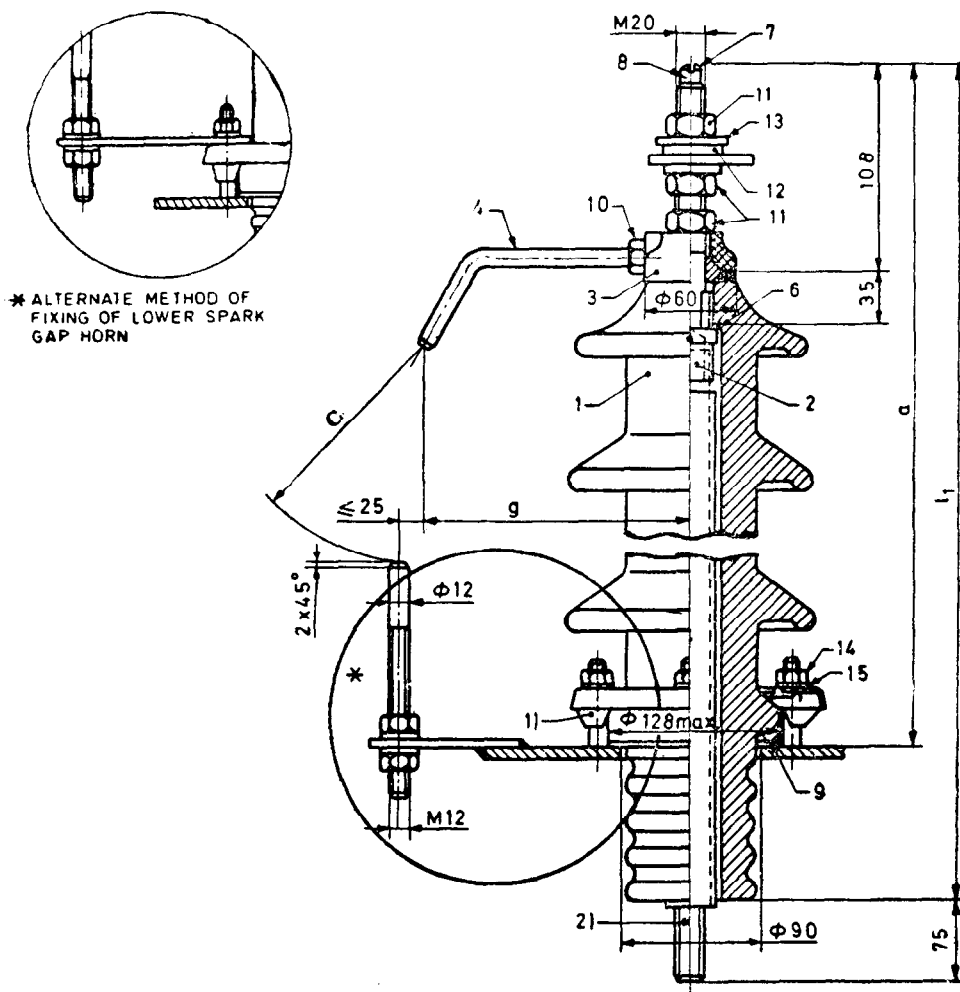

Alternate arrangement for fixing of lower spark gap horn may be used.

1. Clamping arrangement of bushings shall be according to IS: 4257 (Part 1)-1981*.
2. The connecting bolt and the stem may be made in one piece.

BUSHING RATING kV/A	a	C	g	l ₁
36/630	522	220	200	618

Parts Nomenclature

1. Insulator	6. Separator	10. Hexagonal nut
2. Stem	7. Vent plug	11. Hexagonal nut
3. Cap	8. Gasket ring	12. Washer
4. Upper spark gap horn	9. Sealing washer for general purpose	13. Spring washer
5. Sealing washer for stem		14. Hexagonal nut
		15. Washer

*Dimensions for clamping arrangement for porcelain transformer bushings: Part 1 For 12 kV to 36 kV bushings (first revision).

All dimensions in millimetres.

FIG. 30 BUSHING ASSEMBLY WITH COPPER STEM
(FOR 36 kV/630 A RATING)