
ETSI TS 134 123-1 V6.7.0 (2007-06)

Technical Specification

Universal Mobile Telecommunications System (UMTS);
User Equipment (UE) conformance specification;
Part 1: Protocol conformance specification
(3GPP TS 34.123-1 version 6.7.0 Release 6)

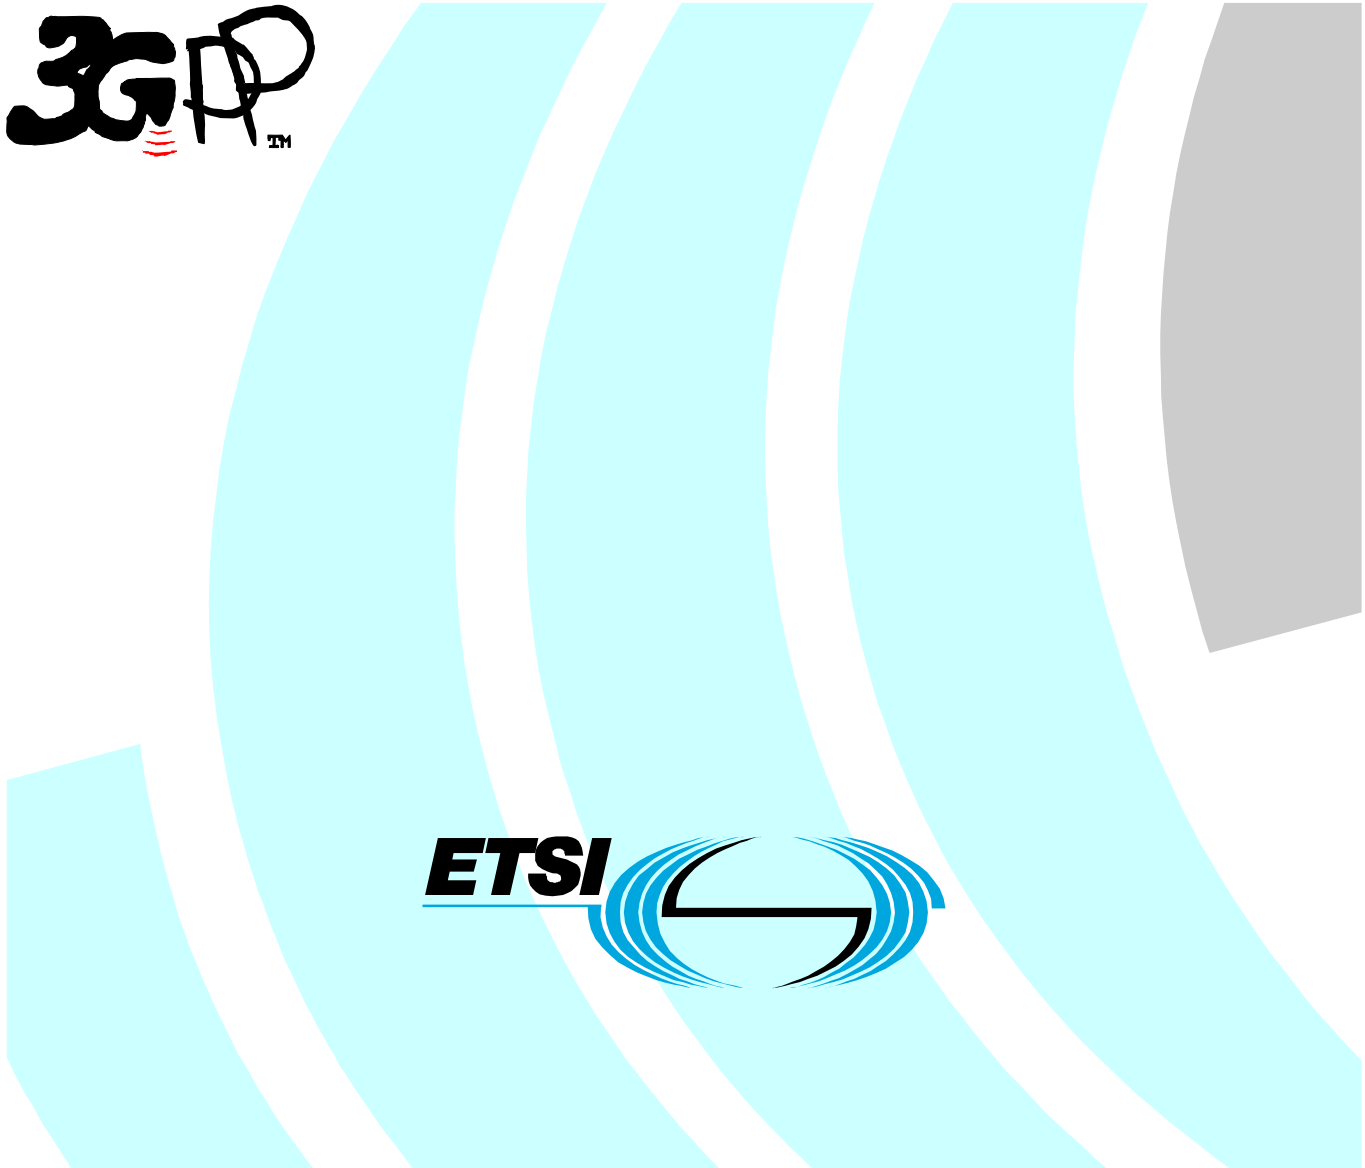

Reference
RTS/TSGR-0534123-1v670

Keywords
UMTS

ETSI

650 Route des Lucioles
F-06921 Sophia Antipolis Cedex - FRANCE

Tel.: +33 4 92 94 42 00 Fax: +33 4 93 65 47 16

Siret N° 348 623 562 00017 - NAF 742 C
Association à but non lucratif enregistrée à la
Sous-Préfecture de Grasse (06) N° 7803/88

Important notice

Individual copies of the present document can be downloaded from:
http://www.etsi.org

The present document may be made available in more than one electronic version or in print. In any case of existing or perceived difference in contents between such versions, the reference version is the Portable Document Format (PDF). In case of dispute, the reference shall be the printing on ETSI printers of the PDF version kept on a specific network drive within ETSI Secretariat.

Users of the present document should be aware that the document may be subject to revision or change of status. Information on the current status of this and other ETSI documents is available at
http://portal.etsi.org/tb/status/status.asp

If you find errors in the present document, please send your comment to one of the following services:
http://portal.etsi.org/chaircor/ETSI_support.asp

Copyright Notification

No part may be reproduced except as authorized by written permission.
The copyright and the foregoing restriction extend to reproduction in all media.

© European Telecommunications Standards Institute 2007.
All rights reserved.

DECT™, **PLUGTESTS**™ and **UMTS**™ are Trade Marks of ETSI registered for the benefit of its Members.
TIPHON™ and the **TIPHON logo** are Trade Marks currently being registered by ETSI for the benefit of its Members.
3GPP™ is a Trade Mark of ETSI registered for the benefit of its Members and of the 3GPP Organizational Partners.

Intellectual Property Rights

IPRs essential or potentially essential to the present document may have been declared to ETSI. The information pertaining to these essential IPRs, if any, is publicly available for **ETSI members and non-members**, and can be found in ETSI SR 000 314: *"Intellectual Property Rights (IPRs); Essential, or potentially Essential, IPRs notified to ETSI in respect of ETSI standards"*, which is available from the ETSI Secretariat. Latest updates are available on the ETSI Web server (http://webapp.etsi.org/IPR/home.asp).

Pursuant to the ETSI IPR Policy, no investigation, including IPR searches, has been carried out by ETSI. No guarantee can be given as to the existence of other IPRs not referenced in ETSI SR 000 314 (or the updates on the ETSI Web server) which are, or may be, or may become, essential to the present document.

Foreword

This Technical Specification (TS) has been produced by ETSI 3rd Generation Partnership Project (3GPP).

The present document may refer to technical specifications or reports using their 3GPP identities, UMTS identities or GSM identities. These should be interpreted as being references to the corresponding ETSI deliverables.

The cross reference between GSM, UMTS, 3GPP and ETSI identities can be found under http://webapp.etsi.org/key/queryform.asp.

Contents

Intellectual Property Rights 2
Foreword 2
Foreword 4
Introduction 4
1 Scope 5
2 References 5
3 Definitions and abbreviations 6
4 Overview 6
5 – 18 (void) 6
Annex A - D: (void) 7
Annex E (informative): Change history 8
History 59

Foreword

This Technical Specification (TS) has been produced by the 3rd Generation Partnership Project (3GPP).

The contents of the present document are subject to continuing work within the TSG and may change following formal TSG approval. Should the TSG modify the contents of the present document, it will be re-released by the TSG with an identifying change of release date and an increase in version number as follows:

Version x.y.z

where:

x the first digit:

1 presented to TSG for information;

2 presented to TSG for approval;

3 or greater indicates TSG approved document under change control.

y the second digit is incremented for all changes of substance, i.e. technical enhancements, corrections, updates, etc.

z the third digit is incremented when editorial only changes have been incorporated in the document.

Introduction

The present document is the first part of a multi-part conformance specification valid for 3GPP Release 1999, 3GPP Release 4 and 3GPP Release 5. 3GPP TS 34.123-2 [11] contains a pro-forma for the Implementation Conformance Statement (ICS) and an applicability table, indicating the release from which each tescase is applicable. 3GPP TS 34.123-3 [12] contains a detailed and executable description of the test cases written in a standard testing language, TTCN, as defined in ISO/IEC 9646.

For at least a minimum set of services, the prose descriptions of test cases will have a matching detailed test case implemented in TTCN [12].

For Release 1999, the minimum set of services are defined as:

- voice calls;
- emergency calls;
- SMS (both Point-to-point and Cell broadcast);
- Circuit Switched data at up to 64 k bits/second;
- fax;

including the underlying layers to support these services.

Release 1999 will also include the areas:

- auto-calling restrictions.

The present document may contain descriptions of tests for additional services, but these tests may not have matching TTCN test cases.

The present document will not contain any tests on the USIM, or the interface between the UE and the USIM. These tests are documented elsewhere.

1 Scope

The present document specifies the protocol conformance testing for the 3rd Generation User Equipment (UE).

This is the first part of a multi-part test specification. The following information can be found in this part:

- the overall test structure;
- the test configurations;
- the conformance requirement and reference to the core specifications;
- the test purposes; and
- a brief description of the test procedure, the specific test requirements and short message exchange table.

The following information relevant to testing can be found in accompanying specifications:

- the default setting of the test parameters [9];
- the applicability of each test case [11].

A detailed description of the expected sequence of messages can be found in the 3rd part of this test specification.

The Implementation Conformance Statement (ICS) pro-forma can be found in the 2nd part of the present document.

The present document is valid for UE implemented according to 3GPP Release 1999, 3GPP Release 4 or 3GPP Release 5.

2 References

The following documents contain provisions which, through reference in this text, constitute provisions of the present document.

- References are either specific (identified by date of publication, edition number, version number, etc.) or non-specific.
- For a specific reference, subsequent revisions do not apply.
- For a non-specific reference, the latest version applies. In the case of a reference to a 3GPP document (including a GSM document), a non-specific reference implicitly refers to the latest version of that document in the same Release as the present document.
  - For a Release 1999 UE, references to 3GPP documents are to version 3.x.y, when available.
  - For a Release 4 UE, references to 3GPP documents are to version 4.x.y, when available.
  - For a Release 5 UE, references to 3GPP documents are to version 5.x.y, when available.
  - For a Release 6 UE, references to 3GPP documents are to version 6.x.y, when available.
  - For a Release 7 UE, references to 3GPP documents are to version 7.x.y, when available.

[1] to [8] (void)

[9] 3GPP TS 34.108: "Common Test Environments for User Equipment (UE) Conformance Testing".

[10] (void)

[11] 3GPP TS 34.123-2: "User Equipment (UE) conformance specification; Part 2: Implementation Conformance Statement (ICS) proforma specification".

[12] 3GPP TS 34.123-3: "User Equipment (UE) conformance specification; Part 3: Abstract Test Suites (ATS)".

[13] to [39] (void)

[40] 3GPP TS 34.123-1 (Release 7): "User Equipment (UE) Conformance Specification, Part 1 – Protocol conformance specification.

3 Definitions and abbreviations

(void)

4 Overview

The requirements of the present document are provided in 3GPP TS 34.123-1 version 7.y.z (Release 7) [40].

5 – 18 (void)

Annex A - D:
(void)

Annex E (informative): Change history

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-08				Approval of the specification		2.0.0	3.0.0	
TP-09	TP-000135	001		Idle mode test cases	F	3.0.0	3.1.0	T1-000165
TP-09	TP-000135	002		Section 8, RRC Tests: RLCSize	C	3.0.0	3.1.0	T1-000169
TP-09	TP-000135	003		Section 8, RRC Tests: HFN	C	3.0.0	3.1.0	T1-000170
TP-09	TP-000135	004		Section 8, RRC Tests: RLCParam	C	3.0.0	3.1.0	T1-000171
TP-09	TP-000135	005		Section 8, RRC Tests: RBIdentity	C	3.0.0	3.1.0	T1-000172
TP-09	TP-000135	006		Section 8, RRC Tests: TrCHParam	C	3.0.0	3.1.0	T1-000173
TP-09	TP-000135	007		Section 8, RRC Tests: UECapability	C	3.0.0	3.1.0	T1-000174
TP-09	TP-000135	008		Section 8, RRC Tests: RBMapping	C	3.0.0	3.1.0	T1-000175
TP-09	TP-000135	009		Section 8, RRC Tests: PagingCause	C	3.0.0	3.1.0	T1-000176
TP-09	TP-000135	010		Section 8, RRC Tests: RRCConnRelease-TM	B	3.0.0	3.1.0	T1-000177
TP-09	TP-000135	011		Section 8, RRC Tests: SignallingRelease	B	3.0.0	3.1.0	T1-000178
TP-09	TP-000135	012		Section 8, RRC Tests: CipheringAndIntegrity	C	3.0.0	3.1.0	T1-000179
TP-09	TP-000135	013		Section 8, RRC Tests: Countercheck_rev	B	3.0.0	3.1.0	T1-000180
TP-09	TP-000135	014		Section 8, RRC Tests: RLCInfo	C	3.0.0	3.1.0	T1-000181
TP-09	TP-000135	015		Section 8, RRC Tests: CompressedMode	C	3.0.0	3.1.0	T1-000182
TP-09	TP-000135	016		Section 8, RRC Tests: SIB	F	3.0.0	3.1.0	T1-000183
TP-09	TP-000135	017		Section 8, RRC Tests: PhyCH	D	3.0.0	3.1.0	T1-000184
TP-09	TP-000135	018		Section 8, RRC Tests: Measurement	C	3.0.0	3.1.0	T1-000185
TP-09	TP-000135	019		Section 8, RRC Tests: FailureCases	C	3.0.0	3.1.0	T1-000186
TP-09	TP-000135	020		Section 8, RRC Tests: TFCS	C	3.0.0	3.1.0	T1-000187
TP-09	TP-000135	021		Section 8, RRC Tests: DPCHFrameOffset	C	3.0.0	3.1.0	T1-000188
TP-09	TP-000135	022		Section 8, RRC Tests: ReEstablishmentTimer	C	3.0.0	3.1.0	T1-000189
TP-09	TP-000135	023		Section 8, RRC Tests: InterFrequencyHardHandOver	F	3.0.0	3.1.0	T1-000206
TP-09	TP-000135	024		clause 12.4.1.5 "Routing area updating / abnormal cases / attempt counter check / miscellaneous reject causes"	C	3.0.0	3.1.0	T1-000211
TP-09	TP-000135	025		SM test cases	C	3.0.0	3.1.0	T1-000208
TP-09	TP-000135	026		MM: Authentication	F	3.0.0	3.1.0	T1-000207
TP-09	TP-000135	027		Update of radio bearer test cases (aligned to GSMA ISG version 1.3)	F	3.0.0	3.1.0	T1-000213
TP-09	TP-000135	028		MAC tests	B	3.0.0	3.1.0	T1-000218
TP-09	TP-000135	029		PDCP tests	B	3.0.0	3.1.0	T1-000166
TP-09	TP-000135	030		BMC tests	B	3.0.0	3.1.0	T1-000167
TP-09	TP-000135	031		RRC updates	F	3.0.0	3.1.0	T1-000168
TP-09	TP-000135	032		clause 12.6.1.2 "Authentication rejected"	F	3.0.0	3.1.0	T1-000210
TP-09	TP-000135	033		clause 12.6 "PS authentication and ciphering"	C	3.0.0	3.1.0	T1-000209
TP-10	TP-000218	034		Application of integrity mode protection to signalling message by default	F	3.1.0	3.2.0	T1-000297
TP-10	TP-000218	035		New teset cases for CS intersystem handover	B	3.1.0	3.2.0	T1-000300
TP-10	TP-000218	036		CR to 34.123-1, Annex B, Mapping of test cases to core specification versions	D	3.1.0	3.2.0	T1-000319
TP-10	TP-000218	037		Application of ciphering during conformance testing and changes to integrity mode protection related messages	C	3.1.0	3.2.0	T1-000286
TP-10	TP-000218	038		Idle Mode test cases in chapter 6	F	3.1.0	3.2.0	T1-000288
TP-10	TP-000218	039		Update to RLC test cases	F	3.1.0	3.2.0	T1-000301
TP-10	TP-000218	040		Technical Corrections to RRC test cases in clause 8	F	3.1.0	3.2.0	T1-000292
TP-10	TP-000218	041		Updates to clause 8 and Annex A due to RAN2 core specifications modifications	C	3.1.0	3.2.0	T1-000293
TP-10	TP-000218	042		Editorial modification for CC test cases (Clause 10)	D	3.1.0	3.2.0	T1-000289
TP-10	TP-000218	043		Update of radio bearer test cases	F	3.1.0	3.2.0	T1-000290
TP-10	TP-000218	044		Update of Session Management test cases	B	3.1.0	3.2.0	T1-000298
TP-10	TP-000218	045		Modification to the 'Authentication rejected by the UE' test case	F	3.1.0	3.2.0	T1-000308
TP-10	TP-000218	046		Update to 16. SMS test specification	F	3.1.0	3.2.0	T1-000309
TP-10	TP-000218	047		Correction to MM tests	D	3.1.0	3.2.0	T1-000310
TP-11	TP-010021	048		Idle mode test cases	F	3.2.0	3.3.0	T1-010076
TP-11	TP-010021	049		Updates to clause 8 of TS 34.123-1 version 3.2.0	F	3.2.0	3.3.0	T1-010106
TP-11	TP-010021	050		Update to GMM test case.	F	3.2.0	3.3.0	T1-010086
TP-11	TP-010021	051		Update to 16. SMS test specification	D	3.2.0	3.3.0	T1-010090
TP-11	TP-010021	052		Annex B: Update of versions of core specifications	F	3.2.0	3.3.0	T1-010091
TP-12	TP-010121	053		Idle mode tests	F	3.3.0	3.4.0	T1-010167

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-12	TP-010121	054		Clause 7.2: Update of RLC tests to 25.322 v3.5.0	F	3.3.0	3.4.0	T1-010170
TP-12	TP-010121	055		Corrections to Clause 7.2: RLC test case updates	F	3.3.0	3.4.0	T1-010171
TP-12	TP-010121	056		Corrections to clause 7.3 PDCP	F	3.3.0	3.4.0	T1-010173
TP-12	TP-010121	057		Corrections to clause 7.4 BMC	F	3.3.0	3.4.0	T1-010174
TP-12	TP-010121	058		7.1 Update to MAC test cases	F	3.3.0	3.4.0	T1-010175
TP-12	TP-010121	059		Modifications to the functional testing of CPCH related UE test cases	C	3.3.0	3.4.0	T1-010176
TP-12	TP-010121	060		Transmission RLC discard	F	3.3.0	3.4.0	T1-010178
TP-12	TP-010121	061		Updates to RRC test case	F	3.3.0	3.4.0	T1-010179
TP-12	TP-010121	062		Deletion of intersystem handover tests GERAN to UTRAN	F	3.3.0	3.4.0	T1-010181
TP-12	TP-010121	063		Corrections to CC test cases	F	3.3.0	3.4.0	T1-010183
TP-12	TP-010121	064		Corrections to Emergency call test cases	F	3.3.0	3.4.0	T1-010184
TP-12	TP-010121	065		Corrections to test of autocalling restrictions	F	3.3.0	3.4.0	T1-010185
TP-12	TP-010121	066		Corrections to call re-establishment tests in CC	F	3.3.0	3.4.0	T1-010187
TP-12	TP-010121	067		MM test case update	F	3.3.0	3.4.0	T1-010189
TP-12	TP-010121	068		CR to 34.123-1	F	3.3.0	3.4.0	T1-010193
TP-12	TP-010121	069		SMS Update	F	3.3.0	3.4.0	T1-010194
TP-12	TP-010121	070		SMS test specification	F	3.3.0	3.4.0	T1-010196
TP-12	TP-010121	071		Update to GMM test cases	F	3.3.0	3.4.0	T1-010235
TP-12	TP-010121	072		GMM service request test cases	F	3.3.0	3.4.0	T1-010236
TP-12	TP-010121	073		GMM authentication reject test cases	F	3.3.0	3.4.0	T1-010237
TP-12	TP-010121	074		Modifications to Clause 12 (GMM)	F	3.3.0	3.4.0	T1-010202
TP-12	TP-010121	075		Correction in test case 11.1, because of problems in core-specs	F	3.3.0	3.4.0	T1-010203
TP-12	TP-010121	076		Procedure and Expected Sequence Corrections to 11.1.2.	F	3.3.0	3.4.0	T1-010204
TP-12	TP-010121	077		Adding section for multi-layer functional testing	D	3.3.0	3.4.0	T1-010207
TP-12	TP-010121	078		Update of interoperability radio bearer test cases	F	3.3.0	3.4.0	T1-010208
TP-12	TP-010121	079		CR to TS 34.123-1 Update of Table B/1	D	3.3.0	3.4.0	T1-010217
TP-13	TP-010186	080		Parameters update and Editorial corrections in clauses 7.2.3.1, 7.2.3.2.1, 7.2.3.23, 7.2.3.24	F	3.4.0	3.5.0	T1-010292
TP-13	TP-010186	081		Corrections to Clause 13 General Tests	F	3.4.0	3.5.0	T1-010293
TP-13	TP-010186	082		Modification in "Method of Test" for RBS test cases in Clause 14	F	3.4.0	3.5.0	T1-010294
TP-13	TP-010186	083		Editorial modification for References	F	3.4.0	3.5.0	T1-010295
TP-13	TP-010186	084		Clause 7.3, PDCP tests	F	3.4.0	3.5.0	T1-010378
TP-13	TP-010186	085		Idle mode: Merge of T1S-010180 and 188	F	3.4.0	3.5.0	T1-010297
TP-13	TP-010186	086		clause 7.4 BMC: editorial correction	F	3.4.0	3.5.0	T1-010379
TP-13	TP-010186	087		Clause 7.1, MAC test cases	F	3.4.0	3.5.0	T1-010299
TP-13	TP-010186	088		Corrections to RLC test case 7.2.2.2	F	3.4.0	3.5.0	T1-010300
TP-13	TP-010186	089		Corrections to RLC test case 7.2.2.3	F	3.4.0	3.5.0	T1-010301
TP-13	TP-010186	090		Corrections to RLC test case 7.2.2.8	F	3.4.0	3.5.0	T1-010302
TP-13	TP-010186	091		Corrections to RLC test case 7.2.2.10	F	3.4.0	3.5.0	T1-010303
TP-13	TP-010186	092		Corrections to RLC test case 7.2.2.9	F	3.4.0	3.5.0	T1-010304
TP-13	TP-010186	093		Corrections to RLC test case 7.2.2.12	F	3.4.0	3.5.0	T1-010305
TP-13	TP-010186	094		Corrections to RLC test case 7.2.2.29	F	3.4.0	3.5.0	T1-010306
TP-13	TP-010186	095		Corrections to RLC test case 7.2.2.30	F	3.4.0	3.5.0	T1-010307
TP-13	TP-010186	096		Corrections to RLC test case 7.2.2.33	F	3.4.0	3.5.0	T1-010308
TP-13	TP-010186	097		Corrections to RLC test case 7.2.2.34	F	3.4.0	3.5.0	T1-010309
TP-13	TP-010186	098		Updates to clause 8 and Annex A	F	3.4.0	3.5.0	T1-010310
TP-13	TP-010186	099		RRC tests (section 8)	F	3.4.0	3.5.0	T1-010311
TP-13	TP-010186	100		InterSystemHandover tests (section 8.3.7)	F	3.4.0	3.5.0	T1-010312
TP-13	TP-010186	101		Update on Mobility Management	F	3.4.0	3.5.0	T1-010313
TP-13	TP-010186	102		Addition of a SM test case for UE in GSM	F	3.4.0	3.5.0	T1-010314
TP-13	TP-010186	103		Clause 12 "Elementary procedure for Packet Switched Mobility Management"(GMM)	F	3.4.0	3.5.0	T1-010315
TP-13	TP-010186	104		Update of radio bearer test cases	F	3.4.0	3.5.0	T1-010316
TP-13	TP-010186	105		SMS test specification	F	3.4.0	3.5.0	T1-010317
TP-13	TP-010186	106		RACH Test Procedures for 1.28 Mcps TDD (Rel-4)	F	3.4.0	4.0.0	T1-010318
TP-13	TP-010186	107		Corrections to RLC test case 7.2.2.14	F	3.4.0	3.5.0	T1-010319
TP-13	TP-010186	108		Corrections to RLC test case 7.2.2.7 and 7.2.2.13	F	3.4.0	3.5.0	T1-010320
TP-13	TP-010186	109		RLC acknowledge mode test cases 7.2.3.14 and 7.2.3.34	F	3.4.0	3.5.0	T1-010321
TP-13	TP-010186	110		Merging of Rel4 and R99 protocol test specifications	F	3.4.0	4.0.0	T1-010272
TP-13	TP-010189	112		Update of Annex B	F	3.4.0	3.5.0	----
TP-14	TP-010261	113		Clause 7.3: PDCP testing: additional configuration information	F	4.0.0	4.1.0	T1-010406
TP-14	TP-010261	114		Clause 7.4: BMC testing: update for BMC testing	F	4.0.0	4.1.0	T1-010407
TP-14	TP-010261	115		Clause 7.2: Update of UM and AM RLC test cases	F	4.0.0	4.1.0	T1-010408
TP-14	TP-010261	116		Idle mode tests (34.123-1)	F	4.0.0	4.1.0	T1-010409

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-14	TP-010261	117		Removal of TBD Power Levels in section 6	F	4.0.0	4.1.0	T1-010410
TP-14	TP-010261	118		Idle Mode Test Parameters for Multi-mode environment (2G/3G) TDD	F	4.0.0	4.1.0	T1-010411
TP-14	TP-010261	119		Traffic Volume Measurement test cases (34.123-1 section 8.4)	F	4.0.0	4.1.0	T1-010412
TP-14	TP-010261	120		New interRAT test cases	F	4.0.0	4.1.0	T1-010413
TP-14	TP-010261	121		Corrections to Annex A	F	4.0.0	4.1.0	T1-010414
TP-14	TP-010261	122		Clause 12 Packet Switched Mobility Management	F	4.0.0	4.1.0	T1-010415
TP-14	TP-010261	123		Update to GMM test cases	F	4.0.0	4.1.0	T1-010416
TP-14	TP-010261	124		Update of interoperbility radio bearer test cases for FDD.	F	4.0.0	4.1.0	T1-010417
TP-14	TP-010261	125		Update to SMS test specification	F	4.0.0	4.1.0	T1-010418
TP-14	TP-010261	126		Corrections to RRC test cases	F	4.0.0	4.1.0	T1-010419
TP-14	TP-010261	127		RRC Connection Management Procedure Tests for the TDD options	F	4.0.0	4.1.0	T1-010420
TP-14	TP-010261	128		Annex A Default RRC Message Contents for 1.28Mcps TDD Mode	F	4.0.0	4.1.0	T1-010421
TP-14	TP-010261	129		Radio Bearer Tests for 1.28 Mcps TDD Mode	F	4.0.0	4.1.0	T1-010422
TP-15	TP-020041	130		Correction to Annex A	F	4.1.0	4.2.0	T1-020037
TP-15	TP-020041	131		Update of Idle mode tests	F	4.1.0	4.2.0	T1-020038
TP-15	TP-020041	132		Update to GMM test cases	F	4.1.0	4.2.0	T1-020039
TP-15	TP-020041	133		Corrections to RRC test cases, 8.2.2 onwards	F	4.1.0	4.2.0	T1-020040
TP-15	TP-020041	134		Corrections to Annex A	F	4.1.0	4.2.0	T1-020041
TP-15	TP-020041	135		Clause 7.3, PDCP testing: Update	F	4.1.0	4.2.0	T1-020042
TP-15	TP-020041	136		Corrections to clause 8.1	F	4.1.0	4.2.0	T1-020043
TP-15	TP-020041	137		Correction to RRC test cases	F	4.1.0	4.2.0	T1-020044
TP-15	TP-020041	138		Corrections to Measurement test cases	F	4.1.0	4.2.0	T1-020045
TP-15	TP-020042	139		Additional test case for packet	F	4.1.0	4.2.0	T1-020046
TP-15	TP-020041	140		Changes to MAC conformance test 7.1.1.1	F	4.1.0	4.2.0	T1-020047
TP-15	TP-020041	141		Changes to MAC conformance test 7.1.1.2	F	4.1.0	4.2.0	T1-020048
TP-15	TP-020041	142		Changes to MAC conformance test 7.1.1.3	F	4.1.0	4.2.0	T1-020049
TP-15	TP-020041	143		Changes to MAC conformance test 7.1.1.4	F	4.1.0	4.2.0	T1-020050
TP-15	TP-020041	144		Changes to MAC conformance test 7.1.1.5	F	4.1.0	4.2.0	T1-020051
TP-15	TP-020041	145		Changes to MAC conformance test 7.1.1.8	F	4.1.0	4.2.0	T1-020052
TP-15	TP-020041	146		Changes to MAC conformance test 7.1.2.2.1	F	4.1.0	4.2.0	T1-020053
TP-15	TP-020041	147		Changes to MAC conformance test 7.1.2.4	F	4.1.0	4.2.0	T1-020054
TP-15	TP-020041	148		Changes to MAC conformance test 7.1.2.5	F	4.1.0	4.2.0	T1-020055
TP-15	TP-020041	149		Changes to MAC conformance test 7.1.3.1	F	4.1.0	4.2.0	T1-020056
TP-15	TP-020041	150		Changes to RLC conformance test 7.2.3.20	F	4.1.0	4.2.0	T1-020057
TP-15	TP-020041	151		Changes to RLC conformance test 7.2.3.25	F	4.1.0	4.2.0	T1-020058
TP-15	TP-020041	152		Modifications on Session Management test case 11.1.1.1	F	4.1.0	4.2.0	T1-020059
TP-15	TP-020041	153		Modifications on Session Management test case 11.1.2	F	4.1.0	4.2.0	T1-020060
TP-15	TP-020041	154		Section 8.1 Connection Management Procedure (TDD both modes)	F	4.1.0	4.2.0	T1-020061
TP-15	TP-020041	155		Modification on Session Management test case 11.1.3.2	F	4.1.0	4.2.0	T1-020062
TP-15	TP-020041	156		Modifications of MM test cases	F	4.1.0	4.2.0	T1-020063
TP-15	TP-020042	157		Update of RB test cases	F	4.1.0	4.2.0	T1-020064
TP-15	TP-020041	158		Section 8.2 Radio Bearer Control Procedure (TDD both modes)	F	4.1.0	4.2.0	T1-020065
TP-15	TP-020041	159		Correction of MAC conformance test 7.1.2.1.1	F	4.1.0	4.2.0	T1-020089
TP-15	TP-020041	160		Correction of MAC conformance test 7.1.2.3.1	F	4.1.0	4.2.0	T1-020090
TP-15	TP-020042	161		Additional Measurement Control and Report test cases	F	4.1.0	4.2.0	T1-020111
TP-15	TP-020042	162		Clause 8.4.1 Measurement Control and Report	F	4.1.0	4.2.0	T1-020112
TP-15	TP-020042	163		Additional test cases for inter-RAT measurements and UE internal measurements	F	4.1.0	4.2.0	T1-020113
TP-15	TP-020042	164		Addition of test case for Inter-RAT measurement, event 3C, in CELL_DCH state using sparse compressed mode pattern	F	4.1.0	4.2.0	T1-020114
TP-15	TP-020042	165		Clause 6.1.2.8 Cell reselection : Equivalent PLMN	F	4.1.0	4.2.0	T1-020115
TP-15	TP-020042	166		Additional test cases for shared networks	F	4.1.0	4.2.0	T1-020116
TP-15	TP-020042	167		Deletion of Equivalent PLMN list in UE	F	4.1.0	4.2.0	T1-020117
TP-15	TP-020042	168		ePLMN list storage at power off	F	4.1.0	4.2.0	T1-020118
TP-15	TP-020042	169		Interaction of ePLMNs and forbidden PLMNs	F	4.1.0	4.2.0	T1-020119
TP-15	TP-020042	170		PLMN interaction with Manual Mode	F	4.1.0	4.2.0	T1-020120
TP-15	TP-020042	171		Clause 8.3 HCS cell reselection	F	4.1.0	4.2.0	T1-020121
TP-15	TP-020042	172		Clause 8.3.7.13 Inter system handover from UTRAN/To GSM/ success / call under establishment	F	4.1.0	4.2.0	T1-020122

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-15	TP-020042	173		Additional test cases for Physical Channel Reconfiguration from CELL_FACH to CELL_PCH or URA_PCH	F	4.1.0	4.2.0	T1-020123
TP-15	TP-020042	174		Additional test cases for Transport channel Reconfiguration from CELL_FACH to CELL_PCH or URA_PCH	F	4.1.0	4.2.0	T1-020124
TP-15	TP-020042	175		Additional test case for RRC connection establishment on another frequency	F	4.1.0	4.2.0	T1-020125
TP-15	TP-020042	176		Additional test case for UE response to changes of System Information data and structure	F	4.1.0	4.2.0	T1-020126
TP-16	TP-020143	177		Modifications of MM test cases	F	4.2.0	4.3.0	T1-020302
TP-16	TP-020143	178		Update to GMM test cases	F	4.2.0	4.3.0	T1-020303
TP-16	TP-020143	179		Correction to clause 8.3 except for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020304
TP-16	TP-020143	180		Update of L2/PDCP testing in alignment to March version 2002	F	4.2.0	4.3.0	T1-020305
TP-16	TP-020142	181		Correction to MAC conformance test 7.1.2.4a	F	4.2.0	4.3.0	T1-020306
TP-16	TP-020142	182		Correction to MAC conformance test 7.1.2.5	F	4.2.0	4.3.0	T1-020307
TP-16	TP-020142	183		Correction to MAC conformance test 7.1.2.1.1	F	4.2.0	4.3.0	T1-020308
TP-16	TP-020142	184		Correction to MAC conformance test 7.1.1.1	F	4.2.0	4.3.0	T1-020309
TP-16	TP-020142	185		General clarification of MAC testing conditions	F	4.2.0	4.3.0	T1-020310
TP-16	TP-020142	186		Correction to MAC conformance test 7.1.1.8	F	4.2.0	4.3.0	T1-020311
TP-16	TP-020142	187		Correction to MAC conformance test 7.1.1.5	F	4.2.0	4.3.0	T1-020312
TP-16	TP-020142	188		Correction to MAC conformance test 7.1.1.4	F	4.2.0	4.3.0	T1-020313
TP-16	TP-020142	189		Correction to MAC conformance test 7.1.1.3	F	4.2.0	4.3.0	T1-020314
TP-16	TP-020142	190		Correction to MAC conformance test 7.1.1.2	F	4.2.0	4.3.0	T1-020315
TP-16	TP-020142	191		Correction to test 7.2.3.12	F	4.2.0	4.3.0	T1-020316
TP-16	TP-020142	192		Correction to test 7.2.3.18	F	4.2.0	4.3.0	T1-020317
TP-16	TP-020142	193		Correction to test 7.2.3.4	D	4.2.0	4.3.0	T1-020318
TP-16	TP-020143	194		Correction to RLC test case 7.2.3.28	F	4.2.0	4.3.0	T1-020319
TP-16	TP-020142	195		Clause 6; Updates to test cases for idle mode operations	F	4.2.0	4.3.0	T1-020320
TP-16	TP-020142	196		Correction to clause 8.2 for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020321
TP-16	TP-020143	197		Clarification of messages sequences in MM test case 9.4.1.	F	4.2.0	4.3.0	T1-020322
TP-16	TP-020142	198		Correction to test cases 9.2.3 and 9.2.4	F	4.2.0	4.3.0	T1-020323
TP-16	TP-020143	199		Update to CC test cases	F	4.2.0	4.3.0	T1-020324
TP-16	TP-020143	200		Removal of TC9.5.3 MM connection / establishment in non-security mode	F	4.2.0	4.3.0	T1-020325
TP-16	TP-020142	201		Correction of layer 2 setting for TM RBs , segmentation indication	F	4.2.0	4.3.0	T1-020326
TP-16	TP-020142	202		Clause 14: Update of radio bearer test cases 14.2.39.x and 14.2.40 (introducing new RB test method)	F	4.2.0	4.3.0	T1-020327
TP-16	TP-020142	203		Clause 14; Update of stand-alone signalling radio bearer test cases	F	4.2.0	4.3.0	T1-020328
TP-16	TP-020143	204		Correction of abbreviations reference	F	4.2.0	4.3.0	T1-020329
TP-16	TP-020143	205		Correction to clause 8.2 except for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020330
TP-16	TP-020143	206		Correction to clause 8.4 except for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020331
TP-16	TP-020143	207		Correction to Annex.A of TS34.123-1	F	4.2.0	4.3.0	T1-020332
TP-16	TP-020143	208		Addition of generic test procedure to Annex C of TS 34.123-1	F	4.2.0	4.3.0	T1-020333
TP-16	TP-020143	209		Additional test cases according to T1S-020098 Hard Handover	F	4.2.0	4.3.0	T1-020334
TP-16	TP-020143	210		Additional test cases according to T1S-020099 State Transition	F	4.2.0	4.3.0	T1-020335
TP-16	TP-020143	211		New test case for Incompatible Simultaneous Security Reconfiguration	F	4.2.0	4.3.0	T1-020336
TP-16	TP-020143	212		New test case for Signalling Connection Release test case	F	4.2.0	4.3.0	T1-020337
TP-16	TP-020143	213		Interfrequency Measurement for Events 2B and 2E – Correction to 8.4.1.25	F	4.2.0	4.3.0	T1-020338
TP-16	TP-020143	214		Correction to HCS Cell Reseletion tests	F	4.2.0	4.3.0	T1-020339
TP-16	TP-020143	215		Changes to radio bearer tests in clause 14.4 Combinations on SCCPCH	F	4.2.0	4.3.0	T1-020340
TP-16	TP-020142	216		Section 8.3.1 Connection Mobility Procedure TDD	F	4.2.0	4.3.0	T1-020341
TP-16	TP-020143	217		Test case for approved new bearers	F	4.2.0	4.3.0	T1-020342
TP-16	TP-020142	218		Correction to clause 8.4 for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020343

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-16	TP-020142	219		Correction to clause 8.3 for Package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020344
TP-16	TP-020142	220		Correction to clause 8.1 for package 1 of TS34.123-1	F	4.2.0	4.3.0	T1-020345
TP-16	TP-020142	221		Corrections to GMM test cases	F	4.2.0	4.3.0	T1-020346
TP-16	TP-020142	222		Corrections to SM test cases	F	4.2.0	4.3.0	T1-020347
TP-16	TP-020143	223		CR to clause 3.1	F	4.2.0	4.3.0	T1-020348
TP-16	TP-020143	224		Correction to RLC conformance test 7.2.2.1	F	4.2.0	4.3.0	T1-020349
TP-16	TP-020142	225		Correction to RLC conformance test 7.2.2.3	F	4.2.0	4.3.0	T1-020350
TP-16	TP-020142	226		Correction to RLC conformance test 7.2.2.6	F	4.2.0	4.3.0	T1-020351
TP-16	TP-020142	227		Correction to RLC conformance test 7.2.2.7	F	4.2.0	4.3.0	T1-020352
TP-16	TP-020142	228		Correction to RLC conformance test 7.2.3.5	F	4.2.0	4.3.0	T1-020353
TP-16	TP-020142	229		Correction to RLC conformance test 7.2.3.13	F	4.2.0	4.3.0	T1-020354
TP-16	TP-020142	230		Correction to RLC conformance test 7.2.3.6	F	4.2.0	4.3.0	T1-020355
TP-16	TP-020142	231		Correction to RLC conformance test 7.2.3.12	F	4.2.0	4.3.0	T1-020356
TP-16	TP-020142	232		Correction to RLC conformance test 7.2.3.14	F	4.2.0	4.3.0	T1-020357
TP-16	TP-020142	233		Correction to RLC conformance test 7.2.3.16	F	4.2.0	4.3.0	T1-020358
TP-16	TP-020142	234		Correction to RLC conformance test 7.2.3.17	F	4.2.0	4.3.0	T1-020359
TP-16	TP-020142	235		Correction to RLC conformance test 7.2.3.19	F	4.2.0	4.3.0	T1-020360
TP-16	TP-020142	236		Correction to RLC conformance test 7.2.3.20	F	4.2.0	4.3.0	T1-020361
TP-16	TP-020142	237		Correction to RLC conformance test 7.2.3.23	F	4.2.0	4.3.0	T1-020362
TP-16	TP-020142	238		Correction to RLC conformance test 7.2.3.24	F	4.2.0	4.3.0	T1-020363
TP-16	TP-020142	239		Conformance test 7.2.3.15	F	4.2.0	4.3.0	T1-020364
TP-16	TP-020142	240		Clause 7.2.3.18 RLC test case	F	4.2.0	4.3.0	T1-020365
TP-16	TP-020143	241		Clause 7.2.3.29 RLC test case	F	4.2.0	4.3.0	T1-020366
TP-16	TP-020143	242		Clause 7.2.3.30 RLC test case	F	4.2.0	4.3.0	T1-020367
TP-16	TP-020143	243		Clause 7.2.3.31 RLC test case	F	4.2.0	4.3.0	T1-020368
TP-16	TP-020142	244		Correction to RLC conformance test 7.2.3.33	F	4.2.0	4.3.0	T1-020369
TP-16	TP-020143	245		Update of package 2: RB test cases according to new ref RB test method	F	4.2.0	4.3.0	T1-020414
TP-16	TP-020143	247		Update of clause 8.3.2 URA Update to be applicable to 3.84 Mcps TDD and 1.28 Mcps TDD	F	4.2.0	4.3.0	T1-020416
TP-16	TP-020143	248		New test for radio bearer	F	4.2.0	4.3.0	T1-020417
TP-16	TP-020143	249		Correction of conformance requirement in test case 11.1.4.3(34.123-1)	F	4.2.0	4.3.0	T1-020418
TP-16	TP-020143	250		Correction in test case 11.4.1 Error cases(34.123-1)	F	4.2.0	4.3.0	T1-020419
TP-16	TP-020142	251		Correction to MAC conformance test 7.1.1.2	F	4.2.0	4.3.0	T1-020410
TP-16	TP-020142	252		Correction to MAC conformance test 7.1.1.8	F	4.2.0	4.3.0	T1-020411
TP-16	TP-020142	253		Correction to RLC conformance test 7.2.3.34	F	4.2.0	4.3.0	T1-020412
TP-16	TP-020142	254		Correction to MAC conformance test 7.1.2.3.1	F	4.2.0	4.3.0	T1-020413
TP-16	TP-020164	255	1	Section 16.1.6 & 16.2.6: Addition of test of short message type 0 (CS/PS) Rel5	F	4.2.0	5.0.0	-
TP-16	TP-020145	256		Creation of 34.123-1 REL-5	F	4.2.0	5.0.0	T1-020404
				Correction of wrong heading in the specification	D	5.0.0	5.0.1	
TP-17	TP-020193	258	-	Corrections to Inter-frequency measurement test cases (8.4.1.24, 8.4.1.25, 8.4.1.26)	F	5.0.1	5.1.0	T1-020510
TP-17	TP-020193	259	-	Change to test case 8.4.1.31	F	5.0.1	5.1.0	T1-020511
TP-17	TP-020187	260	-	Corrections to clause 6.1.1.4 for Package 1 (Idle Mode)	F	5.0.1	5.1.0	T1-020512
TP-17	TP-020193	261	-	Corrections to clause 6.1.1.5 for Package 3 (Idle Mode)	F	5.0.1	5.1.0	T1-020513
TP-17	TP-020193	262	-	Corrections to clause 6.1.1.1 and 6.1.1.2 (Idle Mode)	F	5.0.1	5.1.0	T1-020514
TP-17	TP-020187	263	-	Addition of ITU Band 3 reference test frequencies to Table 6.3	F	5.0.1	5.1.0	T1-020515
TP-17	TP-020193	264	-	Correction to MAC clause 7.1.2.1	F	5.0.1	5.1.0	T1-020516
TP-17	TP-020187	265	-	Correction to MAC test cases 7.1.1.2 and 7.1.1.8	F	5.0.1	5.1.0	T1-020517
TP-17	TP-020187	266	-	Corrections to clause 7.2 for Package 1 test cases (RLC)	F	5.0.1	5.1.0	T1-020518
TP-17	TP-020187	267	-	Corrections to package1 test cases in clause 8.1 as T1S-020352rev1	F	5.0.1	5.1.0	T1-020519
TP-17	TP-020187	268	-	CR to package1 clause 8.2 of TS34.123-1	F	5.0.1	5.1.0	T1-020520
TP-17	TP-020187	269	-	Corrections to package 1 TCs in clause 8.4 of TS 34.123-1 as T1S-020355rev1	F	5.0.1	5.1.0	T1-020521
TP-17	TP-020187	270	-	Corrections to Clause 8.1.10 for Package 2 (System Information)	F	5.0.1	5.1.0	T1-020522
TP-17	TP-020187	271	-	Corrections to clause 8.3.7.1- 8.3.7.4 for Package 2 test cases (Inter System HO)	F	5.0.1	5.1.0	T1-020523
TP-17	TP-020193	272	-	Corrections to non-package1&2 clause 8.1	F	5.0.1	5.1.0	T1-020524
TP-17	TP-020193	273	-	CR to non-package1&2 clause 8.2 of TS34.123-1 (merging T1S-020469 and TC 8.2.6.21 and 8.2.6.22 of T1S-020407)	F	5.0.1	5.1.0	T1-020525

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-17	TP-020187	274	-	Corrections to clause 6 for Package 2 (Idle Mode)	F	5.0.1	5.1.0	T1-020528
TP-17	TP-020187	275	-	Correction of package 2 test case in clause 8.3.1.4, SS cell update waiting timer	F	5.0.1	5.1.0	T1-020531
TP-17	TP-020187	276	-	Corrections to package1 test cases in clause 8.3	F	5.0.1	5.1.0	T1-020532
TP-17	TP-020187	277	-	CR to package2 clause 8.2 of TS34.123-1	F	5.0.1	5.1.0	T1-020533
TP-17	TP-020193	278	-	Corrections to non-package 1&2 TCs in clause 8.3 of TS 34.123-1	F	5.0.1	5.1.0	T1-020534
TP-17	TP-020193	279	-	Corrections to non-package 1&2 TCs in clause 8.4 of TS 34.123-1 (merging T1S-020458 and T1S-020363)	F	5.0.1	5.1.0	T1-020535
TP-17	TP-020193	280	-	Additional test case for timing re-initialised inter-frequency handover	F	5.0.1	5.1.0	T1-020536
TP-17	TP-020193	281	-	Corrections to reference compressed mode pattern	F	5.0.1	5.1.0	T1-020537
TP-17	TP-020193	282	-	Introduction of test cases for additional reference configuration on S-CCPCH and PRACH	F	5.0.1	5.1.0	T1-020542
TP-17	TP-020193	283	-	Removal of test cases for unidirectional streaming CS RABs above 64 kbps	F	5.0.1	5.1.0	T1-020543
TP-17	TP-020187	284	-	Clarification of package 1 and 2 RB test cases.	F	5.0.1	5.1.0	T1-020545
TP-17	TP-020187	285	-	Details of radio bearer tests in clause '14.4 Combinations on SCCPCH' and '14.5 Combinations on PRACH'	F	5.0.1	5.1.0	T1-020546
TP-17	TP-020193	286	-	Corrections to package 3 RB test cases 14.2.43.1, 14.2.49.1 and 14.2.51.1.	F	5.0.1	5.1.0	T1-020547
TP-17	TP-020193	287	-	Addition of details for package 3 RB test cases	F	5.0.1	5.1.0	T1-020548
TP-17	TP-020193	288	-	Corrections to package 3 RB test cases 14.2.5a and 14.2.7a.	F	5.0.1	5.1.0	T1-020549
TP-17	TP-020193	289	-	Update of radio bearer test cases as per new RB test method	F	5.0.1	5.1.0	T1-020550
TP-17	TP-020193	290	-	Correction for test case 14.2.38.2	F	5.0.1	5.1.0	T1-020551
TP-17	TP-020193	291	-	Interactive or background / UL:32 DL:32 kbps / PS RAB + UL:3.4 DL:3.4 kbps SRBs for DCCH (40ms TTI).	F	5.0.1	5.1.0	T1-020552
TP-17	TP-020193	292	-	New Tests for Radio Bearers 14.2.38d and 14.2.57.	F	5.0.1	5.1.0	T1-020553
TP-17	TP-020193	293	-	New tests for radio bearers 23a, 38a, 38b, 38e, 51a & 51b	F	5.0.1	5.1.0	T1-020554
TP-17	TP-020194	294	-	Clause 8, editorial changes to table format	D	5.0.1	5.1.0	T1-020555
TP-17	TP-020187	295	-	Corrections and modifications to clause 9 of Package 2 test cases (MM)	F	5.0.1	5.1.0	T1-020556
TP-17	TP-020187	296	-	Corrections to package 2 test cases in clause 8.3 (T1S-020494rev1)	F	5.0.1	5.1.0	T1-020557
TP-17	TP-020187	297	-	Corrections to package 2 TCs in clause 8.4 of TS 34.123-1 (T1S-020495rev1)	F	5.0.1	5.1.0	T1-020558
TP-17	TP-020193	298	-	Additional test cases in clause 8 of TS34.123-1 as T1S-020365rev1	F	5.0.1	5.1.0	T1-020559
TP-17	TP-020187	299	-	Update of Conformance requirement in test case 11.1.1.1	F	5.0.1	5.1.0	T1-020560
TP-17	TP-020193	300	-	Minor corrections and editorial modifications in clause 11.2 PDP context modification procedure	F	5.0.1	5.1.0	T1-020561
TP-17	TP-020193	301	-	Addition of ICS/IXIT statement in Secondary PDP context activation procedures	F	5.0.1	5.1.0	T1-020563
TP-17	TP-020193	302	-	Editorial corrections in test case 11.2.3.1.	F	5.0.1	5.1.0	T1-020564
TP-17	TP-020193	303	-	Test case 11.1.2: Correction in "Test procedure"	F	5.0.1	5.1.0	T1-020565
TP-17	TP-020187	304	-	Modifications and corrections of GMM test case	F	5.0.1	5.1.0	T1-020566
TP-17	TP-020193	305	-	Corrections to SMS test cases in clause 16.	F	5.0.1	5.1.0	T1-020567
TP-17	TP-020187	306	-	Clarifications in PDP Context deactivation test cases (revision of T1S020450)	F	5.0.1	5.1.0	T1-020568
TP-17	TP-020193	307	-	Update of clause 8.3 for TDD mode	F	5.0.1	5.1.0	T1-020579
TP-17	TP-020193	308	-	New tests for radio bearers 38c, 56 and 58	F	5.0.1	5.1.0	T1-020584
TP-17	TP-020193	309	-	CR to section 16.1.6 & 16.2.6: Addition of test of short message type 0 (CS/PS) R99 and REL-4	F	5.0.1	5.1.0	T1-020608
				Removal of revision marks and rename of history annex to 'annex D'		5.1.0	5.1.1	
TP-18	TP-020296	310	-	Correction to package 1 test case 7.2.3.22	F	5.1.1	5.2.0	T1-020659
TP-18	TP-020296	311	-	Correction to package 1 test case 7.2.3.23	F	5.1.1	5.2.0	T1-020660
TP-18	TP-020297	312	-	Update to Broadcast of System Information in test case 8.1.10	F	5.1.1	5.2.0	T1-020662
TP-18	TP-020297	313	-	Correction of package 2 test case for Inter System HO	F	5.1.1	5.2.0	T1-020663
TP-18	TP-020296	314	-	Corrections to generic setup procedure for radio bearer testing	F	5.1.1	5.2.0	T1-020664
TP-18	TP-020299	315	-	Addition of Integrity protection test case	F	5.1.1	5.2.0	T1-020666
TP-18	TP-020297	316	-	Corrections to package 2 MM test case 9.4.4	F	5.1.1	5.2.0	T1-020667

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-18	TP-020296	317	-	Correction of package 1 test case 8.1.1.7	F	5.1.1	5.2.0	T1-020668
TP-18	TP-020299	318	-	Introduction of a new test case for the integrity protection of NAS signalling message	F	5.1.1	5.2.0	T1-020669
TP-18	TP-020296	319	-	Modifications to package 1 RLC Test Cases	F	5.1.1	5.2.0	T1-020685
TP-18	TP-020298	320	-	Corrections to title of radio bearer test cases 14.4.2a.1, 14.4.2a.2 and 14.4.2a.3	F	5.1.1	5.2.0	T1-020688
TP-18	TP-020296	321	-	Corrections to MAC Package 1 test cases 7.1.1.2, 7.1.1.3, 7.1.1.4,7.1.1.5 and 7.1.1.8	F	5.1.1	5.2.0	T1-020689
TP-18	TP-020299	322	-	Introduction of a new test case for the integrity protection of NAS signalling message	F	5.1.1	5.2.0	T1-020690
TP-18	TP-020296	323	-	General corrections for clause 6	F	5.1.1	5.2.0	T1-020691
TP-18	TP-020299	324	-	Addition of cell reselection test case to verify use of cell status and cell reservations	F	5.1.1	5.2.0	T1-020692
TP-18	TP-020297	325	-	Correction of package 2 test case on measurements (revision of T1S-020568)	F	5.1.1	5.2.0	T1-020697
TP-18	TP-020298	326	-	Correction of test case for timing re-initialised inter-frequency handover (revision of T1S-020569)	F	5.1.1	5.2.0	T1-020698
TP-18	TP-020298	327	-	Corrections to test cases 8.3.1.23, 8.3.1.24 and 8.3.2.13 (HCS Reselection)	F	5.1.1	5.2.0	T1-020699
TP-18	TP-020299	328	-	Correction to test case 9.3.2 Handling of IMSI shorter than the maximum length	F	5.1.1	5.2.0	T1-020700
TP-18	TP-020299	329	-	Correction to MM test 9.5.7.2	F	5.1.1	5.2.0	T1-020701
TP-18	TP-020299	330	-	Correction to the title of sub-clause 14.2.51b.2	F	5.1.1	5.2.0	T1-020703
TP-18	TP-020296	331	-	Correction to RLC P1 7.2.3.12 Correct use of Sequence Numbering	F	5.1.1	5.2.0	T1-020704
TP-18	TP-020296	332	-	Correction to package 1 test case 7.2.3.13 and 7.2.3.14	F	5.1.1	5.2.0	T1-020705
TP-18	TP-020296	333	-	Correction to P1 TC8.1.9 SIGNALLING CONNECTION RELEASE INDICATION test case as T1S020674rev1	F	5.1.1	5.2.0	T1-020706
TP-18	TP-020296	334	-	Corrections to package 1 & 2 idle mode test cases	F	5.1.1	5.2.0	T1-020707
TP-18	TP-020296	335	-	Correction to Package 1 test cases (revision of T1S-020677)	F	5.1.1	5.2.0	T1-020710
TP-18	TP-020297	336	-	Correction to cell configuration	F	5.1.1	5.2.0	T1-020713
TP-18	TP-020296	337	-	Clause 8.1 (Package 1) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020784
TP-18	TP-020296	338	-	CR to Package 1 TC 8.4.1.1: Correction from CRs approved in RP17meeting and T1S020726/727 (revision to T1S020750, T1S020856)	F	5.1.1	5.2.0	T1-020786
TP-18	TP-020296	339	-	Clause 8.2 (Package 1) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020787
TP-18	TP-020296	340	-	Clause 8.3 (Package 1) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020788
TP-18	TP-020296	341	-	Clause 8.3 (Package 1) Rel-5: Correction from CRs approved in RP17meeting (Revision to T1S020737)	F	5.1.1	5.2.0	T1-020789
TP-18	TP-020296	342	-	Update to clause 10 Circuit Switched Call Control tests as revision of T1S-020584	F	5.1.1	5.2.0	T1-020790
TP-18	TP-020296	343	-	Editorial corrections in test cases 11.1.1.1, 11.3.2 (Package 1) and 11.1.1.2.1 (Package 3).	F	5.1.1	5.2.0	T1-020792
TP-18	TP-020296	344	-	Extension of "Test purpose" in test case 11.3.1 (Package 1 test case).	F	5.1.1	5.2.0	T1-020793
TP-18	TP-020296	345	-	Modifications and corrections of GMM test cases	F	5.1.1	5.2.0	T1-020794
TP-18	TP-020297	346	-	Update to test cases 6.1.1.2, 6.1.1.5, 6.2.1.5 and 6.2.1.9, removal of test case 6.1.1.6	F	5.1.1	5.2.0	T1-020795
TP-18	TP-020297	347	-	Cell re-selection within RRC package 2 test case 8.2.2.18 on radio bearer reconfiguration (as T1S-020822rev1)	F	5.1.1	5.2.0	T1-020804
TP-18	TP-020297	348	-	Specification of package 2 TC 8.2.2.11 Unsupported UE configuration (as T1S-020773rev1)	F	5.1.1	5.2.0	T1-020805
TP-18	TP-020297	349	-	Corrections to package 2 test case 8.3.1.9 regarding timers	F	5.1.1	5.2.0	T1-020806
TP-18	TP-020297	350	-	Update to package 2 RRC test case 8.3.2.1 to use two cells	F	5.1.1	5.2.0	T1-020807
TP-18	TP-020297	351	-	Removal of the IE 'New U-RNTI' in package 2 RRC test case 8.2.2.1	F	5.1.1	5.2.0	T1-020808
TP-18	TP-020297	352	-	Correction non-existing periodic RLC status timer value in package 2 and low priority RRC test cases	F	5.1.1	5.2.0	T1-020809
TP-18	TP-020297	353	-	Correction to Package 2 RRC test cases (T1S020729rev1, T1S020808rev1, T1S020825rev1, T1S020833rev1)	F	5.1.1	5.2.0	T1-020810
TP-18	TP-020297	354	-	Clause 8.2 (Package 2) Rel-5: Correction from CRs approved in RP17meeting (revision of T1S-020738)	F	5.1.1	5.2.0	T1-020811

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-18	TP-020297	355	-	Clause 8.3 (Package 2) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020812
TP-18	TP-020297	356	-	Corrections to Clause 8.4 Measurement Test Cases	F	5.1.1	5.2.0	T1-020813
TP-18	TP-020297	357	-	Update of Test procedure in test case 9.4.2.5 (Package 2)	F	5.1.1	5.2.0	T1-020814
TP-18	TP-020297	358	-	Clause 8.4 (Package 2) Rel-5: Correction from CRs approved in RP17meeting (revision to T1S020740)	F	5.1.1	5.2.0	T1-020816
TP-18	TP-020298	359	-	Corrections to package 3 idle mode test cases	F	5.1.1	5.2.0	T1-020820
TP-18	TP-020298	360	-	Corrections to package 3 RRC 8_1_x (Connection mgmt) as revision of T1S-020778.	F	5.1.1	5.2.0	T1-020821
TP-18	TP-020298	361	-	Corrections to package 3 RRC 8_2_x (Radio Bearer procedure) as revision of T1S-020779.	F	5.1.1	5.2.0	T1-020822
TP-18	TP-020298	362	-	Corrections to package 3 RRC 8_3_x (Connection mobility procedure) as revision of T1S-020780.	F	5.1.1	5.2.0	T1-020823
TP-18	TP-020298	363	-	Corrections to package 3 Inter-RAT measurement test cases	F	5.1.1	5.2.0	T1-020824
TP-18	TP-020296	364	-	Update to TC7.2.3.19(RLC PDU Continuous Transmission)	F	5.1.1	5.2.0	T1-020714
TP-18	TP-020299	365	-	Addition of test cases for RBs for conversational/speech service based on TS 34.108	F	5.1.1	5.2.0	T1-020676
TP-18	TP-020299	366	-	Addition of test cases for RBs for conversational/unknown service based on TS 34.108	F	5.1.1	5.2.0	T1-020677
TP-18	TP-020299	367	-	Editorial correction and update for the existed RB test cases	F	5.1.1	5.2.0	T1-020678
TP-18	TP-020298	368	-	Corrections and updates for Idle mode TCs (TDD) in a pure 3GPP environment	F	5.1.1	5.2.0	T1-020695
TP-18	TP-020297	369	-	Corrections and updates for Idle mode TCs (TDD) in a 2G/3G environment	F	5.1.1	5.2.0	T1-020696
TP-18	TP-020296	370	-	Corrections to 8.1.2 RRC Connection Establishment and 8.1.3 RRC Connection Release, TDD tests	F	5.1.1	5.2.0	T1-020825
TP-18	TP-020298	371	-	New TDD test cases for 8.2.1 Radio Bearer Establishment and 8.2.2 Radio Bearer Reconfiguration.	F	5.1.1	5.2.0	T1-020826
TP-18	TP-020299	372	-	Addition of test cases for RBs for symmetric streaming/unknown service based on TS 34.108	F	5.1.1	5.2.0	T1-020828
TP-18	TP-020299	373	-	Addition of test cases of for RBs for asymmetric atreaming/unknown service based on TS 34.108	F	5.1.1	5.2.0	T1-020829
TP-18	TP-020299	374	-	Addition of some test cases of for RBs for interactive/background service based on TS 34.108	F	5.1.1	5.2.0	T1-020830
TP-18	TP-020299	375	-	Correction of General information for radio bearer tests (1.28 Mcps TDD)	F	5.1.1	5.2.0	T1-020831
TP-18	TP-020299	376	-	Idle mode test cases	F	5.1.1	5.2.0	T1-020833
TP-18	TP-020299	377	-	Correction to TC8.1.6.3 Measurement Report on INITIAL DIRECT TRANSFER message and UPLINK DIRECT TRANSFER message	F	5.1.1	5.2.0	T1-020834
TP-18	TP-020298	378	-	Correction to non-package 1&2 RRC test cases	F	5.1.1	5.2.0	T1-020836
TP-18	TP-020298	379	-	Clause 8.1 (Non-package1&2) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020837
TP-18	TP-020298	380	-	Clause 8.4 (Non-package 1&2) Rel-5: Correction from CRs approved in RP17meeting	F	5.1.1	5.2.0	T1-020838
TP-18	TP-020298	381	-	Corrections to package 3 Measurement test cases as revision of T1S-020781.	F	5.1.1	5.2.0	T1-020864
TP-18	TP-020296	382	-	Corrections to radio bearer test cases in clause 14.2	F	5.1.1	5.2.0	T1-020840
TP-18	TP-020299	383	-	Conversational / speech / UL:(12.2 7.95 5.9 4.75) DL(12.2 7.95 5.9 4.75) kbps / CS RAB + Conversational / unknown / UL:64 DL:64 kbps / CS RAB+ UL:3.4 DL: 3.4 kbps SRBs for DCCH	F	5.1.1	5.2.0	T1-020842
TP-18	TP-020298	384	-	Correction to package 3 MM test case 9.4.7	F	5.1.1	5.2.0	T1-020845
TP-18	TP-020298	385	-	Correction to package 3 SM test case 11.1.1.2.1	F	5.1.1	5.2.0	T1-020846
TP-18	TP-020298	386	-	Correction to package 3 test case 16.1.2 SMS mobile originated	F	5.1.1	5.2.0	T1-020847
TP-18	TP-020298	387	-	Correction to package 3 test case 16.1.9 Multiple SMS mobile originated	F	5.1.1	5.2.0	T1-020848
TP-18	TP-020298	388	-	Correction to package 3 test case 16.2.1 SMS mobile terminated	F	5.1.1	5.2.0	T1-020849
TP-18	TP-020298	389	-	Correction to package 3 test case 16.2.2 SMS mobile originated	F	5.1.1	5.2.0	T1-020850
TP-18	TP-020299	390	-	Update of Conformance requirement in test case 11.3.3.1 (low priority test case)	F	5.1.1	5.2.0	T1-020851
TP-18	TP-020299	391	-	Updated PDCP conformance test cases, clause 7.3	F	5.1.1	5.2.0	T1-020852

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-18	TP-020298	392	-	Test case for alternative RAB configuration agreed during T1/SIG #25	F	5.1.1	5.2.0	T1-020853
TP-18	TP-020298	393	-	Update to clause 13 Emergency call tests as revision of T1S-020759rev1	F	5.1.1	5.2.0	T1-020854
TP-18	TP-020299	394	-	Corrections to GCF 'low priority' SMS test cases in 34.123-1, clause 16	F	5.1.1	5.2.0	T1-020857
TP-18	TP-020298	395	-	Correction to package 3 test case 16.2.10 Test of capabilities of simultaneously receiving an SM whilst sending an MO SM (as of T1S-020751rev1)	F	5.1.1	5.2.0	T1-020859
TP-18	TP-020298	396	-	Correction to package 3 test case 16.1.10 Test of capabilities of simultaneously receiving an SM whilst sending an MO SM (as of T1S-020797rev1)	F	5.1.1	5.2.0	T1-020860
TP-18	TP-020299	397	-	New GMM test cases for Service Request with Re-establishment of RABs (as of T1S-020829rev1)	F	5.1.1	5.2.0	T1-020861
TP-18	TP-020299	398	-	Proposed new test case on additional measurements lis.t. As revision of T1S-020783.	F	5.1.1	5.2.0	T1-020862
TP-18	TP-020298	399	-	Addition of new test case for RRC Connection Release following network authentication failure requested by upper layers	F	5.1.1	5.2.0	T1-020863
TP-18	TP-020299	400	-	Clarification of expected sequence in test case 11.2.3.2 (low priority test case).	F	5.1.1	5.2.0	T1-020866
TP-18	TP-020298	401	-	Clause 8.2 (Non-package 1&2) Rel-5: Correction from CRs approved in RP17meeting (T1S020742rev1)	F	5.1.1	5.2.0	T1-020867
TP-18	TP-020299	402	-	Addition of test case for multi- RAB configurations	F	5.1.1	5.2.0	T1-020868
TP-18	TP-020299	403	-	Addition of test case for compressed mode	F	5.1.1	5.2.0	T1-020869
TP-18	TP-020299	404	-	CR to section 16.1.6a & 16.2.6a: Correction of Related ICS/IXIT Statements	F	5.1.1	5.2.0	T1-020855
TP-18	TP-020299	405	-	Interactive or background / UL:32 DL:32kbps / PS RAB (20 ms TTI) + UL:3.4 DL:3.4 kbps SRBs for DCCH	F	5.1.1	5.2.0	T1-020841
TP-18	TP-020298	406	-	Correction to package 3 test case 16.1.1 SMS mobile terminated (as of T1S-020791rev1)	F	5.1.1	5.2.0	T1-020858
TP-18	TP-020299	407	-	Proposed new test case in clause 8.2.6 as revision of T1S-020784.	F	5.1.1	5.2.0	T1-020870
TP-19	TP-030049	408	-	Corrections to GMM Package 1 test cases as T1S030012rev1	F	5.2.0	5.3.0	T1-030032
TP-19	TP-030048	409	-	Clause 8.3.1.1 Cell Update: cell reselection in CELL_FACH(Package1) as T1S0300015rev1	F	5.2.0	5.3.0	T1-030033
TP-19	TP-030047	410	-	Clause 7.2.3.24 Polling for status / Operation of timer Timer_Poll_Prohibit (Package 1)	F	5.2.0	5.3.0	T1-030034
TP-19	TP-030049	411	-	on Correction to package 4 GMM test case 12.6.1.3.3 Authentication Rejected by the UE / fraudulent network	F	5.2.0	5.3.0	T1-030038
TP-19	TP-030047	412	-	Corrections to package 4 idle mode test case 6.1.2.9	F	5.2.0	5.3.0	T1-030064
TP-19	TP-030047	413	-	Alignement of cell numbering for inter-RAT idle mode test case	F	5.2.0	5.3.0	T1-030065
TP-19	TP-030047	414	-	Correction to package 1 RLC test case 7.2.3.18	F	5.2.0	5.3.0	T1-030066
TP-19	TP-030047	415	-	Correction to low prio RLC test cases 7.2.2.11, 7.2.3.31 and 7.2.3.32	F	5.2.0	5.3.0	T1-030067
TP-19	TP-030047	416	-	Clause 7.2.3.21 Polling for status / Operation of Timer_Poll timer / Timer expiry (Package 1)	F	5.2.0	5.3.0	T1-030068
TP-19	TP-030047	417	-	Correction to low prio PDCP test cases 7.3.2.1.2, 7.3.2.2.2, 7.3.2.2.4 and 7.3.2.2.5	F	5.2.0	5.3.0	T1-030069
TP-19	TP-030048	418	-	Correction to package 1 RRC Test Case 8.1.1.1	F	5.2.0	5.3.0	T1-030070
TP-19	TP-030048	419	-	Correction to TS 34.123-1 Package1; Radio Bearer Establishment procedure	F	5.2.0	5.3.0	T1-030071
TP-19	TP-030048	420	-	Corrections to Package 1 RRC test cases	F	5.2.0	5.3.0	T1-030072
TP-19	TP-030048	421	-	Corrections to Package 2 RRC test cases	F	5.2.0	5.3.0	T1-030073
TP-19	TP-030048	422	-	Update to test cases 8.2.4.3 and 8.2.4.4(Package 2)	F	5.2.0	5.3.0	T1-030074
TP-19	TP-030048	423	-	Corrections to Early UE Specific Information in RRC Connection Request (Package 1)	F	5.2.0	5.3.0	T1-030075
TP-19	TP-030048	424	-	Corrections to package 2 test case 8.1.10.1	F	5.2.0	5.3.0	T1-030076
TP-19	TP-030048	425	-	Corrections to package 3 RRC test case 8.4.1.40	F	5.2.0	5.3.0	T1-030077
TP-19	TP-030048	426	-	Corrections to package 4 test cases on Inter system handover	F	5.2.0	5.3.0	T1-030078
TP-19	TP-030048	427	-	Corrections to package 4 test cases on RRC Direct transfer	F	5.2.0	5.3.0	T1-030079
TP-19	TP-030048	428	-	Correction to package 1 RRC Test Case 8.1.1.7	F	5.2.0	5.3.0	T1-030080
TP-19	TP-030048	429	-	Corrections to package 4 test cases on RRC connection establishment and release	F	5.2.0	5.3.0	T1-030081

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-19	TP-030048	430	-	Corrections to package 4 test cases on Physical Channel Reconfiguration	F	5.2.0	5.3.0	T1-030082
TP-19	TP-030048	431	-	Corrections to package 4 test cases on RB establishment	F	5.2.0	5.3.0	T1-030083
TP-19	TP-030048	432	-	Corrections to package 4 test cases on TrCH reconfiguration	F	5.2.0	5.3.0	T1-030084
TP-19	TP-030048	433	-	Corrections to package 4 test cases on RRC Connection mobility	F	5.2.0	5.3.0	T1-030085
TP-19	TP-030048	434	-	New test cases for security	F	5.2.0	5.3.0	T1-030086
TP-19	TP-030048	435	-	Removal of low priority RRC test cases with state transition	F	5.2.0	5.3.0	T1-030087
TP-19	TP-030048	436	-	Corrections to clause 8.2.2.20	F	5.2.0	5.3.0	T1-030088
TP-19	TP-030048	437	-	Addition of re-run statements when it is failed in cell reselection	F	5.2.0	5.3.0	T1-030089
TP-19	TP-030048	438	-	Corrections to package 4 test cases on RB release	F	5.2.0	5.3.0	T1-030090
TP-19	TP-030048	439	-	Corrections to package 4 test cases on RB reconfiguration	F	5.2.0	5.3.0	T1-030091
TP-19	TP-030048	440	-	Corrections to package 4 test cases on Measurements	F	5.2.0	5.3.0	T1-030092
TP-19	TP-030048	441	-	Corrections to Low Priority RRC test cases	F	5.2.0	5.3.0	T1-030093
TP-19	TP-030048	442	-	Correction to clause 8.1.6.4 and 8.1.9a/b as T1S-020628rev1	F	5.2.0	5.3.0	T1-030094
TP-19	TP-030049	443	-	Corrections to package 4 test cases on CC	F	5.2.0	5.3.0	T1-030095
TP-19	TP-030049	444	-	Correction to Tables 10.1.3/2 and 10.1.3/4	F	5.2.0	5.3.0	T1-030096
TP-19	TP-030049	445	-	Corrections to package 4 test cases on MM	F	5.2.0	5.3.0	T1-030097
TP-19	TP-030049	446	-	Correction to low priority TC 12.4.3.2 Periodic routing area updating / accepted / T3312 default value	F	5.2.0	5.3.0	T1-030098
TP-19	TP-030049	447	-	Introduction of a new test case for a PSdetach procedure with the cause "PS services not allowed in this PLMN"	F	5.2.0	5.3.0	T1-030099
TP-19	TP-030049	448	-	Corrections to package 4 test cases on GMM as T1S030221rev1	F	5.2.0	5.3.0	T1-030100
TP-19	TP-030049	449	-	Corrections to package 1 GMM Test Cases	F	5.2.0	5.3.0	T1-030101
TP-19	TP-030049	450	-	Corrections to package 4 GMM test cases on RAB re-establishment	F	5.2.0	5.3.0	T1-030102
TP-19	TP-030048	451	-	Corrections to package 4 test cases on RRC Security	F	5.2.0	5.3.0	T1-030103
TP-19	TP-030049	452	-	Correction to Low Prio SM test case 11.2.3.2	F	5.2.0	5.3.0	T1-030104
TP-19	TP-030049	453	-	Maintenance of low priority test case 11.1.2 PDP context activation requested by the network, successful and unsuccessful	F	5.2.0	5.3.0	T1-030105
TP-19	TP-030049	454	-	Correction to package 3 test case 16.1.2 SMS mobile originated	F	5.2.0	5.3.0	T1-030106
TP-19	TP-030047	455	-	Corrections to generic setup procedure for radio bearer testing	F	5.2.0	5.3.0	T1-030108
TP-19	TP-030047	456	-	Corrections to add minimum set of TFCIs to package 1 RB test cases	F	5.2.0	5.3.0	T1-030109
TP-19	TP-030047	457	-	Corrections to add minimum set of TFCIs to package 2 RB test cases	F	5.2.0	5.3.0	T1-030110
TP-19	TP-030047	458	-	Corrections to add minimum set of TFCIs to package 3 RB test cases	F	5.2.0	5.3.0	T1-030111
TP-19	TP-030047	459	-	Generic procedure for radio bearer testing using the DSCH	F	5.2.0	5.3.0	T1-030112
TP-19	TP-030047	460	-	Prose for the MultiRAB DSCH Radio bearers test cases	F	5.2.0	5.3.0	T1-030113
TP-19	TP-030049	461	-	Update of Conformance requirement and Expected sequence in test case 11.1.1.2.1 (Package 3) as T1S030104rev1	F	5.2.0	5.3.0	T1-030114
TP-19	TP-030049	462	-	Update of Conformance requirement and Expected sequence in test case 11.1.1.2.2 (Package 4) as T1S030105rev1	F	5.2.0	5.3.0	T1-030115
TP-19	TP-030047	463	-	Inclusion of new test cases for intrafrequency Measurement Control and Report TDD	F	5.2.0	5.3.0	T1-030211
TP-19	TP-030047	464	-	Inclusion of test case for events 1H and 1I (TDD)	F	5.2.0	5.3.0	T1-030212
TP-19	TP-030047	465	-	Addition of test cases for RBs for Interactive or background service based on 34.108	F	5.2.0	5.3.0	T1-030214
TP-19	TP-030047	466	-	Addition of test cases for RBs for conversational/speech and interactive or background service based on 34.108	F	5.2.0	5.3.0	T1-030215
TP-19	TP-030047	467	-	Addition of test cases for RBs for conversational/speech and streaming/unknown or	F	5.2.0	5.3.0	T1-030216

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				conversational/Unknown service based on 34.108				
TP-19	TP-030047	468	-	Addition of test cases for RBs for conversational/unknown and Interactive or background service based on 34.108	F	5.2.0	5.3.0	T1-030217
TP-19	TP-030047	469	-	Addition of test case for RB for Interactive or/background and streaming/unknown service and test case for RB for combinations on S-CCPCH based on 34.108	F	5.2.0	5.3.0	T1-030218
TP-19	TP-030049	470	-	Correction to GMM Package 2 test cases	F	5.2.0	5.3.0	T1-030236
TP-19	TP-030048	471	-	Correction to package 1 RRC Test Case 8.1.2.7	F	5.2.0	5.3.0	T1-030242
TP-20	TP-030102	472	-	Measurement Control and Report: Inter-frequency measurement for transitions (TDD)	F	5.3.0	5.4.0	T1-030510
TP-20	TP-030102	473	-	Corrections of Measurement Control and Report: Intra-frequency measurement for transitions (TDD)	F	5.3.0	5.4.0	T1-030511
TP-20	TP-030102	474	-	Update of Broadcast of system information test for TDD mode	F	5.3.0	5.4.0	T1-030512
TP-20	TP-030101	475	-	Measurement Control and Report: Cell forbidden to affect reporting range (FDD only)	F	5.3.0	5.4.0	T1-030513
TP-20	TP-030102	476	-	Measurement Control and Report: Traffic volume measurement for transitions, TDD update	F	5.3.0	5.4.0	T1-030514
TP-20	TP-030109	477	-	Correction to low prio RLC test case 7.2.3.32	F	5.3.0	5.4.0	T1-030519
TP-20	TP-030109	478	-	Correction to package 1 RLC test case 7.2.3.33	F	5.3.0	5.4.0	T1-030520
TP-20	TP-030109	479	-	Removal of RAB test cases associated with recently void RABs in 34.108	F	5.3.0	5.4.0	T1-030521
TP-20	TP-030102	480	-	Corrections to Package 3 RRC test cases (clause 8.1)	F	5.3.0	5.4.0	T1-030527
TP-20	TP-030102	481	-	Corrections to Package 4 RRC test cases (clause 8.2)	F	5.3.0	5.4.0	T1-030528
TP-20	TP-030109	482	-	Introduction of a new test case 9.2.5 Authentication Rejected by the UE / fraudulent network	F	5.3.0	5.4.0	T1-030529
TP-20	TP-030109	483	-	Correction to TC 9.3.2	F	5.3.0	5.4.0	T1-030533
TP-20	TP-030101	484	-	Update to clause 8 conformance requirements according to 25.331 CR1829 and CR1835 approved in RAN#19.	F	5.3.0	5.4.0	T1-030544
TP-20	TP-030102	485	-	Removal of package 4 and low priority redundant RRC Reconfiguration failure cases	F	5.3.0	5.4.0	T1-030546
TP-20	TP-030101	486	-	Usage of downlink CCCH vs DCCH for CELL UPDATE CONFIRM and URA UPDATE CONFIRM RRC messages	F	5.3.0	5.4.0	T1-030547
TP-20	TP-030102	487	-	Correction to package 4 RRC test case 8.2.1.4 according to 25.331 CR 1820	F	5.3.0	5.4.0	T1-030548
TP-20	TP-030101	488	-	Correction of RRC test cases according to 25331 CR1823	F	5.3.0	5.4.0	T1-030549
TP-20	TP-030102	489	-	Corrections to Package 3 RRC test cases (clause 8.3)	F	5.3.0	5.4.0	T1-030560
TP-20	TP-030102	490	-	Corrections to low priority RRC test cases (clause 8.2)	F	5.3.0	5.4.0	T1-030562
TP-20	TP-030102	491	-	Corrections to low priority RRC test cases (clause 8.3)	F	5.3.0	5.4.0	T1-030563
TP-20	TP-030101	492	-	Correction of RRC test cases according to 25331 CR1847	F	5.3.0	5.4.0	T1-030633
TP-20	TP-030102	493	-	Correction of package 4 RRC test cases 8.4.1.42 and 8.4.1.43 according to 25.331 CR1838	F	5.3.0	5.4.0	T1-030634
TP-20	TP-030109	494	-	Corrections to package 3 SMS test cases 16.1.9.1 and 16.1.9.2 (Multiple SMS mobile originated)	F	5.3.0	5.4.0	T1-030636
TP-20	TP-030101	496	-	Corrections to Package 2 RRC test case 8.4.1.7 (revision of T1-030646)	F	5.3.0	5.4.0	T1-030652
TP-20	TP-030101	497	-	Corrections to Package 2 RRC test cases (clause 8.4) (revision to T1-030559)	F	5.3.0	5.4.0	T1-030653
TP-20	TP-030102	498	-	Corrections to Package 3 RRC test cases (clause 8.4) (revision to T1-030561)	F	5.3.0	5.4.0	T1-030663
TP-20	TP-030101	499	-	Corrections to Package 2 RRC test cases 8.3.1.5 and 8.3.1.6	F	5.3.0	5.4.0	T1-030666
TP-20	TP-030109	500	-	Corrections to GMM P4 test case 12.9.6	F	5.3.0	5.4.0	T1-030668
TP-20	TP-030109	501	-	Modifications and corrections for GMM test cases	F	5.3.0	5.4.0	T1-030675
TP-20	TP-030101	502	-	Correction to Package 1 RRC test case 8.1.1.7 (Revision of T1-030570)	F	5.3.0	5.4.0	T1-030676
TP-20	TP-030109	503	-	Correction to package 2 idle mode test cases 6.2.1.7 and 6.2.1.8	F	5.3.0	5.4.0	T1-030683
TP-20	TP-030109	504	-	Correction to low priority idle mode test cases	F	5.3.0	5.4.0	T1-030684

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				6.2.1.3 and 6.2.1.4				
TP-20	TP-030101	505	-	Corrections to Package 2 RRC test cases (clause 8.2) [revision to T1-030477]	F	5.3.0	5.4.0	T1-030690
TP-20	TP-030101	506	-	Corrections to Package 2 RRC test cases (clause 8.3) [revision to T1-030558]	F	5.3.0	5.4.0	T1-030694
TP-20	TP-030101	507	-	Correction to package 1 RRC test case 8.1.1.4	F	5.3.0	5.4.0	T1-030695
TP-20	TP-030101	508	-	Corrections to TC 8.3.2.3 (T1-030434rev1, T1-030481rev1)	F	5.3.0	5.4.0	T1-030696
TP-20	TP-030101	509	-	Corrections to Package 1 RRC test cases (clause 8.3)	F	5.3.0	5.4.0	T1-030697
TP-20	TP-030102	510	-	Corrections to low priority RRC test cases (clause 8.1) [revision to T1-030478]	F	5.3.0	5.4.0	T1-030702
TP-20	TP-030101	511	-	Correction of IE 'Measurement Command' from 'Modify' to 'Setup' for TVM [revision to T1-030566]	F	5.3.0	5.4.0	T1-030704
TP-20	TP-030102	512	-	Removal of low-priority RRC test case 8.4.1.20 and 8.4.1.21	F	5.3.0	5.4.0	T1-030705
TP-20	TP-030102	513	-	Corrections to low priority test case 8.4.1.9 (Measurement)	F	5.3.0	5.4.0	T1-030706
TP-20	TP-030102	514	-	Corrections to low priority test case 8.1.6.3.	F	5.3.0	5.4.0	T1-030707
TP-20	TP-030102	515	-	Corrections to low priority test case 8.1.9a	F	5.3.0	5.4.0	T1-030708
TP-20	TP-030109	516	-	Correction to low priority test cases 9.4.3.2, 9.4.3.3 and 9.4.3.4 (Revision of T1-030572)	F	5.3.0	5.4.0	T1-030710
TP-20	TP-030102	517	-	URA identity for transition from CELL_FACH to URA_PCH	F	5.3.0	5.4.0	T1-030712
TP-20	TP-030109	518	-	Corrections to package 4 GMM test cases 12.4.1.4c and 12.4.1.4.d	F	5.3.0	5.4.0	T1-030713
TP-20	TP-030109	519	-	Modifications and corrections of GMM test case	F	5.3.0	5.4.0	T1-030717
TP-20	TP-030109	520	-	Correction to low priority test cases 14.2.34.1, 14.2.45, 14.2.46, 14.2.54 and to sections 14.1.1 and 14.1.2 (Revision of T1-030573)	F	5.3.0	5.4.0	T1-030718
TP-20	TP-030102	521	-	New RRC test cases for Inter-RAT cell reselection (PS) from UTRAN	B	5.3.0	5.4.0	T1-030719
TP-20	TP-030102	522	-	New RRC test cases for Inter-RAT cell change order from UTRAN	B	5.3.0	5.4.0	T1-030720
TP-20	TP-030101	523	-	Modification of RRC reconfiguration test cases due to updates to default messages as of T1-030714r1	F	5.3.0	5.4.0	T1-030723
TP-20	TP-030101	524	-	Corrections to Package 1 RRC test cases (clause 8.2) [revision to T1-030476, T1-030724]	F	5.3.0	5.4.0	T1-030726
TP-20	TP-030102	525	-	New test cases for radio link failure [revision to T1-030565, T1-030725]	F	5.3.0	5.4.0	T1-030727
TP-20	TP-030101	526	-	Correction to Package 1 RRC test cases 8.2.5.1, 8.3.4.3 (Revision of T1-030571 and T1-030681 and T1-030689)	F	5.3.0	5.4.0	T1-030730
TP-20	TP-030101	527	-	Corrections to Package 1 RRC Test Cases 8.2.1.8 and 8.2.1.9 (Revision of T1-030700 and T1-030698)	F	5.3.0	5.4.0	T1-030736
TP-20	TP-030140	529	-	Correction to clause 8.4.1.2 (Package 2 test case) (revision to T1-030564, T1-030664, T1-030701)	F	5.3.0	5.4.0	T1-030738
TP-20	TP-030140	528	1	Corrections to Package 1 RRC test cases (clause 8.4) [T1-030557rev1, T1-030682rev1]	F	5.3.0	5.4.0	T1-030889
TP-20	TP-030140	530	1	Modifications to Package 1 RRC measurement test cases	F	5.3.0	5.4.0	T1-030890
TP-21	TP-030192	531	-	Corrections and updates on 8.2.1 Radio Bearer Establishment for TDD mode	F	5.4.0	5.5.0	T1-030801
TP-21	TP-030192	532	-	Radio Bearer Reconfiguration from CELL_DCH to CELL_FACH test updated for TDD mode (clause 8.2.2.35), TS 34.123-1	F	5.4.0	5.5.0	T1-030802
TP-21	TP-030192	534	-	Correction to RLC testcases 7.2.3.21 and 7.2.3.22	F	5.4.0	5.5.0	T1-030895
TP-21	TP-030192	535	-	Inclusion of tests for combinations on SCCPCH for TDD 1.28 Mcps option	F	5.4.0	5.5.0	T1-030978
TP-21	TP-030192	536	-	Inclusion of test for 34.123-1 for combination on PRACH for TDD 1.28 Mcps option, Rel-4	F	5.4.0	5.5.0	T1-030979
TP-21	TP-030192	537	-	CR to TS 34.123-1 [REL-5] Package 4 GMM test cases 12.4.1.2 and 12.4.1.4d	F	5.4.0	5.5.0	T1-030989
TP-21	TP-030192	538	-	CR to TS 34.123-1 [REL-5] Package 1 RRC test cases in clause 8.1	F	5.4.0	5.5.0	T1-030991
TP-21	TP-030192	539	-	CR to TS 34.123-1 [REL-5] Low priority PDCP test case 7.3.3.1	F	5.4.0	5.5.0	T1-030993
TP-21	TP-030192	540	-	CR 34.123-1 Rel-5: Mobile identity field removed in TC 12.4.2.2	F	5.4.0	5.5.0	T1-031039
TP-21	TP-030192	541	-	CR to 34.123-1 REL-5; Removal of package 2 MAC	F	5.4.0	5.5.0	T1-031043

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				test case 7.1.2.2.1				
TP-21	TP-030192	542	-	Corrections to Package 1 RRC test case 8.1.2.2	F	5.4.0	5.5.0	T1-031067
TP-21	TP-030192	543	-	Corrections to P2 MM test case 9.4.2.2/test 2	F	5.4.0	5.5.0	T1-031068
TP-21	TP-030192	544	-	CR to 34.123-1 REL-5; Corrections to package 4 and low priority RRC test cases on Unsupported configuration	F	5.4.0	5.5.0	T1-031074
TP-21	TP-030192	545	-	CR to TS 34.123-1 [REL-5] Package 2 MM test case 9.4.5.3 Location updating/ periodic normal/ test 2	F	5.4.0	5.5.0	T1-031078
TP-21	TP-030192	546	-	Corrections to 34.123-1 v5.4.0 Package 4 test case (8.2.3.11)	F	5.4.0	5.5.0	T1-031084
TP-21	TP-030192	547	-	Corrections to 34.123-1 v5.4.0 Package 4 test case (8.2.6.11)	F	5.4.0	5.5.0	T1-031085
TP-21	TP-030192	548	-	Corrections to 34.123-1 v5.4.0 Package 4 test case (8.2.6.12)	F	5.4.0	5.5.0	T1-031086
TP-21	TP-030192	549	-	Corrections to 34.123-1 v5.4.0 low priority test case (8.2.6.14)	F	5.4.0	5.5.0	T1-031089
TP-21	TP-030192	550	-	Corrections to 34.123-1 v5.4.0 low priority test case (8.3.1.23)	F	5.4.0	5.5.0	T1-031090
TP-21	TP-030192	551	-	Corrections to 34.123-1 v5.4.0 low priority test case (8.3.4.5)	F	5.4.0	5.5.0	T1-031091
TP-21	TP-030192	552	-	Correction to 34.123-1 v5.4.0 Low priority test case (8.4.1.22)	F	5.4.0	5.5.0	T1-031092
TP-21	TP-030192	553	-	Corrections to 34.123-1 v5.4.0 low priority test case (8.4.1.39)	F	5.4.0	5.5.0	T1-031093
TP-21	TP-030192	554	-	CR to 34.123-1 REL-5; Correction of Package 4 RRC test case 8.2.6.37	F	5.4.0	5.5.0	T1-031099
TP-21	TP-030192	555	-	Removal of test case 8.2.2.20	F	5.4.0	5.5.0	T1-031135
TP-21	TP-030192	556	-	CR to 34.123-1, Rel-5; correction to idle mode section according to RP-030289	F	5.4.0	5.5.0	T1-031143
TP-21	TP-030192	557	-	CR to 34.123-1, Rel-5; correction to package 1 RLC test case 7.2.3.18 according to RP-030292	F	5.4.0	5.5.0	T1-031144
TP-21	TP-030192	558	-	Correction to 34.123-1 v5.4.0 Package 1 test case (8.4.1.5) – Revision of T1-031080	F	5.4.0	5.5.0	T1-031147
TP-21	TP-030192	559	-	Corrections to 34.123-1 v5.4.0 Package 3 test case (8.4.1.24) – Revision of T1-031082	F	5.4.0	5.5.0	T1-031148
TP-21	TP-030192	560	-	Corrections to 34.123-1 v5.4.0 Package 4 test case (8.4.1.12) – Revision of T1-031088	F	5.4.0	5.5.0	T1-031149
TP-21	TP-030192	561	-	CR to TS 34.123-1 [REL-5] Package 4 RRC test cases: 8.1.3.5 and 8.3.1.15	F	5.4.0	5.5.0	T1-031161
TP-21	TP-030192	562	-	Corrections to 34.123-1 v5.4.0 Package 2 test cases (8.3.1.21 and 8.3.1.22) – Revision of T1-031081	F	5.4.0	5.5.0	T1-031180
TP-21	TP-030192	563	-	CR to TS 34.123-1 [REL-5] Low priority GMM test cases 12.2.2.8, 12.3.2.4 and 12.9.9	F	5.4.0	5.5.0	T1-031199
TP-21	TP-030192	564	-	Correction to 34.123-1, section 7.2.3.19 and 7.2.3.24	F	5.4.0	5.5.0	T1-031200
TP-21	TP-030192	565	-	Correction to GCF package 1 RLC testcases 7.2.3.26 and 7.2.3.27	F	5.4.0	5.5.0	T1-031201
TP-21	TP-030192	566	-	CR to TS 34.123-1 [REL-5] Package 1 RRC test cases 8.3.4.3 and 8.4.1.1	F	5.4.0	5.5.0	T1-031203
TP-21	TP-030192	567	-	CR to 34.123-1 REL-5; Periodical RLC STATUS PDU detection in RRC Radio Bearer Reconfiguration Package 2 and 3 test cases	F	5.4.0	5.5.0	T1-031204
TP-21	TP-030192	568	-	CR to TS 34.123-1 [REL-5] Package 2 RRC test case 8.2.2.19	F	5.4.0	5.5.0	T1-031209
TP-21	TP-030192	569	-	CR to 34-123-1, Rel-5; URA Identity in Cell Update Confirm and URA Update Confirm	F	5.4.0	5.5.0	T1-031210
TP-21	TP-030192	570	-	CR to 34.123-1 on Correction to C/T field value for test case 7.1.1.8	F	5.4.0	5.5.0	T1-031212
TP-21	TP-030192	571	-	CR to TS 34.123-1 [REL-5] Package 2 RRC test case 8.3.1.10 Cell Update: expiry of T307 timer after T305 expiry and being out of service area.	F	5.4.0	5.5.0	T1-031213
TP-21	TP-030192	572	-	CR to 34.123-1 REL-5; Correction to CC test cases 10.1.2.2.1 (package 4), 10.1.2.2.2 (package 3) and 10.1.2.9.2 (low prio)	F	5.4.0	5.5.0	T1-031214
TP-21	TP-030192	573	-	CR to TS 34.123-1 [REL-5] Package 2 GMM test case 12.4.2.2	F	5.4.0	5.5.0	T1-031216
TP-21	TP-030192	574	-	CR 34.123-1 Rel-5: TC 12.8 Ready Timer in use	F	5.4.0	5.5.0	T1-031218
TP-21	TP-030192	575	-	CR to 34.123-1 REL-5; Correction to package 1 GMM test case 12.3.1.2	F	5.4.0	5.5.0	T1-031244
TP-21	TP-030192	576	-	Corrections to low priority Multi RAB test cases	F	5.4.0	5.5.0	T1-031069
TP-21	TP-030192	577	-	Corrections to P3 Inter RAT measurement test case	F	5.4.0	5.5.0	T1-031219

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
				8.4.1.31				
TP-21	TP-030192	578	-	CR to 34.123-1 R5; Correction to Package 1 RRC test case 8.2.5.1	F	5.4.0	5.5.0	T1-031254
TP-21	TP-030192	579	-	CR to 34.123-1 REL-5; Correction to package 2 MAC test case 7.1.3.1	F	5.4.0	5.5.0	T1-031256
TP-21	TP-030192	580	-	Introduction of new test cases for a routing area updating procedure due to a change of DRX parameter IE	F	5.4.0	5.5.0	T1-031041
TP-21	TP-030192	581	-	CR 34.123-1 Rel-5: TC 9.4.2.3 doesn't correspond to conformance claim	F	5.4.0	5.5.0	T1-031037
TP-21	TP-030192	582	-	Corrections to 34.123-1 v5.4.0 low priority test case (8.2.3.26)	F	5.4.0	5.5.0	T1-031208
TP-21	TP-030192	583	-	CR 34.123-1 Rel-5: Automatic MO SMS repeat at TP layer	F	5.4.0	5.5.0	T1-031279
TP-22	TP-030282	02		New RRC test cases on Paging	F	5.5.0	5.6.0	T1-031390
TP-22	TP-030282	14		CR to 34.123-1 R5; Delay between activation and deactivation of compressed mode in package 4 test case 8.4.1.43	F	5.5.0	5.6.0	T1-031425
TP-22	TP-030282	17		CR 34.123-1 Rel-5: P3 TC 8.4.1.28 Measurement Control and Report: UE internal measurement for events 6F and 6G	F	5.5.0	5.6.0	T1-031442
TP-22	TP-030282	18		CR 34.123-1 Rel-5: Removal of P3 TC 10.1.3.3.3 Incoming call / U9 mobile terminating call confirmed / termination requested by the user	F	5.5.0	5.6.0	T1-031443
TP-22	TP-030282	19		General correction of CM TGD parameter	F	5.5.0	5.6.0	T1-031453
TP-22	TP-030282	24		Correction to GMM P2 test case 12.4.2.2	F	5.5.0	5.6.0	T1-031474
TP-22	TP-030282	25		Correction to GMM P4 test case 12.4.1.4c	F	5.5.0	5.6.0	T1-031475
TP-22	TP-030282	92		Maintenance of low priority test case 11.2.1 Network initiated PDP context modification	F	5.5.0	5.6.0	T1-031488
TP-22	TP-030282	28		Package 3 test case 8.3.2.11	F	5.5.0	5.6.0	T1-031494
TP-22	TP-030282	30		Low priority test cases 8.2.5.4	F	5.5.0	5.6.0	T1-031496
TP-22	TP-030282	32		Package 4 test case 8.2.1.26	F	5.5.0	5.6.0	T1-031498
TP-22	TP-030282	33		Package 4 test case 9.5.7.1	F	5.5.0	5.6.0	T1-031499
TP-22	TP-030282	34		Low priority test cases 8.2.3.26	F	5.5.0	5.6.0	T1-031500
TP-22	TP-030282	36		Low priority test cases 8.3.1.29 and 8.3.1.30	F	5.5.0	5.6.0	T1-031502
TP-22	TP-030282	37		Low priority test cases 8.3.1.26 and 8.3.1.28	F	5.5.0	5.6.0	T1-031503
TP-22	TP-030282	40		Editorial Correction to RRC test case 8.3.2.13	F	5.5.0	5.6.0	T1-031512
TP-22	TP-030282	44		Correction to clause 8.1.2.1 to match TTCN	F	5.5.0	5.6.0	T1-031525
TP-22	TP-030282	47		Correction to TC 8.4.1.5 (Package 1)	F	5.5.0	5.6.0	T1-031531
TP-22	TP-030282	22		Correction to RRC P1 test case 8.1.1.8	F	5.5.0	5.6.0	T1-031577
TP-22	TP-030282	42		Correction to GMM Low Priority test case 12.4.3.3	F	5.5.0	5.6.0	T1-031578
TP-22	TP-030282	31		Traffic volume measurement test cases	F	5.5.0	5.6.0	T1-031582
TP-22	TP-030282	35		Package 2 test case 8.4.1.14	F	5.5.0	5.6.0	T1-031583
TP-22	TP-030282	07		Corrections to RRC test cases affected by NAS timer T3317	F	5.5.0	5.6.0	T1-031587
TP-22	TP-030282	03		Removal of session management test cases on QoS negotiation (Package 3+4)	F	5.5.0	5.6.0	T1-031599
TP-22	TP-030282	38		Package 2 test case 8.4.1.7	F	5.5.0	5.6.0	T1-031630
TP-22	TP-030282	01		New RLC test case on reconfiguration of RLC parameters by upper layers	F	5.5.0	5.6.0	T1-031631
TP-22	TP-030282	04		Introduction of test cases on A-GPS positioning	F	5.5.0	5.6.0	T1-031632
TP-22	TP-030282	98		P2 Idle Mode 6.2.1.1	F	5.5.0	5.6.0	T1-031634
TP-22	TP-030282	08		Updates to 6.2 series test cases	F	5.5.0	5.6.0	T1-031635
TP-22	TP-030282	43		Correction to Package 1 test case 7.2.3.13.	F	5.5.0	5.6.0	T1-031638
TP-22	TP-030282	93		P2 Inter-system handover	F	5.5.0	5.6.0	T1-031640
TP-22	TP-030282	94		P4 Inter-system handover	F	5.5.0	5.6.0	T1-031641
TP-22	TP-030282	21		Modification to RRC TC 8.3.3.1 – Assign different C-RNTI in UTRAN MOBILITY INFORMATION	F	5.5.0	5.6.0	T1-031642
TP-22	TP-030282	09		Corrections and updates on 8.1 RRC Connection Management Procedure for TDD mode	F	5.5.0	5.6.0	T1-031646
TP-22	TP-030282	10		Corrections and updates on 8.1.6 RRC Connection Management Procedure for TDD mode, Direct Transfer	F	5.5.0	5.6.0	T1-031647

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-22	TP-030282	11		Corrections and updates on 8.2.1 Radio Bearer control procedure, Radio Bearer Establishment for TDD mode	F	5.5.0	5.6.0	T1-031648
TP-22	TP-030282	12		Corrections and updates on 8.2.2 Radio Bearer control procedure, Radio Bearer Reconfiguration for TDD mode	F	5.5.0	5.6.0	T1-031649
TP-22	TP-030282	13		Correction of references for section 18, RAB testing of TDD 1.28 Mcps option	F	5.5.0	5.6.0	T1-031650
TP-22	TP-030282	26		CR for P1 test cases 8.3.4.1 and 8.4.1.1	F	5.5.0	5.6.0	T1-031655
TP-22	TP-030282	46		Removal of package 1 RRC test case 8.2.5.1 –NOT IMPLEMENTED-NOT AVAILABLE ON TIME-	F	5.5.0	5.6.0	T1-031656
TP-22	TP-030282	99		CR 34.123-1 Rel-5: 12.4.2.4 Combined routing area updating / rejected / PLMN not allowed	F	5.5.0	5.6.0	T1-031657
TP-22	TP-030282	84		Section 7.1.1: correction of coding of the Target Channel Type Field on FACH for TDD	F	5.5.0	5.6.0	T1-031667
TP-22	TP-030282	05		Removal of Low priority RRC Measurement test cases	F	5.5.0	5.6.0	T1-031668
TP-22	TP-030282	06		New RRC test case on soft handover for muliple radio links	F	5.5.0	5.6.0	T1-031672
TP-22	TP-030282	91		Clarifications in low priority test case 11.1.2 PDP context activation requested by the network, successful and unsuccessful	F	5.5.0	5.6.0	T1-031679
TP-22	TP-030282	00		CR 34.123-1 Rel-5: 12.4.2.5a Combined routing area updating / rejected / roaming not allowed in this location area	F	5.5.0	5.6.0	T1-031681
TP-22	TP-030282	95		CR on Package 1 SM test case 11.1.1.1 Attach initiated by context activation/QoS Offered by Network is the QoS Requested	F	5.5.0	5.6.0	T1-031682
TP-22	TP-030282	48		General Modification to clause 9 – MM test cases – to be run only in NMOII	F	5.5.0	5.6.0	T1-031683
TP-22	TP-030282	45		Correction to package 3 test case 14.2.51b	F	5.5.0	5.6.0	T1-031685
TP-22	TP-030282	23		Correction to RRC P2 test case 8.4.1.17	F	5.5.0	5.6.0	T1-031686
TP-22	TP-030282	29		Package 1 test case 8.1.2.2	F	5.5.0	5.6.0	T1-031688
TP-22	TP-030282	49		CR to P2 GMM TC 12.2.1.3	F	5.5.0	5.6.0	T1-031689
TP-22	TP-030282	96		CR on Package 1 SM test cases 11.3.1 PDP context deactivation initiated by the UE and 11.3.2 PDP context deactivation initiated by the UE	F	5.5.0	5.6.0	T1-031696
TP-22	TP-030282	16		Modification for GMM test cases	F	5.5.0	5.6.0	T1-031708
TP-22	TP-040040	260	-	Correction to RLC test case 7.2.3.35	F	5.6.0	5.7.0	T1-040065
TP-23	TP-040040	646	1	Removal of package 1 RRC test case 8.2.5.1	F	5.6.0	5.7.0	T1-031656
TP-23	TP-040040	652	2	Corrections to prose for test case 7.1.1.1	F	5.6.0	5.7.0	T1-040402
TP-23	TP-040040	653	1	Corrections to prose for test cases 8.1.1.4, 8.1.1.5 and 8.1.1.6	F	5.6.0	5.7.0	T1-040268
TP-23	TP-040040	654	1	Clarification of Clause 8.3.1.1	F	5.6.0	5.7.0	T1-040314
TP-23	TP-040040	655	1	Corrections to prose for RRC test case 8.3.1.22	F	5.6.0	5.7.0	T1-040315
TP-23	TP-040040	656	1	Correction to prose for test case 8.3.2.7	F	5.6.0	5.7.0	T1-040269
TP-23	TP-040040	658	-	Correction to Multi PLMN MM test cases.	F	5.6.0	5.7.0	T1-040043
TP-23	TP-040040	659	-	Correction to Multi PLMN GMM test cases.	F	5.6.0	5.7.0	T1-040044
TP-23	TP-040040	661	-	Corrections to Package 1 RLC AM test cases to align with TTCN implementation and correct test case 7.2.3.33 (Revision of T1-040096)	F	5.6.0	5.7.0	T1-040262
TP-23	TP-040040	662	-	Corrections to TMSI Status usage in GMM test cases	F	5.6.0	5.7.0	T1-040350
TP-23	TP-040040	663	-	Correction to Package 2 Inter-system handover testcase 8.3.7.4	F	5.6.0	5.7.0	T1-040054
TP-23	TP-040040	664	-	Introduction of new test cases for lossless SRNS relocation in L2/PDCP, clause 7.3	F	5.6.0	5.7.0	T1-040058
TP-23	TP-040040	665	-	Clarification of initial condition for 8.1.1.1	F	5.6.0	5.7.0	T1-040063
TP-23	TP-040040	666	-	Correction to RLC test case 7.2.3.19	F	5.6.0	5.7.0	T1-040064
TP-23	TP-040040	667	-	New HSDPA radio bearer test cases	B	5.6.0	5.7.0	T1-040074
TP-23	TP-040040	668	-	Corrections to package 2 test RRC tc 8_2_2_23-unclassified test RRC tc 8_1_3_6-unclassified test RRC tc 8_1_6_4-unclassified test RRC tc 8_2_6_36	D	5.6.0	5.7.0	T1-040082
TP-23	TP-040040	669	-	Correction to Unclassified tests RRC tc 8_3_1_29	F	5.6.0	5.7.0	T1-040085
TP-23	TP-040040	670	-	Correction to Unclassified tests RRC tc 8_3_7_10	F	5.6.0	5.7.0	T1-040086
TP-23	TP-040040	670	-	CR to 34.123-1 REL-5; Correction to Unclassified	F	5.6.0	5.7.0	T1-040086

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
				tests RRC tc 8_3_7_10				
TP-23	TP-040040	671	-	Correction to Unclassified tests RRC tc 8_3_1_18	F	5.6.0	5.7.0	T1-040089
TP-23	TP-040040	672	-	Correction to package 4 RRC test case 8.3.2.2	F	5.6.0	5.7.0	T1-040090
TP-23	TP-040040	673	-	Correction of a test step number given in the Test Requirement for Package 1 test case 12.9.2	F	5.6.0	5.7.0	T1-040101
TP-23	TP-040040	674	-	Corrections to P3 Cell Selection (HCS) test cases.	F	5.6.0	5.7.0	T1-040110
TP-23	TP-040040	675	-	Corrections to P1 RRC test cases 8.3.1.1 and 8.3.1.3	F	5.6.0	5.7.0	T1-040112
TP-23	TP-040040	677	-	Corrections to P2 RRC test case 8.3.1.4	F	5.6.0	5.7.0	T1-040113
TP-23	TP-040040	678	-	Correction to P2 RRC test case 8.3. 1.22	F	5.6.0	5.7.0	T1-040114
TP-23	TP-040040	679	-	Removal of low priority GMM test cases 12.4.1.1c and 12.4.2.3a	F	5.6.0	5.7.0	T1-040116
TP-23	TP-040040	680	-	Correction to 8.4.1.41 (P4)	F	5.6.0	5.7.0	T1-040127
TP-23	TP-040040	681	-	Correction to RRC P4 TC 8.4.1.41 due to RAN CR 2146.	F	5.6.0	5.7.0	T1-040132
TP-23	TP-040040	682	-	Correction to RRC P1 TC 8.1.1.7	F	5.6.0	5.7.0	T1-040135
TP-23	TP-040040	683	-	Correction to Package 2 idle mode test cases 6.2.2.2 and 6.2.2.3	F	5.6.0	5.7.0	T1-040159
TP-23	TP-040040	684	-	Correction to 7.2.3.21 (P1)	F	5.6.0	5.7.0	T1-040170
TP-23	TP-040040	685	-	Corrections to Package 2 MM Test Case 9.3.1	F	5.6.0	5.7.0	T1-040173
TP-23	TP-040040	686	-	Correction to Unclassified tests RRC test cases 8_2_6_6..	F	5.6.0	5.7.0	T1-040183
TP-23	TP-040040	687	-	Correction to low priority inter-RAT cell change order test cases 8.3.11.4 & 8.3.11.6. Merge of T1-040081 and T1-040115.	F	5.6.0	5.7.0	T1-040187
TP-23	TP-040040	688	-	Future compatibility of RRC critical extension testing (Not implementable)	F	5.6.0	5.7.0	T1-040236
TP-23	TP-040040	689	-	CR to 34.123-1 REL-5; Correction to Unclassified tests RRC tc 8_3_9_2	F	5.6.0	5.7.0	T1-040237
TP-23	TP-040040	690	-	CR to 34.123-1 REL-5; Correction to Unclassified tests RRC tc 8_3_9_4	F	5.6.0	5.7.0	T1-040238
TP-23	TP-040040	691	-	Correction to package 4 RRC test case 8.3.9.3	F	5.6.0	5.7.0	T1-040239
TP-23	TP-040040	692	-	Removal of 8.2.2.25 (P3) and correction to 8.2.2.10 (P2) for clarification	F	5.6.0	5.7.0	T1-040240
TP-23	TP-040040	693	-	Corrections of 8.2.1.26 (P4) (Revision of T1-040266)	F	5.6.0	5.7.0	T1-040241
TP-23	TP-040040	694	-	Correction to handling of EnteredParameter IE in package 1 test cases 8.1.1.1, 8.1.1.7, and 8.1.1.8; revision of T1-040060	F	5.6.0	5.7.0	T1-040242
TP-23	TP-040040	695	-	Corrections to TestCases 8.3.4.1 and 8.3.4.3	F	5.6.0	5.7.0	T1-040243
TP-23	TP-040040	696	-	Seamless SRNS relocation test cases for TS 34.123-1 v5.6.0 (Revision of T1-040129)	F	5.6.0	5.7.0	T1-040244
TP-23	TP-040040	697	-	Corrections to the Package 1 TestCase 8.1.2.2	F	5.6.0	5.7.0	T1-040245
TP-23	TP-040040	698	-	Correction to package 2 RRC test case 8.1.10.1	F	5.6.0	5.7.0	T1-040255
TP-23	TP-040040	699	-	Correction to P2 MAC test case 7.1.3.1	F	5.6.0	5.7.0	T1-040261
TP-23	TP-040040	700	-	Correction to GCF package 1 RLC testcases 7.2.3.26 and 7.2.3.27	F	5.6.0	5.7.0	T1-040264
TP-23	TP-040040	701	-	Correction to 8.4.1.30 (P3) – Revision of T1-040125	F	5.6.0	5.7.0	T1-040265
TP-23	TP-040040	702	-	Correction to 8.3.1.30 (Low priority) – Revision of T1-040128	F	5.6.0	5.7.0	T1-040267
TP-23	TP-040040	703	-	Correction to RRC low priority TC 8.2.6.29 revision of T1-040182.	F	5.6.0	5.7.0	T1-040274
TP-23	TP-040040	704	-	Correction to TestCase 8.1.2.3	F	5.6.0	5.7.0	T1-040300
TP-23	TP-040040	705	-	Corrections to TestCase 8.3.1.15	F	5.6.0	5.7.0	T1-040301
TP-23	TP-040040	706	-	Correction to TestCase 8.3.2.4	F	5.6.0	5.7.0	T1-040302
TP-23	TP-040040	707	-	Corrections to the testcase 8.2.2.35	F	5.6.0	5.7.0	T1-040303
TP-23	TP-040040	708	-	Corrections to the RRC Test cases 8.1.3.1, 8.1.3.2, 8.1.3.3, 8.1.3.4 & 8.1.3.5	F	5.6.0	5.7.0	T1-040304
TP-23	TP-040040	709	-	Correction to Package II MM test case 9.4.8	F	5.6.0	5.7.0	T1-040305
TP-23	TP-040040	710	-	Correction to handling of EnteredParameter IE in test cases 8.1.1.9, 8.3.1.5, and 8.3.1.6	F	5.6.0	5.7.0	T1-040306
TP-23	TP-040040	711	-	Modifications in clause 11.2	F	5.6.0	5.7.0	T1-040310
TP-23	TP-040040	712	-	Correction to RRC P4 TC 8.2.6.37	F	5.6.0	5.7.0	T1-040351
TP-23	TP-040040	713	-	Corrections to PDP context deactivation procedure test cases	F	5.6.0	5.7.0	T1-040353

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-23	TP-040040	714	-	Modification to NAS TC 12.3.2.1 to prevent an optional ATTACH REQUEST during the RRC connection release procedure. (Revision of T1-040059 and T1-040235)	F	5.6.0	5.7.0	T1-040355
TP-23	TP-040040	715	-	Correction to GMM Package II test case 12.2.1.7	F	5.6.0	5.7.0	T1-040356
TP-23	TP-040040	716	-	Correction to package 4 test case 12.4.1.4b	F	5.6.0	5.7.0	T1-040359
TP-23	TP-040040	717	-	Correction to GMM test case 12.4.2.1	F	5.6.0	5.7.0	T1-040361
TP-23	TP-040040	718	-	Correction to GMM test case 12.9.4	F	5.6.0	5.7.0	T1-040362
TP-23	TP-040040	719	-	Correction to Package 1 GMM test case 12.3.1.2	F	5.6.0	5.7.0	T1-040363
TP-23	TP-040040	720	-	Correction to GMM test case 12.4.1.1a	F	5.6.0	5.7.0	T1-040364
TP-23	TP-040040	721	-	Correction to some of the GMM test cases to include CS registration	F	5.6.0	5.7.0	T1-040365
TP-23	TP-040040	722	-	Correction to some of the GMM test cases	F	5.6.0	5.7.0	T1-040394
TP-23	TP-040040	723	-	Corrections to add minimum set of TFCIs to RB test cases	F	5.6.0	5.7.0	T1-040396
TP-23	TP-040040	724	-	New HSDPA MAC test cases	F	5.6.0	5.7.0	T1-040398
TP-23	TP-040040	725	-	New HSDPA RRC test cases (as of T1-040072rev1)	F	5.6.0	5.7.0	T1-040399
TP-23	TP-040040	726	-	New SM test case for QoS extension for rates above 8640 kbps	F	5.6.0	5.7.0	T1-040400
TP-23	TP-040040	727	-	Splitting ISHO high data rate tests 8.3.7.2 and 8.3.7.3 (Revision of T1-040143 and T1-040357).	F	5.6.0	5.7.0	T1-040406
TP-23	TP-040040	728	-	New test case for approved I/B UL:64 DL:768 kbps PS RAB (TTI=20ms option) – Revision of T1-040108 and T1-040395	F	5.6.0	5.7.0	T1-040407
TP-23	TP-040040	729	-	Correction to package 2 GMM test case 12.6.1.2	F	5.6.0	5.7.0	T1-040410
TP-23	TP-040040	730	-	Correction to CC test case 10.1.2.4.11	F	5.6.0	5.7.0	T1-040415
TP-23	TP-040040	731	-	Add 1.28 Mcps TDD content in clause 8.2.4.29	F	5.6.0	5.7.0	T1-040375
TP-23	TP-040040	732	-	Add 1.28 Mcps TDD content of Physical channel reconfiguration test case	F	5.6.0	5.7.0	T1-040376
TP-23	TP-040040	733	-	Add 1.28 Mcps TDD content of Quality measurements clause 8.4.1.22	F	5.6.0	5.7.0	T1-040377
TP-23	TP-040040	734	-	Add 1.28 Mcps TDD content of Inter-frequency measurement for event 2A	F	5.6.0	5.7.0	T1-040378
TP-23	TP-040040	735	-	Add 1.28 Mcps TDD content for internal measurement for event 6A and 6B	F	5.6.0	5.7.0	T1-040381
TP-23	TP-040040	736	-	Add 1.28 Mcps TDD content for UE internal measurement t for event 6G	F	5.6.0	5.7.0	T1-040382
TP-23	TP-040040	737	-	Add 1.28 Mcps TDD content for UE internal measurement t for event 6F	B	5.6.0	5.7.0	T1-040383
TP-23	TP-040040	738	-	Add 1.28 Mcps TDD content for UE Traffic Volume measurement	F	5.6.0	5.7.0	T1-040384
TP-23	TP-040040	739	-	Add 1.28 Mcps TDD content for UE internal measurement, event 6c	F	5.6.0	5.7.0	T1-040385
TP-23	TP-040040	740	-	Add 1.28 Mcps TDD content for UE internal measurement, event 6d	F	5.6.0	5.7.0	T1-040386
TP-23	TP-040040	741	-	Add 1.28 Mcps TDD content for UE internal measurement, event 6e	F	5.6.0	5.7.0	T1-040387
TP-23	TP-040040	742	-	Add 1.28 Mcps TDD content for Intra-frequency measurement, event1H and 1I (TDD)	F	5.6.0	5.7.0	T1-040388
TP-23	TP-040040	743	-	Add 1.28 Mcps TDD content of Intra-frequency measurement for transition from idle mode to CELL_DCH state (TDD)	F	5.6.0	5.7.0	T1-040390
TP-23	TP-040040	744	-	Add 1.28 Mcps TDD content of Intra-frequency measurement transition from idle mode to CELL_FACH state (TDD)	F	5.6.0	5.7.0	T1-040391
TP-23	TP-040040	745	-	Add 1.28 Mcps TDD content of Intra-frequency measurement transition from CELL_DCH to CELL_FACH state (TDD)	F	5.6.0	5.7.0	T1-040392
TP-23	TP-040040	746	-	Correction to package 3 test cases 16.1.2 and 16.2.2package 3 test cases 16.1.2and 16.2.2	F	5.6.0	5.7.0	T1-040175
TP-23	TP-040040	747	-	Correction to package 2 GMM test case 12.4.2.2 package 2 GMM test case 12.4.2.2	F	5.6.0	5.7.0	T1-040176
TP-23	TP-040040	748	-	Corrections to SM QoS negotiation test cases negotiation test cases	F	5.6.0	5.7.0	T1-040366
TP-23	TP-040040	749	-	Correct editorial errors and reference point for PRACH and UpPCH for 1.28 Mcps TDD in section 7.1.2.4 of TS34.123-17.1.2.4: Correct for PRACH and UpPCH	F	5.6.0	5.7.0	T1-040374

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-23	TP-040040	750	-	Add 1.28 Mcps TDD content of Inter-frequency measurement for event 2B and 2E	F	5.6.0	5.7.0	T1-040379
TP-23	TP-040040	751	-	Add 1.28 Mcps TDD content of Inter-frequency measurement for event 2D and 2F	F	5.6.0	5.7.0	T1-040380
TP-23	TP-040040	752	-	Adding of new test cases for events 1G for 1.28 Mcps TDD	B	5.6.0	5.7.0	T1-040389
TP-23	-	-	-	Adaptation of CR 688 in T1-040236 to 34.123-1 V.5.6.0 (was originally written against v.5.5.0) and editorial corrections on implementation of CRs in T1-040353, T1-040043, T1-040264, and T1-040314	-	5.7.0	5.7.1	-
TP-24	TP-040115	764	-	"Emergency call establishment" as one of the CM Service Type in 10.1.2.1.1	F	5.7.1	5.8.0	T1-040557
TP-24	TP-040115	810	-	Correction to Conformance Requirement for P3 CC NAS TCs regarding support for 'Prolonged Clearing Procedure'.	F	5.7.1	5.8.0	T1-040671
TP-24	TP-040115	838	-	Correction to Package 1 SM TC 11.3.1 RAB release location	F	5.7.1	5.8.0	T1-040962
TP-24	TP-040115	839	-	Correction to Package 1 SM TC 11.3.2 RAB release location	F	5.7.1	5.8.0	T1-040963
TP-24	TP-040115	851	-	Correction to low priority TC 11.1.2	F	5.7.1	5.8.0	T1-040980
TP-24	TP-040115	759	-	Correction to low priority GMM TC 12.4.1.5	F	5.7.1	5.8.0	T1-040527
TP-24	TP-040115	760	-	Correction to P4 GMM TCs 12.2.1.5d and 12.4.1.4d	F	5.7.1	5.8.0	T1-040528
TP-24	TP-040115	855	-	Correction to several GMM TCs to include equivalent PLMN IE	F	5.7.1	5.8.0	T1-040529
TP-24	TP-040115	831	-	CR 34.123-1 Rel-5: Corrections to MM test cases to include GMM procedures	F	5.7.1	5.8.0	T1-040949
TP-24	TP-040115	832	-	Correction to package 3 GMM test case 12.4.2.5a	F	5.7.1	5.8.0	T1-040950
TP-24	TP-040115	833	-	Modification for GMM test cases (P4 and low priority test cases)	F	5.7.1	5.8.0	T1-040951
TP-24	TP-040115	841	-	Correction to P4 GMM Test Case 12.4.1.1b	F	5.7.1	5.8.0	T1-040966
TP-24	TP-040115	768	-	Corrections to prose for test cases 8.1.1.4, 8.1.1.5 and 8.1.1.6	F	5.7.1	5.8.0	T1-040561
TP-24	TP-040115	769	-	Editorial correction for 14.2.11, 14.2.39.2	D	5.7.1	5.8.0	T1-040565
TP-24	TP-040115	773	-	Addition of test case for Interactive or background / UL:64 DL:768 kbps / 10 ms TTI	F	5.7.1	5.8.0	T1-040570
TP-24	TP-040115	830	-	Correction to low priority radio bearer test cases (minimum set of TFCS)	F	5.7.1	5.8.0	T1-040947
TP-24	TP-040115	843	-	Correction to Package III SMS Test Case 16.2.1 (Revision of T1-040548)	F	5.7.1	5.8.0	T1-040968
TP-24	TP-040115	844	-	CR 34.123-1 Rel-5: Correction to package 3 SMS test case 16.1.1	F	5.7.1	5.8.0	T1-040969
TP-24	TP-040115	835	-	CR to 34.123-1 Rel-5, New A-GPS test cases	F	5.7.1	5.8.0	T1-040955
TP-24	TP-040115	778	-	Correction to initial conditions of Idle Mode test case 6.2.1.6	F	5.7.1	5.8.0	T1-040585
TP-24	TP-040115	800	-	General corrections to section 6 of 34.123-1 (idle mode)	F	5.7.1	5.8.0	T1-040647
TP-24	TP-040115	823	-	Changes to test procedure of Idle Mode Cell Reselection test case 6.2.2.3 (Revision of T1-040587)	F	5.7.1	5.8.0	T1-040937
TP-24	TP-040115	845	-	Corrections to P2 PLMN and RAT selection test cases in Multi-mode environment (2G/3G case)	F	5.7.1	5.8.0	T1-040971
TP-24	TP-040115	755	-	Correction to HSDPA MAC-hs test cases	F	5.7.1	5.8.0	T1-040519
TP-24	TP-040115	756	-	New HSDPA MAC-hs reset test case	F	5.7.1	5.8.0	T1-040520
TP-24	TP-040115	758	-	Correction to HSDPA radio bearer test cases	F	5.7.1	5.8.0	T1-040521
TP-24	TP-040115	761	-	Correction to package 1 MAC testcase 7.1.2.3.1	F	5.7.1	5.8.0	T1-040549
TP-24	TP-040115	816	-	Correction to prose for test case 7.1.1.1	D	5.7.1	5.8.0	T1-040682
TP-24	TP-040115	824	-	Re-instatement of Test Requirements to meet the Test Purpose in 7.2.3.24 and 7.2.3.27 (Merged with T1-040550 and revised from T1-040918)	F	5.7.1	5.8.0	T1-040938
TP-24	TP-040115	837	-	CR 34.123-1 Rel-5: Correction to package 2 MAC test case 7.1.3.1	F	5.7.1	5.8.0	T1-040958
TP-24	TP-040115	780	-	Corrections to SRNS relocation PDCP test cases	F	5.7.1	5.8.0	T1-040973
TP-24	TP-040115	753	-	CR to TS 34.123-1 R5, Correction to low priority RRC TCs 8.1.8.3 and 8.2.1.13.	F	5.7.1	5.8.0	T1-040509
TP-24	TP-040115	754	-	CR to TS 34.123-1 R5, Correction to low priority RRC TCs TC 8.1.6.4, 8.1.9a and 8.1.9b.	F	5.7.1	5.8.0	T1-040513
TP-24	TP-040115	765	-	Correction to package 1 test case 8.1.2.9 for BCCH Modification Time in Paging Type 1 message	F	5.7.1	5.8.0	T1-040558

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-24	TP-040115	766	-	Correction for RRC Transaction Identifier in test cases 8.1.5.1 and 8.1.5.4	F	5.7.1	5.8.0	T1-040559
TP-24	TP-040115	767	-	Editorial corrections for 8.3.1.1	D	5.7.1	5.8.0	T1-040560
TP-24	TP-040115	770	-	Future compatibility of RRC critical extension testing	F	5.7.1	5.8.0	T1-040566
TP-24	TP-040115	771	-	Editorial correction for 8.3.1.31	D	5.7.1	5.8.0	T1-040567
TP-24	TP-040115	772	-	Corrections in Specific Message Contents for clause 8.3.1.5.4 and 8.3.1.6.4	F	5.7.1	5.8.0	T1-040568
TP-24	TP-040115	774	-	CR to 34.123-1 Rel-5, Correction to package 4 RRC test case 8.2.2.35	F	5.7.1	5.8.0	T1-040575
TP-24	TP-040115	775	-	CR to 34.123-1 Rel-5, Correction to package 4 RRC test case 8.2.3.29	F	5.7.1	5.8.0	T1-040576
TP-24	TP-040115	776	-	CR to 34.123-1 Rel-5, Correction to package 2 RRC test case 8.3.1.22	F	5.7.1	5.8.0	T1-040577
TP-24	TP-040115	777	-	Correction to package 1 RRC test case 8.2.4.1a	F	5.7.1	5.8.0	T1-040581
TP-24	TP-040115	779	-	Changes to test procedure of Cell Reselection Case 8.3.9.3	F	5.7.1	5.8.0	T1-040589
TP-24	TP-040115	781	-	Correction to number of reported cells in RRC P2 test case 8.4.1.7	F	5.7.1	5.8.0	T1-040625
TP-24	TP-040115	782	-	Correction to Low Priority RRC Cell Change Order Test Cases	F	5.7.1	5.8.0	T1-040626
TP-24	TP-040115	783	-	Removal of 8.2.1.26 (P4)	F	5.7.1	5.8.0	T1-040627
TP-24	TP-040115	784	-	Correction to P4 RRC Cell Change Order Test Cases	F	5.7.1	5.8.0	T1-040628
TP-24	TP-040115	785	-	Correction to P3 HCS test case 8.3.2.13	F	5.7.1	5.8.0	T1-040629
TP-24	TP-040115	786	-	Correction to P2 RRC test case 8.2.4.4	F	5.7.1	5.8.0	T1-040630
TP-24	TP-040115	787	-	Corrections to P4 RRC UTRAN to GERAN Cell Reselection test cases	F	5.7.1	5.8.0	T1-040631
TP-24	TP-040115	788	-	Correction to Low Priority RRC Cell Reselection test cases	F	5.7.1	5.8.0	T1-040632
TP-24	TP-040115	789	-	Corrections to P2 RRC test case 8.3.2.4	F	5.7.1	5.8.0	T1-040633
TP-24	TP-040115	790	-	Corrections to P2 RRC test case 8.3.2.1	F	5.7.1	5.8.0	T1-040634
TP-24	TP-040115	791	-	Correction to P2 test case 8.4.1.18	F	5.7.1	5.8.0	T1-040635
TP-24	TP-040115	792	-	Correction to P3 Inter Rat Measurement test cases	F	5.7.1	5.8.0	T1-040637
TP-24	TP-040115	793	-	Errors correction in section 8.4.1.7A for TDD of TS34.123-1	F	5.7.1	5.8.0	T1-040639
TP-24	TP-040115	794	-	Errors correction in section 8.4.1.29 of TS34.123-1	F	5.7.1	5.8.0	T1-040640
TP-24	TP-040115	795	-	To add the description of "Primary CCPCH info" (for TDD) in 8.1.6.3.	F	5.7.1	5.8.0	T1-040641
TP-24	TP-040115	796	-	To add the description of "Primary CCPCH info" (for TDD) in 8.2.6.8.	F	5.7.1	5.8.0	T1-040642
TP-24	TP-040115	797	-	Errors correction in section 8.3.1.4.4of TS34.123-1	F	5.7.1	5.8.0	T1-040644
TP-24	TP-040115	798	-	Errors correction in section 8.4.1.2a of TS34.123-1	F	5.7.1	5.8.0	T1-040645
TP-24	TP-040115	799	-	Corrections to test case 8.2.1.27 (Low priority)	F	5.7.1	5.8.0	T1-040646
TP-24	TP-040115	801	-	Corrections in Security Mode Command for 8.1.7.1 and 8.1.7.2 test cases.	F	5.7.1	5.8.0	T1-040648
TP-24	TP-040115	802	-	CR to TS 34.123-1 R5, Correction to P1 RRC TC 8.4.1.1.	F	5.7.1	5.8.0	T1-040651
TP-24	TP-040115	803	-	Add HCR TDD content of Inter-frequency measurement for event 2A	F	5.7.1	5.8.0	T1-040658
TP-24	TP-040115	804	-	Add HCR TDD content of Inter-frequency measurement for event 2B and 2E	F	5.7.1	5.8.0	T1-040659
TP-24	TP-040115	805	-	Add HCR TDD content for UE internal measurement, event 6c	F	5.7.1	5.8.0	T1-040661
TP-24	TP-040115	806	-	Add HCR TDD content for UE internal measurement, event 6d	F	5.7.1	5.8.0	T1-040662
TP-24	TP-040115	807	-	Add HCR TDD content for UE internal measurement, event 6e	F	5.7.1	5.8.0	T1-040663
TP-24	TP-040115	808	-	Adding of new test cases for events 1G for HCR TDD	B	5.7.1	5.8.0	T1-040664
TP-24	TP-040115	809	-	Tests for HCR TDD RAB combinations	F	5.7.1	5.8.0	T1-040666
TP-24	TP-040115	811	-	Corrections to specific message contents of test case 8.1.2.9 to support CS Domain.	F	5.7.1	5.8.0	T1-040668
TP-24	TP-040115	812	-	Correction to RRC Package 2 TC 8.4.1.17 on Measurement Reporting Interval.	F	5.7.1	5.8.0	T1-040674
TP-24	TP-040115	813	-	Correction to 8.3.4.2 test case at Step 6 for Measurement Report Message	F	5.7.1	5.8.0	T1-040678
TP-24	TP-040115	814	-	Correction for RRC Transaction Identifier in test	F	5.7.1	5.8.0	T1-040680

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
				cases 8.1.6.1 and 8.1.6.2				
TP-24	TP-040115	815	-	Correction to New C-RNTI value at Step5 in 8.3.1.11 testcase.	F	5.7.1	5.8.0	T1-040681
TP-24	TP-040115	817	-	Editorial correction to 8.2.3.22 (Low Priority)	F	5.7.1	5.8.0	T1-040710
TP-24	TP-040115	757	-	Addition of new SRNS relocation (radio link failure) test cases	F	5.7.1	5.8.0	T1-040715
TP-24	TP-040115	819	-	CR to 34.123-1 Rel-5: Correction to package 3 RRC test case 8.4.1.26	F	5.7.1	5.8.0	T1-040731
TP-24	TP-040115	820	-	CR to 34.123-1 Rel-5: Correction to package 3 RRC test case 8.2.4.1a	F	5.7.1	5.8.0	T1-040732
TP-24	TP-040115	853	-	Correction to low priority TC 8.3.11.3	F	5.7.1	5.8.0	T1-040758
TP-24	TP-040115	822	-	Corrections to TC 8.3.1.30 (Low Priority)	F	5.7.1	5.8.0	T1-040919
TP-24	TP-040115	825	-	System Information Block type 1 modification for FACH to DCH:T312 set to 2 seconds in connected mode	F	5.7.1	5.8.0	T1-040941
TP-24	TP-040115	826	-	Corrections to Table 8.3.7-1 in relation to Package 2 test cases 8.3.7.x (Editorial Revision of T1-040669)	F	5.7.1	5.8.0	T1-040942
TP-24	TP-040115	827	-	Revisions to Package 3 measurement test cases 8.4.1.31 and 8.4.1.40 (Revision of T1-040665)	F	5.7.1	5.8.0	T1-040943
TP-24	TP-040115	828	-	Correction of test case description for test case 8.1.6.4	F	5.7.1	5.8.0	T1-040944
TP-24	TP-040115	829	-	CR to 34.123-1 Rel-5, Correction to package 4 RRC test cases 8.2.3.11, 8.2.6.11 and 8.2.6.12	F	5.7.1	5.8.0	T1-040945
TP-24	TP-040115	854	-	CR to 34.123-1 Rel 5: Correction to package 2 RRC test case 8.4.1.2	F	5.7.1	5.8.0	T1-040959
TP-24	TP-040115	840	-	Corrections to Package 2 test case 9.4.2.4 Procedure 2	F	5.7.1	5.8.0	T1-040964
TP-24	TP-040115	842	-	CR to 34.123-1 Rel-5, Corrections to HSDPA RRC test cases	F	5.7.1	5.8.0	T1-040967
TP-24	TP-040115	846	-	CR to 34.123-1 Rel-5, New HSDPA RRC test cases	F	5.7.1	5.8.0	T1-040974
TP-24	TP-040115	847	-	Corrections to Seamless SRNS relocation RRC test cases (Revision to T1-040712)	F	5.7.1	5.8.0	T1-040975
TP-24	TP-040115	848	-	New SRNS relocation test cases (Revision of T1-040714)	F	5.7.1	5.8.0	T1-040976
TP-24	TP-040115	852	-	Addition of 6 new Inter-RAT test cases.	F	5.7.1	5.8.0	T1-040977r1
TP-24	TP-040115	849	-	Add HCR TDD content of Inter-frequency measurement for event 2D and 2F	F	5.7.1	5.8.0	T1-040978
TP-24	TP-040115	850	-	Change to Test Requirement of Cell Reselection Case: 8.3.9.1(Revision of T1-040588)	F	5.7.1	5.8.0	T1-040979
TP-24	TP-040115	762	-	Correction to package 2 MM testcase 9.4.2.1 to align with TTCN implementation.	F	5.7.1	5.8.0	T1-040552
TP-24	TP-040115	763	-	Correction to package 2 MM testcase 9.4.4	D	5.7.1	5.8.0	T1-040553
TP-24	TP-040115	818	-	CR 34.123-1 Rel-5: Corrections to MM test cases to emergency call support and authentication procedures.	F	5.7.1	5.8.0	T1-040724
TP-24	TP-040115	821	-	Correction of Test Requirement in Package 2 test case 9.3.1	F	5.7.1	5.8.0	T1-040921
TP-24	TP-040115	834	-	CR 34.123-1 Rel-5: Correction to package 2 MM test case 9.4.8	F	5.7.1	5.8.0	T1-040954
TP-24	TP-040115	836	-	Correction to package 2 MM testcase 9.1 to align with TTCN implementation.(Revision of T1-040551)	F	5.7.1	5.8.0	T1-040956
TP-24	TP-040115	856	-	Correction to Package 2 test case 9.4.2.3	F	5.7.1	5.8.0	T1-040961r2
TP-25	TP-040160	853	-	Correction to package 3 RRC test case 8.2.4.1a	F	5.8.0	5.9.0	T1-041002
TP-25	TP-040160	854"	-	System Information Block type 1 modification for FACH to DCH:T312 set to 2 seconds in connected mode	F	5.8.0	5.9.0	T1-041004
TP-25	TP-040160	855	-	Correction to number of reported GSM cells in RRC P3 test case 8.4.1.36	F	5.8.0	5.9.0	T1-041012
TP-25	TP-040160	856	-	Correction to prose for Package 3 RRC test case 8.4.1.30	F	5.8.0	5.9.0	T1-041019
TP-25	TP-040160	857	-	Revisions to Package 3 measurement test cases 8.4.1.33 and 8.4.1.40	F	5.8.0	5.9.0	T1-041020
TP-25	TP-040160	858	-	Correction to Package 2 MM TC 9.4.9 – to remove EFLOCI, EFHPLMNwAcT and EFPLMNwAcT USIM field reference	F	5.8.0	5.9.0	T1-041021
TP-25	TP-040160	859	-	Correction to Package 2 GMM TC 12.6.1.2 to remove ICS reference from test step.	F	5.8.0	5.9.0	T1-041023
TP-25	TP-040160	860	-	Correction to UL and DL TFCS in Package 3 test case 14.2.38e.	F	5.8.0	5.9.0	T1-041024

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-25	TP-040160	861	-	Correction to Conformance Requirement for P4 CC NAS TC 10.1.2.7.1 regarding support for 'Prolonged Clearing Procedure'.	F	5.8.0	5.9.0	T1-041026
TP-25	TP-040160	862	-	Correction to Conformance Requirement for Low Priority CC NAS test cases regarding support for 'Prolonged Clearing Procedure'.	F	5.8.0	5.9.0	T1-041027
TP-25	TP-040160	863	-	Clarification of the Generic Test Procedure in Clause 14.1.2 of the Radio Bearer Tests	F	5.8.0	5.9.0	T1-041032
TP-25	TP-040160	864	-	Editorial Correction to Package 3 Radio Bearer test case 14.2.49.1	F	5.8.0	5.9.0	T1-041033
TP-25	TP-040160	865	-	Removal of package 3 idle mode test case 6.1.2.7	F	5.8.0	5.9.0	T1-041042
TP-25	TP-040160	866	-	Corrections to 8.2.5.4 and 8.3.3.2	F	5.8.0	5.9.0	T1-041045
TP-25	TP-040160	867	-	Corrections to 8.1.9b	F	5.8.0	5.9.0	T1-041047
TP-25	TP-040160	945	-	Correction to TC 8.3.7.1, 8.3.7.2 and 8.3.7.2a	F	5.8.0	5. 9.0	T1-041051
TP-25	TP-040160	868	-	New MAC test case for TFC selection with extended TFCS.	F	5.8.0	5.9.0	T1-041052
TP-25	TP-040160	869	-	Correction to TC 8.3.7.8, 8.3.7.10 and 8.3.7.11	F	5.8.0	5.9.0	T1-041053
TP-25	TP-040160	870	-	Correction of PLMN values for Idle Mode test case.	F	5.8.0	5.9.0	T1-041062
TP-25	TP-040160	871	-	Corrections to GMM test cases	F	5.8.0	5.9.0	T1-041066
TP-25	TP-040160	872	-	Correction to Inter-system hard handover from UTRAN to GSM overview table	F	5.8.0	5.9.0	T1-041079
TP-25	TP-040160	873	-	CR to 34.123-1Rel-5: Correction of 7.1.1.1 for TDD	F	5.8.0	5.9.0	T1-041082
TP-25	TP-040160	874	-	CR to 34.123-1 Rel-5: Adding Specific Contents for TDD in 7.1.1.2	F	5.8.0	5.9.0	T1-041083
TP-25	TP-040160	875	-	CR to 34.123-1 Rel-5: Adding Specific Message Contents for 1.28 Mcps TDD in 8.1.2.7	F	5.8.0	5.9.0	T1-041085
TP-25	TP-040160	876	-	CR to 34.123-1 Rel-5: Adding Specific Message Contents for 1.28 Mcps TDD in 8.1.5.1	F	5.8.0	5.9.0	T1-041086
TP-25	TP-040160	877	-	CR to 34.123-1 Rel-5: Adding Specific Message Contents for 1.28 Mcps TDD in 8.2.2.1	F	5.8.0	5.9.0	T1-041087
TP-25	TP-040160	878	-	CR 34.123-1 Rel-5: Corrections to SMS test cases 16.2.1 and 16.2.2	F	5.8.0	5.9.0	T1-041101
TP-25	TP-040160	879	-	Editorial Change in package 1 testcase 7.1.1.8	D	5.8.0	5.9.0	T1-041116
TP-25	TP-040160	880	-	Correction to Package 1 testcase 7.1.2.3.1 for N300 IE sent in SIB1	F	5.8.0	5.9.0	T1-041117
TP-25	TP-040160	881	-	P-TMSI expected in step 5 in package 4 GMM testcase 12.9.8 is incorrect.	D	5.8.0	5.9.0	T1-041120
TP-25	TP-040160	882	-	Contradiction between test procedure and test requirement in Package 3 SMS testcase 16.1.1	F	5.8.0	5.9.0	T1-041121
TP-25	TP-040160	883	-	Correction in step 2 in package 2 MM testcase 9.4.2.1	F	5.8.0	5.9.0	T1-041122
TP-25	TP-040160	884	-	Modification in SIB5 content for package 2 testcase 14.4.2.1	F	5.8.0	5.9.0	T1-041125
TP-25	TP-040160	885	-	Changes to Initial Conditions of P4 Inter-RAT Cell Change Order from UTRAN test cases and Inter system cell reselection from UTRAN test cases.	F	5.8.0	5.9.0	T1-041129
TP-25	TP-040160	886	-	Correction to P1 MAC test 7.1.1.2	F	5.8.0	5.9.0	T1-041134
TP-25	TP-040160	887	-	New test preamble and postamble for inter-RAT handover/cell change test cases (revision of T1-040779)	F	5.8.0	5.9.0	T1-041145
TP-25	TP-040160	888	-	HSDPA Physical Channel Reconfiguration (Hard Handover)	F	5.8.0	5.9.0	T1-041146
TP-25	TP-040160	889	-	HSDPA Active Set Update in Soft Handover	F	5.8.0	5.9.0	T1-041147
TP-25	TP-040160	890	-	Correction to Package 1 RRC test cases 8.1.7.1 and 8.1.7.2	F	5.8.0	5.9.0	T1-041157
TP-25	TP-040160	891	-	Correction to GMM test cases 12.3.1.7 and 12.4.3.3 (Low Priority)	F	5.8.0	5.9.0	T1-041163
TP-25	TP-040160	892	-	Handling of PS support in step 3 in Package 2 MM testcase 9.4.8.	F	5.8.0	5.9.0	T1-041170
TP-25	TP-040160	893	-	Correction to Generic test procedure for testing multi-RB Combinations and Simultaneous Signalling	F	5.8.0	5.9.0	T1-041172
TP-25	TP-040160	894	-	Correction to generic test procedure for single HS-DSCH radio bearer configurations	F	5.8.0	5.9.0	T1-041198
TP-25	TP-040160	895	-	Correction to Package 1 GMM test case 12.9.1 to make step #9 void.	F	5.8.0	5.9.0	T1-041206
TP-25	TP-040160	896	-	Addition of Specific Message Content for Radio Bearer Setup message in P3 Radio Bearer test case 14.2.57	F	5.8.0	5.9.0	T1-041207

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-25	TP-040160	897	-	Corrections to CELL_DCH to CELL/URA_PCH state transition inconsistency in RRC test cases (package 1, 2 and low priority)	F	5.8.0	5.9.0	T1-041211
TP-25	TP-040160	898	-	Corrections to GCF Package 2 MM test cases 9.2.2, 9.4.2.1, 9.4.2.2.1 and GCF Package 4 test case 9.5.7.1	F	5.8.0	5.9.0	T1-041216
TP-25	TP-040160	899	-	Corrections to approved RRC Package 1 TC 8.3.4.3	F	5.8.0	5.9.0	T1-041221
TP-25	TP-040160	900	-	Corrections to RRC Package 4 TC 8.2.6.38	F	5.8.0	5.9.0	T1-041222
TP-25	TP-040160	901	-	Corrections to approved RRC Package 2 TC 8.2.2.23	F	5.8.0	5.9.0	T1-041225
TP-25	TP-040160	902	-	Updated preambles used for PDCP testing	F	5.8.0	5.9.0	T1-041228
TP-25	TP-040160	903	-	Add HCR TDD content of Inter-frequency measurement for event 2A	F	5.8.0	5.9.0	T1-041233
TP-25	TP-040160	904	-	Add TDD content of Inter-frequency measurement for event 2D and 2F	F	5.8.0	5.9.0	T1-041234
TP-25	TP-040160	905	-	Add to HCR TDD baseline IEs statement	F	5.8.0	5.9.0	T1-041236
TP-25	TP-040160	906	-	Correct 'time to trigger' for Measurement Report in Measurement Control Message	F	5.8.0	5.9.0	T1-041237
TP-25	TP-040160	907	-	Errors corrected in section 8.4.1.29 of TS34.123-1	F	5.8.0	5.9.0	T1-041238
TP-25	TP-040160	908	-	Add HCR TDD S-CCPCH & PRACH tests sections	F	5.8.0	5.9.0	T1-041240
TP-25	TP-040160	909	-	Correction to prose for Package 3 RRC test case 8.4.1.29	F	5.8.0	5.9.0	T1-041242
TP-25	TP-040160	910	-	Adding Specific Message Contents of SIB5 for 1.28 Mcps TDD in 8.1.1.4	F	5.8.0	5.9.0	T1-041245
TP-25	TP-040160	911	-	Adding Specific Message Contents for TDD 128 in 8.2.6.1	F	5.8.0	5.9.0	T1-041247
TP-25	TP-040160	912	-	Delay between CP-ACK and DISCONNECT in package 3 test case 16.1.1	F	5.8.0	5.9.0	T1-041249
TP-25	TP-040160	913	-	Correction to GCF P1 Test Case 8.1.2.2.	F	5.8.0	5.9.0	T1-041254
TP-25	TP-040160	914	-	Correction to low priority RRC test case 8.3.4.7	F	5.8.0	5.9.0	T1-041263
TP-25	TP-040160	915	-	Correction to low priority RRC test case 8.4.1.15	F	5.8.0	5.9.0	T1-041265
TP-25	TP-040160	916	-	Correction of the Measurement Report control timer in the Generic Test Procedure in Clause 14.1.2 and 14.1.2a of the Radio Bearer Tests.	F	5.8.0	5.9.0	T1-041269
TP-25	TP-040160	917	-	RoHC test case as part of PDCP conformance testing	B	5.8.0	5.9.0	T1-041270
TP-25	TP-040160	918	-	Correction to Package 2 test case 8.3.1.22	D	5.8.0	5.9.0	T1-041272
TP-25	TP-040160	919	-	Correction to Package 2 test case 8.2.4.3 & 8.2.4.4	F	5.8.0	5.9.0	T1-041274
TP-25	TP-040160	920	-	Correction to P1 MAC test 7.1.2.4a	F	5.8.0	5.9.0	T1-041276
TP-25	TP-040160	921	-	Correction to LP test case 8.2.3.27	F	5.8.0	5.9.0	T1-041277
TP-25	TP-040160	922	-	Correction to TC 8.2.6.39, 8.2.6.43, 8.2.6.44 and 8.3.3.3	F	5.8.0	5.9.0	T1-041278
TP-25	TP-040160	923	-	Correction to 8.3.9.X test cases	F	5.8.0	5.9.0	T1-041279
TP-25	TP-040160	852	-	Corrections to 8.4.1.8	F	5.8.0	5.9.0	T1-041280
TP-25	TP-040160	924	-	Correction to Low Priority RRC test 8.1.3.6	D	5.8.0	5.9.0	T1-041284
TP-25	TP-040160	925	-	Correction to Low Priority RRC test 8.3.2.5	F	5.8.0	5.9.0	T1-041285
TP-25	TP-040160	926	-	Correction to Low Priority RRC test 8.3.4.4	F	5.8.0	5.9.0	T1-041286
TP-25	TP-040160	927	-	Addition of new test cases for Physical Channel Reconfiguration (radio link failure in old configuration)	F	5.8.0	5.9.0	T1-041288
TP-25	TP-040160	928	-	Modify test cases 8.3.1.10 and 8.3.2.4 to allow dual mode UE time to camp on cell.	F	5.8.0	5.9.0	T1-041290
TP-25	TP-040160	929	-	New radio bearer test case for the support of Wideband AMR speech service	F	5.8.0	5.9.0	T1-041292
TP-25	TP-040160	930	-	Correction to low priority RRC test case 8.2.6.34	F	5.8.0	5.9.0	T1-041294
TP-25	TP-040160	931	-	Correction to low priority RRC test case 8.4.1.9	F	5.8.0	5.9.0	T1-041295
TP-25	TP-040160	932	-	Correction to P3 RRC test 8.4.1.39	F	5.8.0	5.9.0	T1-041296
TP-25	TP-040160	933	-	Update Package 2 test case 8.4.1.7	F	5.8.0	5.9.0	T1-041297
TP-25	TP-040160	934	-	New HSDPA RRC test cases	F	5.8.0	5.9.0	T1-041299
TP-25	TP-040160	935	-	HSDPA Inter-RAT Cell Change Order	F	5.8.0	5.9.0	T1-041300
TP-25	TP-040160	936	-	HSDPA Inter-RAT Handover Test Cases	F	5.8.0	5.9.0	T1-041412
TP-25	TP-040160	937	-	Correction to Package 2 MM TC 9.4.2.2.4.1 - to remove checking of CKSN, LAI and Mobile Identity IEs	F	5.8.0	5.9.0	T1-041413

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-25	TP-040160	938	-	Changes done in step 20 in test procedure 2 for package 3 GMM testcase 12.4.2.5a	F	5.8.0	5.9.0	T1-041417
TP-25	TP-040160	939	-	Correction to GMM test case 12.4.1.4c procedure2	F	5.8.0	5.9.0	T1-041419
TP-25	TP-040160	940	-	Correction to GMM test case 12.4.2.4 (P3)	F	5.8.0	5.9.0	T1-041420
TP-25	TP-040160	941	-	Correction to low priority radio bearer test cases (minimum set of TFCS) for HCR TDD	F	5.8.0	5.9.0	T1-041429
TP-25	TP-040160	942	-	CR to 34.123-1 REL-5: New test cases for A-GPS	F	5.8.0	5.9.0	T1-041430
TP-25	TP-040160	943	-	Correction to prose for Package 2 IR_U test case 6.2.2.1	F	5.8.0	5.9.0	T1-041434
TP-25	TP-040160	944	-	Update to the Expected Sequences in the Generic Radio Bearer Test Procedures of clause 14.1.1 and 14.1.2 to align with the approved TTCN.	F	5.8.0	5.9.0	T1-041436
TP-25	TP-040160	949	-	Correction to several GMM test cases – Mode C/A change	F	5.8.0	5.9.0	T1-041437
TP-25	TP-040160	946	-	Update to the Generic Radio Bearer Test Procedures re: Use of Primary/Secondary Scrambling codes	F	5.8.0	5.9.0	T1-041438
TP-25	TP-040160	947	-	Addition of new Inter-RAT test case.	F	5.8.0	5.9.0	T1-041442r1
TP-25	TP-040160	948	-	Update to the Generic Radio Bearer Test Procedures re: RM Attribute values	F	5.8.0	5.9.0	T1-041468
TP-26	TP-040235	950	-	Corrections to RRC Package 2 TC 8.2.4.3	F	5.9.0	5.10.0	T1-041526
TP-26	TP-040235	951	-	CR to 34.123-1 Rel-5: Correction to SIBs 3 and 4 for 3 MM test cases and 9 GMM test cases for cell selection	F	5.9.0	5.10.0	T1-041528
TP-26	TP-040235	952	-	Clarification in test case 11.3.3.1.	F	5.9.0	5.10.0	T1-041538
TP-26	TP-040235	953	-	Corrections to low priority RRC TCs 8.2.3.21, 8.2.6.26 and 8.2.6.32	F	5.9.0	5.10.0	T1-041543
TP-26	TP-040235	954	-	Correction to Low Priority NAS test case 12.2.1.5a.Proc2	F	5.9.0	5.10.0	T1-041544
TP-26	TP-040235	955	-	Correction to contents of SIB 11 and Cell Update in testcase 8.4.1.3	F	5.9.0	5.10.0	T1-041545
TP-26	TP-040235	956	-	Revisions to Package 3 measurement test cases 8.4.1.34, 8.4.1.35 and 8.4.1.36	F	5.9.0	5.10.0	T1-041546
TP-26	TP-040235	957	-	Correction to package 4 RRC test case 8.1.12	F	5.9.0	5.10.0	T1-041547
TP-26	TP-040235	958	-	Corrections to package 4 ISHO test case 8.3.7.12	F	5.9.0	5.10.0	T1-041548
TP-26	TP-040235	959	-	Correction to Low Priority RRC Test case 8.4.1.6	F	5.9.0	5.10.0	T1-041554
TP-26	TP-040235	960	-	Correction to P2 Inter-RAT cell reselection test cases 6.2.2.1 and 6.2.2.2	F	5.9.0	5.10.0	T1-041560
TP-26	TP-040235	961	-	CR to 34.123-1Rel-5: Correction of 8_4_1_1A for TDD	F	5.9.0	5.10.0	T1-041569
TP-26	TP-040235	962	-	CR to 34.123-1Rel-5: Correction of 8_4_1_3A for TDD	F	5.9.0	5.10.0	T1-041570
TP-26	TP-040235	963	-	CR to 34.123-1Rel-5: Correction of 8_4_1_5A for TDD	F	5.9.0	5.10.0	T1-041571
TP-26	TP-040235	964	-	CR to 34.123-1Rel-5: Correction of 8_4_1_7A for TDD	F	5.9.0	5.10.0	T1-041572
TP-26	TP-040235	965	-	CR to 34.123-1 Rel-5; Modification of low priority test case 8.2.4.24 to increase test coverage	F	5.9.0	5.10.0	T1-041587
TP-26	TP-040235	966	-	CR to 34.123-1 Rel-5; New Rel-5 Measurement Test Case	B	5.9.0	5.10.0	T1-041588
TP-26	TP-040235	967	-	Correction to package 2 approved RAB test case 14.2.29	F	5.9.0	5.10.0	T1-041592
TP-26	TP-040235	968	-	Correction to MAC-hs test cases	F	5.9.0	5.10.0	T1-041593

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-26	TP-040235	969	-	Correction to package 1 MAC approved test case 7.1.1.2	F	5.9.0	5.10.0	T1-041596
TP-26	TP-040235	970	-	Correction to package 2 RRC approved test case 8.3.1.22	F	5.9.0	5.10.0	T1-041597
TP-26	TP-040235	971	-	Add sections for tests on Shared Channels	F	5.9.0	5.10.0	T1-041602
TP-26	TP-040235	972	-	Add generic test procedure for tests Shared Channels	F	5.9.0	5.10.0	T1-041603
TP-26	TP-040235	973	-	Add to HCR TDD baseline IEs statement	F	5.9.0	5.10.0	T1-041604
TP-26	TP-040235	974	-	Add HCR to TDD IEs of Measurement report in 8.4.1.29.4	F	5.9.0	5.10.0	T1-041605
TP-26	TP-040235	975	-	CR to 34.123-1 R5: New test cases for A-GPS failure cases	F	5.9.0	5.10.0	T1-041610
TP-26	TP-040235	976	-	CR to 34.123-1 R5: Editorial corrections to A-GPS test cases	F	5.9.0	5.10.0	T1-041612
TP-26	TP-040235	977	-	CR to 34.123-1 R5: Corrections to A-GPS test cases	F	5.9.0	5.10.0	T1-041613
TP-26	TP-040235	978	-	Correction to low priority RRC test case 8.3.2.5	F	5.9.0	5.10.0	T1-041632
TP-26	TP-040235	979	-	Correction to package 2 GMM approved test case 12.4.2.2	F	5.9.0	5.10.0	T1-041634
TP-26	TP-040235	980	-	CR to 34.123-1 Rel-5: Correction to GCF Package 3 RRC test case 8.3.1.24	F	5.9.0	5.10.0	T1-041639
TP-26	TP-040235	981	-	CR to 34.123-1 Rel-5: Correction to GCF Package 4 RRC test case 8.2.2.4	F	5.9.0	5.10.0	T1-041640
TP-26	TP-040235	982	-	P-TMSI Change in RAU message (GPRS) for GCF Package 2 test case 12.8	F	5.9.0	5.10.0	T1-041656
TP-26	TP-040235	983	-	Correction of package 3 radio bearer test case 14.2.58	F	5.9.0	5.10.0	T1-041688
TP-26	TP-040235	984	-	Corrections to RB TCs 14.2.51a.1 (P3), 14.2.51a.2 (low-prio), 14.2.51b.1 (P3) and 14.2.51b.2 (low-prio)	F	5.9.0	5.10.0	T1-041691
TP-26	TP-040235	985	-	Addition of radio bearer test case for PS streaming and downlink rate up to 128 kbps	F	5.9.0	5.10.0	T1-041692
TP-26	TP-040235	986	-	CR to 34.123-1 Rel-5: Correction to prose for Package 2 MM test case 9.4.5.4.1 (Revision of T1-041527)	F	5.9.0	5.10.0	T1-041704
TP-26	TP-040235	987	-	Correction to Package 4 RRC test case 8.1.7.1d	F	5.9.0	5.10.0	T1-041705
TP-26	TP-040235	988	-	New HSDPA radio bearer test cases	F	5.9.0	5.10.0	T1-041733
TP-26	TP-040235	989	-	Correction to GMM test case 12.9.7a	F	5.9.0	5.10.0	T1-041739
TP-26	TP-040235	990	-	Corrections to RRC Package 4 test cases 8.4.1.42 & 8.4.1.43 (revision of T1-0401636)	F	5.9.0	5.10.0	T1-041760
TP-26	TP-040235	991	-	Correction to Package 1 measurement test case 8.4.1.5	F	5.9.0	5.10.0	T1-041783
TP-26	TP-040235	992	-	Correction to prose for Package 2 MM test case 9.4.2.1	F	5.9.0	5.10.0	T1-041784
TP-26	TP-040235	993	-	Corrections to MM Package 2 TC 9.4.9 revision of T1-041539.	F	5.9.0	5.10.0	T1-041787
TP-26	TP-040235	994	-	Correction to TC 8.2.4.1a	F	5.9.0	5.10.0	T1-041795

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
TP-26	TP-040235	995	-	Correction to TC 8.2.6.44	F	5.9.0	5.10.0	T1-041796
TP-26	TP-040235	996	-	Correction to Package 3 Idle Mode test case 6.1.1.7	F	5.9.0	5.10.0	T1-041807
TP-26	TP-040235	997	-	Correction to Package 4 test case 8.1.2.4	F	5.9.0	5.10.0	T1-041808
TP-26	TP-040235	998	-	Correction to Inter-RAT idle mode Package 2 test case 6.2.1.8	F	5.9.0	5.10.0	T1-041904
TP-26	TP-040235	999	-	CR to 34.123-1 Rel-5: Correction to Radio Bearer Setup used for RLC testing	F	5.9.0	5.10.0	T1-041906
TP-26	TP-040235	1000	-	Correction to Package 4 RRC test case 8.3.7.5	F	5.9.0	5.10.0	T1-041907
TP-26	TP-040235	1001	-	Correction to Package 4 RRC test case 8.1.3.9	F	5.9.0	5.10.0	T1-041908
TP-26	TP-040235	1002	-	Correction to Package 2 RRC test case 8.3.1.21	F	5.9.0	5.10.0	T1-041909
TP-26	TP-040235	1003	-	Correction to Package 3 RRC test case 8.3.2.11	F	5.9.0	5.10.0	T1-041910
TP-26	TP-040235	1004	-	Clarification in test case 11.2.2.2	F	5.9.0	5.10.0	T1-041911
TP-26	TP-040235	1005	-	Correction to Package 1 RRC test case 8.1.7.1b	F	5.9.0	5.10.0	T1-041912
TP-26	TP-040235	1006	-	CR to 34.123-1 Rel-5: Correction to GCF Package 3 RAB test cases 14.2.51b.1 & 14.2.38c (Revision of T1-041644)	F	5.9.0	5.10.0	T1-041913
TP-26	TP-040235	1007	-	Correction to prose for Package 4 RRC test case 8.1.7.1c	F	5.9.0	5.10.0	T1-041915
TP-26	TP-040235	1008	-	Correction to P1 RRC test case 8.4.1.1 (Revision of T1-041553)	F	5.9.0	5.10.0	T1-041916
TP-26	TP-040235	1009	-	CR to 34.123-1 Rel-5: Correction to prose for Package 3 MM test case 9.4.7 (revision of T1-041530)	F	5.9.0	5.10.0	T1-041917
TP-26	TP-040235	1010	-	More alignment of IE Names used in Clause 12 to the core specification	D	5.9.0	5.10.0	T1-041921
TP-26	TP-040235	1011	-	Correction to Approved GCF P4 NAS Test Case 12.9.7c	F	5.9.0	5.10.0	T1-041922
TP-26	TP-040235	1012	-	Corrections to high priority GMM test case 12.9.9	F	5.9.0	5.10.0	T1-041924
TP-26	TP-040235	1013	-	CR to 34.123-1 Rel-5: Correction to GCF Package 1 GMM test cases 12.9.1.(Revision of T1-041642)	F	5.9.0	5.10.0	T1-041925
TP-26	TP-040235	1014	-	Correction to GMM test cases in clause 12.9 (Revision of T1-041918)	F	5.9.0	5.10.0	T1-041928
TP-26	TP-040235	1015	-	CR to 34.123-1 Rel-5; Corrections to HSDPA RRC test cases (revision of T1-041755)	F	5.9.0	5.10.0	T1-041929
TP-26	TP-040235	1016	-	Correction to TC 12.9.8 (P4)	F	5.9.0	5.10.0	T1-041930
TP-26	TP-040235	1017	-	New HSDPA RRC test cases (intra-frequency) (revision of T1-041799)	F	5.9.0	5.10.0	T1-041934
TP-26	TP-040235	1018	-	New HSDPA RRC test cases (inter-frequency) (revision of T1-041800)	F	5.9.0	5.10.0	T1-041935
TP-26	TP-040235	1019	-	Updating "Conformance requirement" in test case 11.1.4.1 and addition of lower layer signalling.	F	5.9.0	5.10.0	T1-041946
TP-26	TP-040235	1020	-	Addition of inter-RAT handover test case to 34.123-1 (Revision of T1-041582)	F	5.9.0	5.10.0	T1-041947
TP-26	TP-040235	1021	-	Correction to low priority RRC test case 8.2.6.34	F	5.9.0	5.10.0	T1-041949
TP-26	TP-040235	1022	-	Alignment of IE values used in Clause 12 to the core	F	5.9.0	5.10.0	T1-041950

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				specification (Revision of T1-041561)				
TP-26	TP-040235	1023	-	Correction to GCF P3 Test Case 8.4.1.29	D	5.9.0	5.10.0	T1-041953
TP-26	TP-040235	1024	-	New test cases for Location updating / periodic search for HPLMN or higher priority PLMN when in VPLMN	F	5.9.0	5.10.0	T1-041954
TP-26	TP-040235	1025	-	Update of HSDPA radio bearer test cases 14.6.1 and 14.6.2	F	5.9.0	5.10.0	T1-041955
TP-26	TP-040235	1026	-	Correction to 14.1.2 (Revision of T1-041798)	F	5.9.0	5.10.0	T1-041956
TP-26	TP-040235	1027	-	CR to 34.123-1 R5: New test cases for A-GPS transfer to third party	F	5.9.0	5.10.0	T1-041957
TP-26	TP-040235	1028	-	CR to 34.123-1 R5: New test cases for A-GPS privacy options	F	5.9.0	5.10.0	T1-041958
TP-26	TP-040235	1029	-	CR to 34.123-1 R5: Assistance data for UE-assisted A-GPS	F	5.9.0	5.10.0	T1-041959
TP-26	TP-040235	1030	-	Update of radio bearer test case 14.2.62 for Wideband AMR	F	5.9.0	5.10.0	T1-041960
TP-26	TP-040235	1031	-	CR to 34.123-1 Rel-5; New HSDPA RRC test cases (revision of T1-041589)	B	5.9.0	5.10.0	T1-041961
TP-26	TP-040235	1032	-	New MAC-hs test case for transport format selection	F	5.9.0	5.10.0	T1-041962
TP-26	TP-040235	1033	-	Removal of optional "Follow-on request pending" indicator in SM test case 11.1.1.1.	F	5.9.0	5.10.0	T1-041966
TP-26	TP-040235	1034	-	Removal of optional "Follow-on request pending" indicator in SM test case 11.1.1.1a.	F	5.9.0	5.10.0	T1-041967
TP-26	TP-040235	1035	-	CR to 34.123-1 Rel-5: Correction to GCF Package 4 RRC test case 8.3.1.18	F	5.9.0	5.10.0	T1-041972
TP-26	TP-040235	1036	-	Correction to Package 2 IR_U test case 12.8	F	5.9.0	5.10.0	T1-041977
TP-26	TP-040235	1037	-	Correction to Package 2 testcase 8.4.1.7	F	5.9.0	5.10.0	T1-041902rev1
TP-26	TP-040235	1038	-	Modification of SIB5 content for package 4 testcase 14.4.2a.1 and Addition of Specific Message Content for Radio Bearer Setup message in section 14.4.2a.	F	5.9.0	5.10.0	T1-041512
TP-26	TP-040235	1039	-	CR to 34.123-1 Rel-5: Correction to GCF Package 3 RRC test case 8.3.2.13	F	5.9.0	5.10.0	T1-041637
TP-27	TP-050052	1040		Modification of SIB5 content for 18.2.5.2a.1 and Addition of Specific Message Content for Radio Bearer Setup message in section 18.2.5.2a.	F	5.10.0	5.11.0	T1-050294
TP-27	TP-050052	1041		Correction to Package 2 RRC test case 8.4.1.19 (Revison of T1-050046, T1-050291)	F	5.10.0	5.11.0	T1-050427
TP-27	TP-050052	1042		CR to 34.123-1 R5: New GMM test case for verification of follow-on request pending indicator.	F	5.10.0	5.11.0	T1-050446
TP-27	TP-050052	1043		Corrections to A-GPS test cases	F	5.10.0	5.11.0	T1-050174
TP-27	TP-050052	1044		Addition of GPS scenario and A-GPS assistance data to 34.123	F	5.10.0	5.11.0	T1-050457
TP-27	TP-050052	1045		Correction to Package 2 RRC test case 8.3.1.10	F	5.10.0	5.11.0	T1-050002
TP-27	TP-050052	1046		Correction to Package 4 NAS test case 12.4.1.4a	F	5.10.0	5.11.0	T1-050006
TP-27	TP-050052	1047		Correction to Package 4 NAS test case 12.4.1.4d Proc 1	F	5.10.0	5.11.0	T1-050007

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-27	TP-050052	1048		Correction to Package 4 RRC test case 8.1.3.5	F	5.10.0	5.11.0	T1-050008
TP-27	TP-050052	1049		Correction to Package 1 RRC test case 8.3.4.3	F	5.10.0	5.11.0	T1-050010
TP-27	TP-050052	1050		Correction to Package 4 NAS test case 9.4.3.5	D	5.10.0	5.11.0	T1-050011
TP-27	TP-050052	1051		Correction to Package 1 RRC test case 8.4.1.1	F	5.10.0	5.11.0	T1-050015
TP-27	TP-050052	1052		Correction to Package 3 RRC test case 8.4.1.37	D	5.10.0	5.11.0	T1-050016
TP-27	TP-050052	1053		Correction to Package 3 RRC test case 8.1.2.10	D	5.10.0	5.11.0	T1-050017
TP-27	TP-050052	1054		Correction to GCF P4 RRC 8.3.1.18	F	5.10.0	5.11.0	T1-050022
TP-27	TP-050052	1055		Correction to Package 1 RRC test case 8.1.2.2	F	5.10.0	5.11.0	T1-050023
TP-27	TP-050052	1056		Correction to Package 4 RRC test case 8.4.1.26	F	5.10.0	5.11.0	T1-050024
TP-27	TP-050052	1057		Correction to default contents of System Information Block 3 and 4 for Idle Mode test cases	F	5.10.0	5.11.0	T1-050025
TP-27	TP-050052	1058		Correction to GCF P4 IR_U 8.3.7.5	F	5.10.0	5.11.0	T1-050030
TP-27	TP-050052	1059		Correction to Package 2 MultiRAT GMM test case 12.8	F	5.10.0	5.11.0	T1-050032
TP-27	TP-050052	1060		Correction to Package 4 RAB test case 14.4.2a	F	5.10.0	5.11.0	T1-050041
TP-27	TP-050052	1061		Correction to NAS GMM test cases 12.4.2.6.1 and 12.4.2.6.2 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050044
TP-27	TP-050052	1062		Correction to P3 RRC test cases 8.4.1.40	F	5.10.0	5.11.0	T1-050049
TP-27	TP-050052	1063		Correction of USIM HPLMN information in idle mode test cases	F	5.10.0	5.11.0	T1-050050
TP-27	TP-050052	1064		Correction of "Test requirements" in high priority test case 14.2.32.2 (GCF WI -12) and in low priority test cases 14.2.31.1, 14.2.31.2, 14.2.35.1 and 14.2.35.2.	F	5.10.0	5.11.0	T1-050053
TP-27	TP-050052	1065		Corrections to GCF P3 test cases 14.2.51.1, 14.2.51a.1, 14.2.51b.1 and to low priority test cases 14.2.38d, 14.2.51a.2, 14.2.51b.2	F	5.10.0	5.11.0	T1-050054
TP-27	TP-050052	1066		Correction to RAB test case 14.2.34.1 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050058
TP-27	TP-050052	1067		CR to 34.123-1Rel-5: Correction of 8_4_1_2A for TDD	F	5.10.0	5.11.0	T1-050060
TP-27	TP-050052	1068		CR to 34.123-1Rel-5: Correction of 8_4_1_4A for TDD	F	5.10.0	5.11.0	T1-050061
TP-27	TP-050052	1069		CR to 34.123-1Rel-5: Correction of 8_4_1_6A for TDD	F	5.10.0	5.11.0	T1-050062
TP-27	TP-050052	1070		CR to 34.123-1Rel-5: Correction of 8_4_1_8A for TDD	F	5.10.0	5.11.0	T1-050063
TP-27	TP-050052	1071		Corrections to Package 4 RRC test case 8.1.2.3 & Package 1 RRC test case 8.1.2.9	F	5.10.0	5.11.0	T1-050071
TP-27	TP-050052	1072		Corrections to HSDPA RRC test cases 8.2.2.36, 8.2.2.37 & 8.2.2.38	F	5.10.0	5.11.0	T1-050074
TP-27	TP-050052	1073		Corrections to Package 4 GMM test case 12.9.7c	F	5.10.0	5.11.0	T1-050098
TP-27	TP-050052	1074		Editorial correction to P1 GMM test case 12.9.1	F	5.10.0	5.11.0	T1-050107
TP-27	TP-050052	1075		Correction to Package 2 MAC test case 7.1.3.1	F	5.10.0	5.11.0	T1-050127
TP-27	TP-050052	1076		Correction to Radio Bearer Setup used for RLC	F	5.10.0	5.11.0	T1-050128

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				testing				
TP-27	TP-050052	1077		Correction to MAC test cases 7.1.3.2	F	5.10.0	5.11.0	T1-050136
TP-27	TP-050052	1078		Correction to MAC-hs test cases 7.1.5.2	F	5.10.0	5.11.0	T1-050137
TP-27	TP-050052	1079		Correction to GCF low priority RRC test cases	F	5.10.0	5.11.0	T1-050160
TP-27	TP-050052	1080		Correction to GCF high priority (WI-010) RRC test cases	F	5.10.0	5.11.0	T1-050161
TP-27	TP-050052	1081		Correction to GCF high priority (WI-12) RRC test cases	F	5.10.0	5.11.0	T1-050162
TP-27	TP-050052	1082		Correction to GCF high priority (WI-14) RRC test cases	F	5.10.0	5.11.0	T1-050163
TP-27	TP-050052	1083		Correction of 3rd party transfer A-GPS test cases	F	5.10.0	5.11.0	T1-050168
TP-27	TP-050052	1084		Correction of UE-assisted A-GPS test cases	F	5.10.0	5.11.0	T1-050170
TP-27	TP-050052	1085		Correction to Approved RRC Package 3 TC 8.4.1.33	F	5.10.0	5.11.0	T1-050193
TP-27	TP-050052	1086		CR to TS 34.123-1 v5.a.0 - Correction to Package 2 Test Case 6.2.2.2	F	5.10.0	5.11.0	T1-050203
TP-27	TP-050052	1087		CR to TS 34.123-1 v5.a.0 - Correction to Low-Priority Test Case TC 8.1.8.3	F	5.10.0	5.11.0	T1-050204
TP-27	TP-050052	1088		CR to TS 34.123-1 v5.a.0 - Editorial corrections to Package 4 test case 8.3.7.5 and Package 3 test case 8.4.1.31	F	5.10.0	5.11.0	T1-050206
TP-27	TP-050052	1089		Correction to 34.123, clause 6, idle mode test case 6.1.2.9	F	5.10.0	5.11.0	T1-050232
TP-27	TP-050052	1091		Correction to Package 2 RRC test case 8.1.10.1	F	5.10.0	5.11.0	T1-050272
TP-27	TP-050052	1092		Correction to RRC test case 8.1.1.10 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050273
TP-27	TP-050052	1093		Correction to NAS GMM test case 12.4.1.5 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050274
TP-27	TP-050052	1094		Correction to RRC test cases 8.1.2.11 and 8.2.1.24 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050275
TP-27	TP-050052	1095		Correction to Package 2 RRC test case 8.4.1.7	F	5.10.0	5.11.0	T1-050276
TP-27	TP-050052	1096		Correction to NAS MM test case 9.4.2.4 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050277
TP-27	TP-050052	1097		Correction to Package 2 Testcase 8.2.4.1	F	5.10.0	5.11.0	T1-050285
TP-27	TP-050052	1098		CR to 34.123-1 : Correction to P4 RRC test case 8.2.2.35	F	5.10.0	5.11.0	T1-050287
TP-27	TP-050052	1099		Correction to Package 2 RRC test case 8.4.1.23 (Revision T1-050009)	F	5.10.0	5.11.0	T1-050290
TP-27	TP-050052	1100		Correction to GCF priority 2 (WI-010) RRC test case 8.4.1.14	F	5.10.0	5.11.0	T1-050299
TP-27	TP-050052	1101		Correction to Approved RRC Package 3 TC 8.4.1.31	F	5.10.0	5.11.0	T1-050402
TP-27	TP-050052	1102		Deletion of postamble of switch-off UE and detach in GMM test cases.	F	5.10.0	5.11.0	T1-050405
TP-27	TP-050052	1103		Correction to Package 2 RRC test case 8.3.1.31 (Revision of T1-050004)	F	5.10.0	5.11.0	T1-050407
TP-27	TP-050052	1104		Correction to Package 4 Inter-system handover test	F	5.10.0	5.11.0	T1-050410

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
				case 8.3.7.12				
TP-27	TP-050052	1105		Correction to Package 1 RRC test case 8.4.1.5	F	5.10.0	5.11.0	T1-050411
TP-27	TP-050052	1106		CR to 34.123-1 Rel-5; Corrections to RRC test cases on seamless SRNS relocation (revision of T1-050084)	F	5.10.0	5.11.0	T1-050412
TP-27	TP-050052	1107		CR to 34.123-1 Rel-5; New RRC test case on seamless SRNS relocation using Radio Bearer Reconfiguration (revision of T1-050085)	B	5.10.0	5.11.0	T1-050413
TP-27	TP-050052	1108		CR to TS34.123-1; New RRC test cases for Radio Bearer Setup Procedure	F	5.10.0	5.11.0	T1-050414
TP-27	TP-050052	1109		Correction to WI-012 test case 8.1.6.3	F	5.10.0	5.11.0	T1-050415
TP-27	TP-050052	1110		CR to 34.123-1 Rel-5: Correction to P4 RRC test case 8.3.11.4	F	5.10.0	5.11.0	T1-050416
TP-27	TP-050052	1111		Correction to Package 4 NAS test cases 12.6.1.3.1 , 12.6.1.3.2 and 12.9.6	F	5.10.0	5.11.0	T1-050417
TP-27	TP-050052	1112		Corrections to HSDPA RRC test case 8.2.2.39 (revision of T1-050270)	F	5.10.0	5.11.0	T1-050421
TP-27	TP-050052	1113		Correction to HSDPA generic radio bearer test procedure	F	5.10.0	5.11.0	T1-050425
TP-27	TP-050052	1114		Addition of inter-RAT handover test case (UE supporting DTM) to 34.123-1	F	5.10.0	5.11.0	T1-050428
TP-27	TP-050052	1115		Correcting Initial Conditions of Inter-RAT 8.3.7. test cases	F	5.10.0	5.11.0	T1-050429
TP-27	TP-050052	1116		CR to TS34.123-1 Rel-5; Addition of new HSDPA test case (Revision of T1-050179, T1-050265)	F	5.10.0	5.11.0	T1-050430
TP-27	TP-050052	1117		CR to TS34.123-1 Rel-5; Correction to TC 8.2.4.36 (Revision of T1-050181, T1-050266)	F	5.10.0	5.11.0	T1-050431
TP-27	TP-050052	1118		Correction to GCF P4 IR_U 8.3.7.9 and 8.3.7.13 (Revision of T1-050031 & T1-050408)	F	5.10.0	5.11.0	T1-050432
TP-27	TP-050052	1119		Alignment of IE Names used in Clause 12 to the core specification (revision of T1-050021)	D	5.10.0	5.11.0	T1-050434
TP-27	TP-050052	1120		Correction to Package 4 NAS test case 12.4.1.4c Proc 2 (revision of T1-050040)	D	5.10.0	5.11.0	T1-050439
TP-27	TP-050052	1121		Corrections to Package 4 GMM test case 12.4.1.1b	F	5.10.0	5.11.0	T1-050440
TP-27	TP-050052	1122		Correction to NAS GMM test case 12.3.2.8 (GCF Work Item 12)	F	5.10.0	5.11.0	T1-050442
TP-27	TP-050052	1123		Correction to GMM clause	F	5.10.0	5.11.0	T1-050443
TP-27	TP-050052	1124		Correction to Package 4 NAS test case 12.9.3	F	5.10.0	5.11.0	T1-050447
TP-27	TP-050052	1125		Corrections to Package 4 GMM test case 12.2.1.6.2. (Revision of T1-050097 & T1-050228).	F	5.10.0	5.11.0	T1-050448
TP-27	TP-050052	1126		Correction to Package 4 test case 12.2.1.5d (Revision of T1-050021)	F	5.10.0	5.11.0	T1-050449
TP-27	TP-050052	1127		Correction to Package 3 RB test case 14.2.51a.1	F	5.10.0	5.11.0	T1-050453
TP-27	TP-050052	1128		Correction of A-GPS assistance data sets	F	5.10.0	5.11.0	T1-050454
TP-27	TP-050052	1129		CR to 34.123-1 Rel-5: Correction to P4 RRC test case 8.1.7.1d (Revision of T1-050249)	F	5.10.0	5.11.0	T1-050471r1

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
TP-27	TP-050052	1130		CR to TS34.123-1 Rel-5; Correction to HSDPA test cases (Revision of T1-050182)	F	5.10.0	5.11.0	T1-050459
TP-27	TP-050052	1131		Corrections to HSDPA RRC test cases 8.2.1.28 & 8.2.3.34 (revision of T1-050073)	F	5.10.0	5.11.0	T1-050463
TP-27	TP-050052	1132		CR to 34.123-1 Rel-5; New HSDPA RRC test cases (revision of T1-050267)	B	5.10.0	5.11.0	T1-050465
TP-27	TP-050052	1133		Corrections to HSDPA RRC test case 8.2.2.40 (revision of T1-050271)	F	5.10.0	5.11.0	T1-050466
TP-27	TP-050052	1134		Correction to MAC-hs test cases 7.1.5.6	F	5.10.0	5.11.0	T1-050470
TP-27	TP-050052	1135		CR to TS 34.123-1 v5.a.0 - Correction to GCF P3 Test Case 8.3.2.12	F	5.10.0	5.11.0	T1-050205r1
TP-27	TP-050052	1136		Generic test procedure for HS-DSCH multi-RB combinations	F	5.10.0	5.11.0	T1-050467r1
TP-27	TP-050052	1137		Addition of details to HSDPA radio bearer test case 14.6.3a (new), 14.6.4, 14.6.4a (new), 14.6.5 and 14.6.5a (new)	F	5.10.0	5.11.0	T1-050475
TP-27	TP-050052	1138		Addition of details to HSDPA radio bearer test case 14.6.3	F	5.10.0	5.11.0	T1-050468
				2005-04: Cosmetic tidy up of clause styles; splits clause 8 into four files for easier manipulation.		5.11.0	5.11.1	

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-28	RP-050271	1139	-	Correction to Package 2 IR_U test case 6.2.2.1	F	5.11.1	5.12.0	R5-050636
RP-28	RP-050271	1140	-	CR to 34.123-1: Addition of test frequencies for Band V and VI for idle mode testing	F	5.11.1	5.12.0	R5-050748
RP-28	RP-050271	1141	-	Correction to GCF WI-10 Idle Mode Test Cases 6.1.1.7 and 6.1.2.8	F	5.11.1	5.12.0	R5-050791
RP-28	RP-050271	1142	-	FDD_Qmin values in cell reselection test cases 6.2.2.2 and 6.2.2.3	F	5.11.1	5.12.0	R5-050807
RP-28	RP-050271	1143	-	CR to 34.123-1 Rel-5; New cell reselection test case on HCS inter-frequency cell reselection	F	5.11.1	5.12.0	R5-050966
RP-28	RP-050271	1144	-	Correction to Package 2 RRC test case 8.1.10.1	F	5.11.1	5.12.0	R5-050504
RP-28	RP-050271	1145	-	Correction to RRC test case 8.1.1.9 (GCF Work Item 12)	F	5.11.1	5.12.0	R5-050523
RP-28	RP-050271	1146	-	Correcting initial conditions of Inter-RAT test cases 8.1.2.12 and 8.1.2.13	F	5.11.1	5.12.0	R5-050545
RP-28	RP-050271	1147	-	Corrections to P4 RRC test case 8.1.3.9	F	5.11.1	5.12.0	R5-050607
RP-28	RP-050271	1148	-	Correction to MIB, PLMN and Cell Value Tag Value Definition to 8.1	F	5.11.1	5.12.0	R5-050609
RP-28	RP-050271	1149	-	Addition of new Rel-5 RRC test cases to 34.123-1 for RRC Connection establishment using Default Radio Configurations	B	5.11.1	5.12.0	R5-050914
RP-28	RP-050271	1150	-	Correction to RRC test case 8.1.1.10 (GCF Work Item 12)	F	5.11.1	5.12.0	R5-050915
RP-28	RP-050271	1151	-	Correction to RRC Package 2 testcase 8.2.2.9	F	5.11.1	5.12.0	R5-050555
RP-28	RP-050271	1152	-	CR to 34.123-1 Rel-5; Correction to SRNS relocation test case 8.2.2.43	F	5.11.1	5.12.0	R5-050623
RP-28	RP-050271	1153	-	Correction to P4 RRC test case 8.2.6.38	F	5.11.1	5.12.0	R5-050637
RP-28	RP-050271	1154	-	Correction to Package 4 RRC test case 8.2.6.12	F	5.11.1	5.12.0	R5-050766
RP-28	RP-050271	1155	-	Correction to GCF WI-10 RRC Test Cases 8.2.4.10	F	5.11.1	5.12.0	R5-050789
RP-28	RP-050271	1156	-	Removal of TGPL2 from section 8.2	F	5.11.1	5.12.0	R5-050928
RP-28	RP-050271	1157	-	Correction of table number in Test 8.2.3.24	D	5.11.1	5.12.0	R5-050653
RP-28	RP-050271	1158	-	Correction to Package 2 RRC test case 8.3.1.21	F	5.11.1	5.12.0	R5-050505
RP-28	RP-050272	1159	-	Correction to Package 4 Inter system cell reselection test case 8.3.9.1	F	5.11.1	5.12.0	R5-050506
RP-28	RP-050272	1160	-	Correction to GCF WI-10 RRC Test Cases 8.3.1.3	D	5.11.1	5.12.0	R5-050589
RP-28	RP-050272	1161	-	Updation of Table 8.3.7-1 in section 8.3.7	F	5.11.1	5.12.0	R5-050596
RP-28	RP-050272	1162	-	Correction to MIB, PLMN and Cell Value Tag Value Definition to 8.3	F	5.11.1	5.12.0	R5-050610
RP-28	RP-050272	1163	-	Correction to RRC test case 8.3.11.4 (WI-010)	F	5.11.1	5.12.0	R5-050612
RP-28	RP-050272	1164	-	Correction to GCF WI-010 test cases 8.3.1.10 and 8.3.2.4	F	5.11.1	5.12.0	R5-050635
RP-28	RP-050272	1165	-	CR to 34.123-1: Correction to GCF WI-012 RRC test case 8.3.1.30.	F	5.11.1	5.12.0	R5-050754
RP-28	RP-050272	1166	-	Correction to RRC test case 8.3.1.18 (WI-010)	F	5.11.1	5.12.0	R5-050784
RP-28	RP-050272	1167	-	Correction to RRC test cases 8.3.4.1, 8.3.4.2 (P1), 8.3.4.8 (WI-12), 8.3.4.4, 8.3.4.5 (Low priority)	F	5.11.1	5.12.0	R5-050790
RP-28	RP-050272	1168	-	Corrections to GCF WI-010 (P4) approved test case 8.3.7.5	F	5.11.1	5.12.0	R5-050800
RP-28	RP-050272	1169	-	Correction to GCF WI-10 RRC Test Cases 8.3.7.13	F	5.11.1	5.12.0	R5-050926
RP-28	RP-050272	1170	-	Removal of TGPL2 for section 8.3	F	5.11.1	5.12.0	R5-050927
RP-28	RP-050272	1171	-	Correction to RRC Package 4 testcase 8.3.1.18	F	5.11.1	5.12.0	R5-050930
RP-28	RP-050272	1172	-	Correction to Package 4 Inter-system handover test case 8.3.7.12	F	5.11.1	5.12.0	R5-050931
RP-28	RP-050272	1173	-	Correction to GCF WI-10 Inter-RAT Test Case 8.3.7.12	D	5.11.1	5.12.0	R5-050932
RP-28	RP-050272	1174	-	Correction to Package 3 RRC test case 8.3.2.13	F	5.11.1	5.12.0	R5-050937
RP-28	RP-050272	1175	-	Addition of new Rel-5 RRC test cases to 34.123-1 for Inter-RAT Network Assisted Cell Change	B	5.11.1	5.12.0	R5-050940
RP-28	RP-050272	1176	-	Addition of new Rel-5 test cases for CELL_FACH and CELL_PCH state specific handling of Treselection and Qhyst parameters in cell reselection to 34.123-1	B	5.11.1	5.12.0	R5-050942
RP-28	RP-050272	1177	-	Correction to Package 3 RRC test case 8.3.1.23	F	5.11.1	5.12.0	R5-050944
RP-28	RP-050272	1178	-	Correction to Package 3 RRC test case 8.3.1.24	F	5.11.1	5.12.0	R5-050945
RP-28	RP-050273	1179	-	CR to 34.123-1 Rel-5: Addition of SIB 12 contents to section 8.3.9	F	5.11.1	5.12.0	R5-050974

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
RP-28	RP-050273	1180	-	CR to 34.123-1 Rel-5: Correction to WI-010 P4 IR_U test case 8.3.9.1	F	5.11.1	5.12.0	R5-050978
RP-28	RP-050273	1181	-	CR to 34.123-1 Rel-5: Correction to WI-010 P4 IR_U test case 8.3.9.5	F	5.11.1	5.12.0	R5-050979
RP-28	RP-050273	1182	-	Correction to GCF WI-10 IR_U Test Cases 8.3.7.12 (approved)	F	5.11.1	5.12.0	R5-050934
RP-28	RP-050273	1183	-	Correction to MIB, PLMN and Cell Value Tag Value Definition to 8.4	F	5.11.1	5.12.0	R5-050611
RP-28	RP-050273	1184	-	CR to 34.123-1 Rel-5; Removal of Release 5 test case 8.4.1.46	F	5.11.1	5.12.0	R5-050624
RP-28	RP-050273	1185	-	Corrections to GCF WI-010 (P2) approved test case 8.4.1.7	F	5.11.1	5.12.0	R5-050634
RP-28	RP-050273	1186	-	Correction to Package 4 RRC test case 8.4.1.41	F	5.11.1	5.12.0	R5-050646
RP-28	RP-050273	1187	-	CR to 34.123-1: Correction to GCF WI-012 RRC test case 8.4.1.6.	F	5.11.1	5.12.0	R5-050753
RP-28	RP-050273	1188	-	Correction to GCF WI-10 RRC Test Cases 8.4.1.29	F	5.11.1	5.12.0	R5-050792
RP-28	RP-050273	1189	-	Correction to GCF WI-10 RRC Test Cases 8.4.1.25	F	5.11.1	5.12.0	R5-050794
RP-28	RP-050273	1190	-	Correction to GCF WI-10 Inter-RAT Test Cases 8.4.1.31, 8.4.1.33, 8.4.1.34, 8.4.1.35, 8.4.1.36, 8.4.1.40 (Revision of R5-050598)	F	5.11.1	5.12.0	R5-050795
RP-28	RP-050273	1191	-	Removal of TGPL2 from section 8.4	F	5.11.1	5.12.0	R5-050929
RP-28	RP-050273	1192	-	Correction to Package 3 RRC test case 8.4.1.37	F	5.11.1	5.12.0	R5-050935
RP-28	RP-050273	1193	-	Clarification of Cell 3 CPICH level for 'Measurement Control and Report: Intra-frequency measurement for transition from CELL_DCH to CELL_FACH state (FDD)', Test 8.4.1.5	F	5.11.1	5.12.0	R5-050642
RP-28	RP-050273	1194	-	Correction to NAS MM test case 9.4.2.4 (GCF Work Item 12)	F	5.11.1	5.12.0	R5-050524
RP-28	RP-050273	1195	-	Corrections to low priority MM test case 9.4.5.4.3	F	5.11.1	5.12.0	R5-050659
RP-28	RP-050273	1196	-	Correction to GCF WI-10 NAS Test Cases 9.2.2	F	5.11.1	5.12.0	R5-050936
RP-28	RP-050273	1197	-	Correction to GCF WI-12 MM Test Case 9.4.3.3	F	5.11.1	5.12.0	R5-050946
RP-28	RP-050273	1198	-	Correction to GCF WI-10 NAS Test Case 9.4.1	F	5.11.1	5.12.0	R5-050952
RP-28	RP-050274	1199	-	Correction to NAS GMM test case 12.3.2.7 (GCF Work Item 12)	F	5.11.1	5.12.0	R5-050509
RP-28	RP-050274	1200	-	Correction to NAS GMM test case 12.9.9 (GCF Work Item 12)	F	5.11.1	5.12.0	R5-050510
RP-28	RP-050274	1201	-	Correction to GCF WI-10 RRC Test Case 12.2.2.1	F	5.11.1	5.12.0	R5-050569
RP-28	RP-050274	1202	-	CR to 34.123-1 : Correction to WI-012 GMM test case 12.3.2.8 Proc1	F	5.11.1	5.12.0	R5-050755
RP-28	RP-050274	1203	-	Correction to Package 4 NAS test case 12.2.1.5d	F	5.11.1	5.12.0	R5-050780
RP-28	RP-050274	1204	-	Correction to GCF WI-10 NAS Test Cases 12.4.1.4d	F	5.11.1	5.12.0	R5-050797
RP-28	RP-050274	1205	-	Deletion of postamble of switch-off UE and detach in GMM test cases 12.3.x	F	5.11.1	5.12.0	R5-050805
RP-28	RP-050274	1206	-	CR to 34.123-1:Corrections to GCF WI-010 RAB TC 14.2.43.1 and GCF WI-012 RAB TC 14.2.43.2.	F	5.11.1	5.12.0	R5-050949
RP-28	RP-050274	1207	-	CR to 34.123-1:Correction to GCF WI-010 P3 RAB TC 14.2.58a	F	5.11.1	5.12.0	R5-050950
RP-28	RP-050274	1208	-	Correction to test requirement of radio bearer test cases for multi radio bearer combinations (Section 14)	F	5.11.1	5.12.0	R5-050520
RP-28	RP-050274	1209	-	Correction to GCF WI-10 SMS Test Cases 16.1.2, 16.1.9.1, 16.1.9.2 and 16.1.10	D	5.11.1	5.12.0	R5-050798
RP-28	RP-050274	1210	-	CR to 34.123-1 Rel-5: Correction to WI-010 SMS test cases 16.1.2, 16.1.10, 16.2.2 and 16.2.10	F	5.11.1	5.12.0	R5-050951
RP-28	RP-050274	1211	-	CR 34.123-1 Correction to A-GPS test case 17.2.4.10	F	5.11.1	5.12.0	R5-050706
RP-28	RP-050274	1212	-	CR 34.123-1 Correction to initial UE conditions for A-GPS MT-LR test cases	F	5.11.1	5.12.0	R5-050708
RP-28	RP-050274	1213	-	Clarifications and editorial changes to A-GPS test cases	F	5.11.1	5.12.0	R5-050968
RP-28	RP-050274	1214	-	Corrections to HSDPA radio bearer test cases	F	5.11.1	5.12.0	R5-050563
RP-28	RP-050274	1215	-	Correction to GCF WI-014 RRC HSDPA test case 8.2.1.27	F	5.11.1	5.12.0	R5-050601
RP-28	RP-050274	1216	-	Correction to GCF WI-014 RRC HSDPA test case 8.2.1.31	F	5.11.1	5.12.0	R5-050603
RP-28	RP-050274	1217	-	Correction to GCF WI-014 RRC HSDPA test case 8.2.4.36	F	5.11.1	5.12.0	R5-050605
RP-28	RP-050274	1218	-	CR to 34.123-1: Correction to GCF WI-014 RRC	F	5.11.1	5.12.0	R5-050711

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				HSDPA test case 8.2.6.39a.				
RP-28	RP-050275	1219	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.32.	F	5.11.1	5.12.0	R5-050712
RP-28	RP-050275	1220	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.33.	F	5.11.1	5.12.0	R5-050713
RP-28	RP-050275	1221	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.34.	F	5.11.1	5.12.0	R5-050714
RP-28	RP-050275	1222	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.35.	F	5.11.1	5.12.0	R5-050715
RP-28	RP-050275	1223	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.36.	F	5.11.1	5.12.0	R5-050716
RP-28	RP-050275	1224	-	CR to 34.123-1: Correction to GCF WI-014 RRC HSDPA test case 8.3.1.37.	F	5.11.1	5.12.0	R5-050717
RP-28	RP-050275	1225	-	Correction to GCF WI-014 RRC HSDPA test case 8.2.1.28	F	5.11.1	5.12.0	R5-050776
RP-28	RP-050275	1226	-	CR to 34.123-1Rel-5: Message Content Correction for TDD in 8.4.1.24	F	5.11.1	5.12.0	R5-050580
RP-28	RP-050275	1227	-	CR to 34.123-1Rel-5: Message Content Correction for TDD in 8.4.1.25	F	5.11.1	5.12.0	R5-050581
RP-28	RP-050275	1228	-	CR to 34.123-1Rel-5: Message Content Correction for TDD in 8.4.1.26	F	5.11.1	5.12.0	R5-050582
RP-28	RP-050275	1229	-	CR to 34.123-1Rel-5: To Delete Test Case 7.1.2.2.3 of LCR TDD	F	5.11.1	5.12.0	R5-050925
RP-28	RP-050275	1230	-	Correction of 8_4_1_2A for TDD	F	5.11.1	5.12.0	R5-050688
RP-28	RP-050275	1231	-	Correction to MAC test cases 7.1.3.2 to add HCR TDD	F	5.11.1	5.12.0	R5-050689
RP-28	RP-050275	1232	-	Correction to RRC test case 8.4.1.1A (TDD)	F	5.11.1	5.12.0	R5-050691
RP-28	RP-050275	1233	-	Correction to RRC test case 8.4.1.5A (TDD)	F	5.11.1	5.12.0	R5-050693
RP-28	RP-050275	1234	-	8.2.2.43 RRC test case on seamless SRNS relocation using Radio Bearer Reconfiguration add TDD content	B	5.11.1	5.12.0	R5-050694
RP-28	RP-050275	1235	-	Correction to 8.1.8.3 to add TDD to step 2	F	5.11.1	5.12.0	R5-050695
RP-28	RP-050275	1236	-	Add TDD to RRC test case 8.3.11.4	F	5.11.1	5.12.0	R5-050696
RP-28	RP-050275	1237	-	Correction to RAB test case 18.2.2.34.1	F	5.11.1	5.12.0	R5-050698
RP-28	RP-050275	1238	-	Correct RAB test case 18.2.5.2a Poll_SDU value (TDD)	F	5.11.1	5.12.0	R5-050699
RP-28	RP-050276	1239	-	Tests for HCR TDD RAB combinations #38 thru #61	F	5.11.1	5.12.0	R5-050700
RP-28	RP-050276	1240	-	Add TDD to RRC test case 8.4.1.33	F	5.11.1	5.12.0	R5-050957
RP-28	RP-050276	1241	-	Correction to Package 4 RRC test case 8.4.1.26 to change TDD content	F	5.11.1	5.12.0	R5-050958
RP-28	RP-050276	1242	-	Correction RRC test case 8.4.1.7A (TDD)	F	5.11.1	5.12.0	R5-050959
RP-28	RP-050276	1243	-	Correction to Package 4 Inter system cell reselection test case 8.3.9.3	F	5.11.1	5.12.0	R5-050954
RP-28	RP-050276	1244	-	Correction to GCF WI-014 MAC-HS test case 7.1.5.1	F	5.11.1	5.12.0	R5-050970
RP-28	RP-050276	1245	-	Correction to GCF WI-014 MAC-HS test case 7.1.5.4	F	5.11.1	5.12.0	R5-050971
RP-28	RP-050276	1246	-	Correction to GCF WI-014 MAC-HS test case 7.1.5.5	F	5.11.1	5.12.0	R5-050972
RP-28	RP-050276	1247	-	Correction to GCF WI-10 NAS Test Cases 12.2.1.2, 12.2.1.5a Proc 1, 12.2.1.5a Proc 2, 12.3.2.7, 12.4.1.2 and 12.6.1.2	F	5.11.1	5.12.0	R5-050985
RP-28	RP-050276	1248	-	CR to 34.123-1 Rel-5: Correction to WI-012 RLC test case 7.2.3.28	F	5.11.1	5.12.0	R5-050876
RP-28	RP-050276	1249	-	Corrections to WI-10 P4 approved GMM test case 12.2.1.5a Test Procedures 1 & 2	F	5.11.1	5.12.0	R5-050878
RP-29	RP-050519	1250	-	Feature Clean Up: Removal of DRAC from RRC section 8.1 of 34.123-1	F	5.12.0	6.0.0	R5-051313
RP-29	RP-050519	1251	-	Feature Clean Up: Removal of DRAC from RRC section 8.2 of 34.123-1	F	5.12.0	6.0.0	R5-051314
RP-29	RP-050519	1252	-	Feature Clean Up: Removal of DRAC from RRC section 8.3 of 34.123-1	F	5.12.0	6.0.0	R5-051315
RP-29	RP-050519	1253	-	Feature Clean Up: Removal of DRAC from RRC section 8.4 of 34.123-1	F	5.12.0	6.0.0	R5-051316
RP-29	RP-050519	1254	-	Feature Clean Up: Removal of DSCH (FDD mode) from 34.123-1 clause 7	F	5.12.0	6.0.0	R5-051347
RP-29	RP-050519	1255	-	Feature Clean Up: Removal of DSCH (FDD mode) from 34.123-1 clause 8.1	F	5.12.0	6.0.0	R5-051348
RP-29	RP-050519	1256	-	Feature Clean Up: Removal of DSCH (FDD mode)	F	5.12.0	6.0.0	R5-051349

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				from 34.123-1 clause 8.2				
RP-29	RP-050519	1257	-	Feature Clean Up: Removal of DSCH (FDD mode) from 34.123-1 clause 8.3	F	5.12.0	6.0.0	R5-051350
RP-29	RP-050519	1258	-	Feature Clean Up: Removal of DSCH (FDD mode) from 34.123-1 clause 8.4	F	5.12.0	6.0.0	R5-051351
RP-29	RP-050519	1259	-	Feature Clean Up: Removal of DSCH (FDD mode) from 34.123-1 clause 14	F	5.12.0	6.0.0	R5-051352
RP-29	RP-050519	1260	-	Feature Clean Up: Removal of Observed time difference to GSM cell from 34.123-1 clause 8.3	F	5.12.0	6.0.0	R5-051354
RP-29	RP-050519	1261	-	Feature Clean Up: Removal of Observed time difference to GSM cell from 34.123-1 clause 8.4	F	5.12.0	6.0.0	R5-051355
RP-29	RP-050519	1262	-	Feature Clean Up: Removal of SSDT from 34.123-1 clause 8.1	F	5.12.0	6.0.0	R5-051357
RP-29	RP-050519	1263	-	Feature Clean Up: Removal of SSDT from 34.123-1 clause 8.2	F	5.12.0	6.0.0	R5-051358
RP-29	RP-050519	1264	-	Feature Clean Up: Removal of SSDT from 34.123-1 clause 8.3	F	5.12.0	6.0.0	R5-051359
RP-29	RP-050519	1265	-	Feature Clean Up: Removal of SSDT from 34.123-1 clause 8.4	F	5.12.0	6.0.0	R5-051360
RP-29	RP-050519	1266	-	Feature Clean Up: Removal of SSDT from 34.123-1 clause 14	F	5.12.0	6.0.0	R5-051361
RP-29	RP-050519	1267	-	Feature Clean Up: Removal of 80 ms TTI for DCH for all cases except when the UE supports SF512 from 34.123-1	F	5.12.0	6.0.0	R5-051380
RP-29	RP-050519	1268	-	Feature Clean Up: Removal of CPCH from MAC section 7.1	F	5.12.0	6.0.0	R5-051540
RP-29	RP-050519	1269	-	Feature Clean Up: Removal of CPCH from RRC section 8.2	F	5.12.0	6.0.0	R5-051541
RP-29	RP-050520	1270	-	Feature Clean Up: Removal of CPCH from RRC section 8.3	F	5.12.0	6.0.0	R5-051542
RP-29	RP-050514	1271	-	CR to 34.123-1Rel-5: Correction of testcase 8.2.1.4 for TDD	F	5.12.0	6.0.0	R5-051214
RP-29	RP-050514	1272	-	CR to 34.123-1Rel-5: Correction of testcase 8.2.2.4 for TDD	F	5.12.0	6.0.0	R5-051215
RP-29	RP-050514	1273	-	CR to 34.123-1Rel-5: Correction of testcase 8.2.6.6 for TDD	F	5.12.0	6.0.0	R5-051216
RP-29	RP-050520	1274	-	Correction of WI-10 TC 6.1.2.1 (TTCN approved)	F	5.12.0	6.0.0	R5-051039
RP-29	RP-050520	1275	-	Correction of WI-10 TC 6.1.2.8 (TTCN not approved)	F	5.12.0	6.0.0	R5-051040
RP-29	RP-050520	1276	-	Change test method for 6.2.2.2	F	5.12.0	6.0.0	R5-051303
RP-29	RP-050537	1277	-	Addition of new test case: 6.1.1.8 PLMN selection in shared network environment, Automatic mode	F	5.12.0	6.0.0	R5-051383
RP-29	RP-050537	1278	-	Addition of new test case: 6.2.1.10 Selection of PLMN and RAT in shared network environment, Automatic mode	F	5.12.0	6.0.0	R5-051382
RP-29	RP-050520	1279	-	Correction to WI-010 MAC test case 7.1.2.4a	F	5.12.0	6.0.0	R5-051310
RP-29	RP-050520	1280	-	Correction to Low Priority RRC test case 8.1.5.6	F	5.12.0	6.0.0	R5-051149
RP-29	RP-050520	1281	-	Correction to GCF WI-012 RRC test case 8.1.6.3	F	5.12.0	6.0.0	R5-051187
RP-29	RP-050537	1282	-	Addition of new test case: 8.1.1.11 Paging for Connection in idle mode (Shared Network environment)	F	5.12.0	6.0.0	R5-051374
RP-29	RP-050520	1283	-	Addition of a new Rel-5 RRC test case to 34.123-1 for Establishment Cause in Direct Transfer Procedure.	F	5.12.0	6.0.0	R5-051384
RP-29	RP-050520	1284	-	Correction to WI-10 RRC testcase 8.2.4.1	F	5.12.0	6.0.0	R5-051009
RP-29	RP-050520	1285	-	Correction to WI-12 RRC testcases 8.2.1.33 and 8.2.1.34	F	5.12.0	6.0.0	R5-051019
RP-29	RP-050520	1286	-	Correction to WI-10 RRC testcase 8.2.3.8	F	5.12.0	6.0.0	R5-051061
RP-29	RP-050520	1287	-	CR to 34.123-1: Correction to test case 8.2.6.29 (low priority)	F	5.12.0	6.0.0	R5-051105
RP-29	RP-050520	1288	-	Corrections to GCF WI-010 (P4) RRC test case 8.2.6.38	F	5.12.0	6.0.0	R5-051370
RP-29	RP-050520	1289	-	Correction to GCF WI-012 RRC test cases 8.2.6.39	F	5.12.0	6.0.0	R5-051376
RP-29	RP-050520	1290	-	Timing Reinitialized Handover & Radio Link Timing Adjustment	F	5.12.0	6.0.0	R5-051385
RP-29	RP-050520	1291	-	Correction to WI-10 RRC testcases 8.2.4.4 and 8.2.2.4	F	5.12.0	6.0.0	R5-051392
RP-29	RP-050520	1292	-	Correction to WI-10 RRC test cases 8.3.1.23, 8.3.1.24 and 8.3.2.13	F	5.12.0	6.0.0	R5-051005
RP-29	RP-050520	1293	-	Corrections to WI-10 test case 8.3.1.1	F	5.12.0	6.0.0	R5-051006

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-29	RP-050520	1294	-	Correction to WI-12 RRC testcase 8.3.1.30	F	5.12.0	6.0.0	R5-051011
RP-29	RP-050520	1295	-	Correction to WI-10 RRC testcase 8.3.4.2	F	5.12.0	6.0.0	R5-051020
RP-29	RP-050521	1296	-	Correction to WI-10 InterRAT cell change order from UTRAN testcase 8.3.11.4	F	5.12.0	6.0.0	R5-051323
RP-29	RP-050521	1297	-	Invalid Fach Measurement Occassion and Ntti combinations used in WI10/2 Test Case 8.3.1.21, WI-13/1 Test Case 8.3.1.38.	F	5.12.0	6.0.0	R5-051333
RP-29	RP-050521	1298	-	Correction to WI-10 Inter-system hard handover from UTRAN to GSM testcase 8.3.7.5	F	5.12.0	6.0.0	R5-051386
RP-29	RP-050521	1299	-	Addition of a new Rel-5 RRC test case to 34.123-1 for Establishment Cause in Cell Update Procedure.	F	5.12.0	6.0.0	R5-051387
RP-29	RP-050521	1300	-	Correction to GCF high priority (WI-010) RRC test case 8.3.4.2	F	5.12.0	6.0.0	R5-051394
RP-29	RP-050521	1301	-	Correction to WI-10 RRC testcase 8.4.1.14	F	5.12.0	6.0.0	R5-051042
RP-29	RP-050521	1302	-	Correction to WI-10 RRC test cases 8.4.1.14 and 8.4.1.28	F	5.12.0	6.0.0	R5-051045
RP-29	RP-050521	1303	-	Corrections to GCF WI-010 (P4) RRC test case 8.4.1.42	F	5.12.0	6.0.0	R5-051199
RP-29	RP-050521	1304	-	Correction to GCF WI-010/2 RRC test case 8.4.1.23	F	5.12.0	6.0.0	R5-051255
RP-29	RP-050521	1305	-	Correction to WI-10 Inter-RAT measurement in CELL_DCH testcase 8.4.1.31	F	5.12.0	6.0.0	R5-051261
RP-29	RP-050521	1306	-	Corrections to WI-10 test case 8.4.1.5	F	5.12.0	6.0.0	R5-051388
RP-29	RP-050521	1307	-	Correction to GCF WI-10 RRC test case 8.4.1.2, 8.4.1.24, 8.4.1.25	F	5.12.0	6.0.0	R5-051389
RP-29	RP-050521	1308	-	Corrections to GCF WI-010 (P2) RRC test case 8.4.1.8	F	5.12.0	6.0.0	R5-051390
RP-29	RP-050521	1309	-	Addition of a new Rel-5 RRC test case to 34.123-1 for RRC event-triggered periodic measurements for Event 1B.	F	5.12.0	6.0.0	R5-051391
RP-29	RP-050521	1310	-	Invalid Fach Measurement Occassion and Ntti combinations used in WI-12/1 Test Case 8.4.1.6.	F	5.12.0	6.0.0	R5-051395
RP-29	RP-050521	1311	-	Correction to WI-10 RRC testcases 8.4.1.23 and 8.4.1.16	F	5.12.0	6.0.0	R5-051507
RP-29	RP-050521	1312	-	Correction to WI-12 MM testcase 9.4.2.4.4	F	5.12.0	6.0.0	R5-051341
RP-29	RP-050521	1313	-	Corrections to GCF WI-12 NAS Test Case 9.4.5.4.6	F	5.12.0	6.0.0	R5-051396
RP-29	RP-050521	1314	-	Correction required for WI-010 P2 NAS Testcase 9.4.2.3.	F	5.12.0	6.0.0	R5-051397
RP-29	RP-050521	1315	-	Correction to WI-010 GMM test case 12.4.1.4b	F	5.12.0	6.0.0	R5-051147
RP-29	RP-050522	1316	-	Corrections to GCF WI-10 NAS Test Case 12.4.1.4d Proc 2	F	5.12.0	6.0.0	R5-051284
RP-29	RP-050522	1317	-	Correction to GMM test case clause 12.4.1.4a (GCF WI-10) (Revision of R5-051145)	F	5.12.0	6.0.0	R5-051398
RP-29	RP-050522	1318	-	Correction to WI-12 test case 12.9.7a	F	5.12.0	6.0.0	R5-051399
RP-29	RP-050522	1319	-	Correction to NAS test cases 12.4.1.4c, 12.2.1.5d, 12.3.2.8	F	5.12.0	6.0.0	R5-051506
RP-29	RP-050522	1320	-	Correction to WI-10 and WI-12 MultiRAB test cases 14.238c, 14.2.38f, 14.2.40, 14.2.41, 14.2.43.1, 14.2.43.2, 14.2.51.1, 14.2.51b.1, 14.2.58, 14.2.58a	F	5.12.0	6.0.0	R5-051320
RP-29	RP-050522	1321	-	Correction to NB AMR Radio Bearer Test Cases	F	5.12.0	6.0.0	R5-051508
RP-29	RP-050522	1322	-	Editorial Corrections to A-GPS Test Cases 17.2.3.4 and 17.2.3.9	F	5.12.0	6.0.0	R5-051188
RP-29	RP-050522	1323	-	Correction to Message Type IE in Supplementary Services Messages for A-GPS Test Cases	F	5.12.0	6.0.0	R5-051189
RP-29	RP-050522	1324	-	Correction of WI-14 HSDPA test case 8.2.1.29	F	5.12.0	6.0.0	R5-051012
RP-29	RP-050522	1325	-	Correction of WI-14 HSDPA test case 8.2.1.31	F	5.12.0	6.0.0	R5-051013
RP-29	RP-050522	1326	-	Correction to WI-14 MAC-Hs test case 7.1.5.1 and 7.1.5.5	F	5.12.0	6.0.0	R5-051021
RP-29	RP-050522	1327	-	Correction to WI-14 HSDPA RRC testcase 8.3.1.32	F	5.12.0	6.0.0	R5-051023
RP-29	RP-050513	1328	-	Cor Correction to HSDPA RAB test cases (WI-014)	F	5.12.0	6.0.0	R5-051151
RP-29	RP-050513	1329	-	Correction to MAC-hs test case 7.1.5.2 (WI-014)	F	5.12.0	6.0.0	R5-051162
RP-29	RP-050522	1330	-	Correction of WI-14 HSDPA test case 8.2.1.27	F	5.12.0	6.0.0	R5-051167
RP-29	RP-050522	1331	-	Correction of WI-14 HSDPA test case 8.2.1.30	F	5.12.0	6.0.0	R5-051168
RP-29	RP-050522	1332	-	Correction of WI-14 HSDPA test case 8.2.2.40	F	5.12.0	6.0.0	R5-051172
RP-29	RP-050522	1333	-	Correction of WI-14 HSDPA test case 8.3.1.32	F	5.12.0	6.0.0	R5-051173
RP-29	RP-050522	1334	-	Correction of WI-14 HSDPA test case 8.3.1.33	F	5.12.0	6.0.0	R5-051174

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-29	RP-050522	1335	-	Correction of WI-14 HSDPA test case 8.3.1.34 (not approved)	F	5.12.0	6.0.0	R5-051175
RP-29	RP-050522	1336	-	Correction of WI14 HSDPA test case 8.3.1.35 (not approved)	F	5.12.0	6.0.0	R5-051176
RP-29	RP-050522	1337	-	Correction to GCF WI-014/1 RRC HSDPA test case 8.2.3.35	F	5.12.0	6.0.0	R5-051186
RP-29	RP-050523	1338	-	Correction to 8.2.1.28	F	5.12.0	6.0.0	R5-051253
RP-29	RP-050523	1339	-	Correction to 8.2.4.36	F	5.12.0	6.0.0	R5-051254
RP-29	RP-050523	1340	-	Correction of WI-14 HSDPA test case 8.2.2.38	F	5.12.0	6.0.0	R5-051328
RP-29	RP-050523	1341	-	Correction of WI-14 HSDPA test case 8.2.2.39 (non approved test case)	F	5.12.0	6.0.0	R5-051329
RP-29	RP-050523	1342	-	Correction to GCF WI-014/1 RRC HSDPA test cases 8.2.6.39a & 8.2.6.39b	F	5.12.0	6.0.0	R5-051336
RP-29	RP-050523	1343	-	Correction to WI-14 HSDPA RRC testcase 8.2.1.29	F	5.12.0	6.0.0	R5-051340
RP-29	RP-050523	1344	-	Editorial Correction to Test Case 8.2.1.29, 8.2.1.32 and 8.2.3.31	F	5.12.0	6.0.0	R5-051362
RP-29	RP-050523	1345	-	Correction to RRC Test Case 8.2.3.33, 8.2.6.39a and 8.2.6.39b	F	5.12.0	6.0.0	R5-051363
RP-29	RP-050523	1346	-	Correction to MAC Test Case 7.1.5.6	F	5.12.0	6.0.0	R5-051364
RP-29	RP-050523	1347	-	Correction to GCF WI-014/2 RRC HSDPA test case 8.2.3.34	F	5.12.0	6.0.0	R5-051377
RP-29	RP-050523	1348	-	Correction to RRC HSDPA WI-14 test case 8.2.2.36.	F	5.12.0	6.0.0	R5-051509
RP-29	RP-050523	1349	-	Correction of WI-14 HSDPA test case 8.2.1.32	F	5.12.0	6.0.0	R5-051511
RP-29	RP-050523	1350	-	Correction of WI-14 HSDPA test case 8.3.1.36 (not approved).	F	5.12.0	6.0.0	R5-051515
RP-29	RP-050523	1351	-	Correction of WI-14 HSDPA test case 8.3.1.37 (not approved)	F	5.12.0	6.0.0	R5-051516
RP-29	RP-050523	1352	-	Secondary scrambling code in RADIO BEARER RELEASE messages in HSDPA RAB test cases	F	5.12.0	6.0.0	R5-051517
RP-29	RP-050523	1353	-	Correction to GCF WI-014/2 RRC HSDPA test case 8.2.3.31	F	5.12.0	6.0.0	R5-051518
RP-29	RP-050523	1354	-	Correction to GCF WI-014/2 RRC HSDPA test case 8.2.3.32	F	5.12.0	6.0.0	R5-051519
RP-29	RP-050523	1355	-	Correction to WI-14 HSDPA RRC testcase 8.2.2.40	F	5.12.0	6.0.0	R5-051521
RP-29	RP-050523	1356	-	Correction to WI-14 MAC-HS test case 7.1.5.3	F	5.12.0	6.0.0	R5-051551
RP-29	RP-050523	1357	-	Correction to WI-14 HSDPA RRC testcases 8.2.6.39a, 8.2.6.39b and 8.2.6.40	F	5.12.0	6.0.0	R5-051552
RP-29	RP-050599	1358	-	Correction to Annexure C.4 and C.5	F	5.12.0	6.0.0	R5-051322
RP-29	RP-050599	1359	-	Replacement of the technical content of 34.123-1 Rel-5 by a pointer to Rel-6 document	F	5.12.0	6.0.0	R5-051585
RP-29	RP-050599	1360	-	Correction to idle WI-10 test case 6.2.2.3 (not approved)	F	5.12.0	6.0.0	R5-051587
RP-29	RP-050599	1361	-	New test case for Inter-frequency and Inter-RAT measurements	F	5.12.0	6.0.0	R5-051591
RP-29	RP-050599	1362	-	Correction to WI-13/1 Test Case 6.1.2.10	F	5.12.0	6.0.0	R5-051592
RP-29	RP-050533	1367	-	Correction to WI-10 Inter system cell reselection testcases 8.3.9.1, 8.3.9.3 and 8.3.9.5	F	5.12.0	6.0.0	-
RP-30	RP-050781	1368	-	Correction to WI 14/1 HSDPA RRC testcase 8.2.2.40	F	6.0.0	6.1.0	R5-051805
RP-30	RP-050781	1369	-	Correction to WI 14/2 HSDPA RRC testcase 8.2.6.41	F	6.0.0	6.1.0	R5-051806
RP-30	RP-050781	1370	-	Correction to WI 14 HSDPA RRC testcases 8.3.1.34 and 8.3.1.36	F	6.0.0	6.1.0	R5-051807
RP-30	RP-050781	1371	-	Correction to WI 14/1 HSDPA RRC testcase 8.2.1.32	F	6.0.0	6.1.0	R5-051808
RP-30	RP-050781	1372	-	Correction to WI 14 Inter-RAT cell change order from UTRAN testcase 8.3.11.10	F	6.0.0	6.1.0	R5-052130
RP-30	RP-050781	1373	-	Correction to WI 14 HSDPA RRC testcases 8.2.1.30, 8.2.2.39, 8.2.2.42, 8.2.3.32, 8.2.3.33, 8.2.6.41, 8.2.6.42, 8.2.6.46.	F	6.0.0	6.1.0	R5-052153
RP-30	RP-050781	1374	-	Correction to WI 14 HSDPA RRC testcase 8.3.1.33	F	6.0.0	6.1.0	R5-052154
RP-30	RP-050781	1375	-	Correction to WI 14/2 HSDPA RRC testcase 8.3.1.37	F	6.0.0	6.1.0	R5-051850
RP-30	RP-050781	1376	-	Correction to HSDPA generic radio bearer test procedure (section 14.1.3)	F	6.0.0	6.1.0	R5-051856
RP-30	RP-050781	1377	-	Correction to WI-14/1 HSDPA test case 7.1.5.5	F	6.0.0	6.1.0	R5-051947
RP-30	RP-050781	1378	-	Correction to WI-14/2 HSDPA test case 8.2.6.46	F	6.0.0	6.1.0	R5-051948

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-30	RP-050781	1379	-	Corrections to WI-14 test case 8.3.7.14	F	6.0.0	6.1.0	R5-051952
RP-30	RP-050781	1380	-	Correction to Testcase 8.2.2.41	F	6.0.0	6.1.0	R5-051988
RP-30	RP-050781	1381	-	Correction to Radio Bearer Release Testcases (with HS-DSCH)	F	6.0.0	6.1.0	R5-051989
RP-30	RP-050781	1382	-	Correction to Testcase 8.3.4.9	F	6.0.0	6.1.0	R5-052071
RP-30	RP-050781	1383	-	Correction to Testcase 7.1.5.3	F	6.0.0	6.1.0	R5-052098
RP-30	RP-050781	1384	-	Correction to Testcase 7.1.5.4	F	6.0.0	6.1.0	R5-052099
RP-30	RP-050781	1385	-	Correction to Testcase 8.3.1.36	F	6.0.0	6.1.0	R5-052184
RP-30	RP-050781	1386	-	New radio bearer test cases for HSDPA WB AMR	F	6.0.0	6.1.0	R5-052052
RP-30	RP-050717	1387	-	New test case: (6.1.2.11 Cell reselection in shared network environment)	F	6.0.0	6.1.0	R5-051811
RP-30	RP-050717	1388	-	New RRC test case: 8.3.3.4 UTRAN Mobility Information: Shared Network	F	6.0.0	6.1.0	R5-052137
RP-30	RP-050716	1389	-	Addition of RADIO BEARER SETUP test case for EDCH	F	6.0.0	6.1.0	R5-052113
RP-30	RP-050716	1390	-	Addition of RADIO BEARER RELEASE test case for EDCH	F	6.0.0	6.1.0	R5-052166
RP-30	RP-050718	1391	-	CR to TS34.123-1; Adding a new test case for DSAC	F	6.0.0	6.1.0	R5-052161
RP-30	RP-050718	1392	-	Addition of new MM location updating test case for DSAC.	F	6.0.0	6.1.0	R5-052147
RP-30	RP-050718	1393	-	Addition of new MM connection test case for DSAC.	F	6.0.0	6.1.0	R5-052148
RP-30	RP-050718	1394	-	Introduction of new GMM test cases for Domain Specific Access Control in a network that operates in mode II.	F	6.0.0	6.1.0	R5-052180
RP-30	RP-050718	1395	-	Introduction of new GMM test cases for Domain Specific Access Control in a network that operates in mode I.	F	6.0.0	6.1.0	R5-052164
RP-30	RP-050777	1396	-	Change the System Information 11 (TDD) in 8.1.2.10.	F	6.0.0	6.1.0	R5-052063
RP-30	RP-050777	1397	-	Change the cell 1 power (TDD) at T1 and T2 in 8.3.1.21	F	6.0.0	6.1.0	R5-052064
RP-30	RP-050777	1398	-	Change Request to TC 8.3.1.22	F	6.0.0	6.1.0	R5-052065
RP-30	RP-050777	1399	-	Change the context of TRANSPORT CHANNEL RECONFIGURATION(TDD) in TC 8.2.4.1	F	6.0.0	6.1.0	R5-052066
RP-30	RP-050777	1400	-	Add the context of TRANSPORT CHANNEL RECONFIGURATION (TDD) in TC 8.2.4.1a, 8.2.4.3, 8.2.4.4, 8.2.4.10	F	6.0.0	6.1.0	R5-052067
RP-30	RP-050777	1401	-	Add P-CCPCH power for TDD in TC 8.3.11.6	F	6.0.0	6.1.0	R5-052068
RP-30	RP-050771	1402	-	Corrections to WI-10 test case 6.1.1.4	F	6.0.0	6.1.0	R5-052080
RP-30	RP-050771	1403	-	CR to 34.123-1: Correction to WI-010 (P2) test case 6.2.2.3	F	6.0.0	6.1.0	R5-052126
RP-30	RP-050771	1404	-	Editorial correction of missing generic test procedures to check UE"s state according to Annex C.	F	6.0.0	6.1.0	R5-052127
RP-30	RP-050771	1405	-	Correction to WI 10 and WI 12 RRC testcases 8.1.2.4, 8.1.2.10, 8.1.2.11, 8.1.10.1	F	6.0.0	6.1.0	R5-052156
RP-30	RP-050771	1406	-	Correction to WI 10/4 RRC test case 8.1.3.9	F	6.0.0	6.1.0	R5-051830
RP-30	RP-050771	1407	-	Corrections to WI-10 test case 8.1.10.1	F	6.0.0	6.1.0	R5-052087
RP-30	RP-050771	1408	-	Correction of WI-12 InterRAT test cases 8.1.2.12 and 8.1.2.13	F	6.0.0	6.1.0	R5-051949
RP-30	RP-050777	1409	-	Correction to Testcase 8.1.2.14	F	6.0.0	6.1.0	R5-052168
RP-30	RP-050777	1410	-	Correction to Testcase 8.1.2.15	F	6.0.0	6.1.0	R5-052169
RP-30	RP-050771	1411	-	Correction to WI 10 and WI 12 RRC testcases 8.2.1.24, 8.2.1.34, 8.2.2.31, 8.2.2.43, 8.2.6.37, 8.2.6.38	F	6.0.0	6.1.0	R5-052151
RP-30	RP-050771	1412	-	Corrections to WI-10 test case 8.2.2.35	F	6.0.0	6.1.0	R5-052183
RP-30	RP-050771	1413	-	Correction to WI-010 RRC test case 8.2.6.37	F	6.0.0	6.1.0	R5-051916
RP-30	RP-050771	1414	-	Correction to WI-12 test case 8.2.6.44	F	6.0.0	6.1.0	R5-052075
RP-30	RP-050771	1415	-	Correction to WI 10/4 Inter-RAT cell change order from UTRAN testcase 8.3.11.4	F	6.0.0	6.1.0	R5-052129
RP-30	RP-050771	1416	-	Correction to WI 10/4 Inter-system Handover from UTRAN to GSM testcase 8.3.7.12	F	6.0.0	6.1.0	R5-052131
RP-30	RP-050771	1417	-	Corrections to WI-10 test case 8.3.1.21	F	6.0.0	6.1.0	R5-052082
RP-30	RP-050771	1418	-	Corrections to WI-10 test case 8.3.2.13	F	6.0.0	6.1.0	R5-052132

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-30	RP-050777	1419	-	Correction to WI-013 test case 8.3.1.40	F	6.0.0	6.1.0	R5-051918
RP-30	RP-050771	1420	-	Correction of WI-10 InterRAT test cases 8.3.7.x	F	6.0.0	6.1.0	R5-051950
RP-30	RP-050771	1421	-	Corrections to WI-10 test case 8.3.1.18	F	6.0.0	6.1.0	R5-051951
RP-30	RP-050771	1422	-	Correction to WI-10/4 InterRAT test cases 8.3.11.1, 8.3.11.4	F	6.0.0	6.1.0	R5-051972
RP-30	RP-050777	1423	-	Correction to WI-13 InterRAT test cases 8.3.11.12, 8.3.11.13	F	6.0.0	6.1.0	R5-051973
RP-30	RP-050771	1424	-	Correction to WI-10/4 InterRAT test cases 8.3.9.1, 8.3.9.3, 8.3.9.5	F	6.0.0	6.1.0	R5-051975
RP-30	RP-050771	1425	-	Correction to WI-12 RRC test case 8.3.1.30	F	6.0.0	6.1.0	R5-052133
RP-30	RP-050772	1426	-	Correction to WI 10 and WI 12 RRC testcases 8.4.1.2, 8.4.1.6, 8.4.1.8, 8.4.1.25, 8.4.1.42, 8.4.1.43	F	6.0.0	6.1.0	R5-052152
RP-30	RP-050772	1427	-	Correction to WI 12 RRC testcase 8.4.1.6	F	6.0.0	6.1.0	R5-051829
RP-30	RP-050772	1428	-	Corrections to WI-12 test case 8.4.1.14	F	6.0.0	6.1.0	R5-052084
RP-30	RP-050772	1429	-	Corrections to WI-10 test case 8.4.1.3	F	6.0.0	6.1.0	R5-052085
RP-30	RP-050772	1430	-	Corrections to WI-10 test case 8.4.1.41	F	6.0.0	6.1.0	R5-051866
RP-30	RP-050772	1431	-	Corrections to WI-12 test case 8.4.1.6	F	6.0.0	6.1.0	R5-052134
RP-30	RP-050772	1432	-	Corrections to WI-10 test case 8.4.1.7	F	6.0.0	6.1.0	R5-051868
RP-30	RP-050772	1433	-	Correction to WI-10/3 InterRAT test cases 8.4.1.31, 8.4.1.33, 8.4.1.34, 8.4.1.35, 8.4.1.36, 8.4.1.40	F	6.0.0	6.1.0	R5-051969
RP-30	RP-050772	1434	-	Corrections to WI-010 test cases 8.4.1.33, 8.4.1.34, 8.4.1.35, 8.4.1.36, 8.4.1.37, 8.4.1.38, 8.4.1.39 and 8.4.1.40	F	6.0.0	6.1.0	R5-051984
RP-30	RP-050772	1435	-	Correction of RRC test cases 8.4.1.6 and 8.4.1.7	F	6.0.0	6.1.0	R5-052027
RP-30	RP-050772	1436	-	Correction of test case 8.4.1.8	F	6.0.0	6.1.0	R5-052058
RP-30	RP-050772	1437	-	Correction to MM section 9 to clarify test procedure for the PS registration in case of manual attach UE	F	6.0.0	6.1.0	R5-051804
RP-30	RP-050772	1438	-	Correction to WI 12 NAS test case 9.4.3.3	F	6.0.0	6.1.0	R5-052142
RP-30	RP-050772	1439	-	Correction of MM test case 9.4.2.4	F	6.0.0	6.1.0	R5-052076
RP-30	RP-050772	1440	-	Correction to WI 10 NAS test cases 12.9.12, 12.9.13 & 12.9.14	F	6.0.0	6.1.0	R5-051831
RP-30	RP-050772	1441	-	Correction to GMM test cases in clause12	F	6.0.0	6.1.0	R5-051870
RP-30	RP-050772	1442	-	Correction to WI-12 GMM test case 12.3.2.7	F	6.0.0	6.1.0	R5-052143
RP-30	RP-050772	1443	-	Correction to DPCCH Power Offset IE in RADIO BEARER SETUP message: AM or UM (Packet to CELL_DCH from CELL_DCH in PS).	F	6.0.0	6.1.0	R5-051822
RP-30	RP-050772	1444	-	Correction to WI 10/3 RB CTCH test case 14.4.4	F	6.0.0	6.1.0	R5-051842
RP-30	RP-050772	1445	-	Corrections to WI-12 test case 14.2.9	F	6.0.0	6.1.0	R5-051953
RP-30	RP-050772	1446	-	Corrections to low priority test cases 14.2.10 and 14.2.11	F	6.0.0	6.1.0	R5-051954
RP-30	RP-050776	1447	-	Addition of test case for multi-rate AMR-NB configuration using SRB#5	F	6.0.0	6.1.0	R5-052177
RP-30	RP-050772	1448	-	Correction to WI 12 Short message service cell broadcast test case 16.3	F	6.0.0	6.1.0	R5-052170
RP-30	RP-050771	1449	-	Corrections to GCF WI-15 test case 17.2.4.10	F	6.0.0	6.1.0	R5-052173
RP-30	RP-050781	1450	-	New radio bearer test cases for HSDPA streaming	F	6.0.0	6.1.0	R5-052051
RP-30	RP-050771	1451	-	Corrections to WI-10 NAS test case 9.4.5.4.1	F	6.0.0	6.1.0	R5-052157
RP-30	RP-050777	1452	-	Correction to GCF WI-10 RLC test cases 7.1.3.1, 7.2.2.2, 7.2.2.3, 7.2.2.4, 7.2.2.5, 7.2.2.6 and 7.2.2.7	F	6.0.0	6.1.0	R5-052207
RP-30	RP-050781	1453	-	Correction to RAB HSDPA generic procedure.	F	6.0.0	6.1.0	R5-052199
RP-31	RP-060145	1454	-	New test cases for MAC-es/e E-TFC selection	F	6.1.0	6.2.0	R5-060551
RP-31	RP-060156	1455	-	Correction to WI-12 GMM test case 12.3.2.8.1	F	6.1.0	6.2.0	R5-060562
RP-31	RP-060156	1456	-	Corrections to GCF WI-10 and 12 test case RRC Test Case 8.2.6.37, 8.2.6.38, 8.4.1.2, 8.4.1.6, 8.4.1.8, 8.4.1.24, 8.4.1.25, 8.4.1.42, 8.4.1.43	F	6.1.0	6.2.0	R5-060500
RP-31	RP-060156	1457	-	Corrections to GCF WI-010 RRC test case 8.4.1.23	F	6.1.0	6.2.0	R5-060398
RP-31	RP-060164	1458	-	Correction to Testcase 8.4.1.47	F	6.1.0	6.2.0	R5-060538
RP-31	RP-060145	1459	-	New test case for MAC-es/e transport block size selection	F	6.1.0	6.2.0	R5-060553
RP-31	RP-060145	1460	-	CR to 34.123-1;Adding new test cases for Enhanced Uplink	F	6.1.0	6.2.0	R5-060555
RP-31	RP-060145	1461	-	New test cases for MAC-es/e E-DCH retransmissions	F	6.1.0	6.2.0	R5-060552

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-31	RP-060145	1462	-	New test cases for MAC-es/e scheduling	F	6.1.0	6.2.0	R5-060550
RP-31	RP-060145	1463	-	New test cases for MAC-es/e multiplexing	F	6.1.0	6.2.0	R5-060549
RP-31	RP-060145	1464	-	New Radio Bearer Reconfiguration test cases for Enhanced uplink	F	6.1.0	6.2.0	R5-060374
RP-31	RP-060145	1465	-	Addition of a new FDD Enhanced Uplink Physical Channel Reconfiguration test case	F	6.1.0	6.2.0	R5-060372
RP-31	RP-060145	1466	-	Addition of two Cell Update test cases for FDD Enhanced Uplink testing	F	6.1.0	6.2.0	R5-060337
RP-31	RP-060145	1467	-	Addition of one test case about Physical Channel Reconfiguration for FDD Enhanced Uplink	F	6.1.0	6.2.0	R5-060548
RP-31	RP-060150	1468	-	New test case: 6.2.2.4 Cell reselection in multi-mode shared network environment	F	6.1.0	6.2.0	R5-060387
RP-31	RP-060150	1469	-	New test case: 6.2.1.11 Selection of PLMN and RAT in shared network environment, Manual mode	F	6.1.0	6.2.0	R5-060386
RP-31	RP-060150	1470	-	New test case: 6.1.1.9 PLMN selection in shared network environment, Manual Mode	F	6.1.0	6.2.0	R5-060385
RP-31	RP-060147	1471	-	Corrections to HSDPA RB test cases 14.6.8	F	6.1.0	6.2.0	R5-060369
RP-31	RP-060156	1472	-	Corrections to GCF WI-10 NAS test case 12.4.1.4c Proc 1	F	6.1.0	6.2.0	R5-060539
RP-31	RP-060156	1473	-	Correction of initial condition of TC 8.1.1.1 and TC 8.1.1.9 for CS domain	F	6.1.0	6.2.0	R5-060541
RP-31	RP-060150	1474	-	Correction of initial condition of TC 8.1.1.11 for CS domain	F	6.1.0	6.2.0	R5-060540
RP-31	RP-060147	1475	-	Correction to the HS-SCCH channelisation code used in the Radio Bearer control procedure test cases	F	6.1.0	6.2.0	R5-060325
RP-31	RP-060145	1476	-	Generic test procedure for E-DCH radio bearer testing	F	6.1.0	6.2.0	R5-060366
RP-31	RP-060145	1477	-	New E-DCH radio bearer test cases 14.7.5	F	6.1.0	6.2.0	R5-060330
RP-31	RP-060145	1478	-	New E-DCH radio bearer test cases 14.7.4	F	6.1.0	6.2.0	R5-060329
RP-31	RP-060145	1479	-	New EDCH Physical Channel Reconfiguration test case for transition from CELL_DCH to CELL_DCH: Success (with ongoing E-DCH transmission)	F	6.1.0	6.2.0	R5-060382
RP-31	RP-060145	1480	-	New E-DCH radio bearer test cases 14.7.1, 14.7.2 and 14.7.3	F	6.1.0	6.2.0	R5-060379
RP-31	RP-060156	1481	-	Corrections to GCF WI-10 RRC test case 8.3.2.13	F	6.1.0	6.2.0	R5-060397
RP-31	RP-060147	1482	-	Correction to GCF WI 14/2 Inter-system hard handover from UTRAN to GSM test case 8.3.7.14	F	6.1.0	6.2.0	R5-060228
RP-31	RP-060156	1483	-	Correction to GCF WI-012 MM test case 9.4.5.4.6	F	6.1.0	6.2.0	R5-060509
RP-31	RP-060156	1484	-	Correction to GCF WI 10/4 NAS test case 12.4.1.1b	F	6.1.0	6.2.0	R5-060080
RP-31	RP-060156	1485	-	Correction to RRC test cases 8.1.1.1, 8.1.1.9 and 8.1.1.11	F	6.1.0	6.2.0	R5-060504
RP-31	RP-060156	1486	-	Correction to approved WI-10 test case 8.3.7.5	F	6.1.0	6.2.0	R5-060209
RP-31	RP-060156	1487	-	Correction to approved WI-10 test case 8.4.1.31	F	6.1.0	6.2.0	R5-060208
RP-31	RP-060156	1488	-	Correction of WI-10 InterRAT test cases 6.2.X.X	F	6.1.0	6.2.0	R5-060051
RP-31	RP-060156	1489	-	CR to 34.123-1: Correction to WI-010 (P2) test case 6.2.2.3	F	6.1.0	6.2.0	R5-060009
RP-31	RP-060145	1490	-	New Physical Channel Reconfiguration test case for Enhanced uplink	F	6.1.0	6.2.0	R5-060376
RP-31	RP-060145	1491	-	Addition of two new FDD Enhanced Uplink Radio Bearer Reconfiguration test cases	F	6.1.0	6.2.0	R5-060371
RP-31	RP-060147	1492	-	Downlink compressed mode method when using HS-DSCH	F	6.1.0	6.2.0	R5-060503
RP-31	RP-060147	1493	-	Corrections to HSDPA RB test cases 14.6.6 and 14.6.7	F	6.1.0	6.2.0	R5-060169
RP-31	RP-060156	1494	-	Correction to testcase 14.2.58a and 14.2.51b.1	F	6.1.0	6.2.0	R5-060231
RP-31	RP-060156	1495	-	Correction to approved GMM test case 12.4.2.4	F	6.1.0	6.2.0	R5-060223
RP-31	RP-060156	1496	-	Correction to GCF WI-12/1 NAS test case 12.3.2.7	F	6.1.0	6.2.0	R5-060347
RP-31	RP-060156	1497	-	Corrections to GCF WI-10 test case 12.4.1.4c.1	F	6.1.0	6.2.0	R5-060067
RP-31	RP-060156	1498	-	Correction to approved MM test case 9.4.3.3	F	6.1.0	6.2.0	R5-060226
RP-31	RP-060156	1499	-	Correction to TC 9.4.5.4.1	F	6.1.0	6.2.0	R5-060136
RP-31	RP-060156	1500	-	Corrections to testcases 8.2.1.24 & 8.2.1.34	F	6.1.0	6.2.0	R5-060342
RP-31	RP-060156	1501	-	Correction to approved RRC test case 8.3.4.2	F	6.1.0	6.2.0	R5-060225
RP-31	RP-060157	1502	-	Correction to approved WI-10 test case 8.1.7.1d	F	6.1.0	6.2.0	R5-060204
RP-31	RP-060157	1503	-	Corrections to GCF WI-10 RRC test case 8.4.1.14	F	6.1.0	6.2.0	R5-060108

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
RP-31	RP-060157	1504	-	Corrections to GCF WI-12 RRC_ActSetUpdate test case 8.3.4.8	F	6.1.0	6.2.0	R5-060071
RP-31	RP-060157	1505	-	Correction of WI-10/3 Inter-RAT test case 8.4.1.31	F	6.1.0	6.2.0	R5-060068
RP-31	RP-060157	1506	-	Corrections to GCF WI-010 RRC test case 8.3.1.24	F	6.1.0	6.2.0	R5-060061
RP-31	RP-060157	1507	-	Corrections to GCF WI-010 RRC test case 8.3.1.18	F	6.1.0	6.2.0	R5-060060
RP-31	RP-060157	1508	-	Correction to WI-10/3 RRC testcase 8.4.1.36	F	6.1.0	6.2.0	R5-060052
RP-31	RP-060164	1509	-	Corrections to GCF WI-13/1 test case 8.3.1.40	F	6.1.0	6.2.0	R5-060346
RP-31	RP-060157	1510	-	Corrections to GCF WI-010/4 test case 8.3.11.4	F	6.1.0	6.2.0	R5-060345
RP-31	RP-060157	1511	-	Corrections to GCF WI-10/4 test case 8.3.7.12	F	6.1.0	6.2.0	R5-060344
RP-31	RP-060157	1512	-	Corrections to approved GCF WI-10 test case 7.1.2.4a	F	6.1.0	6.2.0	R5-060343
RP-31	RP-060157	1513	-	Corrections to GCF WI-10 test case 7.2.3.21 and 7.2.3.22	F	6.1.0	6.2.0	R5-060058
RP-31	RP-060157	1514	-	Corrections to GCF WI-10/1 Idle Mode test case 6.1.2.1	F	6.1.0	6.2.0	R5-060278
RP-31	RP-060157	1515	-	Correction to GCF WI-010 Idle Mode test case 6.1.1.4	F	6.1.0	6.2.0	R5-060199
RP-31	RP-060157	1516	-	Corrections to GCF WI-10/2 Idle Mode test case 6.1.2.8	F	6.1.0	6.2.0	R5-060050
RP-31	RP-060166	1517	-	CR to TS34.123-1; Correction to DSAC test cases at clause 12.	F	6.1.0	6.2.0	R5-060219
RP-31	RP-060166	1518	-	CR to TS34.123-1; Correction to the applicability in 9.4.3.6 and 9.5.9.	F	6.1.0	6.2.0	R5-060390
RP-31	RP-060166	1519	-	CR to TS34.123-1; Correction to RRC test case 8.1.2.16	F	6.1.0	6.2.0	R5-060217
RP-31	RP-060157	1520	-	Corrections to GCF WI-010/1 Idle Mode test case 6.1.2.2	F	6.1.0	6.2.0	R5-060134
RP-31	RP-060157	1521	-	Correction to GCF WI-010 HCS idle mode test cases 6.1.2.3, 6.1.2.4 and 6.1.2.5	F	6.1.0	6.2.0	R5-060120
RP-31	RP-060164	1522	-	Correction to GCF WI-013 HCS idle mode test case 6.1.2.10	F	6.1.0	6.2.0	R5-060121
RP-31	RP-060164	1523	-	Correction to GCF WI-013 RAB test case 14.2.62	F	6.1.0	6.2.0	R5-060076
RP-31	RP-060163	1524	-	Update of GCF WI-013 RB test case 14.2.4b	F	6.1.0	6.2.0	R5-060126
RP-31	RP-060150	1525	-	Removal of all references to TDD in 34.123-1	F	6.1.0	6.2.0	R5-060148
RP-31	RP-060150	1526	-	Corrections to broadcasted PLMN codes in idle mode tests (Network Sharing)	F	6.1.0	6.2.0	R5-060147
RP-31	RP-060147	1527	-	CR to TS34.123-1:New test case for HSDPA RAB combination with uplink 128 kpbs	F	6.1.0	6.2.0	R5-060300
RP-31	RP-060147	1528	-	Correction to testcase 14.6.5	F	6.1.0	6.2.0	R5-060361
RP-31	RP-060147	1529	-	Correction to Testcase 7.1.5.2	F	6.1.0	6.2.0	R5-060252
RP-31	RP-060147	1530	-	Corrections to testcases 8.2.3.33, 8.2.6.39a & 8.2.6.39b	F	6.1.0	6.2.0	R5-060232
RP-31	RP-060147	1531	-	Correction to GCF WI 14/2 Inter-RAT cell change order from UTRAN test case 8.3.11.10	F	6.1.0	6.2.0	R5-060227
RP-31	RP-060147	1532	-	Corrections to WI-14 HSDPA UL 64 kbps RAB test cases	F	6.1.0	6.2.0	R5-060207
RP-31	RP-060147	1533	-	Correction to WI-14 test case 8.3.11.10	F	6.1.0	6.2.0	R5-060205
RP-31	RP-060147	1534	-	Introduction of generic test procedure for testing of HSDPA radio bearers in combination with AMR using SRB#5 for TFC control	F	6.1.0	6.2.0	R5-060202
RP-31	RP-060147	1535	-	Correction to GCF WI 14/2 RRC testcase 8.2.3.33	F	6.1.0	6.2.0	R5-060334
RP-31	RP-060147	1536	-	Correction to GCF WI 14/2 RRC testcase 8.2.2.42	F	6.1.0	6.2.0	R5-060079
RP-31	RP-060147	1537	-	Correction to GCF WI 14/2 RRC test case 8.3.4.9	F	6.1.0	6.2.0	R5-060078
RP-31	RP-060157	1538	-	Addition of T309 timer value	F	6.1.0	6.2.0	R5-060567
RP-31	RP-060157	1539	-	Corrections to GCF WI-010 RRC test case 8.4.1.43	F	6.1.0	6.2.0	R5-060558
RP-31	RP-060157	1540	-	Corrections to GCF WI-12/1 InterRAT test case 8.4.1.48	F	6.1.0	6.2.0	R5-060559
-	-	-	-	File 34123-1-320_s13_s15.doc crashes MS Word2000 - repaired by ETSI MCC	-	6.2.0	6.2.1	-
RP-32	RP-060337	1541	-	Correction to the table 8.3.7-1 for GCF WI 14/2 Inter-system hard handover from UTRAN to GSM test case 8.3.7.14	F	6.2.1	6.3.0	R5-061030
RP-32	RP-060337	1542	-	Corrections to GCF WI-014 HSENH test case 8.2.6.39b	F	6.2.1	6.3.0	R5-061296
RP-32	RP-060337	1543	-	Correction to testcase 8.2.6.48	F	6.2.1	6.3.0	R5-061297
RP-32	RP-060337	1544	-	Corrections to WI-14 HSDPA UL 64 kbps RAB test	F	6.2.1	6.3.0	R5-061298

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				cases				
RP-32	RP-060337	1545	-	Correction to the initial conditions for mac-hs testcases	F	6.2.1	6.3.0	R5-061301
RP-32	RP-060337	1546	-	Correction to the generic test procedure for HS-DSCH radio bearer combinations with AMR RB configurations using SRB#5 for TFC control	F	6.2.1	6.3.0	R5-061331
RP-32	RP-060337	1547	-	Correction to GCF WI-14 radio bearer test case 14.6.5	F	6.2.1	6.3.0	R5-061199
RP-32	RP-060337	1548	-	Correction to GCF WI-014 test case 7.1.5.6	F	6.2.1	6.3.0	R5-061394
RP-32	RP-060337	1549	-	Correction to GCF WI 14/2 RRC testcase 8.2.6.48	F	6.2.1	6.3.0	R5-061280
RP-32	RP-060338	1550	-	Contents addition for LCR TDD in 8.2.1.32	F	6.2.1	6.3.0	R5-061039
RP-32	RP-060338	1551	-	CR for 34.123-1:Addition of the test case of 8.2.1.27a for LCR TDD	F	6.2.1	6.3.0	R5-061055
RP-32	RP-060338	1552	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.1.28	F	6.2.1	6.3.0	R5-061056
RP-32	RP-060338	1553	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.2.36	F	6.2.1	6.3.0	R5-061057
RP-32	RP-060338	1554	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.2.37	F	6.2.1	6.3.0	R5-061058
RP-32	RP-060338	1555	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.2.38	F	6.2.1	6.3.0	R5-061059
RP-32	RP-060338	1556	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.2.41	F	6.2.1	6.3.0	R5-061060
RP-32	RP-060338	1557	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.3.30	F	6.2.1	6.3.0	R5-061292
RP-32	RP-060338	1558	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.3.31	F	6.2.1	6.3.0	R5-061062
RP-32	RP-060338	1559	-	CR for 34.123-1:Contents addition for LCR TDD in 8.2.3.35	F	6.2.1	6.3.0	R5-061063
RP-32	RP-060338	1560	-	CR for 34.123-1:Contents Addition for LCR TDD in 8.3.1.32	F	6.2.1	6.3.0	R5-061064
RP-32	RP-060338	1561	-	CR for 34.123-1:Contents Addition for LCR TDD in 8.3.1.35	F	6.2.1	6.3.0	R5-061065
RP-32	RP-060338	1562	-	CR for 34.123-1:Addition of test cases of the combinations on DPCH and HS-PDSCH for LCR TDD	F	6.2.1	6.3.0	R5-061066
RP-32	RP-060338	1563	-	Contents addition for LCR TDD in 8.2.1.31	F	6.2.1	6.3.0	R5-061154
RP-32	RP-060332	1564	-	New Enhanced Uplink RRC test case for Active Set Update With Serving Cell Change	F	6.2.1	6.3.0	R5-061351
RP-32	RP-060332	1565	-	Correction to Enhanced uplink RRC test case 8.2.6.51 on MAC-d flow multiplexing	F	6.2.1	6.3.0	R5-061304
RP-32	RP-060332	1566	-	New Radio Bearer Reconfiguration test cases for Enhanced uplink	F	6.2.1	6.3.0	R5-061382
RP-32	RP-060332	1567	-	Generalize E-DCH radio bearer names	F	6.2.1	6.3.0	R5-061159
RP-32	RP-060332	1568	-	Addition of details to E-DCH radio bearer test case 14.7.5	F	6.2.1	6.3.0	R5-061316
RP-32	RP-060332	1569	-	Introduction of test cases for conversational radio bearer combinations for E-DCH/HS-DSCH testing	F	6.2.1	6.3.0	R5-061317
RP-32	RP-060333	1570	-	Test case 7.1.6.2.1 for MAC-es/e scheduling	F	6.2.1	6.3.0	R5-061343
RP-32	RP-060333	1571	-	New MAC-es/e combined non-scheduled and scheduled transmissions test case	F	6.2.1	6.3.0	R5-061513
RP-32	RP-060333	1572	-	Correction to Enhanced Uplink DCH test case	F	6.2.1	6.3.0	R5-061306
RP-32	RP-060333	1573	-	New Mac-es/e test case de-activation and re-activation of HARQ processes	F	6.2.1	6.3.0	R5-061307
RP-32	RP-060333	1574	-	New Mac-es/e test case correct handling of absolute grants	F	6.2.1	6.3.0	R5-061308
RP-32	RP-060333	1575	-	New Mac-es/e test case correct handling of relative grants	F	6.2.1	6.3.0	R5-061309
RP-32	RP-060333	1576	-	E-HICH/E-RGCH and E-AGCH codes used in Physical Channel Reconfiguration test cases	F	6.2.1	6.3.0	R5-061247
RP-32	RP-060333	1577	-	Introduction of test case for WB-AMR RAB combination for E-DCH/HS-DSCH testing	F	6.2.1	6.3.0	R5-061340
RP-32	RP-060331	1578	-	Correction to GMM test cases in sub clause 12.4.2.11, 12.4.2.12	F	6.2.1	6.3.0	R5-061077
RP-32	RP-060322	1579	-	Corrections to GCF WI-010 RRC test cases 6.1.2.4 and 6.1.2.5 .	F	6.2.1	6.3.0	R5-061319
RP-32	RP-060329	1580	-	Corrections to GCF WI-013 Idle Mode test case 6.1.2.10	F	6.2.1	6.3.0	R5-061320
RP-32	RP-060322	1582	-	Correction to GCF WI 10/3 Idle mode testcase 6.1.2.6	F	6.2.1	6.3.0	R5-061378

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
RP-32	RP-060322	1583	-	Correction to GCF WI-10/2 InterRAT test case 6.2.2.1	F	6.2.1	6.3.0	R5-061099
RP-32	RP-060322	1584	-	Correction to GCF WI-10/2 InterRAT test case 6.2.2.2	F	6.2.1	6.3.0	R5-061102
RP-32	RP-060329	1585	-	Correction to GCF WI 13/1 RRC testcase 8.4.1.47	F	6.2.1	6.3.0	R5-061029
RP-32	RP-060323	1586	-	Corrections to GCF WI-010 RRC test case 8.4.1.25.	F	6.2.1	6.3.0	R5-061370
RP-32	RP-060329	1587	-	Correction to WI-13 RRC test case 8.4.1.47	F	6.2.1	6.3.0	R5-061071
RP-32	RP-060323	1588	-	Corrections to GCF WI 10 and WI 12 RRC test case 8.1.1.1 and 8.1.1.9	F	6.2.1	6.3.0	R5-061078
RP-32	RP-060323	1589	-	Correction to GCF WI 12/1 RRC testcase 8.2.6.44	F	6.2.1	6.3.0	R5-061323
RP-32	RP-060323	1590	-	Correction to GCF WI 12/1 RRC testcase 8.2.6.39	F	6.2.1	6.3.0	R5-061324
RP-32	RP-060323	1591	-	Editorial Corrections to GCF WI-10/3 InterRAT test case 8.4.1.33	F	6.2.1	6.3.0	R5-061122
RP-32	RP-060323	1592	-	Editorial correction to GCF WI-10/3 InterRAT test case 8.4.1.34	F	6.2.1	6.3.0	R5-061125
RP-32	RP-060323	1593	-	Editorial correction to GCF WI-10/3 InterRAT test case 8.4.1.35	F	6.2.1	6.3.0	R5-061127
RP-32	RP-060323	1594	-	Editorial correction to GCF WI-10/3 InterRAT test case 8.4.1.36	F	6.2.1	6.3.0	R5-061128
RP-32	RP-060323	1595	-	Editorial Correction to GCF WI-10/3 InterRAT test case 8.4.1.40	F	6.2.1	6.3.0	R5-061129
RP-32	RP-060323	1596	-	Editorial Correction to GCF WI-12/1 InterRAT test case 8.4.1.48	F	6.2.1	6.3.0	R5-061130
RP-32	RP-060323	1597	-	34.123-1 Section 8.1 - Corrections to the values for IE based on calculated ASN.1 value.	F	6.2.1	6.3.0	R5-061325
RP-32	RP-060323	1598	-	34.123-1 Section 8.2 - Corrections to the values for IE based on calculated ASN.1 value.	F	6.2.1	6.3.0	R5-061132
RP-32	RP-060323	1599	-	34.123-1 Section 8.3 - Corrections to the values for IE based on calculated ASN.1 value.	F	6.2.1	6.3.0	R5-061353
RP-32	RP-060323	1600	-	Corrections to values for IEs based on calculated ASN.1	F	6.2.1	6.3.0	R5-061326
RP-32	RP-060329	1601	-	Correction to testcase 8.4.1.47	F	6.2.1	6.3.0	R5-061327
RP-32	RP-060329	1602	-	Correction to GCF WI-13 Inter-RAT cell change order from UTRAN test case 8.3.11.12 and 8.3.11.13	F	6.2.1	6.3.0	R5-061371
RP-32	RP-060323	1603	-	Correction to WI-012 RRC test case 8.4.1.48	F	6.2.1	6.3.0	R5-061170
RP-32	RP-060323	1604	-	Correction to WI-12 RRC test case 8.3.1.30	F	6.2.1	6.3.0	R5-061302
RP-32	RP-060323	1605	-	Correction to GCF WI-12 test case 8.3.1.30	F	6.2.1	6.3.0	R5-061222
RP-32	RP-060323	1606	-	Correction to GCF WI-10 test case 8.4.1.35	F	6.2.1	6.3.0	R5-061239
RP-32	RP-060323	1607	-	Correction to testcase 9.4.3.3	F	6.2.1	6.3.0	R5-061360
RP-32	RP-060323	1608	-	Correction to approved GMM TC 12.4.1.4a	F	6.2.1	6.3.0	R5-061275
RP-32	RP-060324	1609	-	Correction to GCF WI-10 GMM test case 12.4.1.4b	F	6.2.1	6.3.0	R5-061137
RP-32	RP-060324	1610	-	Correction to approved GMM TC 12.9.7b	F	6.2.1	6.3.0	R5-061352
RP-32	RP-060324	1611	-	Correction to GCF WI-12 GMM test case 12.4.1.1b	F	6.2.1	6.3.0	R5-061328
RP-32	RP-060324	1612	-	Correction to testcase 14.2.40 and 14.2.41	F	6.2.1	6.3.0	R5-061329
RP-32	RP-060328	1613	-	Correction to the generic radio bearer test procedure for standalone AMR RB configurations using SRB#5 for TFC control	F	6.2.1	6.3.0	R5-061330
RP-33	RP-060568	1614	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.2.1.30	F	6.3.0	6.4.0	R5-062073
RP-33	RP-060568	1615	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.2.2.39	F	6.3.0	6.4.0	R5-062074
RP-33	RP-060568	1616	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.2.2.42	F	6.3.0	6.4.0	R5-062075
RP-33	RP-060568	1617	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.2.3.32	F	6.3.0	6.4.0	R5-062076
RP-33	RP-060568	1618	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.3.1.33	F	6.3.0	6.4.0	R5-062078
RP-33	RP-060568	1619	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.3.1.34	F	6.3.0	6.4.0	R5-062399
RP-33	RP-060568	1620	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.3.1.36	F	6.3.0	6.4.0	R5-062080
RP-33	RP-060568	1621	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.3.1.37	F	6.3.0	6.4.0	R5-062081
RP-33	RP-060568	1622	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.1.29	F	6.3.0	6.4.0	R5-062500
RP-33	RP-060568	1623	-	CR to 34.123-1: Addition of TDD contents to	F	6.3.0	6.4.0	R5-062501

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
				testcase 8.2.1.32				
RP-33	RP-060568	1624	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.2.40	F	6.3.0	6.4.0	R5-062502
RP-33	RP-060568	1625	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.3.33	F	6.3.0	6.4.0	R5-062503
RP-33	RP-060568	1626	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.3.34	F	6.3.0	6.4.0	R5-062114
RP-33	RP-060568	1627	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.4.36	F	6.3.0	6.4.0	R5-062504
RP-33	RP-060568	1628	-	CR to 34.123-1: Addition of TDD part for testcase 8.2.6.42	F	6.3.0	6.4.0	R5-062505
RP-33	RP-060568	1629	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.6.46	F	6.3.0	6.4.0	R5-062506
RP-33	RP-060568	1630	-	CR to 34.123-1: Addition of LCR TDD contents to testcase 8.2.6.49	F	6.3.0	6.4.0	R5-062507
RP-33	RP-060568	1631	-	CR to 34.123-1: Contents Addition for LCR TDD in 8.3.11.9, 8.3.11.10 and 8.3.7.14	F	6.3.0	6.4.0	R5-062508
RP-33	RP-060568	1632	-	CR to 34.123-1: New test case addition of 8.2.6.40a to LCR TDD	F	6.3.0	6.4.0	R5-062509
RP-33	RP-060566	1634	-	Addition of 3.84 Mcps TDD MAC-hs transport block size selection to HS-DSCH MAC-hs Tests	F	6.3.0	6.4.0	R5-062542
RP-33	RP-060566	1635	-	Addition of combinations on DPCH and HS-PDSCH for interoperability radio bearer tests for 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062384
RP-33	RP-060566	1636	-	Addition of test: Physical Channel Reconfiguration for transition from CELL_DCH to CELL_DCH: Success (Timing re-initialized hard handover to another frequency, serving HS-DSCH cell change) for 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062385
RP-33	RP-060566	1637	-	Addition of TFRC test points for HS-DSCH radio bearer testing in 3.84 Mcps	F	6.3.0	6.4.0	R5-062386
RP-33	RP-060566	1638	-	Update of test: Physical channel reconfiguration for transition from CELL_DCH to CELL_DCH (Hard handover to another frequency with timing re-initialised. Serving HS-DSCH cell change): Failure (Physical channel failure and reversion to old channel) to include 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062258
RP-33	RP-060566	1639	-	Update of test: Radio Bearer Establishment for transition from CELL_FACH to CELL_DCH: Success (Start of HS-DSCH reception) to include 3.84Mcps TDD	F	6.3.0	6.4.0	R5-062261
RP-33	RP-060566	1640	-	Update of test: Radio Bearer Reconfiguration for transition from CELL_DCH to CELL_DCH: Success (Start and stop of HS-DSCH reception) to include 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062262
RP-33	RP-060566	1641	-	Update of test: Radio Bearer Reconfiguration for transition from CELL_DCH to CELL_FACH and from CELL_FACH to CELL_DCH: Success (start and stop of HS-DSCH reception) to include 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062263
RP-33	RP-060566	1642	-	Update of test: Radio Bearer Release for transition from CELL_DCH to CELL_DCH: Success (stop of HS-DSCH reception) to include 3.84 Mcps TDD	F	6.3.0	6.4.0	R5-062265
RP-33	RP-060567	1643	-	Correction to the generic test procedure for HS-DSCH radio bearer combinations with AMR RB configurations using SRB#5 for TFC control	F	6.3.0	6.4.0	R5-062312
RP-33	RP-060567	1644	-	Corrections to HSDPA test case 8.2.6.39a	F	6.3.0	6.4.0	R5-062313
RP-33	RP-060567	1645	-	Corrections to HSDPA test case 8.2.6.39b	F	6.3.0	6.4.0	R5-062314
RP-33	RP-060567	1646	-	Correction to GCF WI-14 HSDPA Test Cases 8.3.1.35 and 8.3.1.37	F	6.3.0	6.4.0	R5-062294
RP-33	RP-060567	1647	-	Corrections to GCF WI-014 (HSDPA) RAB test case 14.6.4	F	6.3.0	6.4.0	R5-062170
RP-33	RP-060567	1648	-	Corrections to GCF WI-014 (HSDPA) RAB test case 14.6.4a	F	6.3.0	6.4.0	R5-062171
RP-33	RP-060567	1649	-	Correction to HS-SCCH code allocation	F	6.3.0	6.4.0	R5-062212
RP-33	RP-060567	1650	-	Corrections to GCF WI-014 MAC-HS test case 7.1.5.6	F	6.3.0	6.4.0	R5-062239
RP-33	RP-060567	1651	-	Enhancement of GCF WI-014 IRAT test case 8.3.7.14	F	6.3.0	6.4.0	R5-062316
RP-33	RP-060567	1652	-	Correction to GCF WI-014 test cases 8.3.11.9 and 8.3.11.10	F	6.3.0	6.4.0	R5-062303
RP-33	RP-060562	1653	-	Introduction of generic test procedure for AMR RB	F	6.3.0	6.4.0	R5-062317

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
				configurations using SRB#5 for TFC control in combination with HS-DSCH/E-DCH radio bearers				
RP-33	RP-060562	1654	-	Addition of details to E-DCH/WB AMR radio bearer test case 14.7.8	F	6.3.0	6.4.0	R5-062321
RP-33	RP-060562	1655	-	Correction to E-DCH radio bearer test case 14.7.4	F	6.3.0	6.4.0	R5-062296
RP-33	RP-060562	1656	-	Addition of details to radio bearer test cases 14.7.6	F	6.3.0	6.4.0	R5-062318
RP-33	RP-060562	1657	-	Addition of details to radio bearer test cases 14.7.7	F	6.3.0	6.4.0	R5-062319
RP-33	RP-060562	1658	-	Correction to E-DCH radio bearer test case 14.7.5	F	6.3.0	6.4.0	R5-062065
RP-33	RP-060562	1659	-	Correction to E-DCH radio bearer test case 14.7.1	F	6.3.0	6.4.0	R5-062066
RP-33	RP-060562	1660	-	Corrections to Enhanced uplink test case 8.2.6.51	F	6.3.0	6.4.0	R5-062326
RP-33	RP-060563	1661	-	Corrections to Enhanced uplink test case 8.3.4.10	F	6.3.0	6.4.0	R5-062354
RP-33	RP-060563	1662	-	New Mac-es/e test case on Correct handling of HARQ profile power offsets	F	6.3.0	6.4.0	R5-062514
RP-33	RP-060563	1663	-	New Mac-es/e test case on Correct handling of minimum set of E-TFCI	F	6.3.0	6.4.0	R5-062531
RP-33	RP-060563	1664	-	Correction to testcase 8.2.6.50	F	6.3.0	6.4.0	R5-062154
RP-33	RP-060563	1665	-	Correction to testcase 8.3.1.41	F	6.3.0	6.4.0	R5-062327
RP-33	RP-060563	1666	-	Corrections to MAC-E/Es test case 7.1.6.1.1	F	6.3.0	6.4.0	R5-062333
RP-33	RP-060563	1667	-	Corrections to MAC-E/Es test case 7.1.6.1.2	F	6.3.0	6.4.0	R5-062334
RP-33	RP-060563	1668	-	Corrections to MAC-E/Es test case 7.1.6.1.3	F	6.3.0	6.4.0	R5-062335
RP-33	RP-060563	1669	-	Corrections to MAC-E/Es test case 7.1.6.2.1	F	6.3.0	6.4.0	R5-062336
RP-33	RP-060563	1670	-	Corrections to MAC-E/Es test case 7.1.6.2.3	F	6.3.0	6.4.0	R5-062338
RP-33	RP-060563	1671	-	Corrections to MAC-E/Es test case 7.1.6.2.4	F	6.3.0	6.4.0	R5-062339
RP-33	RP-060563	1672	-	Corrections to MAC-E/Es test case 7.1.6.2.5	F	6.3.0	6.4.0	R5-062340
RP-33	RP-060563	1673	-	Corrections to MAC-E/Es test case 7.1.6.2.6	F	6.3.0	6.4.0	R5-062341
RP-33	RP-060563	1674	-	Corrections to MAC-E/Es test case 7.1.6.2.7	F	6.3.0	6.4.0	R5-062342
RP-33	RP-060563	1675	-	Corrections to MAC-E/Es test case 7.1.6.2.8	F	6.3.0	6.4.0	R5-062343
RP-33	RP-060563	1676	-	Corrections to MAC-E/Es test case 7.1.6.3.1	F	6.3.0	6.4.0	R5-062344
RP-33	RP-060563	1677	-	Corrections to MAC-E/Es test case 7.1.6.3.2	F	6.3.0	6.4.0	R5-062345
RP-33	RP-060563	1678	-	Corrections and extensions to MAC-E/Es test case 7.1.6.4.1	F	6.3.0	6.4.0	R5-062392
RP-33	RP-060563	1679	-	Corrections to MAC-E/Es test case 7.1.6.4.2	F	6.3.0	6.4.0	R5-062347
RP-33	RP-060563	1680	-	Correction TC 8.2.6.52: Physical channel reconfiguration for transition from CELL_DCH to CELL_DCH: Success	F	6.3.0	6.4.0	R5-062329
RP-33	RP-060564	1681	-	Addition of a new E-DCH RRC test case to 34.123 for Hard Handover fallback with active E-DCH transmission	F	6.3.0	6.4.0	R5-062330
RP-33	RP-060564	1682	-	Addition of a new E-DCH RRC test case to 34.123 for Radio Link Failure during active E-DCH transmission	F	6.3.0	6.4.0	R5-062331
RP-33	RP-060564	1683	-	Addition of a new E-DCH RRC test case to 34.123 for Cell Change Order From UTRAN with stop of E-DCH transmission	F	6.3.0	6.4.0	R5-062379
RP-33	RP-060564	1684	-	Enhancement of GCF WI-025 MACes/e test case 7.1.6.2.2	F	6.3.0	6.4.0	R5-062378
RP-33	RP-060564	1685	-	New Mac-es/e test case on Correct handling of MAC-es/e reset	F	6.3.0	6.4.0	R5-062516
RP-33	RP-060560	1686	-	Correction to testcase 9.4.3.6 & 9.5.9	F	6.3.0	6.4.0	R5-062156
RP-33	RP-060560	1687	-	Correction to Idle mode test case 6.1.1.8 (Network Sharing)	F	6.3.0	6.4.0	R5-062523
RP-33	RP-060560	1688	-	Correction to Idle mode test case 6.1.1.9 (Network Sharing)	F	6.3.0	6.4.0	R5-062367
RP-33	RP-060550	1689	-	Correction to GCF WI-10 Inter-RAT Test Case 6.2.2.3	F	6.3.0	6.4.0	R5-062099
RP-33	RP-060550	1690	-	Correction to GCF WI-010 HCS idle mode test case 6.1.2.4	F	6.3.0	6.4.0	R5-062521
RP-33	RP-060550	1691	-	Correction to GCF WI-010 HCS idle mode test case 6.1.2.5	F	6.3.0	6.4.0	R5-062522
RP-33	RP-060550	1692	-	Correction to GCF WI 10/1 Idle mode test case 6.1.1.4	F	6.3.0	6.4.0	R5-062351
RP-33	RP-060560	1693	-	New test case: 6.2.2.5 Cell reselection using SIB18; UTRAN to GSM	F	6.3.0	6.4.0	R5-062519
RP-33	RP-060550	1694	-	Correction to 34.123-1 Section 6 : Defines the uplink UARFCN for test frequencies of Band IV	F	6.3.0	6.4.0	R5-062277

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-33	RP-060550	1695	-	Correction to InterRAT Idle Mode frequency lists	F	6.3.0	6.4.0	R5-062310
RP-33	RP-060550	1696	-	Correction to GCF WI 10/1 MAC testcase 7.1.2.3.1	F	6.3.0	6.4.0	R5-062159
RP-33	RP-060550	1697	-	Correction to 34.123-1 Section 7: Inclusion of System Information Block Type 5bis	F	6.3.0	6.4.0	R5-062278
RP-33	RP-060560	1698	-	Frequency band extension for GSM 710, GSM 750 and T-GSM 810 bands in interRAT tests	F	6.3.0	6.4.0	R5-062394
RP-33	RP-060553	1699	-	Correction to GCF WI-13 Test Cases 8.3.1.38 and 8.3.1.39	F	6.3.0	6.4.0	R5-062095
RP-33	RP-060550	1700	-	Corrections to GCF WI-012 RRC test case 8.3.1.30	F	6.3.0	6.4.0	R5-062097
RP-33	RP-060550	1701	-	Corrections to GCF WI-010 RRC test case 8.3.1.10 and 8.3.2.4	F	6.3.0	6.4.0	R5-062098
RP-33	RP-060550	1702	-	Correction to GCF WI 10/2 RRC testcase 8.4.1.8	F	6.3.0	6.4.0	R5-062160
RP-33	RP-060550	1703	-	Correction to GCF WI-010/2 InterRAT test case 8.3.7.4	F	6.3.0	6.4.0	R5-062297
RP-33	RP-060550	1704	-	Correction to GCF WI-010/4 InterRAT test case 8.3.7.13	F	6.3.0	6.4.0	R5-062298
RP-33	RP-060550	1705	-	34.123-1 Section 8.1 - Corrections to the values for IE based on calculated ASN.1 value.	F	6.3.0	6.4.0	R5-062192
RP-33	RP-060550	1706	-	Correction to GCF WI-10 RRC Hard Handover Test Case 8.2.6.37	F	6.3.0	6.4.0	R5-062396
RP-33	RP-060550	1707	-	Correction to 34.123-1 Section 8.1: Inclusion of System Information Block Type 5bis	F	6.3.0	6.4.0	R5-062397
RP-33	RP-060550	1708	-	Correction to 34.123-1 Section 8.2: Inclusion of System Information Block Type 5bis	F	6.3.0	6.4.0	R5-062280
RP-33	RP-060550	1709	-	Corrections to GCF WI-12 test case 8.4.1.48	F	6.3.0	6.4.0	R5-062284
RP-33	RP-060550	1710	-	Correction to GCF WI-10 test Case 9.4.5.2	F	6.3.0	6.4.0	R5-062356
RP-33	RP-060550	1711	-	Correction to WI-012 GMM test case 12.3.2.8 Proc1	F	6.3.0	6.4.0	R5-062315
RP-33	RP-060551	1712	-	Correction to GCF WI-10 NAS Test Case 12.4.2.4	F	6.3.0	6.4.0	R5-062094
RP-33	RP-060551	1713	-	Correction to GCF WI 10 GMM testcase 12.9.7c	F	6.3.0	6.4.0	R5-062391
RP-33	RP-060551	1714	-	Correction to GCF WI-012/1 test case 12.3.2.7	F	6.3.0	6.4.0	R5-062191
RP-33	RP-060551	1715	-	Correction to 34.123-1 Section 14: Inclusion of System Information Block Type 5bis	F	6.3.0	6.4.0	R5-062281
RP-33	RP-060551	1716	-	CR to 34.123-1: Corrections to SMS TC 16.1.1 and 16.1.2	F	6.3.0	6.4.0	R5-062050
RP-34	RP-060732	1717	-	CR to 34.123-1: Correction test requirement for LCR TDD in 8.1.1.4, 8.1.1.5, 8.1.1.6.	F	6.4.0	6.5.0	R5-063293
RP-34	RP-060732	1718	-	Corrections to RRC test case 8.4.1.8A	F	6.4.0	6.5.0	R5-063273
RP-34	RP-060747	1719	-	Update of 8.2.1.30 to include HCR TDD	F	6.4.0	6.5.0	R5-063210
RP-34	RP-060747	1720	-	Update of 8.2.4.36 to include HCR TDD	F	6.4.0	6.5.0	R5-063212
RP-34	RP-060747	1721	-	Update of 8.2.6.39a to include HCR TDD	F	6.4.0	6.5.0	R5-063519
RP-34	RP-060747	1722	-	Update of 8.2.6.39b for HCR TDD	F	6.4.0	6.5.0	R5-063520
RP-34	RP-060747	1723	-	Update of 8.3.1.32 for HCR TDD	F	6.4.0	6.5.0	R5-063215
RP-34	RP-060747	1724	-	Update of 8.3.1.33 for HCR TDD	F	6.4.0	6.5.0	R5-063216
RP-34	RP-060743	1725	-	Correction to GCF WI 25 RRC test case 8.2.6.50	F	6.4.0	6.5.0	R5-063051
RP-34	RP-060743	1726	-	Corrections to Enhanced uplink RRC test case 8.2.2.45	F	6.4.0	6.5.0	R5-063081
RP-34	RP-060743	1727	-	Corrections to Enhanced uplink RRC test case 8.2.2.47	F	6.4.0	6.5.0	R5-063082
RP-34	RP-060744	1728	-	Corrections to Enhanced uplink RRC test case 8.2.2.49	F	6.4.0	6.5.0	R5-063083
RP-34	RP-060744	1729	-	Extension of Mac-es/e test case 7.1.6.2.6 to cover correct handling of Maximum_Serving_Grant and Non_Serving_RG_Timer	F	6.4.0	6.5.0	R5-063568
RP-34	RP-060744	1730	-	Update of conformance requirement for Mac-es/e test cases 7.1.6.2.5 and 7.1.6.2.7	F	6.4.0	6.5.0	R5-063138
RP-34	RP-060744	1731	-	Corrections to GCF WI-25/1 test case 7.1.6.1.1	F	6.4.0	6.5.0	R5-063309
RP-34	RP-060744	1732	-	Corrections to GCF WI-25/1 test case 7.1.6.4.1	F	6.4.0	6.5.0	R5-063310
RP-34	RP-060744	1733	-	Corrections to GCF WI-25/1 test case 8.2.2.46	F	6.4.0	6.5.0	R5-063311
RP-34	RP-060744	1734	-	Corrections to GCF WI-25/1 test case 8.2.2.48	F	6.4.0	6.5.0	R5-063312
RP-34	RP-060744	1735	-	Correction to testcase 8.2.6.52	F	6.4.0	6.5.0	R5-063361
RP-34	RP-060744	1736	-	Correction to GCF WI 25 MAC test case 7.1.6.2.7	F	6.4.0	6.5.0	R5-063202
RP-34	RP-060744	1737	-	Correction to GCF WI 25 MAC test case 7.1.6.2.4	F	6.4.0	6.5.0	R5-063333
RP-34	RP-060744	1738	-	Correction to E-DCH radio bearer test case 14.7.7	F	6.4.0	6.5.0	R5-063313

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-34	RP-060744	1739	-	Deletion of EDCH test case 8.2.6.53	F	6.4.0	6.5.0	R5-063238
RP-34	RP-060744	1740	-	Correction to testcase 8.2.6.54	F	6.4.0	6.5.0	R5-063360
RP-34	RP-060744	1741	-	Correction to E-DCH radio bearer test case 7.1.6.4.2	F	6.4.0	6.5.0	R5-063322
RP-34	RP-060744	1742	-	Correction to E-DCH radio bearer test case 7.1.6.2.10	F	6.4.0	6.5.0	R5-063323
RP-34	RP-060742	1743	-	Addition of RoHC Performance TC 7.3.6.6: Compressor response to single lost packets in O-mode	F	6.4.0	6.5.0	R5-063131
RP-34	RP-060742	1744	-	Addition of RoHC Performance TC 7.3.6.2: Base test of ROHC RTP O-mode compressor	F	6.4.0	6.5.0	R5-063318
RP-34	RP-060742	1745	-	Addition of RoHC Performance TC 7.3.6.3 Base test of ROHC RTP R-mode compressor	F	6.4.0	6.5.0	R5-063554
RP-34	RP-060750	1746	-	New MBMS test case: Session start in CELL_FACH state	F	6.4.0	6.5.0	R5-063503
RP-34	RP-060750	1747	-	New MBMS test case: Session start in CELL_DCH state, MCCH notification	F	6.4.0	6.5.0	R5-063548
RP-34	RP-060750	1748	-	New MBMS test case: MBMS Session Start in CELL_DCH when entering into an MBMS cell	F	6.4.0	6.5.0	R5-063549
RP-34	RP-060750	1749	-	New MBMS test case: MBMS serving cell reselection in CELL_FACH state during ongoing session	F	6.4.0	6.5.0	R5-063506
RP-34	RP-060750	1750	-	New MBMS test case for Session stop – Frequency Layer Dispersion - no previous Frequency layer present (URA_PCH)	F	6.4.0	6.5.0	R5-063507
RP-34	RP-060750	1751	-	New MBMS test case for Session stop – Frequency Layer Dispersion - no previous Frequency layer present (CELL_FACH)	F	6.4.0	6.5.0	R5-063508
RP-34	RP-060750	1752	-	New MBMS test case for MTCH RLC duplicate avoidance and reordering	F	6.4.0	6.5.0	R5-063509
RP-34	RP-060750	1753	-	New MBMS test case for MCCH RLC Out Of Sequence Delivery handling	F	6.4.0	6.5.0	R5-063510
RP-34	RP-060750	1754	-	Addition of a MBMS Signaling test case: Service request procedure not accepted by the network	F	6.4.0	6.5.0	R5-063511
RP-34	RP-060750	1755	-	Addition of a MBMS Signaling test case: Service Request procedure collision with Routing Area Update	F	6.4.0	6.5.0	R5-063512
RP-34	RP-060750	1756	-	Addition of a MBMS Signaling test case: Test Network Feature Support IE	F	6.4.0	6.5.0	R5-063513
RP-34	RP-060750	1757	-	New MBMS Test Case - SERVICE REQUEST /counting / MBMS multicast service	F	6.4.0	6.5.0	R5-063531
RP-34	RP-060750	1758	-	New MBMS Test Case - SERVICE REQUEST / point to point RBs / MBMS multicast service	F	6.4.0	6.5.0	R5-063532
RP-34	RP-060750	1759	-	New MBMS test case – Service Request/Accepted/Handling of MBMS context status information	F	6.4.0	6.5.0	R5-063533
RP-34	RP-060750	1760	-	New MBMS test cases – MBMS Context Activation requested by the network, Successful procedure	F	6.4.0	6.5.0	R5-063534
RP-34	RP-060750	1761	-	Addition of TC 8.5.1.1: MBMS Session Start in Idle mode	F	6.4.0	6.5.0	R5-063535
RP-34	RP-060750	1762	-	Addition of TC 8.5.3.1: MBMS Session Start (FLC)/Session Stop (FLD) in Idle mode	F	6.4.0	6.5.0	R5-063536
RP-34	RP-060750	1763	-	Addition of TC 8.5.5.1: MBMS Counting in Idle Mode for Joined Services	F	6.4.0	6.5.0	R5-063537
RP-34	RP-060750	1764	-	Addition of TC 8.5.5.3: MBMS No Counting in CELL_DCH for Joined Services	F	6.4.0	6.5.0	R5-063538
RP-34	RP-060751	1765	-	Addition of TC 8.5.5.4: MBMS Counting in Cell_PCH for Selected Services	F	6.4.0	6.5.0	R5-063539
RP-34	RP-060751	1766	-	Addition of TC 11.6.1: MBMS Context deactivation requested by the network, Successful	F	6.4.0	6.5.0	R5-063540
RP-34	RP-060751	1767	-	Addition of TC 12.4.1.1d: Routing Area Updating/Accepted/Handling of MBMS context status information	F	6.4.0	6.5.0	R5-063541
RP-34	RP-060749	1768	-	Introduction of new interband test case 8.2.1.24a	F	6.4.0	6.5.0	R5-063514
RP-34	RP-060749	1769	-	Introduction of new interband test case 8.2.1.34a	F	6.4.0	6.5.0	R5-063515
RP-34	RP-060749	1770	-	Introduction of new interband test case 8.3.1.1a	F	6.4.0	6.5.0	R5-063555
RP-34	RP-060749	1771	-	Introduction of new interband test case 8.3.2.1a	F	6.4.0	6.5.0	R5-063320
RP-34	RP-060749	1772	-	Introduction of new interband test case 8.2.6.37b	F	6.4.0	6.5.0	R5-063517
RP-34	RP-060749	1773	-	Introduction of test case 6.1.2.1a Cell reselection for inter-band operation	F	6.4.0	6.5.0	R5-063256

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-34	RP-060749	1774	-	Introduction of test case 6.1.2.10a HCS inter-frequency cell reselection for inter-band operation	F	6.4.0	6.5.0	R5-063257
RP-34	RP-060749	1775	-	Introduction of measurement test case 8.4.1.2B for Inter-Band FDD testing	F	6.4.0	6.5.0	R5-063305
RP-34	RP-060749	1776	-	Introduction of measurement test case 8.4.1.24A for Inter-Band FDD testing	F	6.4.0	6.5.0	R5-063306
RP-34	RP-060749	1777	-	Introduction of measurement test case 8.4.1.25A for Inter-Band FDD testing	F	6.4.0	6.5.0	R5-063307
RP-34	RP-060739	1778	-	Correction to GCF WI-24 DSAC Test Case 12.9.15	F	6.4.0	6.5.0	R5-063374
RP-34	RP-060739	1779	-	Correction to idle mode test case 6.1.1.9 (Network Sharing)	F	6.4.0	6.5.0	R5-063334
RP-34	RP-060732	1780	-	Correction to network sharing test case 6.2.1.11 Selection of PLMN and RAT in shared network environment, Manual Mode	F	6.4.0	6.5.0	R5-063168
RP-34	RP-060735	1781	-	Correction to GCF WI-14 InterRAT test case 8.3.7.14	F	6.4.0	6.5.0	R5-063501
RP-34	RP-060735	1782	-	Correction to test case 7.1.5.6	F	6.4.0	6.5.0	R5-063335
RP-34	RP-060735	1783	-	Corrections to GCF WI-14 test case 14.6.8	F	6.4.0	6.5.0	R5-063336
RP-34	RP-060735	1784	-	Corrections to GCF WI-14/1 test case 8.2.3.35	F	6.4.0	6.5.0	R5-063337
RP-34	RP-060735	1785	-	Correction to GCF WI 14/2 RRC test case 8.3.1.37	F	6.4.0	6.5.0	R5-063338
RP-34	RP-060732	1786	-	Correction to GCF WI-10 Idle Mode Test Case 6.1.2.4	F	6.4.0	6.5.0	R5-063074
RP-34	RP-060732	1787	-	Correction to GCF WI-10 Test Cases 6.2.1.1, 6.2.1.2, 6.2.1.3, 6.2.1.4, 6.2.1.6, 6.2.1.7, 6.2.1.8 and 6.2.1.10	F	6.4.0	6.5.0	R5-063348
RP-34	RP-060732	1788	-	Corrections to GCF WI-10/3 test case 6.1.2.6	F	6.4.0	6.5.0	R5-063349
RP-34	RP-060732	1789	-	Correction of test channels for idle mode testing	F	6.4.0	6.5.0	R5-063350
RP-34	RP-060732	1790	-	Correction to Idle mode test case 6.1.1.1 (low priority TC)	F	6.4.0	6.5.0	R5-063351
RP-34	RP-060732	1791	-	Addition of R99 Idle Mode Test Case 6.1.2.9a and 6.1.2.9b	F	6.4.0	6.5.0	R5-063579
RP-34	RP-060732	1792	-	Correction to GCF WI10/1 MAC testcase 7.1.2.4a	F	6.4.0	6.5.0	R5-063080
RP-34	RP-060732	1793	-	Correction to WI-010 test cases 7.1.1.2, 7.1.1.3, 7.1.1.4 and 7.1.1.8	F	6.4.0	6.5.0	R5-063380
RP-34	RP-060732	1794	-	Corrections to GCF WI-012 RRC test cases 8.2.6.39 and 8.2.6.44	F	6.4.0	6.5.0	R5-063316
RP-34	RP-060732	1795	-	Correction to WI-12/1 RRC test case 8.3.1.30	F	6.4.0	6.5.0	R5-063040
RP-34	RP-060732	1796	-	Correction to GCF WI 10/3 RRC testcase 8.1.10.1	F	6.4.0	6.5.0	R5-063049
RP-34	RP-060732	1797	-	Correction to GCF WI10/4 RRC testcase 8.2.6.38	F	6.4.0	6.5.0	R5-063050
RP-34	RP-060732	1798	-	Correction to GCF WI 10/3 RRC testcase 8.4.1.28	F	6.4.0	6.5.0	R5-063347
RP-34	RP-060841	1799	-	Correction to GCF WI 12 InterRAT test case 8.4.1.48	F	6.4.0	6.5.0	R5-063054
RP-34	RP-060841	1800	-	Correction to GCF WI-10 RRC Test Case 8.4.1.8	F	6.4.0	6.5.0	R5-063301
RP-34	RP-060841	1801	-	Correction to GCF Low Priority Test Case 8.3.1.28	F	6.4.0	6.5.0	R5-063352
RP-34	RP-060841	1802	-	Corrections to GCF WI-10/2 test case 8.3.1.9	F	6.4.0	6.5.0	R5-063353
RP-34	RP-060841	1803	-	Correction to RRC testcases 8.1.1.4, 8.1.1.5 and 8.1.1.6	F	6.4.0	6.5.0	R5-063354
RP-34	RP-060841	1804	-	Correction to RRC testcases 8.1.2.2 and 8.1.2.9	F	6.4.0	6.5.0	R5-063159
RP-34	RP-060841	1805	-	Correction to IRAT RRC TC 8.4.1.31	F	6.4.0	6.5.0	R5-063342
RP-34	RP-060841	1806	-	Corrections to WI-010 test cases 8.1.1.4, 8.1.1.5 and 8.1.1.6	F	6.4.0	6.5.0	R5-063355
RP-34	RP-060841	1807	-	Correction to WI-010 test case 8.1.2.4	F	6.4.0	6.5.0	R5-063265
RP-34	RP-060841	1808	-	Correction to GCF WI-10 RRC Test Case 8.4.1.25 and WI-12 RRC Test Case 8.4.1.48	F	6.4.0	6.5.0	R5-063302
RP-34	RP-060841	1809	-	Correction of GCF WI-010/2 MM test case 9.4.5.4.1	F	6.4.0	6.5.0	R5-063356
RP-34	RP-060841	1810	-	Correction to GCF WI-12 NAS Test Case 12.9.9	F	6.4.0	6.5.0	R5-063357
RP-34	RP-060841	1811	-	Correction to GMM IRAT TC 12.8	F	6.4.0	6.5.0	R5-063343
RP-34	RP-060841	1812	-	Correction to WI-010 test case 12.2.1.10	F	6.4.0	6.5.0	R5-063266
RP-34	RP-060841	1813	-	Correction to testcase 14.2.58	F	6.4.0	6.5.0	R5-063358
RP-34	RP-060841	1814	-	Editorial corrections to GCF WI-010/3 test case 14.2.43.1	F	6.4.0	6.5.0	R5-063359
RP-34	RP-060841	1815	-	Correction to SMS testcases 16.1.9.1 and 16.1.9.2	F	6.4.0	6.5.0	R5-063156
RP-34	RP-060841	1816	-	Correction to GCF WI-10 test case 6.1.2.1 and 6.1.2.9	F	6.4.0	6.5.0	R5-063163

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-34	RP-060749	1817	-	Introduction of test case 8.1.2.10a for Inter-band testing	F	6.4.0	6.5.0	R5-063161
RP-35	RP-070104	1818	-	Addition of LCR TDD contents in testcase 8.4.1.31, 8.4.1.33, 8.4.1.44, 8.4.1.45 and 8.4.1.46	F	6.5.0	6.6.0	R5-070108
RP-35	RP-070104	1819	-	Change the Message Content of Testcase 8.1.5.1	F	6.5.0	6.6.0	R5-070354
RP-35	RP-070111	1820	-	Supplement to HS-DSCH radio bearer test parameters in TDD	F	6.5.0	6.6.0	R5-070355
RP-35	RP-070097	1821	-	Correction to GCF WI-25 MAC Test Case 7.1.6.4.2	F	6.5.0	6.6.0	R5-070042
RP-35	RP-070097	1822	-	Correction to GCF WI 25 MAC test cases 7.1.6.1.1, 7.1.6.1.2, 7.1.6.1.3, 7.1.6.2.1, 7.1.6.2.8, 7.1.6.2.9, 7.1.6.3.1, 7.1.6.4.1, 7.1.6.4.2	D	6.5.0	6.6.0	R5-070043
RP-35	RP-070097	1823	-	Correction to GCF WI 25 RRC test case 8.2.2.45	F	6.5.0	6.6.0	R5-070044
RP-35	RP-070097	1824	-	Correction to generic test procedure for HS-DSCH and E-DCH radio bearer combinations	F	6.5.0	6.6.0	R5-070479
RP-35	RP-070097	1825	-	Correction of RADIO BEARER RECONFIGURATION message used in E-DCH RRC TC 8.2.2.46 & 8.2.2.48	F	6.5.0	6.6.0	R5-070052
RP-35	RP-070097	1826	-	Correction of Generic test procedure for HS-DSCH & HS-DSCH / E-DCH radio bearer combinations in 14.1.3 & 14.1.4	F	6.5.0	6.6.0	R5-070053
RP-35	RP-070097	1827	-	TC-8.2.6.52 - IE 'Uplink channel requirement' in Physical channel reconfiguration message is replaced with 'Uplink DPCH info'.	F	6.5.0	6.6.0	R5-070403
RP-35	RP-070097	1828	-	Correction to E-DCH radio bearer test case 14.7.8	F	6.5.0	6.6.0	R5-070143
RP-35	RP-070097	1829	-	Addition of new test case for RRC connection establishment using the default configuration for HS-DSCH / E-DCH signalling bearers.	F	6.5.0	6.6.0	R5-070360
RP-35	RP-070097	1830	-	Introduction of test scenario for Stand-alone SRBs for DCCH on E-DCH and HS-DSCH	F	6.5.0	6.6.0	R5-070361
RP-35	RP-070097	1831	-	Correction to test case 14.7.4	F	6.5.0	6.6.0	R5-070362
RP-35	RP-070097	1832	-	Correction to GCF WI 25 HSUPA RAB test case 14.7.8	F	6.5.0	6.6.0	R5-070278
RP-35	RP-070097	1833	-	Corrections to GCF WI-25 test case 7.1.6.2.10	F	6.5.0	6.6.0	R5-070307
RP-35	RP-070097	1834	-	Correction to GCF WI 25 MAC test case 7.1.6.2.9	F	6.5.0	6.6.0	R5-070331
RP-35	RP-070097	1835	-	Correction to MAC test cases 7.1.6.2.2, 7.1.6.4.1, 7.1.6.4.2 and 7.1.6.4.3	F	6.5.0	6.6.0	R5-070470
RP-35	RP-070095	1836	-	Addition of RoHC Performance TC 7.3.6.5 Re-establishment of TS function after DTX in R-mode	F	6.5.0	6.6.0	R5-070363
RP-35	RP-070095	1837	-	Addition of RoHC Performance TC 7.3.6.7 Compressor response to single lost packets in R-mode	F	6.5.0	6.6.0	R5-070229
RP-35	RP-070095	1838	-	Addition of RoHC Performance TC 7.3.6.9 TS function during DTX with varying delta in R-mode	F	6.5.0	6.6.0	R5-070364
RP-35	RP-070095	1839	-	Addition of a new RoHC Performance Test Case.	F	6.5.0	6.6.0	R5-070365
RP-35	RP-070095	1840	-	Addition of RoHC Performance TC 7.3.6.8: TS function during DTX with varying delta in O-mode	F	6.5.0	6.6.0	R5-070366
RP-35	RP-070086	1841	-	Correction to MBMS GMM test case 12.9.18	F	6.5.0	6.6.0	R5-070069
RP-35	RP-070086	1842	-	Generic test procedure for MBMS radio bearer test cases	F	6.5.0	6.6.0	R5-070431
RP-35	RP-070086	1843	-	New MBMS radio bearer test cases	F	6.5.0	6.6.0	R5-070432
RP-35	RP-070086	1844	-	Corrections to MBMS RLC test cases	F	6.5.0	6.6.0	R5-070473
RP-35	RP-070086	1845	-	Corrections to MBMS test cases 8.5.3.5 and 8.5.3.6	F	6.5.0	6.6.0	R5-070475
RP-35	RP-070086	1846	-	New MBMS test case for Modification of the list of MBMS Selected Service whilst in Cell_PCH, URA_PCH & Cell_FACH	F	6.5.0	6.6.0	R5-070466
RP-35	RP-070086	1847	-	Correction to MBMS Test Cases 11.5.1, 11.5.2.1 and 11.5.2.2	F	6.5.0	6.6.0	R5-070436
RP-35	RP-070086	1848	-	New MBMS RRC Test Case: MBMS session Start at Notification via DCCH in CELL_DCH	F	6.5.0	6.6.0	R5-070465
RP-35	RP-070086	1849	-	New MBMS RRC Test Case: Transmission of the MBMS Selected Services Information when entering RRC connected mode	F	6.5.0	6.6.0	R5-070406
RP-35	RP-070086	1850	-	New MBMS RRC Test Case: MBMS Serving Cell Reselection in CELL_DCH during ongoing Session	F	6.5.0	6.6.0	R5-070437
RP-35	RP-070086	1851	-	New MBMS RRC Test Case: MBMS Serving Cell Reselection in CELL_PCH during ongoing Session	F	6.5.0	6.6.0	R5-070438
RP-35	RP-070086	1852	-	Correction of TC 8.5.1.1: MBMS Session Start in Idle mode	F	6.5.0	6.6.0	R5-070439

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
RP-35	RP-070086	1853	-	Addition of TC 8.5.1.2: MBMS session start at notification in CELL_PCH	F	6.5.0	6.6.0	R5-070440
RP-35	RP-070086	1854	-	Addition of TC 8.5.3.2: MBMS Session Start (Frequency Layer Convergence)/Session Stop (Frequency Layer Dispersion) in CELL_PCH	F	6.5.0	6.6.0	R5-070443
RP-35	RP-070086	1855	-	Addition of TC 8.5.1.6: MBMS session start at MCCH acquisition in CELL_DCH (for a MBMS service) when entering into an MBMS cell (UE capable of MBMS p-t-m reception in CELL_DCH)	F	6.5.0	6.6.0	R5-070441
RP-35	RP-070086	1856	-	Addition of TC 8.5.3.3: MBMS Session Start (Frequency Layer Convergence)/Session Stop (Frequency Layer Dispersion) in CELL_FACH	F	6.5.0	6.6.0	R5-070442
RP-35	RP-070086	1857	-	Addition of TC 8.5.5.5: P-t-p Request in Idle Mode	F	6.5.0	6.6.0	R5-070444
RP-35	RP-070087	1858	-	Addition of TC 'MBMS Cell reselection - Idle mode - Frequency Layer Convergence – HCS Not Used'	F	6.5.0	6.6.0	R5-070457
RP-35	RP-070087	1859	-	Addition of TC 8.5.5.6: P-t-p Request in URA_PCH, CELL_PCH or CELL_FACH	F	6.5.0	6.6.0	R5-070445
RP-35	RP-070087	1860	-	Addition of TC 8.5.2.2: MBMS Session Stop at Notification, reception via MCCH	F	6.5.0	6.6.0	R5-070458
RP-35	RP-070087	1861	-	Addition of TC 8.5.3.4: MBMS session stop with frequency layer dispersion - no previous frequency layer available (Idle Mode)	F	6.5.0	6.6.0	R5-070480
RP-35	RP-070087	1862	-	Update of TC 8.5.5.1: MBMS Counting in Idle Mode to cover Selected services.	F	6.5.0	6.6.0	R5-070459
RP-35	RP-070087	1863	-	Update of TC 8.5.5.3: MBMS No Counting in CELL_DCH to cover Selected services.	F	6.5.0	6.6.0	R5-070280
RP-35	RP-070087	1864	-	Update of TC 8.5.5.4: MBMS Counting in CELL_PCH to cover Selected services.	F	6.5.0	6.6.0	R5-070281
RP-35	RP-070087	1865	-	Addition of TC 8.5.5.2: MBMS Counting in CELL_FACH	F	6.5.0	6.6.0	R5-070380
RP-35	RP-070087	1866	-	Update to MBMS test cases 11.6.1 and 11.7	F	6.5.0	6.6.0	R5-070396
RP-35	RP-070101	1867	-	Add a note in clause 6	F	6.5.0	6.6.0	R5-070058
RP-35	RP-070101	1868	-	Correction to GCF WI-10 Inter-RAT Test Case 6.2.2.3	F	6.5.0	6.6.0	R5-070082
RP-35	RP-070101	1869	-	Correction to WI-010 test case 7.1.1.3	F	6.5.0	6.6.0	R5-070288
RP-35	RP-070105	1870	-	Correction of RRC HSDPA test case 8.3.1.35	F	6.5.0	6.6.0	R5-070386
RP-35	RP-070105	1871	-	Correction of RRC test case 8.4.1.47	F	6.5.0	6.6.0	R5-070387
RP-35	RP-070105	1872	-	Correction of RRC test case 8.3.4.9	F	6.5.0	6.6.0	R5-070388
RP-35	RP-070105	1873	-	Correction to GCF WI 13/1 RRC test case 8.4.1.47	F	6.5.0	6.6.0	R5-070078
RP-35	RP-070101	1874	-	Correction to GCF WI 10 RRC test case 8.2.4.1	F	6.5.0	6.6.0	R5-070079
RP-35	RP-070101	1875	-	Correction to WI-10/3 RRC test case 8.4.1.29	F	6.5.0	6.6.0	R5-070373
RP-35	RP-070101	1876	-	Correction to RRC test case 8.4.1.14	F	6.5.0	6.6.0	R5-070085
RP-35	RP-070101	1877	-	Change in the phrase "Frequency band modification" to 'Frequency modification' in RRC cases	F	6.5.0	6.6.0	R5-070086
RP-35	RP-070101	1878	-	Correction to GCF WI 10 RRC test case 8.1.2.2	F	6.5.0	6.6.0	R5-070089
RP-35	RP-070101	1879	-	Correction to GCF WI 10/4 Inter system cell reselection from UTRAN test case 8.3.9.1	F	6.5.0	6.6.0	R5-070090
RP-35	RP-070111	1880	-	Addition of new test case for Radio Bearer Establishment using Specification Mode = Preconfiguration	F	6.5.0	6.6.0	R5-070375
RP-35	RP-070101	1881	-	Update to test case 8.1.2.15 for Rel-6	F	6.5.0	6.6.0	R5-070477
RP-35	RP-070102	1882	-	Correction to RRC test case 8.2.6.37	F	6.5.0	6.6.0	R5-070377
RP-35	RP-070102	1883	-	Correction to test cases 8.4.1.2 and 8.4.1.24	F	6.5.0	6.6.0	R5-070376
RP-35	RP-070102	1884	-	Correction to GCF WI 10/2 RRC test case 8.1.10.1	F	6.5.0	6.6.0	R5-070277
RP-35	RP-070102	1885	-	Corrections to test cases in Section 8	F	6.5.0	6.6.0	R5-070378
RP-35	RP-070102	1886	-	Correction to GCF WI-10 RRC test case 8.4.1.28	F	6.5.0	6.6.0	R5-070332
RP-35	RP-070102	1887	-	Correction to GCF WI 10 MM test case 9.2.2	F	6.5.0	6.6.0	R5-070077
RP-35	RP-070102	1888	-	Corrections to GCF WI-10/4 test cases 9.4.3.5 and 9.5.7.1	F	6.5.0	6.6.0	R5-070402
RP-35	RP-070102	1889	-	Correction to GCF WI-012 test case 12.3.2.7	F	6.5.0	6.6.0	R5-070046
RP-35	RP-070102	1890	-	Correction of GMM test case 12.4.1.4b	F	6.5.0	6.6.0	R5-070064
RP-35	RP-070102	1891	-	Correction to GCF WI 10/4 GMM test case 12.9.13	F	6.5.0	6.6.0	R5-070068
RP-35	RP-070111	1892	-	Correction to GMM test cases in sub clause 12.4.2.11, 12.4.2.12	F	6.5.0	6.6.0	R5-070349
RP-35	RP-070102	1893	-	Correction to GCF WI-10 RAB Test Case 14.2.58	F	6.5.0	6.6.0	R5-070047

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version - Current	Version -New	Doc-2nd-Level
RP-35	RP-070105	1894	-	Correction to GCF WI-14 RAB Test Case 14.6.1a and 14.6.2	D	6.5.0	6.6.0	R5-070048
RP-35	RP-070105	1895	-	Correction to GCF WI 14/3 HSDPA test case 14.6.7	F	6.5.0	6.6.0	R5-070049
RP-35	RP-070105	1896	-	Correction to GCF WI13/1 RAB testcase 14.2.4b and 14.2.62	F	6.5.0	6.6.0	R5-070050
RP-35	RP-070105	1897	-	Correction to GCF WI 14/3 HSDPA test case 14.6.8	F	6.5.0	6.6.0	R5-070051
RP-35	RP-070105	1898	-	Correction to HSDPA radio bearer test case 14.6.8	F	6.5.0	6.6.0	R5-070142
RP-35	RP-070105	1899	-	Corrections to GCF WI-14 test case 14.6.8	F	6.5.0	6.6.0	R5-070287
RP-35	RP-070097	1900	-	Correction to GCF WI-25 test case 8.3.4.10	F	6.5.0	6.6.0	R5-070435
RP-35	RP-070095	1901	-	Addition of RoHC Performance TC 7.3.6.10: SRNS relocation for ROHC RTP O-mode compressor	F	6.5.0	6.6.0	R5-070248r1
RP-35	RP-070102	1902	-	Correction of SMS test case 16.1.2	F	6.5.0	6.6.0	R5-070478r1
RP-36	RP-070360	1903		Correction to MBMS Test Case 8.5.3.3	F	6.6.0	6.7.0	R5-071471
RP-36	RP-070344	1904		Correction to testcase 8.4.1.42.	F	6.6.0	6.7.0	R5-071494
RP-36	RP-070360	1905		Correction to MBMS Test Case 8.5.3.2	F	6.6.0	6.7.0	R5-071470
RP-36	RP-070360	1906		Corrections to MBMS RRC test cases	F	6.6.0	6.7.0	R5-071534
RP-36	RP-070350	1907		Correction to GCF WI-14 RAB Test Case 14.6.1 and 14.6.1a	F	6.6.0	6.7.0	R5-071037
RP-36	RP-070344	1908		Removal of GCF WI-10 Idle Mode Test Case 6.1.2.9	F	6.6.0	6.7.0	R5-071038
RP-36	RP-070344	1909		Correction to GCF WI-10 RRC Testcases 8.2.6.38 and 8.4.1.8	F	6.6.0	6.7.0	R5-071040
RP-36	RP-070357	1910		Correction of index of absolute grant for max bit rate	F	6.6.0	6.7.0	R5-071043
RP-36	RP-070357	1911		Correction to GCF WI-25 HSUPA Testcase 8.2.3.36	F	6.6.0	6.7.0	R5-071049
RP-36	RP-070344	1912		Correction to SMS test cases	F	6.6.0	6.7.0	R5-071050
RP-36	RP-070358	1913		Correction to GCF WI-25 HSUPA test case 8.3.1.41	F	6.6.0	6.7.0	R5-071076
RP-36	RP-070344	1914		Correction to GCF WI-10 RRC test case 8.2.6.37	F	6.6.0	6.7.0	R5-071077
RP-36	RP-070360	1915		Editorial corrections to section 8.5 text styles and missing clause	F	6.6.0	6.7.0	R5-071100
RP-36	RP-070367	1916		Addition of LCR TDD part of 8.5.1.1	F	6.6.0	6.7.0	R5-071108
RP-36	RP-070367	1917		Addition of LCR TDD part of 8.5.1.4	F	6.6.0	6.7.0	R5-071109
RP-36	RP-070367	1918		Addition of LCR TDD part of 8.5.1.5	F	6.6.0	6.7.0	R5-071110
RP-36	RP-070367	1919		Addition of LCR TDD part of 8.5.1.6	F	6.6.0	6.7.0	R5-071111
RP-36	RP-070367	1920		Addition of LCR TDD part of 8.5.3.4	F	6.6.0	6.7.0	R5-071112
RP-36	RP-070367	1921		Addition of LCR TDD part of 8.5.3.5	F	6.6.0	6.7.0	R5-071113
RP-36	RP-070367	1922		Addition of LCR TDD part of 8.5.3.6	F	6.6.0	6.7.0	R5-071114
RP-36	RP-070367	1923		Addition of LCR TDD part of 8.5.6.1	F	6.6.0	6.7.0	R5-071115
RP-36	RP-070367	1924		Addition of LCR TDD part of 8.5.6.2	F	6.6.0	6.7.0	R5-071116
RP-36	RP-070367	1925		Addition of LCR TDD part of 8.5.6.3	F	6.6.0	6.7.0	R5-071117
RP-36	RP-070367	1926		Addition of LCR TDD part of 8.5.6.5	F	6.6.0	6.7.0	R5-071118
RP-36	RP-070349	1927		Addition of LCR TDD part of 8.4.1.41	F	6.6.0	6.7.0	R5-071121
RP-36	RP-070345	1928		Correction to GCF Testcase 8.4.1.25	F	6.6.0	6.7.0	R5-071133
RP-36	RP-070345	1929		Correction to GCF WI 10 Inter system cell reselection from UTRAN test case 8.3.9.3	F	6.6.0	6.7.0	R5-071147
RP-36	RP-070350	1930		Correction to Generic radio bearer test procedure for standalone AMR RB configurations in 14.1.1a	F	6.6.0	6.7.0	R5-071152
RP-36	RP-070358	1931		Correction to GCF WI 25 EDCH RRC test case 8.1.2.17 and 8.1.2.18	F	6.6.0	6.7.0	R5-071154
RP-36	RP-070360	1932		'MBMS serving cell reselection' terminology	F	6.6.0	6.7.0	R5-071164
RP-36	RP-070345	1933		Correction to GCF WI-010 test case 6.1.2.6	F	6.6.0	6.7.0	R5-071170
RP-36	RP-070345	1934		Correction to low priority Radio Bearer Release test cases	F	6.6.0	6.7.0	R5-071172
RP-36	RP-070345	1935		Correction to low priority Physical Channel Reconfiguration test case 8.2.6.25	F	6.6.0	6.7.0	R5-071173
RP-36	RP-070356	1936		Introduction of FDD Mode Test frequencies for Operating Band X (Extended 1.7/2.1 GHz) in clause 6	F	6.6.0	6.7.0	R5-071175
RP-36	RP-070356	1937		Introduction of FDD Mode Test frequencies for Operating Band X (Extended 1.7/2.1 GHz) in clause 8	F	6.6.0	6.7.0	R5-071176
RP-36	RP-070345	1938		Correction to TC 6.1.1.7	F	6.6.0	6.7.0	R5-071185
RP-36	RP-070354	1939		Correction to TCs 6.1.1.9 and 6.2.1.11	F	6.6.0	6.7.0	R5-071186

Meeting -1st-Level	Doc-1st-Level	CR	Rev	Subject	Cat	Version -Current	Version -New	Doc-2nd-Level
RP-36	RP-070350	1940		Update of ROHC test cases 7.3.6.8, 7.3.6.9.	F	6.6.0	6.7.0	R5-071208
RP-36	RP-070351	1941		Update of ROHC test cases 7.3.6.2, 7.3.6.3, 7.3.6.4, 7.3.6.5 and 7.3.6.10.	F	6.6.0	6.7.0	R5-071209
RP-36	RP-070345	1942		Correction to testcase 8.2.6.37	F	6.6.0	6.7.0	R5-071259
RP-36	RP-070351	1949		Correction of RRC test case 8.4.1.47	F	6.6.0	6.7.0	R5-071306
RP-36	RP-070351	1950		Correction to WI 14 HSDPA RRC testcase 8.2.2.42	F	6.6.0	6.7.0	R5-071307
RP-36	RP-070345	1952		Correction to GCF WI-10 RRC Testcase 8.4.1.14	F	6.6.0	6.7.0	R5-071314
RP-36	RP-070349	1953		Clarify a test condition to testcase 9.4.7	F	6.6.0	6.7.0	R5-071422
RP-36	RP-070351	1954		Modification of HS-DSCH TB size for LCR TDD	F	6.6.0	6.7.0	R5-071424
RP-36	RP-070358	1955		Correction of 8.3.4.10 modifying A12 to A13	F	6.6.0	6.7.0	R5-071430
RP-36	RP-070358	1956		Correction to GCF WI 25 EDCH MAC test case 7.1.6.2.2	F	6.6.0	6.7.0	R5-071431
RP-36	RP-070358	1957		Correction to testcase 7.1.6.4.3	F	6.6.0	6.7.0	R5-071432
RP-36	RP-070351	1958		Correction to GCF WI-14 MAC Test Case 7.1.5.2	F	6.6.0	6.7.0	R5-071451
RP-36	RP-070345	1959		Correction to GCF WI 10 RRC test case 8.4.1.42	F	6.6.0	6.7.0	R5-071452
RP-36	RP-070345	1960		Correction to Inter-band test case 8.3.2.1a	F	6.6.0	6.7.0	R5-071453
RP-36	RP-070345	1961		Correction to test case 8.3.9.1 for FDD II and FDD VIII	F	6.6.0	6.7.0	R5-071454
RP-36	RP-070345	1962		Correction to test case 12.4.1.4a	F	6.6.0	6.7.0	R5-071455
RP-36	RP-070345	1963		Corrections to Interoperability Radio Bearer Test case 14.4.1	F	6.6.0	6.7.0	R5-071456
RP-36	RP-070345	1964		Correction to the RRC testcase 8.3.11.4	F	6.6.0	6.7.0	R5-071463
RP-36	RP-070360	1965		Correction to MBMS Test Case 8.5.3.1.	F	6.6.0	6.7.0	R5-071472
RP-36	RP-070360	1966		Update of TC 8.5.5.3: MBMS No Counting in CELL_DCH	F	6.6.0	6.7.0	R5-071475
RP-36	RP-070360	1967		Update of TC 8.5.5.1: MBMS Counting in Idle Mode	F	6.6.0	6.7.0	R5-071476
RP-36	RP-070360	1968		Update of TC 8.5.5.2: MBMS Counting in CELL_FACH	F	6.6.0	6.7.0	R5-071477
RP-36	RP-070360	1969		Extension of MBMS test case 8.5.1.8	F	6.6.0	6.7.0	R5-071480
RP-36	RP-070360	1970		Update of TC 8.5.5.4: MBMS Counting in CELL_PCH	F	6.6.0	6.7.0	R5-071481
RP-36	RP-070360	1971		Addition of new MBMS Test Case 8.5.2.3	F	6.6.0	6.7.0	R5-071482
RP-36	RP-070360	1972		Correction to MBMS Test Case 8.5.6.1	F	6.6.0	6.7.0	R5-071483
RP-36	RP-070360	1973		Correction to MBMS test case 7.2.4.3	F	6.6.0	6.7.0	R5-071485
RP-36	RP-070345	1974		Correction to Inter-band test case 8.3.1.1a	F	6.6.0	6.7.0	R5-071491
RP-36	RP-070345	1975		Correction to testcase 8.4.1.2 and 8.4.1.6	F	6.6.0	6.7.0	R5-071492
RP-36	RP-070360	1976		Correction to MBMS RLC test case 7.2.4.2	F	6.6.0	6.7.0	R5-071504
RP-36	RP-070361	1977		Correction to MBMS NAS test cases	F	6.6.0	6.7.0	R5-071505
RP-36	RP-070361	1978		Correction to Generic test procedure for radio bearers on MTCH	F	6.6.0	6.7.0	R5-071506
RP-36	RP-070358	1979		Correction to Radio Bearer Establishment Test case 8.2.1.36	F	6.6.0	6.7.0	R5-071509
RP-36	RP-070345	1980		Correction to GCF WI 10 RRC test case 8.4.1.24	F	6.6.0	6.7.0	R5-071512
RP-36	RP-070345	1981		Correction to GCF WI-10 Inter-RAT test case 6.2.1.6	F	6.6.0	6.7.0	R5-071513
RP-36	RP-070361	1982		Correction to clause numbering of MBMS service request test cases	F	6.6.0	6.7.0	R5-071523
RP-36	RP-070358	1984		Addition of new E-DCH test case 8.4.1.49 for E-DCH measurement event 1J	F	6.6.0	6.7.0	R5-071527
RP-36	RP-070358	1985		Correction to GCF WI 25 EDCH MAC test case 7.1.6.2.1	F	6.6.0	6.7.0	R5-071533
RP-36	RP-070361	1986		Addition of new MBMS Test Case 8.5.6.4	F	6.6.0	6.7.0	R5-071539
RP-36	RP-070361	1987		Correction to MBMS Test Case 8.5.3.4	F	6.6.0	6.7.0	R5-071540
RP-36	RP-070345	1988		Improvement to test case 6.2.2.3	F	6.6.0	6.7.0	R5-071450r1
RP-36	RP-070345	1989		Correction to GCF WI 12 MAC test case 7.1.3.2	F	6.6.0	6.7.0	R5-071522
RP-36	RP-070351	1990		Addition of test scenario for Paging for notification of Synchronised BCCH modification in idle mode using BCCH modification time	F	6.6.0	6.7.0	R5-071537
RP-36	RP-070361	1991		Addition of new MBMS Test Case 8.5.2.1	F	6.6.0	6.7.0	R5-071550r1
RP-36	RP-070354	1992		Editorial corrections in the reference list (wrong spec indicated on the coversheet, intially CR nr to 34.123-3 allocated)	F	6.6.0	6.7.0	R5-071445
RP-36	RP-070354	1983		34.123-1 Pointer version 6.7.0	F	6.6.0	6.7.0	R5-071525

History

Document history		
V6.0.0	October 2005	Publication
V6.1.0	December 2005	Publication
V6.2.1	March 2006	Publication
V6.3.0	June 2006	Publication
V6.4.0	October 2006	Publication
V6.5.0	December 2006	Publication
V6.6.0	March 2007	Publication
V6.7.0	June 2007	Publication